Hunts Point
Hunts Point
Bronx, NY 10474

Inquiry Number: 3929425.2s
May 02, 2014

The EDR Radius Map™ Report with GeoCheck®

EDR® Environmental Data Resources Inc

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	167
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-7
Physical Setting Source Map Findings	A-8
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

HUNTS POINT
BRONX, NY 10474

COORDINATES

Latitude (North):	40.8024927 - 40° 48' 8.97''
Longitude (West):	73.8741922 - 73° 52' 27.09''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	594967.7
UTM Y (Meters):	4517230.5
Elevation:	17 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	40073-G7 FLUSHING, NY
Most Recent Revision:	1995
West Map:	40073-G8 CENTRAL PARK, NY NJ
Most Recent Revision:	1995

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	2010, 2011
Source:	USDA

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
HUNTS PT - PARCEL C 550 FOOD CENTER DRIVE BRONX, NY 10474	LTANKS Spill Number/Closed Date: 0302288 / 6/4/2003 NY Spills Spill Number/Closed Date: 0300674 / 4/18/2003 ENG CONTROLS INST CONTROL VCP	N/A
HUNTS PT TERMINAL BLDG230 HUNTS PT TERMINAL BL-320 BRONX, NY	NY Spills Spill Number/Closed Date: 9400429 / 4/13/1994	N/A

EXECUTIVE SUMMARY

NY POWER AUTH - HUNTS POINT FUEL COSTER ST & RYAWA AVE NS BLDG BRONX, NY	FINDS	N/A
HUNTS POINT WASTE WATER PLANT HUNTS POINT WASTE WATER PLANT BRONX, NY	NY Spills Spill Number/Closed Date: 1310228 / 1/23/2014	N/A
HUNTS POINT RIVERSIDE PAR LAFAYETTE AVE. TO THE END BRONX, NY	NY Spills Spill Number/Closed Date: 0805602 / 8/14/2008	N/A
HUNTS POINT AVENUE COMPRESSOR STA 332 HUNTS POINT AVE BRONX, NY 10474	AIRS	N/A
HUNTS POINT #631 RANDELL AV/E CHESTER BAY BRONX, NY	NY Spills Spill Number/Closed Date: 0102940 / 6/18/2001	N/A
HUNTS POINT DRAWBRIDGE BRONX RIVER RD BRONX, NY	NY Spills Spill Number/Closed Date: 0002298 / 2/13/2003	N/A
NYCDEP HUNTS PT-LAFAYETTE & EDGEWATER BRONX, NY	MANIFEST	N/A
HUNTS POINT COKING STATION HUNTS POINT RD & E RIVER BRONX, NY 10474	CERC-NFRAP	NYD980532352
HUNTS PT. FDC PERIMETER FOOD CENTER DRIVE BRONX, NY 10474	ENG CONTROLS INST CONTROL VCP	N/A
HUNTS POINT COOP MARKET PARCEL B /FOOD CTR DR BRONX, NY	LTANKS Spill Number/Closed Date: 9709363 / 10/26/2005	N/A
HUNTS POINT - OUTFALL 004 HUNTS POINT DRAINAGE AREA BRONX, NY	NY Spills Spill Number/Closed Date: 0605982 / 8/24/2006	N/A
NYC ECONOMIC DEV HUNTS PT MARKET HALLECK & VIELE ST BRONX, NY	FINDS	N/A

EXECUTIVE SUMMARY

HUNTS POINT WP PLANT BRONX BRONX, NY	NY Spills Spill Number/Closed Date: 9515096 / 2/12/2003	N/A
HUNTS POINT MARKET RANDALL ST BRONX, NY	NY Spills Spill Number/Closed Date: 0401309 / 8/27/2004	N/A
HUNTS POINT AVENUE COMPRESSOR STA 332 HUNTS POINT AVENUE BRONX, NY	FINDS	N/A
CON EDISON - HUNTS POINT WORKS MG BETWEEN BRONX RIVER, EAST RIVER, AND EAST BAY AVE BRONX, NY 10474	EDR MGP	N/A
HUNTS POINT REGULATOR BRONX, NY	NY Spills Spill Number/Closed Date: 9603961 / 7/3/1996	N/A
HUNTS POINT WASTE WATER TREATMENT RAYAWA ST AND MANIDA ST BRONX, NY	NY Spills Spill Number/Closed Date: 1005423 / 8/16/2010	N/A
CONSOLIDATED EDISON HUNTS POINT S 332 HUNTS POINT AVE NEW YORK, NY 10474	MANIFEST	N/A
NYC EDC-HUNTS PT FOOD DIST CENTER FOOD CENTER DR BRONX, NY	FINDS	N/A
HUNTS POINT AVENUE COMPRESSOR STA 332 HUNTS POINT AVE BRONX, NY 10474	RCRA-LQG US AIRS	NYD982738577
NYCDOS - SOUTH BRONX MARINE TRANS HUNTS POINT AVE & E RIVER BRONX, NY	FINDS	N/A
HUNTS POINT FOOD DIST. CTR. (PAR 800 FOOD CENTER DRIVE NEW YORK, NY 10474	ENG CONTROLS INST CONTROL VCP	N/A
HUNTS POINT SUBWAY TUNNEL HUNTS POINT AVE BRONX, NY	NY Spills Spill Number/Closed Date: 0701773 / 5/29/2007	N/A

EXECUTIVE SUMMARY

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL ---------- National Priority List
Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL ---------- National Priority List Deletions

Federal CERCLIS list

CERCLIS ---------- Comprehensive Environmental Response, Compensation, and Liability Information System
FEDERAL FACILITY ---------- Federal Facility Site Information listing

Federal RCRA CORRACTS facilities list

CORRACTS ---------- Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-SQG ---------- RCRA - Small Quantity Generators
RCRA-CESQG ---------- RCRA - Conditionally Exempt Small Quantity Generator

Federal institutional controls / engineering controls registries

US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROL ---------- Sites with Institutional Controls
LUCIS ---------- Land Use Control Information System

State- and tribal - equivalent CERCLIS

SHWS ---------- Inactive Hazardous Waste Disposal Sites in New York State
VAPOR REOPENED ---------- Vapor Intrusion Legacy Site List

State and tribal landfill and/or solid waste disposal site lists

SWF/LF ---------- Facility Register

EXECUTIVE SUMMARY

State and tribal leaking storage tank lists

HIST LTANKS - Listing of Leaking Storage Tanks
INDIAN LUST - Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

TANKS - Storage Tank Faciliy Listing
CBS UST - Chemical Bulk Storage Database
MOSF UST - Major Oil Storage Facilities Database
CBS AST - Chemical Bulk Storage Database
MOSF AST - Major Oil Storage Facilities Database
MOSF - Major Oil Storage Facility Site Listing
CBS - Chemical Bulk Storage Site Listing
INDIAN UST - Underground Storage Tanks on Indian Land
FEMA UST - Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

RES DECL - Restrictive Declarations Listing

State and tribal voluntary cleanup sites

INDIAN VCP - Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

ERP - Environmental Restoration Program Listing
BROWNFIELDS - Brownfields Site List

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS - A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

ODI - Open Dump Inventory
DEBRIS REGION 9 - Torres Martinez Reservation Illegal Dump Site Locations
SWRCY - Registered Recycling Facility List
SWTIRE - Registered Waste Tire Storage & Facility List
INDIAN ODI - Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL - Clandestine Drug Labs
DEL SHWS - Delisted Registry Sites
US HIST CDL - National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

HIST AST - Historical Petroleum Bulk Storage Database

EXECUTIVE SUMMARY

Local Land Records

LIENS 2	CERCLA Lien Information
LIENS	Spill Liens Information

Records of Emergency Release Reports

HMIRS	Hazardous Materials Information Reporting System
NY Hist Spills	SPILLS Database
SPILLS 80	SPILLS 80 data from FirstSearch
SPILLS 90	SPILLS 90 data from FirstSearch

Other Ascertainable Records

DOT OPS	Incident and Accident Data
DOD	Department of Defense Sites
FUDS	Formerly Used Defense Sites
CONSENT	Superfund (CERCLA) Consent Decrees
ROD	Records Of Decision
UMTRA	Uranium Mill Tailings Sites
US MINES	Mines Master Index File
TRIS	Toxic Chemical Release Inventory System
TSCA	Toxic Substances Control Act
FTTS	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS	FIFRA/TSCA Tracking System Administrative Case Listing
SSTS	Section 7 Tracking Systems
ICIS	Integrated Compliance Information System
PADS	PCB Activity Database System
MLTS	Material Licensing Tracking System
RADINFO	Radiation Information Database
RAATS	RCRA Administrative Action Tracking System
RMP	Risk Management Plans
HSWDS	Hazardous Substance Waste Disposal Site Inventory
UIC	Underground Injection Control Wells
DRYCLEANERS	Registered Drycleaners
SPDES	State Pollutant Discharge Elimination System
E DESIGNATION	E DESIGNATION SITE LISTING
INDIAN RESERV	Indian Reservations
SCRD DRYCLEANERS	State Coalition for Remediation of Drycleaners Listing
Financial Assurance	Financial Assurance Information Listing
2020 COR ACTION	2020 Corrective Action Program List
LEAD SMELTERS	Lead Smelter Sites
PRP	Potentially Responsible Parties
COAL ASH DOE	Steam-Electric Plant Operation Data
US FIN ASSUR	Financial Assurance Information
PCB TRANSFORMER	PCB Transformer Registration Database
COAL ASH EPA	Coal Combustion Residues Surface Impoundments List
COAL ASH	Coal Ash Disposal Site Listing
EPA WATCH LIST	EPA WATCH LIST

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR US Hist Auto Stat	EDR Exclusive Historic Gas Stations

EDR US Hist Cleaners ------- EDR Exclusive Historic Dry Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS ---------- Recovered Government Archive State Hazardous Waste Facilities List
RGA LF ---------- Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal ERNS list

ERNS: The Emergency Response Notification System records and stores information on reported releases of oil and hazardous substances. The source of this database is the U.S. EPA.

A review of the ERNS list, as provided by EDR, and dated 09/30/2013 has revealed that there are 3 ERNS sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	HUNTS POINT WATER POLLU	N 1/8 - 1/4 (0.246 mi.)	G51	166

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	600 FOOD CENTER DR	NE 0 - 1/8 (0.074 mi.)	C34	116
Not reported	1 HALLECK STREET	WNW 1/8 - 1/4 (0.209 mi.)	E45	158

State and tribal leaking storage tank lists

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 02/17/2014 has revealed that there is 1

LTANKS site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NYC DEPT OF GEN SER/NATIONAL F	***600 FOOD CENTER DRIVE***	***NE 0 - 1/8 (0.074 mi.)***	***C37***	***124***
Spill Number/Closed Date: 9409882 / 7/18/1996				

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 03/31/2014 has revealed that there is 1 UST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NATIONAL FOODS	***600 FOOD CENTER DR***	***NE 0 - 1/8 (0.074 mi.)***	***C36***	***116***

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the AST list, as provided by EDR, and dated 03/31/2014 has revealed that there is 1 AST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
VERNON. C. BAIN CENTER	1 HALLECK STREET	WNW 1/8 - 1/4 (0.209 mi.)	E46	158

State and tribal institutional control / engineering control registries

ENG CONTROLS: Environmental Remediation sites that have engineering controls in place.

A review of the ENG CONTROLS list, as provided by EDR, and dated 03/27/2014 has revealed that there is 1 ENG CONTROLS site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CE - GAS COMPRESSOR STATION	***FOOD CENTER DRIVE***	***NNW 0 - 1/8 (0.123 mi.)***	***D40***	***132***

INST CONTROL: Environmental Remediation sites that have institutional controls in place.

A review of the INST CONTROL list, as provided by EDR, and dated 03/27/2014 has revealed that there is 1 INST CONTROL site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CE - GAS COMPRESSOR STATION	***FOOD CENTER DRIVE***	***NNW 0 - 1/8 (0.123 mi.)***	***D40***	***132***

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the VCP list, as provided by EDR, and dated 03/27/2014 has revealed that there is 1 VCP site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CE - GAS COMPRESSOR STATION	***FOOD CENTER DRIVE***	***NNW 0 - 1/8 (0.123 mi.)***	***D40***	***132***

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Registered Storage Tanks

HIST UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the HIST UST list, as provided by EDR, and dated 01/01/2002 has revealed that there is 1 HIST UST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NATIONAL FOODS	***600 FOOD CENTER DR***	***NE 0 - 1/8 (0.074 mi.)***	***C36***	***116***

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 02/17/2014 has revealed that there are 7 NY Spills sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
DRUM RUN - ON SIDEWALK	FARAGAUT STREE/FOOD CNTN	0 - 1/8 (0.007 mi.)	B27	109
Spill Number/Closed Date: 0407093 / 11/1/2004				
SPILL NUMBER 0211696	HUNTS POINT AV/FARRAGOT N	0 - 1/8 (0.007 mi.)	B28	111
Spill Number/Closed Date: 0211696 / 2/25/2003				

Lower Elevation	Address	Direction / Distance	Map ID	Page
N/S 600 FOODCENTER DR	600 FOODCENTER DR	NE 0 - 1/8 (0.074 mi.)	C33	115
Spill Number/Closed Date: 0401327 / 2/25/2005				
NYC DEPT OF GEN SER/NATIONAL F	***600 FOOD CENTER DRIVE***	***NE 0 - 1/8 (0.074 mi.)***	***C37***	***124***
Spill Number/Closed Date: 0503472 / 7/13/2005				
Spill Number/Closed Date: 9414540 / 7/18/1996				
Spill Number/Closed Date: 0210026 / 1/31/2003				

Lower Elevation	Address	Direction / Distance	Map ID	Page
HUNSTPOINT	REGULATOR 2	WNW 0 - 1/8 (0.088 mi.)	39	131
Spill Number/Closed Date: 9603962 / 7/3/1996				
SPILL NUMBER 0201619	801 FOOD CENTER DRIVE	NNW 1/8 - 1/4 (0.138 mi.)	D41	149
Spill Number/Closed Date: 0201619 / 5/14/2002				
NYC DEPT OF CORRECTION	***1 HALLECK ST***	***WNW 1/8 - 1/4 (0.209 mi.)***	***E44***	***154***
Spill Number/Closed Date: 0101731 / 6/23/2003				
Spill Number/Closed Date: 0313151 / 3/19/2004				
Spill Number/Closed Date: 0011512 / 2/13/2003				

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 03/11/2014 has revealed that there are 6 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON MANHOLE 28552	FOOD CENTER DR & FARRAG	NNE 0 - 1/8 (0.009 mi.)	B30	113

Lower Elevation	Address	Direction / Distance	Map ID	Page
NATIONAL FOODS	***600 FOOD CENTER DR***	***NE 0 - 1/8 (0.074 mi.)***	***C36***	***116***
NYC ECONOMIC DEVELOPMENT CORP	***600-A FOOD CENTER DR***	***NE 0 - 1/8 (0.074 mi.)***	***C38***	***129***
NYCEDC - SITE B	***800 FOOD CENTER DR***	***NNW 1/8 - 1/4 (0.184 mi.)***	***42***	***151***
NYC DEPT OF CORRECTION	***1 HALLECK ST***	***WNW 1/8 - 1/4 (0.209 mi.)***	***E43***	***152***
CON EDISON MANHOLE 28852	500 FOOD CENTER DR FRON	NE 1/8 - 1/4 (0.222 mi.)	F48	164

FINDS: The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 11/18/2013 has revealed that there are 6 FINDS sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON MANHOLE 28552	FOOD CENTER DR & FARRAG	NNE 0 - 1/8 (0.009 mi.)	B31	114

Lower Elevation	Address	Direction / Distance	Map ID	Page
NYC ECONOMIC DEVELOPMENT CORP	600-A FOOD CENTER DR	NE 0 - 1/8 (0.074 mi.)	C35	116
NATIONAL FOODS	***600 FOOD CENTER DR***	***NE 0 - 1/8 (0.074 mi.)***	***C36***	***116***

Lower Elevation	Address	Direction / Distance	Map ID	Page
NYCEDC - SITE B	***800 FOOD CENTER DR***	***NNW 1/8 - 1/4 (0.184 mi.)***	***42***	***151***
NYC DEPT OF CORRECTION	***1 HALLECK ST***	***WNW 1/8 - 1/4 (0.209 mi.)***	***E43***	***152***
CON EDISON MANHOLE 28852	500 FOOD CENTER DR FRON	NE 1/8 - 1/4 (0.222 mi.)	F47	164

MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the MANIFEST list, as provided by EDR, and dated 02/28/2014 has revealed that there are 7 MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CONSOLIDATED EDISON - MH 28552	FOOD CENTER DR & FARRAG	NNE 0 - 1/8 (0.009 mi.)	B29	112

Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON	655 FOOD CENTER DR	NE 0 - 1/8 (0.034 mi.)	C32	114
NYC DEPT OF GEN SER/NATIONAL F	***600 FOOD CENTER DRIVE***	***NE 0 - 1/8 (0.074 mi.)***	***C37***	***124***
NYC ECONOMIC DEVELOPMENT CORP	***600-A FOOD CENTER DR***	***NE 0 - 1/8 (0.074 mi.)***	***C38***	***129***
CE - GAS COMPRESSOR STATION	***FOOD CENTER DRIVE***	***NNW 0 - 1/8 (0.123 mi.)***	***D40***	***132***
NYC DEPT OF CORRECTION	***1 HALLECK ST***	***WNW 1/8 - 1/4 (0.209 mi.)***	***E44***	***154***
CONSOLIDATED EDISON - MH 28552	500 FOOD CENTER DRIVE	NE 1/8 - 1/4 (0.222 mi.)	F49	165

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CONSOLIDATED EDISON COMPRESSOR	FOOD CENTER DRIVE	N 1/8 - 1/4 (0.233 mi.)	G50	166

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 20 records.

Site Name	Database(s)
GOLD MEDAL PRODUCE INC	US AIRS
SHELL OIL-ANGAMA AUTO CTR INC	RCRA NonGen / NLR, FINDS, MANIFEST, US AIRS
NYSDOT BIN 1066220	FINDS, MANIFEST
VERIZON NEW YORK INC. MANHOLE	FINDS, MANIFEST
CONSOLIDATED EDISON	MANIFEST
NYCDOT	RCRA NonGen / NLR, MANIFEST
ANHEUSER-BUSCH DISTRIBUTORS OF NEW	AST
CON EDISON OTHER - SPECIFY TUNNELS	RCRA NonGen / NLR
NYS DOT-OAK POINT LINK	FINDS
POINT TRANSPORTATION CORP	FINDS
FERRY POINT PARK GOLF COURSE	FINDS
NYCP&R - FERRY POINT WATERFRONT PA	FINDS
ATLANTIC EXPRESS - OAK POINT	FINDS
NYC DPR-CLASON POINT PARK	FINDS
DRUM RUN	NY Spills
QUEENS BOUND AT THE TOLL PLAZA AT	NY Spills
TRAFFIC ACCIDENT	NY Spills
MILE MARKER IS POSSIBLY 2.6 THE CA	NY Spills
IFO TASK FORCE	NY Spills
NYCDOS - SOUTH BRONX MARINE TRANSF	ICIS

OVERVIEW MAP - 3929425.2s

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

National Priority List Sites

Dept. Defense Sites

0 1/4 1/2 1 Miles

Indian Reservations BIA

County Boundary

Oil & Gas pipelines from USGS

100-year flood zone

500-year flood zone

National Wetland Inventory

State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Hunts Point	CLIENT: STV Inc.
ADDRESS: Hunts Point Bronx NY 10474	CONTACT: Doug Glorie
LAT/LONG: 40.8024926701848 / 73.8741922004371	INQUIRY #: 3929425.2s DATE: May 02, 2014 8:53 am

Copyright © 2014 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

DETAIL MAP - 3929425.2s

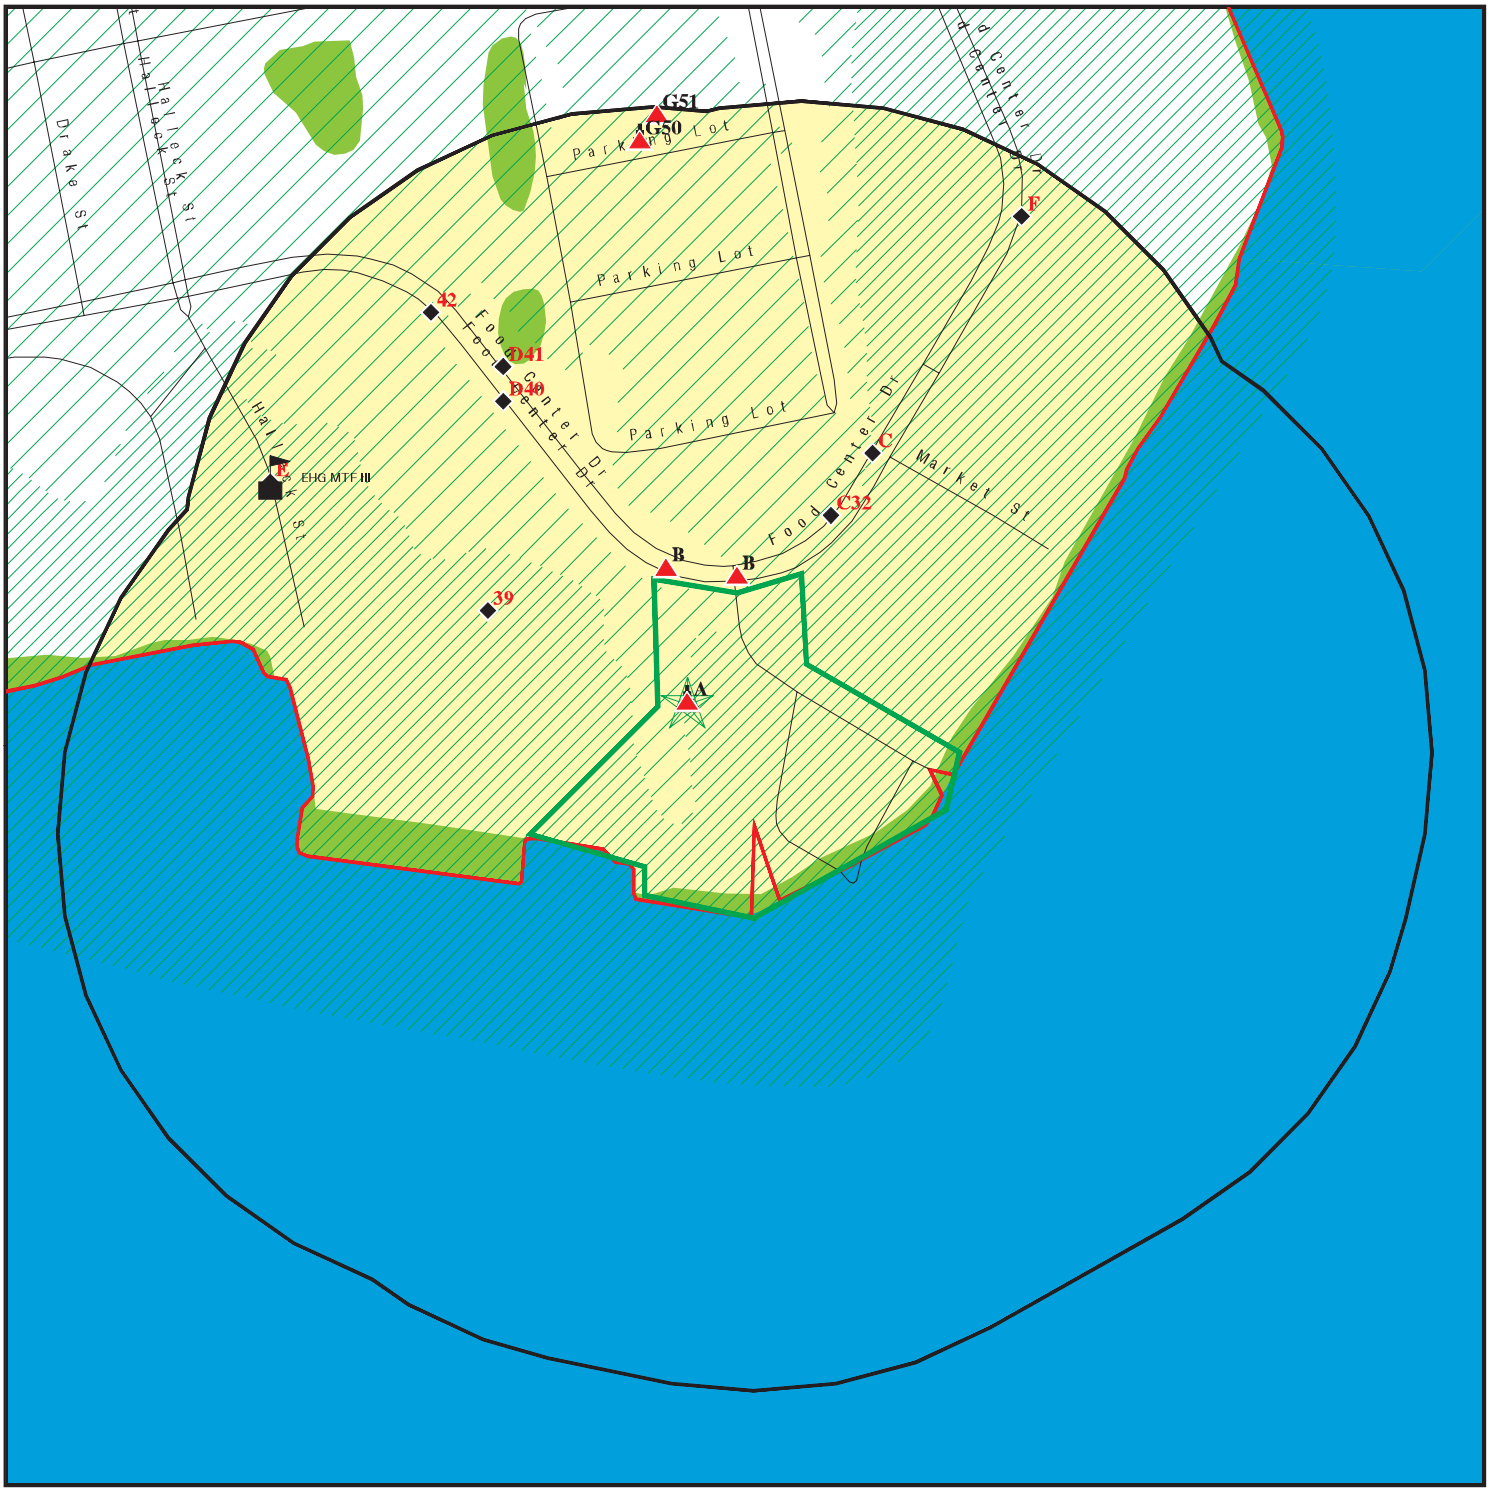

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

0 1/16 1/8 1/4 Miles

Indian Reservations BIA

County Boundary

Oil & Gas pipelines from USGS

100-year flood zone

500-year flood zone

National Wetland Inventory

State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Hunts Point	CLIENT:	STV Inc.
ADDRESS:	Hunts Point Bronx NY 10474	CONTACT:	Doug Glorie
		INQUIRY #:	3929425.2s
LAT/LONG:	40.8024926701848 / 73.8741922004371	DATE:	May 02, 2014 8:54 am

Copyright © 2014 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Federal NPL site list								
NPL	0.250		0	0	NR	NR	NR	0
Proposed NPL	0.250		0	0	NR	NR	NR	0
NPL LIENS	0.250		0	0	NR	NR	NR	0
Federal Delisted NPL site list								
Delisted NPL	0.250		0	0	NR	NR	NR	0
Federal CERCLIS list								
CERCLIS	0.250		0	0	NR	NR	NR	0
FEDERAL FACILITY	0.250		0	0	NR	NR	NR	0
Federal CERCLIS NFRAP site List								
CERC-NFRAP	0.250	1	0	0	NR	NR	NR	1
Federal RCRA CORRACTS facilities list								
CORRACTS	0.250		0	0	NR	NR	NR	0
Federal RCRA non-CORRACTS TSD facilities list								
RCRA-TSDF	0.250		0	0	NR	NR	NR	0
Federal RCRA generators list								
RCRA-LQG	0.250	1	0	0	NR	NR	NR	1
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-CESQG	0.250		0	0	NR	NR	NR	0
Federal institutional controls / engineering controls registries								
US ENG CONTROLS	0.250		0	0	NR	NR	NR	0
US INST CONTROL	0.250		0	0	NR	NR	NR	0
LUCIS	0.250		0	0	NR	NR	NR	0
Federal ERNS list								
ERNS	0.250		1	2	NR	NR	NR	3
State- and tribal - equivalent CERCLIS								
SHWS	0.250		0	0	NR	NR	NR	0
VAPOR REOPENED	0.250		0	0	NR	NR	NR	0
State and tribal landfill and/or solid waste disposal site lists								
SWF/LF	0.250		0	0	NR	NR	NR	0
State and tribal leaking storage tank lists								
LTANKS	0.250	2	1	0	NR	NR	NR	3
HIST LTANKS	0.250		0	0	NR	NR	NR	0
INDIAN LUST	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
State and tribal registered storage tank lists								
TANKS	0.250		0	0	NR	NR	NR	0
UST	0.250		1	0	NR	NR	NR	1
CBS UST	0.250		0	0	NR	NR	NR	0
MOSF UST	0.250		0	0	NR	NR	NR	0
AST	0.250		0	1	NR	NR	NR	1
CBS AST	0.250		0	0	NR	NR	NR	0
MOSF AST	0.250		0	0	NR	NR	NR	0
MOSF	0.250		0	0	NR	NR	NR	0
CBS	0.250		0	0	NR	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
FEMA UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
ENG CONTROLS	0.250	3	1	0	NR	NR	NR	4
INST CONTROL	0.250	3	1	0	NR	NR	NR	4
RES DECL	0.250		0	0	NR	NR	NR	0
State and tribal voluntary cleanup sites								
INDIAN VCP	0.250		0	0	NR	NR	NR	0
VCP	0.250	3	1	0	NR	NR	NR	4
State and tribal Brownfields sites								
ERP	0.250		0	0	NR	NR	NR	0
BROWNFIELDS	0.250		0	0	NR	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.250		0	0	NR	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
ODI	0.250		0	0	NR	NR	NR	0
DEBRIS REGION 9	0.250		0	0	NR	NR	NR	0
SWRCY	0.250		0	0	NR	NR	NR	0
SWTIRE	0.250		0	0	NR	NR	NR	0
INDIAN ODI	0.250		0	0	NR	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL	0.250		0	0	NR	NR	NR	0
DEL SHWS	0.250		0	0	NR	NR	NR	0
US HIST CDL	0.250		0	0	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
HIST UST	0.250		1	0	NR	NR	NR	1
HIST AST	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Local Land Records								
LIENS 2	0.250		0	0	NR	NR	NR	0
LIENS	0.250		0	0	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.250		0	0	NR	NR	NR	0
NY Spills	0.250	12	5	2	NR	NR	NR	19
NY Hist Spills	0.250		0	0	NR	NR	NR	0
SPILLS 80	0.250		0	0	NR	NR	NR	0
SPILLS 90	0.250		0	0	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		3	3	NR	NR	NR	6
DOT OPS	0.250		0	0	NR	NR	NR	0
DOD	0.250		0	0	NR	NR	NR	0
FUDS	0.250		0	0	NR	NR	NR	0
CONSENT	0.250		0	0	NR	NR	NR	0
ROD	0.250		0	0	NR	NR	NR	0
UMTRA	0.250		0	0	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
TRIS	0.250		0	0	NR	NR	NR	0
TSCA	0.250		0	0	NR	NR	NR	0
FTTS	0.250		0	0	NR	NR	NR	0
HIST FTTS	0.250		0	0	NR	NR	NR	0
SSTS	0.250		0	0	NR	NR	NR	0
ICIS	0.250		0	0	NR	NR	NR	0
PADS	0.250		0	0	NR	NR	NR	0
MLTS	0.250		0	0	NR	NR	NR	0
RADINFO	0.250		0	0	NR	NR	NR	0
FINDS	0.250	5	3	3	NR	NR	NR	11
RAATS	0.250		0	0	NR	NR	NR	0
RMP	0.250		0	0	NR	NR	NR	0
HSWDS	0.250		0	0	NR	NR	NR	0
UIC	0.250		0	0	NR	NR	NR	0
MANIFEST	0.250	2	5	2	NR	NR	NR	9
DRYCLEANERS	0.250		0	0	NR	NR	NR	0
SPDES	0.250		0	0	NR	NR	NR	0
AIRS	0.250	1	0	0	NR	NR	NR	1
E DESIGNATION	0.250		0	0	NR	NR	NR	0
INDIAN RESERV	0.250		0	0	NR	NR	NR	0
SCRD DRYCLEANERS	0.250		0	0	NR	NR	NR	0
Financial Assurance	0.250		0	0	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
LEAD SMELTERS	0.250		0	0	NR	NR	NR	0
US AIRS	0.250	1	0	0	NR	NR	NR	1
PRP	0.250		0	0	NR	NR	NR	0
COAL ASH DOE	0.250		0	0	NR	NR	NR	0
US FIN ASSUR	0.250		0	0	NR	NR	NR	0
PCB TRANSFORMER	0.250		0	0	NR	NR	NR	0
COAL ASH EPA	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
COAL ASH	0.250		0	0	NR	NR	NR	0
EPA WATCH LIST	0.250		0	0	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	0.250	1	0	1	NR	NR	NR	2
EDR US Hist Auto Stat	0.250		0	0	NR	NR	NR	0
EDR US Hist Cleaners	0.250		0	0	NR	NR	NR	0
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
RGA HWS	0.250		0	0	NR	NR	NR	0
RGA LF	0.250		0	0	NR	NR	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

A1
Target Property
HUNTS PT - PARCEL C
550 FOOD CENTER DRIVE
BRONX, NY 10474

Site 1 of 26 in cluster A

LTANKS **S106013291**
NY Spills **N/A**
ENG CONTROLS
INST CONTROL
VCP

Actual:
17 ft.

LTANKS:

Site ID:	280307
Spill Number/Closed Date:	0302288 / 6/4/2003
Spill Date:	6/2/2003
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	0301
Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	6/3/2003
CID:	207
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	6/3/2003
Spill Record Last Update:	6/4/2003
Spiller Name:	DAVID FONTAINE
Spiller Company:	IROQUOIS GAS TRANSMISSION
Spiller Address:	1 CORPORTATE DR SUITE 600
Spiller City,St,Zip:	SHELTON, CT 06484-
Spiller County:	001
Spiller Contact:	DAVID FONTAINE
Spiller Phone:	(203) 925-7264
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	227590
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "DEMEO"
Remarks:	Not reported

Material:

Site ID:	280307
Operable Unit ID:	868989
Operable Unit:	01
Material ID:	506762
Material Code:	0060A
Material Name:	WASTEWATER
Case No.:	Not reported
Material FA:	Other
Quantity:	15
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

HUNTS PT - PARCEL C (Continued) **S106013291**

Tank Test:

SPILLS:

Facility ID:	0300674
Facility Type:	ER
DER Facility ID:	227590
Site ID:	280306
DEC Region:	2
Spill Date:	4/18/2003
Spill Number/Closed Date:	0300674 / 4/18/2003
Spill Cause:	Human Error
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	MXTIPPLE
Referred To:	Not reported
Reported to Dept:	4/18/2003
CID:	297
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	4/18/2003
Spill Record Last Update:	4/18/2003
Spiller Name:	DAVID FONTAINE
Spiller Company:	IROQUOIS GAS TRANSMISSION
Spiller Address:	1 CORPORTATE DR SUITE 600
Spiller City,St,Zip:	SHELTON, CT 06484-
Spiller Company:	001
Contact Name:	DAVID FONTAINE
Contact Phone:	(203) 925-7264
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE"4/18/2003 - Spill closed by Zhao/DO.
Remarks:	A PORTABLE WATER PUMP WAS NOT PROPERLY SET ON THE GROUND AND FELL OVER SPILLING THE FUEL TO THE GROUND - SPILL CLEANED UP BY EMPLOYEES

Material:

Site ID:	280306
Operable Unit ID:	867024
Operable Unit:	01
Material ID:	508749
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10
Units:	Gallons
Recovered:	10
Resource Affected:	Not reported
Oxygenate:	False

HUNTS PT - PARCEL C (Continued) **S106013291**

Tank Test:

ENG CONTROLS:

Site Code:	58552
HW Code:	V00412
Control Code:	15
Control Type:	ENG
Date Record Added:	12/23/2011
Date Rec Updated:	03/25/2014
Updated By:	RSLEE
Site Description:	Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.
Env Problem:	Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.
Health Problem:	Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

Site Code:	58552
HW Code:	V00412
Control Code:	22
Control Type:	ENG
Date Record Added:	12/23/2011
Date Rec Updated:	03/25/2014
Updated By:	RSLEE
Site Description:	Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light

HUNTS PT - PARCEL C (Continued) **S106013291**

commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.

Env Problem: Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.

Health Problem: Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

INST CONTROL:
Site Code: 58552
Control Name: Deed Restriction
HW Code: V00412
Control Code: A
Control Type: INST
Dt record added: 12/23/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58552
Site Description: Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.

Env Problem: Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.

HUNTS PT - PARCEL C (Continued) **S106013291**

Health Problem: Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

Site Code: 58552
Control Name: Site Management Plan
HW Code: V00412
Control Code: 32
Control Type: INST
Dt record added: 12/23/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58552
Site Description: Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.
Env Problem: Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.
Health Problem: Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

Site Code: 58552
Control Name: Ground Water Use Restriction
HW Code: V00412
Control Code: 08
Control Type: INST
Dt record added: 12/23/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58552
Site Description: Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It

HUNTS PT - PARCEL C (Continued) **S106013291**

is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.

Env Problem: Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.

Health Problem: Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

Site Code: 58552
Control Name: Landuse Restriction
HW Code: V00412
Control Code: 25
Control Type: INST
Dt record added: 12/23/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58552

Site Description: Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.

Env Problem: Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern

HUNTS PT - PARCEL C (Continued) **S106013291**

at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.

Health Problem: Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

VCP:

Program Type:	VCP
Site Code:	58552
HW Code:	V00412
Site Class:	C
SWIS:	0301
Region:	2
Town:	New York City
Acres:	10.300
Date Record Added:	11/30/2000
Date Record Updated:	10/25/2013
Updated By:	JAMORAS
Site Description:	Location:The Hunts Point Food Distribution Center (HPFDC) lies on the Hunts Point peninsula in the South Bronx and is comprised of several separate parcels listed as A through F. It is approximately 10 acres in size and is located in the southeastern portion of the HPFDC. It is bounded to the north & south by adjacent properties, on the west by Food Center Drive, & on the east by the East River. Current Zoning/Uses:Current Zoning and Land Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. The surrounding area is mainly industrial/commercial in nature.Historical Uses:The site was formerly used by Consolidated Edison for a coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Parcel C was historically used for coal storage. Site Geology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities; however, fill material consistently includes soil, construction and demolition debris material, ash, cinders, residual coal as well as coal tar and purifier waste. Underlying the fill is a clay layer.
Env Problem:	Nature and Extent of Contamination:Remediation of the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs) and metals, including copper, selenium and zinc in soil, and cyanide and naphthalene in groundwater.
Health Problem:	Soil and groundwater are impacted by manufactured gas plant waste. A building and pavement will minimize the potential for expsoure to subsurface contamination. Groundwater is not used as a source for drinking water, therefore, expsoures are unlikely.

A2 Target Property **HUNTS PT TERMINAL BLDG230**
HUNTS PT TERMINAL BL-320
BRONX, NY

NY Spills **S102148074**
N/A

Site 2 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	9400429
Facility Type:	ER
DER Facility ID:	254869
Site ID:	316145
DEC Region:	2
Spill Date:	4/11/1994
Spill Number/Closed Date:	9400429 / 4/13/1994
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	O'DOWD
Referred To:	Not reported
Reported to Dept:	4/11/1994
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	4/13/1994
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	4/11/1994
Spill Record Last Update:	4/13/1994
Spiller Name:	Not reported
Spiller Company:	UNK
Spiller Address:	Not reported
Spiller City,St,Zip:	***UPDATE***, ZZ
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	Not reported
Remarks:	FD @ SCENE - BUREAU OF INDUSTRIAL WASTE TO BE NOTIFIED - NO CALL BACKS NEEDED.

Material:

Site ID:	316145
Operable Unit ID:	997926
Operable Unit:	01
Material ID:	387745
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-100
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

HUNTS PT TERMINAL BLDG230 (Continued) **S102148074**

Tank Test:

A3 Target Property **NY POWER AUTH - HUNTS POINT FUEL CELL** **FINDS** **1016305888**
COSTER ST & RYAWA AVE NS BLDG **N/A**
BRONX, NY

Site 3 of 26 in cluster A

Actual: 17 ft.

FINDS:

Registry ID: 110014359407

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

A4 Target Property **HUNTS POINT WASTE WATER PLANT** **NY Spills** **S116156280**
HUNTS POINT WASTE WATER PLANT **N/A**
BRONX, NY

Site 4 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	1310228
Facility Type:	ER
DER Facility ID:	446069
Site ID:	491066
DEC Region:	2
Spill Date:	1/22/2014
Spill Number/Closed Date:	1310228 / 1/23/2014
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	0301
Investigator:	vszhune
Referred To:	Not reported
Reported to Dept:	1/23/2014
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1/23/2014
Spill Record Last Update:	1/23/2014
Spiller Name:	Not reported
Spiller Company:	HUNTS POINT

HUNTS POINT WASTE WATER PLANT (Continued) **S116156280**

Spiller Address:	HUNTS POINT WASTE WATER PLANT
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	999
Contact Name:	VAWE JAWANDO
Contact Phone:	7183492812
DEC Memo:	01/23/14-Non Petroleum. Spill referred to Water Division. Spill Closed.
Remarks:	Not reported

Material:

Site ID:	491066
Operable Unit ID:	1240615
Operable Unit:	01
Material ID:	2240818
Material Code:	9999
Material Name:	Other - BYPASS
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A5
Target Property
HUNTS POINT RIVERSIDE PAR
LAFAYETTE AVE. TO THE END
BRONX, NY

NY Spills **S109207184**
N/A

Site 5 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	0805602
Facility Type:	ER
DER Facility ID:	351942
Site ID:	402729
DEC Region:	2
Spill Date:	8/13/2008
Spill Number/Closed Date:	0805602 / 8/14/2008
Spill Cause:	Unknown
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required.
SWIS:	0301
Investigator:	RMPIPER
Referred To:	Not reported
Reported to Dept:	8/14/2008
CID:	406
Water Affected:	HUNTS POINT RIVERSID
Spill Source:	Unknown
Spill Notifier:	Citizen
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False

HUNTS POINT RIVERSIDE PAR (Continued) **S109207184**

Remediation Phase:	0
Date Entered In Computer:	8/14/2008
Spill Record Last Update:	8/15/2008
Spiller Name:	UNKNOWN NAME
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	999
Contact Name:	BRENDA LEE CRUZ
Contact Phone:	(718) 430-4665
DEC Memo:	I spoke with caller. She described red. brown water and dead fish. She sees no oil on surface. I explained to her that i seems like a fish kill and algae bloom. If we hear any differnet, we will be in touch. Closed.
Remarks:	Material in the water is a reddish brown, very foul smell. There are a lot of dead crabs and fish. The fish that normally swim at the bottom are now at the top of the water. Spill extends from bank to bank. Unknown material and unknown amount. No info on clean up..... (Aug. 2007 spill #0705030 exact same conditions.. smell, mass die off, same color material)

Material:

Site ID:	402729
Operable Unit ID:	1159483
Operable Unit:	01
Material ID:	2150595
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A6 **HUNTS POINT AVENUE COMPRESSOR STATION** **AIRS** **S106001824**
Target **332 HUNTS POINT AVE** **N/A**
Property **BRONX, NY 10474**

Site 6 of 26 in cluster A

Actual: 17 ft.

AIRS:

Permit Type:	Air Title V Facility
Permit Status:	Issued
Issue Date:	02/05/2008
Expiration Date:	02/04/2013
County Fips:	Not reported
DEC Id:	2600700190
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Unit: Not reported

Detail:

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 39.896704741599997

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.67428743999999996

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 592.23933199999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 2.2476248000000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 1.62952798

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 7.3047806000000007E-2

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 1.7980998399999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 2.4161966600000001E-2

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.35961996800000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 7.3047806

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 12244150

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 10457.0771

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 3.5961996799999998

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 75.698340000000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2009

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount (Lbs/Yr): 273

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 380.07321986621503

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 876.998533096507

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 20036.099999999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1391.0534

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1243.1616154428

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 22228.68

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 147.261

Year: 2009
DECID: 2600700190

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 341.883752362721

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 59.316600000000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 3.0193618560000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 5189528.1900000004

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 6.13307877

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.30193618560000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 2.0286337500000001E-2

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 1.5096809280000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 0.0613307877

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 1.3681483409999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 1.8871011600000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 405.72674940000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.56613034799999995

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 33.497429843399999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 7056.3050000000003

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: UI0001
Process Id: E01EI
Contaminant Name/cas: PM25-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.00410752
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: PM25-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.01114846
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: 001EI
Contaminant Name/cas: PM25-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0028481
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: HP0005
Process Id: GTNFP
Contaminant Name/cas: PM25-PRI
Epa Control Code: Not reported
Contol Eff: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Emissions: 0.4995
Unit: TON

Permit Type: Air Title V Facility
Permit Status: Issued
Issue Date: 02/05/2008
Expiration Date: 02/04/2013
County Fips: Not reported
DEC Id: 2600700190
Emission Unit Id: Not reported
Process Id: Not reported
Contaminant Name/cas: Not reported
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: Not reported
Unit: Not reported

Detail:

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 3.0089046000000002

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 8274487.6500000004

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 3.2345724499999999E-2

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 47.830441022999999

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 9.7789399499999998

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Amount (Lbs/Yr): 0.48142473600000002

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 4.8142473600000004

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1878.9991380114

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 527.810319962721

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.90267138000000002

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 9.7789399499999999E-2

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 29.793173987799999

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.50352583200000001

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 360.86017959999998

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 1.6784194400000001

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 1.2168540940000001

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 5.4548631799999997E-2

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 1.3427355519999999

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 1.8043008999999999E-2

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.26854711040000001

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 5.4548631800000003

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 4615653.46

Year: 2006

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 6400.6021000000001

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 2.6854711039999999

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 53.459339999999997

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 308.28026856272101

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 130.73699999999999

Year: 2006
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 20209.995999999999

Year: 2006
DECID: 2600700190

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1130.703918059

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 4.3113657600000002

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1701.4816981653

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 8.7574616999999993E-2

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 8.7574617000000003

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 53.409259323599997

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 80.405739999999994

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 579.33977400000003

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 130.54499999999999

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 7410159.9000000004

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.43113657599999999

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 475.95065496272099

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.80838107999999997

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 9034.3621000000003

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 2.4071236800000002

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 2.6946036000000002

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 127.944

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 2.181455835

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 9837.0170999999991

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 30452.655999999999

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2007
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Amount (Lbs/Yr): 646.914489

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 2.8966988700000001E-2

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 67.809539999999998

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 28084.036

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 1.95358761

Year: 2008
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 2.1556828800000001

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: HP0005
Process Id: GTNFP
Contaminant Name/cas: PM10-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.4995
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

DEC Id: 2600700190
Emission Unit Id: HP0005
Process Id: GTNFP
Contaminant Name/cas: NOX
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 11.313
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: HP0005
Process Id: GTNFP
Contaminant Name/cas: CO
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 3.783
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: VOC
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.00806499
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: SO2
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.00087999
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: PM10-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.011145
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: NOX
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.14669999
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: CO
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.12322499
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001
Process Id: E02EI
Contaminant Name/cas: 7439921
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0015
Unit: LB

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: EI0001

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Process Id: 001EI
Contaminant Name/cas: PM10-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.005
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: UI0001
Process Id: E01EI
Contaminant Name/cas: VOC
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.00297
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: UI0001
Process Id: E01EI
Contaminant Name/cas: SO2
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.00031999
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: UI0001
Process Id: E01EI
Contaminant Name/cas: PM10-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.004105
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36005
DEC Id: 2600700190
Emission Unit Id: UI0001
Process Id: E01EI

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05404999
Unit:	TON
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36005
DEC Id:	2600700190
Emission Unit Id:	UI0001
Process Id:	E01EI
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0454
Unit:	TON
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36005
DEC Id:	2600700190
Emission Unit Id:	UI0001
Process Id:	E01EI
Contaminant Name/cas:	7439921
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0005
Unit:	LB
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36005
DEC Id:	2600700190
Emission Unit Id:	HP0005
Process Id:	GTNFP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.8565
Unit:	TON
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36005
DEC Id:	2600700190
Emission Unit Id:	HP0005
Process Id:	GTNFP
Contaminant Name/cas:	SO2

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.02078499
Unit: TON

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: Not reported
DEC Id: 2600700190
Emission Unit Id: Not reported
Process Id: Not reported
Contaminant Name/cas: Not reported
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: Not reported
Unit: Not reported

Permit Type: Air Title V Facility
Permit Status: Issued
Issue Date: 02/05/2008
Expiration Date: 02/04/2013
County Fips: Not reported
DEC Id: 2600700190
Emission Unit Id: Not reported
Process Id: Not reported
Contaminant Name/cas: Not reported
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: Not reported
Unit: Not reported

Detail:
Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 39.896704741599997

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.67428743999999996

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 592.23933199999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 2.2476248000000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 1.62952798

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 7.3047806000000007E-2

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 1.7980998399999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 2.4161966600000001E-2

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.35961996800000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 7.3047806

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 12244150

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 10457.0771

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 3.5961996799999998

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 75.698340000000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount (Lbs/Yr): 273

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 380.07321986621503

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 876.998533096507

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Amount (Lbs/Yr): 20036.099999999999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1391.0534

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 1243.1616154428

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 22228.68

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 147.261

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 341.883752362721

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3887999999999998

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 59.316600000000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 1.9390372786058699E-3

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 3.0193618560000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 5189528.1900000004

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 6.13307877

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.30193618560000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 2.0286337500000001E-2

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 1.5096809280000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 0.0613307877

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 1.3681483409999999

Year: 2009

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 1.8871011600000001

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 405.72674940000002

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 0.56613034799999995

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 33.497429843399999

Year: 2009
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 7056.3050000000003

Permit Type: ATV
Permit Status: Issued
Issue Date: 02/05/2008
Expiration Date: 02/04/2013
County Fips: Not reported
DEC Id: 2600700190
Emission Unit Id: Not reported
Process Id: Not reported
Contaminant Name/cas: Not reported
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: Not reported
Unit: Not reported

Permit Type: ATV
Permit Status: Issued
Issue Date: 09/19/2013
Expiration Date: 09/18/2018
County Fips: Not reported
DEC Id: 2600700190
Emission Unit Id: Not reported
Process Id: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Contaminant Name/cas: Not reported
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: Not reported
Unit: Not reported

Detail:

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount (Lbs/Yr): 89.678674708

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000071432
Contaminant: BENZENE
Amount (Lbs/Yr): 1.51568208

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000074828
Contaminant: METHANE
Amount (Lbs/Yr): 1151.238824

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount (Lbs/Yr): 5.0522736

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount (Lbs/Yr): 3.66289836

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount (Lbs/Yr): 0.164198892

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount (Lbs/Yr): 4.04181888

Year: 2012
DECID: 2600700190

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount (Lbs/Yr): 0.0543119412

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000107028
Contaminant: ACROLEIN
Amount (Lbs/Yr): 0.808363776

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000108883
Contaminant: TOLUENE
Amount (Lbs/Yr): 16.4198892

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount (Lbs/Yr): 18195443

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount (Lbs/Yr): 16534.0771

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount (Lbs/Yr): 8.08363776

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007439921
Contaminant: LEAD
Amount (Lbs/Yr): 0.0019391337854

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount (Lbs/Yr): 101.45874

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **S106001824**

CAS #: 007664417
Contaminant: AMMONIA
Amount (Lbs/Yr): 9.3888

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount (Lbs/Yr): 442

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075025
Contaminant: PM 2.5
Amount (Lbs/Yr): 864.96767187

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 983.074989

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount (Lbs/Yr): 41584.1

Year: 2012
DECID: 2600700190
Facility Name: HUNTS POINT AVENUE COMPRESSOR STATION
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount (Lbs/Yr): 248.7119148

A7 Target Property **HUNTS POINT #631** **NY Spills** **S105058198**
RANDELL AV/E CHESTER BAY **N/A**
BRONX, NY

Site 7 of 26 in cluster A

Actual: 17 ft.

SPILLS:
Facility ID: 0102940
Facility Type: ER
DER Facility ID: 222016
Site ID: 272821
DEC Region: 2
Spill Date: 6/16/2001
Spill Number/Closed Date: 0102940 / 6/18/2001
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS: 0301

HUNTS POINT #631 (Continued) **S105058198**

Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	6/16/2001
CID:	281
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	6/16/2001
Spill Record Last Update:	7/11/2001
Spiller Name:	TIM CHRISTENSEN
Spiller Company:	NYC DEP
Spiller Address:	96-05 HORACE HARDING EXP
Spiller City,St,Zip:	ELMHURST, NY 11368-
Spiller Company:	001
Contact Name:	TIM CHRISTENSEN
Contact Phone:	(718) 372-7193
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "DEMEO"Reffered to Water Program for follow-up investigation.
Remarks:	ABOVE MATERIAL DISCOVERED AT ABOVE LOCATION.CAUSE IS UNDER INVESTIGATION. LEAK RATE IS 5 GALLONS PER MINUTE.CALLER IS REQUESTING CALL BACK.

Material:

Site ID:	272821
Operable Unit ID:	839531
Operable Unit:	01
Material ID:	535041
Material Code:	0062A
Material Name:	RAW SEWAGE
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A8
Target Property
HUNTS POINT DRAWBRIDGE
BRONX RIVER RD
BRONX, NY

NY Spills **S104653047**
N/A

Site 8 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	0002298
Facility Type:	ER
DER Facility ID:	187800
Site ID:	227547
DEC Region:	2

HUNTS POINT DRAWBRIDGE (Continued) **S104653047**

Spill Date:	5/24/2000
Spill Number/Closed Date:	0002298 / 2/13/2003
Spill Cause:	Housekeeping
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	5/24/2000
CID:	312
Water Affected:	BRONX RIVER
Spill Source:	Commercial/Industrial
Spill Notifier:	Federal Government
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	5/24/2000
Spill Record Last Update:	2/13/2003
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND"ADMINISTRATIVE CLOSURE - AUSTIN
Remarks:	CONTRACTORS WORKING ON THE BRIDGE ARE CREATING A PROBLEM - DEAD FISH AROUND - FOUL SMELLING AIR - ETC... - USCG SENDING A TEAM TO CHECK

Material:

Site ID:	227547
Operable Unit ID:	823812
Operable Unit:	01
Material ID:	550664
Material Code:	0059A
Material Name:	SOLVENTS
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	227547
Operable Unit ID:	823812
Operable Unit:	01
Material ID:	550663
Material Code:	0055A
Material Name:	PAINT
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No

HUNTS POINT DRAWBRIDGE (Continued) **S104653047**

Resource Affected: Not reported
Oxygenate: False

Tank Test:

A9 **NYCDEP** **MANIFEST** **1009235607**
Target Property **HUNTS PT-LAFAYETTE & EDGEWATER** **N/A**
BRONX, NY

Site 9 of 26 in cluster A

Actual: 17 ft.

NY MANIFEST:

EPA ID:	NYP003660727
Country:	USA
Mailing Name:	NYCDEP
Mailing Contact:	CHRIS HAAS
Mailing Address:	96-05 HOARCE HARDING EXPWY
Mailing Address 2:	Not reported
Mailing City:	FLUSHING
Mailing State:	NY
Mailing Zip:	11368
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-595-4664

Document ID:	NYG1416501
Manifest Status:	Not reported
Trans1 State ID:	NYD077444263
Trans2 State ID:	Not reported
Generator Ship Date:	10/20/1998
Trans1 Recv Date:	10/20/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/21/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP003660727
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	PD1011NY
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	01600
Units:	P - Pounds
Number of Containers:	006
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	98

A10 **HUNTS POINT COKING STATION** **CERC-NFRAP** **1003863874**
Target **HUNTS POINT RD & E RIVER** **NYD980532352**
Property **BRONX, NY 10474**

Site 10 of 26 in cluster A

Actual:
17 ft.

CERC-NFRAP:
Site ID: 0202008
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

CERCLIS-NFRAP Assessment History:
Action: DISCOVERY
Date Started: / /
Date Completed: 06/01/81
Priority Level: Not reported

Action: ARCHIVE SITE
Date Started: / /
Date Completed: 09/22/87
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 09/22/87
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

---

A11 **HUNTS PT. FDC PERIMETER** **ENG CONTROLS** **S105857223**
Target **FOOD CENTER DRIVE** **INST CONTROL** **N/A**
Property **BRONX, NY 10474** **VCP**

Site 11 of 26 in cluster A

Actual:
17 ft.

ENG CONTROLS:
Site Code: 57555
HW Code: V00641
Control Code: 15
Control Type: ENG
Date Record Added: 02/15/2008
Date Rec Updated: 03/25/2014
Updated By: RSLEE
Site Description: Location:The Hunts Point Perimeter Site is located along the eastern and southeastern portions of the roadway known as Food Center Drive within the Hunts Point Food Distribution Center (HPFDC). The HPFDC lies on the Hunts Point peninsula in the South Bronx. Site Features:The site is an active mapped roundway situated along the perimeter of the HPFDC.Current Zoning/Use:The site is an active mapped roadway and is zoned for commercial/industrial use.Historical Use:Ths site was part of the former Con Ed Hunts Point Manufactured Gas Plant (MGP), also known as the Hunts Point Coking Station. The initial coke oven plant at the facility was constructed in 1924 through 1926 and had a capacity of 20 million cubic feet of gas per day. The gas produced was used as a primary source of energy for lighting and heating. Another battery of coke ovens was installed in 1931, increasing gas production capacity by 10 million cubic feet per day. A carburetted water gas plant was added in 1932, adding 30 million cubic feet per day to the capacity. The MGP included 46 buildings or structures and was devoted entirely to the manufacture

HUNTS PT. FDC PERIMETER (Continued) **S105857223**

of gas and its associated by-products, including coal tars, cyanide-contaminated purifier waste, sludges and oils. This manufacturing process has led to site contamination. The structures included two gas holders. The MGP operated into the 1950s. Much of the property was subsequently redeveloped into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The soil stratigraphy varies across the MGP site and is influenced by historic filling activities. Historic fill material such as coal, slag, ash, and wood intermingled with sand and gravel and dredged sediment is present across the former MGP property. Underlying the fill unit in the eastern portion of the site is a mixture of clayey silt, sand and gravel which has been described as poorly sorted outwash deposits. A silty clay unit, described as meadowmat underlies the outwash deposits with the thickest intervals in the western portion of the former MGP.The water table generally occurs in the shallow subsurface at depths ranging from approximately 2 to 15 feet below ground surface. In general, groundwater flow is directed from the upland to the East and Bronx Rivers. However, groundwater flow may be influenced by tidal conditions with the adjacent rivers and the numerous subsurface utilities in the area.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete and involved the excavation and off-site disposal of approximately 17,500 tons of material contaminated with coal tar and purifier waste. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), and purifier waste (cyanide) in soil, and PAHs, benzene, toluene, ethylbenzene and xylenes (BTEX), and cyanide in groundwater.

Health Problem: This site consists of a portion of Food Center Drive where a natural gas pipeline, known as the Eastchester Extension Project, was installed. Soil contaminated with coal tar has been excavated and disposed of properly. Exposures are not expected since the site is paved.

INST CONTROL:

Site Code: 57555
Control Name: Soil Management Plan
HW Code: V00641
Control Code: 14
Control Type: INST
Dt record added: 02/15/2008
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57555
Site Description: Location:The Hunts Point Perimeter Site is located along the eastern and southeastern portions of the roadway known as Food Center Drive within the Hunts Point Food Distribution Center (HPFDC). The HPFDC lies on the Hunts Point peninsula in the South Bronx. Site Features:The site is an active mapped roundway situated along the perimeter of the HPFDC.Current Zoning/Use:The site is an active mapped roadway and is zoned for commercial/industrial use.Historical Use:Ths site was part of the former Con Ed Hunts Point Manufactured Gas Plant (MGP), also known as the Hunts Point Coking Station. The initial coke oven plant at the facility was constructed in 1924 through 1926 and had a capacity of 20 million cubic feet of gas per day. The gas produced was used as a primary source of energy for lighting and heating. Another battery of coke ovens was installed in 1931, increasing gas production capacity by 10 million cubic feet per

HUNTS PT. FDC PERIMETER (Continued) **S105857223**

day. A carburetted water gas plant was added in 1932, adding 30 million cubic feet per day to the capacity. The MGP included 46 buildings or structures and was devoted entirely to the manufacture of gas and its associated by-products, including coal tars, cyanide-contaminated purifier waste, sludges and oils. This manufacturing process has led to site contamination. The structures included two gas holders. The MGP operated into the 1950s. Much of the property was subsequently redeveloped into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The soil stratigraphy varies across the MGP site and is influenced by historic filling activities. Historic fill material such as coal, slag, ash, and wood intermingled with sand and gravel and dredged sediment is present across the former MGP property. Underlying the fill unit in the eastern portion of the site is a mixture of clayey silt, sand and gravel which has been described as poorly sorted outwash deposits. A silty clay unit, described as meadowmat underlies the outwash deposits with the thickest intervals in the western portion of the former MGP.The water table generally occurs in the shallow subsurface at depths ranging from approximately 2 to 15 feet below ground surface. In general, groundwater flow is directed from the upland to the East and Bronx Rivers. However, groundwater flow may be influenced by tidal conditions with the adjacent rivers and the numerous subsurface utilities in the area.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete and involved the excavation and off-site disposal of approximately 17,500 tons of material contaminated with coal tar and purifier waste. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), and purifier waste (cyanide) in soil, and PAHs, benzene, toluene, ethylbenzene and xylenes (BTEX), and cyanide in groundwater.

Health Problem: This site consists of a portion of Food Center Drive where a natural gas pipeline, known as the Eastchester Extension Project, was installed. Soil contaminated with coal tar has been excavated and disposed of properly. Exposures are not expected since the site is paved.

Site Code: 57555
Control Name: Ground Water Use Restriction
HW Code: V00641
Control Code: 08
Control Type: INST
Dt record added: 02/15/2008
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57555

Site Description: Location:The Hunts Point Perimeter Site is located along the eastern and southeastern portions of the roadway known as Food Center Drive within the Hunts Point Food Distribution Center (HPFDC). The HPFDC lies on the Hunts Point peninsula in the South Bronx. Site Features:The site is an active mapped roundway situated along the perimeter of the HPFDC.Current Zoning/Use:The site is an active mapped roadway and is zoned for commercial/industrial use.Historical Use:Ths site was part of the former Con Ed Hunts Point Manufactured Gas Plant (MGP), also known as the Hunts Point Coking Station. The initial coke oven plant at the facility was constructed in 1924 through 1926 and had a capacity of 20 million cubic feet of gas per day. The gas produced was used as a primary source of energy for

HUNTS PT. FDC PERIMETER (Continued) **S105857223**

lighting and heating. Another battery of coke ovens was installed in 1931, increasing gas production capacity by 10 million cubic feet per day. A carburetted water gas plant was added in 1932, adding 30 million cubic feet per day to the capacity. The MGP included 46 buildings or structures and was devoted entirely to the manufacture of gas and its associated by-products, including coal tars, cyanide-contaminated purifier waste, sludges and oils. This manufacturing process has led to site contamination. The structures included two gas holders. The MGP operated into the 1950s. Much of the property was subsequently redeveloped into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The soil stratigraphy varies across the MGP site and is influenced by historic filling activities. Historic fill material such as coal, slag, ash, and wood intermingled with sand and gravel and dredged sediment is present across the former MGP property. Underlying the fill unit in the eastern portion of the site is a mixture of clayey silt, sand and gravel which has been described as poorly sorted outwash deposits. A silty clay unit, described as meadowmat underlies the outwash deposits with the thickest intervals in the western portion of the former MGP.The water table generally occurs in the shallow subsurface at depths ranging from approximately 2 to 15 feet below ground surface. In general, groundwater flow is directed from the upland to the East and Bronx Rivers. However, groundwater flow may be influenced by tidal conditions with the adjacent rivers and the numerous subsurface utilities in the area.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete and involved the excavation and off-site disposal of approximately 17,500 tons of material contaminated with coal tar and purifier waste. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), and purifier waste (cyanide) in soil, and PAHs, benzene, toluene, ethylbenzene and xylenes (BTEX), and cyanide in groundwater.

Health Problem: This site consists of a portion of Food Center Drive where a natural gas pipeline, known as the Eastchester Extension Project, was installed. Soil contaminated with coal tar has been excavated and disposed of properly. Exposures are not expected since the site is paved.

Site Code: 57555
Control Name: Landuse Restriction
HW Code: V00641
Control Code: 25
Control Type: INST
Dt record added: 02/15/2008
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57555

Site Description: Location:The Hunts Point Perimeter Site is located along the eastern and southeastern portions of the roadway known as Food Center Drive within the Hunts Point Food Distribution Center (HPFDC). The HPFDC lies on the Hunts Point peninsula in the South Bronx. Site Features:The site is an active mapped roundway situated along the perimeter of the HPFDC.Current Zoning/Use:The site is an active mapped roadway and is zoned for commercial/industrial use.Historical Use:Ths site was part of the former Con Ed Hunts Point Manufactured Gas Plant (MGP), also known as the Hunts Point Coking Station. The initial coke oven plant at the facility was constructed in 1924

HUNTS PT. FDC PERIMETER (Continued) **S105857223**

through 1926 and had a capacity of 20 million cubic feet of gas per day. The gas produced was used as a primary source of energy for lighting and heating. Another battery of coke ovens was installed in 1931, increasing gas production capacity by 10 million cubic feet per day. A carburetted water gas plant was added in 1932, adding 30 million cubic feet per day to the capacity. The MGP included 46 buildings or structures and was devoted entirely to the manufacture of gas and its associated by-products, including coal tars, cyanide-contaminated purifier waste, sludges and oils. This manufacturing process has led to site contamination. The structures included two gas holders. The MGP operated into the 1950s. Much of the property was subsequently redeveloped into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The soil stratigraphy varies across the MGP site and is influenced by historic filling activities. Historic fill material such as coal, slag, ash, and wood intermingled with sand and gravel and dredged sediment is present across the former MGP property. Underlying the fill unit in the eastern portion of the site is a mixture of clayey silt, sand and gravel which has been described as poorly sorted outwash deposits. A silty clay unit, described as meadowmat underlies the outwash deposits with the thickest intervals in the western portion of the former MGP.The water table generally occurs in the shallow subsurface at depths ranging from approximately 2 to 15 feet below ground surface. In general, groundwater flow is directed from the upland to the East and Bronx Rivers. However, groundwater flow may be influenced by tidal conditions with the adjacent rivers and the numerous subsurface utilities in the area.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete and involved the excavation and off-site disposal of approximately 17,500 tons of material contaminated with coal tar and purifier waste. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), and purifier waste (cyanide) in soil, and PAHs, benzene, toluene, ethylbenzene and xylenes (BTEX), and cyanide in groundwater.

Health Problem: This site consists of a portion of Food Center Drive where a natural gas pipeline, known as the Eastchester Extension Project, was installed. Soil contaminated with coal tar has been excavated and disposed of properly. Exposures are not expected since the site is paved.

Site Code: 57555
Control Name: Deed Restriction
HW Code: V00641
Control Code: A
Control Type: INST
Dt record added: 02/15/2008
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57555
Site Description: Location:The Hunts Point Perimeter Site is located along the eastern and southeastern portions of the roadway known as Food Center Drive within the Hunts Point Food Distribution Center (HPFDC). The HPFDC lies on the Hunts Point peninsula in the South Bronx. Site Features:The site is an active mapped roundway situated along the perimeter of the HPFDC.Current Zoning/Use:The site is an active mapped roadway and is zoned for commercial/industrial use.Historical Use:Ths site was part of the former Con Ed Hunts Point Manufactured

HUNTS PT. FDC PERIMETER (Continued) **S105857223**

Gas Plant (MGP), also known as the Hunts Point Coking Station. The initial coke oven plant at the facility was constructed in 1924 through 1926 and had a capacity of 20 million cubic feet of gas per day. The gas produced was used as a primary source of energy for lighting and heating. Another battery of coke ovens was installed in 1931, increasing gas production capacity by 10 million cubic feet per day. A carburetted water gas plant was added in 1932, adding 30 million cubic feet per day to the capacity. The MGP included 46 buildings or structures and was devoted entirely to the manufacture of gas and its associated by-products, including coal tars, cyanide-contaminated purifier waste, sludges and oils. This manufacturing process has led to site contamination. The structures included two gas holders. The MGP operated into the 1950s. Much of the property was subsequently redeveloped into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The soil stratigraphy varies across the MGP site and is influenced by historic filling activities. Historic fill material such as coal, slag, ash, and wood intermingled with sand and gravel and dredged sediment is present across the former MGP property. Underlying the fill unit in the eastern portion of the site is a mixture of clayey silt, sand and gravel which has been described as poorly sorted outwash deposits. A silty clay unit, described as meadowmat underlies the outwash deposits with the thickest intervals in the western portion of the former MGP.The water table generally occurs in the shallow subsurface at depths ranging from approximately 2 to 15 feet below ground surface. In general, groundwater flow is directed from the upland to the East and Bronx Rivers. However, groundwater flow may be influenced by tidal conditions with the adjacent rivers and the numerous subsurface utilities in the area.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete and involved the excavation and off-site disposal of approximately 17,500 tons of material contaminated with coal tar and purifier waste. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), and purifier waste (cyanide) in soil, and PAHs, benzene, toluene, ethylbenzene and xylenes (BTEX), and cyanide in groundwater.

Health Problem: This site consists of a portion of Food Center Drive where a natural gas pipeline, known as the Eastchester Extension Project, was installed. Soil contaminated with coal tar has been excavated and disposed of properly. Exposures are not expected since the site is paved.

VCP:

Program Type:	VCP
Site Code:	57555
HW Code:	V00641
Site Class:	C
SWIS:	0301
Region:	2
Town:	New York City
Acres:	1.860
Date Record Added:	02/26/2003
Date Record Updated:	10/25/2013
Updated By:	JAMORAS
Site Description:	Location:The Hunts Point Perimeter Site is located along the eastern and southeastern portions of the roadway known as Food Center Drive within the Hunts Point Food Distribution Center (HPFDC). The HPFDC

HUNTS PT. FDC PERIMETER (Continued) **S105857223**

lies on the Hunts Point peninsula in the South Bronx. Site Features:The site is an active mapped roundway situated along the perimeter of the HPFDC.Current Zoning/Use:The site is an active mapped roadway and is zoned for commercial/industrial use.Historical Use:Ths site was part of the former Con Ed Hunts Point Manufactured Gas Plant (MGP), also known as the Hunts Point Coking Station. The initial coke oven plant at the facility was constructed in 1924 through 1926 and had a capacity of 20 million cubic feet of gas per day. The gas produced was used as a primary source of energy for lighting and heating. Another battery of coke ovens was installed in 1931, increasing gas production capacity by 10 million cubic feet per day. A carburetted water gas plant was added in 1932, adding 30 million cubic feet per day to the capacity. The MGP included 46 buildings or structures and was devoted entirely to the manufacture of gas and its associated by-products, including coal tars, cyanide-contaminated purifier waste, sludges and oils. This manufacturing process has led to site contamination. The structures included two gas holders. The MGP operated into the 1950s. Much of the property was subsequently redeveloped into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The soil stratigraphy varies across the MGP site and is influenced by historic filling activities. Historic fill material such as coal, slag, ash, and wood intermingled with sand and gravel and dredged sediment is present across the former MGP property. Underlying the fill unit in the eastern portion of the site is a mixture of clayey silt, sand and gravel which has been described as poorly sorted outwash deposits. A silty clay unit, described as meadowmat underlies the outwash deposits with the thickest intervals in the western portion of the former MGP.The water table generally occurs in the shallow subsurface at depths ranging from approximately 2 to 15 feet below ground surface. In general, groundwater flow is directed from the upland to the East and Bronx Rivers. However, groundwater flow may be influenced by tidal conditions with the adjacent rivers and the numerous subsurface utilities in the area.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete and involved the excavation and off-site disposal of approximately 17,500 tons of material contaminated with coal tar and purifier waste. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), and purifier waste (cyanide) in soil, and PAHs, benzene, toluene, ethylbenzene and xylenes (BTEX), and cyanide in groundwater.

Health Problem: This site consists of a portion of Food Center Drive where a natural gas pipeline, known as the Eastchester Extension Project, was installed. Soil contaminated with coal tar has been excavated and disposed of properly. Exposures are not expected since the site is paved.

A12 Target Property **HUNTS POINT COOP MARKET**
PARCEL B /FOOD CTR DR
BRONX, NY

LTANKS **S102960140**
N/A

Site 12 of 26 in cluster A

Actual: 17 ft.

LTANKS:
Site ID: 306360
Spill Number/Closed Date: 9709363 / 10/26/2005
Spill Date: 10/21/1997
Spill Cause: Tank Failure

HUNTS POINT COOP MARKET (Continued) **S102960140**

Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	0301
Investigator:	RSLEE
Referred To:	Not reported
Reported to Dept:	11/12/1997
CID:	365
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	11/12/1997
Spill Record Last Update:	2/6/2006
Spiller Name:	KAY ZIAS
Spiller Company:	NYC ECONOMIC DEVELOP CORP
Spiller Address:	110 WILLIAM ST
Spiller City,St,Zip:	NEW YORK CITY, NY 10038-
Spiller County:	001
Spiller Contact:	KAY ZIAS
Spiller Phone:	(212) 312-3752
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	247438
DEC Memo:	10/26/05 - Lee - This spill was closed on 10/26/05 for the following reasons: this site is being managed under the voluntary cleanup program. The Operation & Maintenance Plan for the approved soil vapor extraction/air sparging system was approved on 6/20/05.Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL" NO PBS FOUND.4/12/04-Vought-Spill transferred from Tibbe to Rommel as per Rommel.
Remarks:	during soil sampling they found about 1 ft of contaminated soil

Material:

Site ID:	306360
Operable Unit ID:	1052507
Operable Unit:	01
Material ID:	327713
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A13 **HUNTS POINT - OUTFALL 004** **NY Spills** **S108130285**
Target **HUNTS POINT DRAINAGE AREA** **N/A**
Property **BRONX, NY**

Site 13 of 26 in cluster A

Actual:
17 ft.

SPILLS:

Facility ID:	0605982
Facility Type:	ER
DER Facility ID:	319145
Site ID:	369261
DEC Region:	2
Spill Date:	8/23/2006
Spill Number/Closed Date:	0605982 / 8/24/2006
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	8/23/2006
CID:	27
Water Affected:	BRONX RIVER
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	8/23/2006
Spill Record Last Update:	8/24/2006
Spiller Name:	Not reported
Spiller Company:	HUNTS POINT - OUTFALL 004
Spiller Address:	HUNTS POINT DRAINAGE AREA
Spiller City,St,Zip:	BRONX, NY 10474
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	forwarded to DEC Water
Remarks:	Caller reports bypass. Unknown reason at this time. Caller had no further information.

Material:

Site ID:	369261
Operable Unit ID:	1127103
Operable Unit:	01
Material ID:	2116684
Material Code:	0062A
Material Name:	RAW SEWAGE
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

HUNTS POINT - OUTFALL 004 (Continued) **S108130285**

Tank Test:

A14 Target Property **NYC ECONOMIC DEV HUNTS PT MARKET SITE A** **FINDS** **1016255325**
HALLECK & VIELE ST **N/A**
BRONX, NY

Site 14 of 26 in cluster A

Actual: 17 ft.

FINDS:

Registry ID: 110008102506

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

A15 Target Property **HUNTS POINT WP PLANT** **NY Spills** **S102239223**
BRONX **N/A**
BRONX, NY

Site 15 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	9515096
Facility Type:	ER
DER Facility ID:	220875
Site ID:	271376
DEC Region:	2
Spill Date:	2/24/1996
Spill Number/Closed Date:	9515096 / 2/12/2003
Spill Cause:	Equipment Failure
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	CAENGELH
Referred To:	Not reported
Reported to Dept:	2/24/1996
CID:	349
Water Affected:	EAST RIVER
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2/24/1996
Spill Record Last Update:	2/12/2003

HUNTS POINT WP PLANT (Continued) **S102239223**

Spiller Name:	Not reported
Spiller Company:	HUNTS POINT WP PLANT
Spiller Address:	BRONX
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	(718) 589-1120
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"2/12/2003 Closed Due To The Nature / Extent Of The Spill Report
Remarks:	2 pumps of the 6 are down causing by-pass

Material:

Site ID:	271376
Operable Unit ID:	1026187
Operable Unit:	01
Material ID:	355226
Material Code:	0062A
Material Name:	RAW SEWAGE
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A16 **HUNTS POINT MARKET** **NY Spills** **S106468781**
Target **RANDALL ST** **N/A**
Property **BRONX, NY**

Site 16 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	0401309
Facility Type:	ER
DER Facility ID:	118148
Site ID:	138167
DEC Region:	2
Spill Date:	5/6/2004
Spill Number/Closed Date:	0401309 / 8/27/2004
Spill Cause:	Traffic Accident
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	CESAWYER
Referred To:	Not reported
Reported to Dept:	5/6/2004
CID:	41
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported

HUNTS POINT MARKET (Continued) **S106468781**

Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	5/6/2004
Spill Record Last Update:	8/27/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	UNKNOWN NAME
Contact Phone:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER"5/7/04 - Sawyer - Responded to the site at 23:45 to find a yard jockey cab with a trailer attached, backed into a diesel fueling tank truck from North Atlantic Energy. Between 300-500 gallon had been released out of the 2900 gallon tank truck because of the accident. Royal Environmental Services Corp. was on the scene, FDNY had contained the release and left and North Atlantic's Jimmy Coleman was also there. The spill had been contained, but the product had to worked in with the speedy-dry to be picked. Royal used a Vac-truck to pickup most of the free product on the ground and then proceeded to cover most of the ground with absorbent to be drummed. When I left at About 1:15 Royal had about 10 drums full of deisel soaked debris. I told Marc from Royal that I was going to need disposal manifest for all the debris taken away from the site. I have not received any documentation to date. 5/13/04 - Sawyer - Talked to a Kevin McCarty of LMS, a contractor for the property owner wanted information on the traffic accident.(845)735-8300 Ext. 2237/14/04 - Sawyer - Talked to Arnie at Royal Environmental and he will forward manifest as soon as possible.8/27/04 - Sawyer - Received maifest and documentation from the cleanup from Brenda at Royal Environmental.
Remarks:	TRUCK WAS FUELING ANOTHER TRUCK. A THIRD TRUCK STRUCK FIRST TRUCK AND RIPPED CARGO TANK OPEN, CAUSING SPILL. CLEANUP COMPANY ENROUTE. REQUESTING DEC TO RESPOND.

Material:

Site ID:	138167
Operable Unit ID:	883144
Operable Unit:	01
Material ID:	492521
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	300
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A17 **HUNTS POINT AVENUE COMPRESSOR STATION** **FINDS** **1016053692**
Target **332 HUNTS POINT AVENUE** **N/A**
Property **BRONX, NY**

Site 17 of 26 in cluster A

Actual:
17 ft.

FINDS:

Registry ID: 110001600385

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

HAZARDOUS WASTE BIENNIAL REPORTER

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

CRITERIA AND HAZARDOUS AIR POLLUTANT INVENTORY

A18 **CON EDISON - HUNTS POINT WORKS MGP** **EDR MGP** **1008407869**
Target **BETWEEN BRONX RIVER, EAST RIVER, AND EAST BAY AVE** **N/A**
Property **BRONX, NY 10474**

Site 18 of 26 in cluster A

Actual:
17 ft.

Manufactured Gas Plants:
No additional information available

A19 **HUNTS POINT** **NY Spills** **S102240310**
Target **REGULATOR** **N/A**
Property **BRONX, NY**

Site 19 of 26 in cluster A

Actual:
17 ft.

SPILLS:

Facility ID:	9603961
Facility Type:	ER
DER Facility ID:	263499
Site ID:	327343
DEC Region:	2
Spill Date:	6/22/1996
Spill Number/Closed Date:	9603961 / 7/3/1996
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
SWIS:	0301
Investigator:	CAENGELH
Referred To:	Not reported
Reported to Dept:	6/22/1996
CID:	196
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	6/22/1996
Spill Record Last Update:	7/8/1996
Spiller Name:	MR MCAULIFFE
Spiller Company:	DEP NYS
Spiller Address:	HUINTS POINT
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	001
Contact Name:	MR MCAULIFFE
Contact Phone:	(718) 372-7193
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"Passed on to Tim Burns of the Water Division.
Remarks:	raw sewage in the longisland sound. appears on going problemrep is on scene.

Material:

Site ID:	327343
Operable Unit ID:	1031617
Operable Unit:	01
Material ID:	350233
Material Code:	0062A
Material Name:	RAW SEWAGE
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

HUNTS POINT (Continued) **S102240310**

Tank Test:

A20 **HUNTS POINT WASTE WATER TREATMENT FACILITY** **NY Spills** **S110488556**
Target **RAYAWA ST AND MANIDA ST** **N/A**
Property **BRONX, NY**

Site 20 of 26 in cluster A

Actual:
17 ft.

SPILLS:

Facility ID:	1005423
Facility Type:	ER
DER Facility ID:	393730
Site ID:	438739
DEC Region:	2
Spill Date:	8/11/2010
Spill Number/Closed Date:	1005423 / 8/16/2010
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	8/14/2010
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	8/14/2010
Spill Record Last Update:	8/16/2010
Spiller Name:	ANTHONY TRENTACOST
Spiller Company:	HUNTS POINT WASTE WATER TREATMENT FACILITY
Spiller Address:	RAYAWA ST AND MANIDA ST
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	999
Contact Name:	ANTHONY TRENTACOST
Contact Phone:	(973) 445-4131
DEC Memo:	Spoke with URS(Anthony).Minor quantity motor oil spilled from the backhoe.It was cleaned up immediately.Contaminated soil was removed for disposal.(sr)
Remarks:	Caller reporting 1 gallon of motor oil to soil. Clean up complete.

Material:

Site ID:	438739
Operable Unit ID:	1189388
Operable Unit:	01
Material ID:	2184343
Material Code:	0015
Material Name:	Motor Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1

HUNTS POINT WASTE WATER TREATMENT FACILITY (Continued) **S110488556**

Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

A21 **CONSOLIDATED EDISON HUNTS POINT STA** **MANIFEST** **S112139397**
Target **332 HUNTS POINT AVE** **N/A**
Property **NEW YORK, NY 10474**

Site 21 of 26 in cluster A

Actual:
17 ft.

NY MANIFEST:

EPA ID:	NYD982738577
Country:	USA
Mailing Name:	CONSOLIDATED EDISON HUNTS POINT STA
Mailing Contact:	FRANKLIN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD003812047
Trans2 State ID:	Not reported
Generator Ship Date:	2012-03-21
Trans1 Recv Date:	2012-03-21
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-03-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD980536593
Waste Code:	Not reported
Quantity:	1800.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	9.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	001128514GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD003812047
Trans2 State ID: NJD003812047
Generator Ship Date: 2012-03-23
Trans1 Recv Date: 2012-03-23
Trans2 Recv Date: 2012-03-29
TSD Site Recv Date: 2012-03-30
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982738577
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported
Quantity: 91.0
Units: K - Kilograms (2.2 pounds)
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 001128578GBF
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 2012-02-23
Trans1 Recv Date: 2012-02-23
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2012-02-23
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982738577
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

TSDF ID:	NYD077444263
Waste Code:	Not reported
Quantity:	8.8
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203021FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-24
Trans1 Recv Date:	2012-02-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	Not reported
Quantity:	60.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	3.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003207243FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-24
Trans1 Recv Date:	2012-02-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	Not reported
Quantity:	20.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	2.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003207243FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-03-01
Trans1 Recv Date:	2012-03-01
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-03-02
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	3.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	1.0

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Year:	2012
Manifest Tracking Num:	003203204FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-22
Trans1 Recv Date:	2012-02-22
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-23
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	5.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203226FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-22
Trans1 Recv Date:	2012-02-22

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-23
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	10.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203226FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-04-25
Trans1 Recv Date:	2012-04-25
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-04-26
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	20.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203854FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-04-19
Trans1 Recv Date:	2012-04-19
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-04-20
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	40.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203864FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-04-13
Trans1 Recv Date:	2012-04-13
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-04-16
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	30.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203874FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD003812047
Trans2 State ID:	Not reported
Generator Ship Date:	2012-03-21
Trans1 Recv Date:	2012-03-21
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-03-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD980536593
Waste Code:	Not reported
Quantity:	1800.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	9.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	001128514GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD003812047
Trans2 State ID: NJD003812047
Generator Ship Date: 2012-03-23
Trans1 Recv Date: 2012-03-23
Trans2 Recv Date: 2012-03-29
TSD Site Recv Date: 2012-03-30
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982738577
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: Not reported
Quantity: 91.0
Units: K - Kilograms (2.2 pounds)
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 001128578GBF
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H132

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 2012-02-23
Trans1 Recv Date: 2012-02-23
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2012-02-23
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982738577
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NYD077444263
Waste Code: Not reported
Quantity: 8.8
Units: P - Pounds
Number of Containers: 1.0

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203021FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-24
Trans1 Recv Date:	2012-02-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	Not reported
Quantity:	60.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	3.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003207243FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-24
Trans1 Recv Date:	2012-02-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	Not reported
Quantity:	20.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	2.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003207243FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-03-01
Trans1 Recv Date:	2012-03-01
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-03-02
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	3.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203204FLE
Import Ind:	N

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-22
Trans1 Recv Date:	2012-02-22
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-23
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	5.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203226FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-02-22
Trans1 Recv Date:	2012-02-22
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-02-23
Part A Recv Date:	Not reported

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	10.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203226FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2012-04-25
Trans1 Recv Date:	2012-04-25
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2012-04-26
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982738577
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	20.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2012
Manifest Tracking Num:	003203854FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N

CONSOLIDATED EDISON HUNTS POINT STA (Continued) **S112139397**

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Click this hyperlink while viewing on your computer to access
14 additional NY_MANIFEST: record(s) in the EDR Site Report.

A22 **NYC EDC-HUNTS PT FOOD DIST CENTER** **FINDS** **1010013292**
Target **FOOD CENTER DR** **N/A**
Property **BRONX, NY**

Site 22 of 26 in cluster A

Actual: 17 ft.

FINDS:

Registry ID: 110028281909

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

A23 **HUNTS POINT AVENUE COMPRESSOR STATION** **RCRA-LQG** **1000111695**
Target **332 HUNTS POINT AVE** **US AIRS** **NYD982738577**
Property **BRONX, NY 10474**

Site 23 of 26 in cluster A

Actual: 17 ft.

RCRA-LQG:
Date form received by agency: 03/06/2012
Facility name: CON EDISON - HUNTS POINT STATION
Facility address: 332 HUNTS POINT AVE
BRONX, NY 10474
EPA ID: NYD982738577
Mailing address: IRVING PLACE
NEW YORK, NY 10003
Contact: DENNIS HUACON
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: (212) 460-2757
Contact email: Not reported
EPA Region: 02
Land type: Private
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE, 15TH FL
	NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	01/01/2011
Owner/Op end date:	Not reported

Owner/operator name:	CONSOLIDATED EDISON
Owner/operator address:	NOT REQUIRED
	NOT REQUIRED, WY 99999
Owner/operator country:	Not reported
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE, 15TH FL
	NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/2011
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Historical Generators:

Date form received by agency:	01/01/2007
Facility name:	CON EDISON - HUNTS POINT STATION
Site name:	CON EDISON - HUNTS POINT STATION

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Classification: Small Quantity Generator

Date form received by agency: 01/01/2006
Facility name: CON EDISON - HUNTS POINT STATION
Site name: CON EDISON - HUNTS POINT STATION
Classification: Small Quantity Generator

Date form received by agency: 02/25/2004
Facility name: CON EDISON - HUNTS POINT STATION
Site name: CON EDISON - HUNTS POINT STATION
Classification: Large Quantity Generator

Date form received by agency: 01/01/2001
Facility name: CON EDISON - HUNTS POINT STATION
Site name: HUNTS POINT STATION
Classification: Large Quantity Generator

Date form received by agency: 07/08/1999
Facility name: CON EDISON - HUNTS POINT STATION
Classification: Not a generator, verified

Date form received by agency: 07/26/1989
Facility name: CON EDISON - HUNTS POINT STATION
Classification: Large Quantity Generator

Hazardous Waste Summary:
Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D008
Waste name: LEAD

Waste code: D018
Waste name: BENZENE

Waste code: B002
Waste name: B002

Waste code: B003
Waste name: B003

Waste code: B007
Waste name: B007

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Biennial Reports:

Last Biennial Reporting Year: 2013

Annual Waste Handled:

Waste code:	D001
Waste name:	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
Amount (Lbs):	40947
Waste code:	D008
Waste name:	LEAD
Amount (Lbs):	55.1
Waste code:	D018
Waste name:	BENZENE
Amount (Lbs):	41096.9

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date:	11/09/2012
Evaluation:	COMPLIANCE ASSISTANCE VISIT
Area of violation:	Not reported
Date achieved compliance:	Not reported
Evaluation lead agency:	EPA
Evaluation date:	03/18/2008
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Not reported
Date achieved compliance:	Not reported
Evaluation lead agency:	State

AIRS (AFS):

Compliance and Violation Data Major Sources:

EPA plant ID:	110001592081
Plant name:	HUNTS POINT AVENUE COMPRESSOR STATION
Plant address:	332 HUNTS POINT AVE BRONX, NY 10474
County:	BRONX
Region code:	02
Dunn & Bradst #:	Not reported
Air quality cntrl region:	043
Sic code:	4924
Sic code desc:	Not reported
North Am. industrial classf:	221210
NAIC code description:	Natural Gas Distribution
Default compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Default classification:	ACTUAL OR POTENTIAL EMISSIONS ARE ABOVE THE APPLICABLE MAJOR SOURCE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

THRESHOLDS
Govt facility: ALL OTHER FACILITIES NOT OWNED OR OPERATED BY A FEDERAL, STATE, OR LOCAL GOVERNMENT
Current HPV: Not reported

Compliance and Enforcement Major Issues:
Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 000110
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 000110
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: COMPL BY EPA, NO ACT REQ
Date achieved: 000601
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: SV RESOLVED
Date achieved: 000601
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 010214
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 010214
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 020313
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 020313
Penalty amount: 000000000

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 020501
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 020501
Penalty amount: 000000000

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 020501
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: TITLE V COMPLIANCE CERT DUE/RECEIVED BY
Date achieved: 020507
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION EPA REVIEW
Date achieved: 020715
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 020909
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 020909
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 020909
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 021023
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 021023
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 021023
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 021030
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 030107
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 030107
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 030425
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 030425
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 030425
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 030425
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 030425
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 030425
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 030626
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 030707
Penalty amount: Not reported

Air program: NSPS
National action type: NOTIFICATION RECEIVED
Date achieved: 030813
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 030919
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 030919
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 030919
Penalty amount: Not reported

Air program: NSPS
National action type: NOTIFICATION RECEIVED
Date achieved: 030922
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 031017
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 031017
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 031017
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 031103
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 040113
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 040213
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 040427
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 040427
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 040427
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 040427
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: TITLE V COMPLIANCE CERT DUE/RECEIVED BY
Date achieved: 040427
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 040427
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 040427
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 040727
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 040922
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 040922
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 040927
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 040927
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 040927
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 041028
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 041028
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 041028
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 041029
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 050202
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 050429
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 050429
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 050429
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 050429
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 050429
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: TITLE V COMPLIANCE CERT DUE/RECEIVED BY
Date achieved: 050429
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 050429
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 050801
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 050804
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 050804
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 050914
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 050914
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 050914
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 051027
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 051027
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 051027
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 060130
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 060421
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 060421
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 060421
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 060421
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 060421
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 060421
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 060424
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: TITLE V COMPLIANCE CERT DUE/RECEIVED BY
Date achieved: 060425
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 061025
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 061025
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 061025
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 070427
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 070427
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 070427
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 070427
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 070427
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 070427
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 070427
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: TITLE V COMPLIANCE CERT DUE/RECEIVED BY
Date achieved: 070502
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 070606
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 070606
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 070726
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 070919
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 070919
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 070919
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 071026
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 071026
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 071026
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 080131
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 080429
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 080508
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 080508
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 080508
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 080508
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 080508
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 080508
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 080724
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 080724
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 080724
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 080724
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 080724
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 080724
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 081029
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 090130
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 090130
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 090130
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 090422
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 090422
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 090427
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 090501
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 090501
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 090501
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 090730
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 090730
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 090730
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 090730
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 090730
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 090730
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 091029
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 100201
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 100201
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 100201
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 100428
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 100730
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 100730
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 100730
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 100730
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 100730
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 100730
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 101101
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 110131
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 110131
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 110131
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 110309
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 110309
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 110413
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 110413
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 110413
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 110425
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 110728
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 110728
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 110728
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 110728
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 110728
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 110728
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 111028
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 120201
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 120201
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 120201
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 120501
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 120731
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 120731
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 120731
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 120731
Penalty amount: Not reported

Air program: NSPS
National action type: COMPLIANCE CERTIFICATION STATE REVIEW
Date achieved: 120731
Penalty amount: Not reported

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 120731
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: COMPLIANCE CERTIFICATION EPA REVIEW
Date achieved: 120905
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: EPA CONDUCTED PCE/ OFF-SITE
Date achieved: 120905
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 121106
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: PCE/OFF-SITE
Date achieved: 130122
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: PCE/OFF-SITE
Date achieved: 130122
Penalty amount: Not reported

Air program: NSPS
National action type: PCE/OFF-SITE
Date achieved: 130122
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 130417
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 130417
Penalty amount: Not reported

Air program: NSPS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 130423
Penalty amount: Not reported

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED FCE / ON-SITE
Date achieved: 130423
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE CONDUCTED FCE / ON-SITE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Date achieved: 130423
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: STATE DAY 0
Date achieved: 970410
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: NXXXXX
Date achieved: 970916
Penalty amount: 000000000

Air program: SIP SOURCE
National action type: STATE SV DELETED
Date achieved: 971117
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 980304
Penalty amount: 000000000

Air program: TITLE V PERMITS
National action type: STATE CONDUCTED PCE/ ON-SITE
Date achieved: 981106
Penalty amount: 000000000

Historical Compliance Minor Sources:
State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1004
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1101
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1004
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1004
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1101
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1101
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1102
Air prog code hist file: SIP SOURCE

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1102
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1102
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1103
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1103
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1103
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1104
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1104
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1104
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1201
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1201
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1201
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1202
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1202
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1202
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Hist compliance date: 1203
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1203
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1203
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1204
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1204
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1204
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1301
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1301
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1301
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1302
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1302
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1302
Air prog code hist file: TITLE V PERMITS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1303
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1303
Air prog code hist file: NSPS

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1303

HUNTS POINT AVENUE COMPRESSOR STATION (Continued) **1000111695**

Air prog code hist file: TITLE V PERMITS

Permit Information:
Compliance plant ID: N1121
Permit number: 260070019000002
Permit category: V
Permit category desc: TITLE V PERMIT - PLANT SP

Permit Source:
Compliance plant ID: N1121
Plant name: HUNTS POINT AVENUE COMPRESSOR STATION
Plant address: 332 HUNTS POINT AVE
BRONX, NY 10474

Event Information:
Compliance permit ID: N1121
Permit number: 260070019000002
Event action type: IF
Event description: *PERMIT AUTHORITY ISSUES FINAL PERMIT
Event action #: 006
Event date: 20010417

Compliance permit ID: N1121
Permit number: 260070019000002
Event action type: IR
Event description: *PERMITTING AUTHORITY RENEWS TITLE V PERMIT
Event action #: 010
Event date: 20080205

Compliance permit ID: N1121
Permit number: 260070019000002
Event action type: IX
Event description: PERMIT EXPIRES
Event action #: 007
Event date: 20060416

Compliance permit ID: N1121
Permit number: 260070019000002
Event action type: RR
Event description: PERMIT AUTHORITY DRAFTS RENEWAL
Event action #: 008
Event date: 20070926

Compliance permit ID: N1121
Permit number: 260070019000002
Event action type: SR
Event description: PERMIT AUTHORITY SUBMITS PROPOSED RENEWAL TO EPA
Event action #: 009
Event date: 20071102

A24
Target Property
NYCDOS - SOUTH BRONX MARINE TRANSFER STA
HUNTS POINT AVE & E RIVER
BRONX, NY

FINDS **1005882781**
N/A

Site 24 of 26 in cluster A

Actual: 17 ft.

FINDS:

Registry ID: 110010611294

Environmental Interest/Information System
ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

A25
Target Property
HUNTS POINT FOOD DIST. CTR. (PARCEL B)
800 FOOD CENTER DRIVE
NEW YORK, NY 10474

ENG CONTROLS **S105114386**
INST CONTROL **N/A**
VCP

Site 25 of 26 in cluster A

Actual: 17 ft.

ENG CONTROLS:

Site Code:	58441
HW Code:	V00436
Control Code:	15
Control Type:	ENG
Date Record Added:	03/02/2011
Date Rec Updated:	03/25/2014
Updated By:	RSLEE
Site Description:	Location:The site is approximately 29 acres in size and lies on the Hunts Point peninsula in the Borough and County of the Bronx. It is located at the intersection of Food Center Drive/Ryawa Avenue and Halleck Street approximately one mile south of the Bruckner Expressway's Bronx River crossing. The site is bounded to the north by the Hunts Point Cooperative (Meat Market), to the west (across Halleck Street) by the NYC Department of Environmental Protection's Hunts Point Water Pollution Control Plant (Sewage Treatment Plant), to the east by Farragut Street and a property owned by the NYC Department of Sanitation which includes a recycling facility, a salt storage facility and a Marine Transfer Station which has been out of use since 1997, and to the south by the East River. Also to the south, on a barge in the East River, is the NYC Department of Corrections Vernon C. Bain Floating Detention Facility, an 800-bed maximum security facility, and its associated parking lot. Site Features:A 325,000 square foot two-story state-of-the art wholesale seafood distribution facility (the new "Fulton Street Fish Market") was constructed on the site. An asphalt parking lot was constructed on most of the remainder of the site. Any open or

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

landscaped areas were demarcated with geotextile fabric and covered with an additional foot of clean soil prior to planting.Current Zoning/Use:The Fulton Street Fish Market is currently open. The site is zoned for business district, light commercial, light industrial, and local service district.Historical Uses:Con Edison operated a coal gasification facility at the site from 1925 through the early 1950's. Much of the property was subsequently redeveloped into the Hunts Point Food Distribution Center (HPFDC), a wholesale food complex. Parcel B was historically used for the storage of large quantities of petroleum and tar compounds. Site Geology and Hydrogeology:The southeastern portion of the site is underlain by approximately 2 to 7 feet of fill, consisting of silty sand and gravel with fragments of brick, coal, coke slag and ash. The thickness of fill decreases to the northeast. The fill is underlain by micaceous silty sand and gravel, with intermittent layers of well sorted sand, gravel, and clayey silt. Site groundwater is generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete, and the Department issued a Release letter on August 6, 2010.Prior to remediation, the primary contaminants of concern at the site included volatile organic compounds, polyaromatic hydrocarbons (PAHs), cyanide and lead. Coal tar and purifier wastes were also found on-site. Exceedances of standards, criteria and guidance included lead and naphthalene and other PAHs in soil, and benzene, toluene, ethylbenzene and xylenes in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soils contaminated with coal tar, purifier waster and fuel oil were excavated and disposed of properly. A newly constructed building and pavement minimize the potential for exposure to residually contaminated soil. A soil vapor extraction/air sparge system is in place to remediate on-site contamination. This system, in conjunction with the positive pressure in the building, will minimize the potential for exposures via soil vapor intrusion. Groundwater is not used as a source for drinking water, therefore, exposures via ingestion are unlikely.

INST CONTROL:

Site Code:	58441
Control Name:	Ground Water Use Restriction
HW Code:	V00436
Control Code:	08
Control Type:	INST
Dt record added:	03/02/2011
Dt rec updated:	03/25/2014
Updated By:	RSLEE
Site Code:	58441
Site Description:	Location:The site is approximately 29 acres in size and lies on the Hunts Point peninsula in the Borough and County of the Bronx. It is located at the intersection of Food Center Drive/Ryawa Avenue and Halleck Street approximately one mile south of the Bruckner Expressway's Bronx River crossing. The site is bounded to the north by the Hunts Point Cooperative (Meat Market), to the west (across Halleck Street) by the NYC Department of Environmental Protection's Hunts Point Water Pollution Control Plant (Sewage Treatment Plant), to the east by Farragut Street and a property owned by the NYC Department of Sanitation which includes a recycling facility, a salt

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

storage facility and a Marine Transfer Station which has been out of use since 1997, and to the south by the East River. Also to the south, on a barge in the East River, is the NYC Department of Corrections Vernon C. Bain Floating Detention Facility, an 800-bed maximum security facility, and its associated parking lot. Site Features:A 325,000 square foot two-story state-of-the art wholesale seafood distribution facility (the new "Fulton Street Fish Market") was constructed on the site. An asphalt parking lot was constructed on most of the remainder of the site. Any open or landscaped areas were demarcated with geotextile fabric and covered with an additional foot of clean soil prior to planting.Current Zoning/Use:The Fulton Street Fish Market is currently open. The site is zoned for business district, light commercial, light industrial, and local service district.Historical Uses:Con Edison operated a coal gasification facility at the site from 1925 through the early 1950's. Much of the property was subsequently redeveloped into the Hunts Point Food Distribution Center (HPFDC), a wholesale food complex. Parcel B was historically used for the storage of large quantities of petroleum and tar compounds. Site Geology and Hydrogeology:The southeastern portion of the site is underlain by approximately 2 to 7 feet of fill, consisting of silty sand and gravel with fragments of brick, coal, coke slag and ash. The thickness of fill decreases to the northeast. The fill is underlain by micaceous silty sand and gravel, with intermittent layers of well sorted sand, gravel, and clayey silt. Site groundwater is generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete, and the Department issued a Release letter on August 6, 2010.Prior to remediation, the primary contaminants of concern at the site included volatile organic compounds, polyaromatic hydrocarbons (PAHs), cyanide and lead. Coal tar and purifier wastes were also found on-site. Exceedances of standards, criteria and guidance included lead and naphthalene and other PAHs in soil, and benzene, toluene, ethylbenzene and xylenes in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soils contaminated with coal tar, purifier waster and fuel oil were excavated and disposed of properly. A newly constructed building and pavement minimize the potential for exposure to residually contaminated soil. A soil vapor extraction/air sparge system is in place to remediate on-site contamination. This system, in conjunction with the positive pressure in the building, will minimize the potential for exposures via soil vapor intrusion. Groundwater is not used as a source for drinking water, therefore, exposures via ingestion are unlikely.

Site Code: 58441
Control Name: Landuse Restriction
HW Code: V00436
Control Code: 25
Control Type: INST
Dt record added: 03/02/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58441
Site Description: Location:The site is approximately 29 acres in size and lies on the Hunts Point peninsula in the Borough and County of the Bronx. It is

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

located at the intersection of Food Center Drive/Ryawa Avenue and Halleck Street approximately one mile south of the Bruckner Expressway's Bronx River crossing. The site is bounded to the north by the Hunts Point Cooperative (Meat Market), to the west (across Halleck Street) by the NYC Department of Environmental Protection's Hunts Point Water Pollution Control Plant (Sewage Treatment Plant), to the east by Farragut Street and a property owned by the NYC Department of Sanitation which includes a recycling facility, a salt storage facility and a Marine Transfer Station which has been out of use since 1997, and to the south by the East River. Also to the south, on a barge in the East River, is the NYC Department of Corrections Vernon C. Bain Floating Detention Facility, an 800-bed maximum security facility, and its associated parking lot. Site Features:A 325,000 square foot two-story state-of-the art wholesale seafood distribution facility (the new "Fulton Street Fish Market") was constructed on the site. An asphalt parking lot was constructed on most of the remainder of the site. Any open or landscaped areas were demarcated with geotextile fabric and covered with an additional foot of clean soil prior to planting.Current Zoning/Use:The Fulton Street Fish Market is currently open. The site is zoned for business district, light commercial, light industrial, and local service district.Historical Uses:Con Edison operated a coal gasification facility at the site from 1925 through the early 1950's. Much of the property was subsequently redeveloped into the Hunts Point Food Distribution Center (HPFDC), a wholesale food complex. Parcel B was historically used for the storage of large quantities of petroleum and tar compounds. Site Geology and Hydrogeology:The southeastern portion of the site is underlain by approximately 2 to 7 feet of fill, consisting of silty sand and gravel with fragments of brick, coal, coke slag and ash. The thickness of fill decreases to the northeast. The fill is underlain by micaceous silty sand and gravel, with intermittent layers of well sorted sand, gravel, and clayey silt. Site groundwater is generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete, and the Department issued a Release letter on August 6, 2010.Prior to remediation, the primary contaminants of concern at the site included volatile organic compounds, polyaromatic hydrocarbons (PAHs), cyanide and lead. Coal tar and purifier wastes were also found on-site. Exceedances of standards, criteria and guidance included lead and naphthalene and other PAHs in soil, and benzene, toluene, ethylbenzene and xylenes in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soils contaminated with coal tar, purifier waster and fuel oil were excavated and disposed of properly. A newly constructed building and pavement minimize the potential for exposure to residually contaminated soil. A soil vapor extraction/air sparge system is in place to remediate on-site contamination. This system, in conjunction with the positive pressure in the building, will minimize the potential for exposures via soil vapor intrusion. Groundwater is not used as a source for drinking water, therefore, exposures via ingestion are unlikely.

Site Code: 58441
Control Name: Deed Restriction
HW Code: V00436

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

Control Code: A
Control Type: INST
Dt record added: 03/02/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58441
Site Description: Location:The site is approximately 29 acres in size and lies on the Hunts Point peninsula in the Borough and County of the Bronx. It is located at the intersection of Food Center Drive/Ryawa Avenue and Halleck Street approximately one mile south of the Bruckner Expressway's Bronx River crossing. The site is bounded to the north by the Hunts Point Cooperative (Meat Market), to the west (across Halleck Street) by the NYC Department of Environmental Protection's Hunts Point Water Pollution Control Plant (Sewage Treatment Plant), to the east by Farragut Street and a property owned by the NYC Department of Sanitation which includes a recycling facility, a salt storage facility and a Marine Transfer Station which has been out of use since 1997, and to the south by the East River. Also to the south, on a barge in the East River, is the NYC Department of Corrections Vernon C. Bain Floating Detention Facility, an 800-bed maximum security facility, and its associated parking lot. Site Features:A 325,000 square foot two-story state-of-the art wholesale seafood distribution facility (the new "Fulton Street Fish Market") was constructed on the site. An asphalt parking lot was constructed on most of the remainder of the site. Any open or landscaped areas were demarcated with geotextile fabric and covered with an additional foot of clean soil prior to planting.Current Zoning/Use:The Fulton Street Fish Market is currently open. The site is zoned for business district, light commercial, light industrial, and local service district.Historical Uses:Con Edison operated a coal gasification facility at the site from 1925 through the early 1950's. Much of the property was subsequently redeveloped into the Hunts Point Food Distribution Center (HPFDC), a wholesale food complex. Parcel B was historically used for the storage of large quantities of petroleum and tar compounds. Site Geology and Hydrogeology:The southeastern portion of the site is underlain by approximately 2 to 7 feet of fill, consisting of silty sand and gravel with fragments of brick, coal, coke slag and ash. The thickness of fill decreases to the northeast. The fill is underlain by micaceous silty sand and gravel, with intermittent layers of well sorted sand, gravel, and clayey silt. Site groundwater is generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.
Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete, and the Department issued a Release letter on August 6, 2010.Prior to remediation, the primary contaminants of concern at the site included volatile organic compounds, polyaromatic hydrocarbons (PAHs), cyanide and lead. Coal tar and purifier wastes were also found on-site. Exceedances of standards, criteria and guidance included lead and naphthalene and other PAHs in soil, and benzene, toluene, ethylbenzene and xylenes in groundwater.
Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soils contaminated with coal tar, purifier waster and fuel oil were excavated and disposed of properly. A newly constructed building and pavement minimize the potential for exposure to residually contaminated soil. A soil vapor extraction/air sparge system is in place to remediate on-site contamination. This system, in conjunction

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

with the positive pressure in the building, will minimize the potential for exposures via soil vapor intrusion. Groundwater is not used as a source for drinking water, therefore, exposures via ingestion are unlikely.

Site Code: 58441
Control Name: Site Management Plan
HW Code: V00436
Control Code: 32
Control Type: INST
Dt record added: 03/02/2011
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 58441
Site Description: Location:The site is approximately 29 acres in size and lies on the Hunts Point peninsula in the Borough and County of the Bronx. It is located at the intersection of Food Center Drive/Ryawa Avenue and Halleck Street approximately one mile south of the Bruckner Expressway's Bronx River crossing. The site is bounded to the north by the Hunts Point Cooperative (Meat Market), to the west (across Halleck Street) by the NYC Department of Environmental Protection's Hunts Point Water Pollution Control Plant (Sewage Treatment Plant), to the east by Farragut Street and a property owned by the NYC Department of Sanitation which includes a recycling facility, a salt storage facility and a Marine Transfer Station which has been out of use since 1997, and to the south by the East River. Also to the south, on a barge in the East River, is the NYC Department of Corrections Vernon C. Bain Floating Detention Facility, an 800-bed maximum security facility, and its associated parking lot. Site Features:A 325,000 square foot two-story state-of-the art wholesale seafood distribution facility (the new "Fulton Street Fish Market") was constructed on the site. An asphalt parking lot was constructed on most of the remainder of the site. Any open or landscaped areas were demarcated with geotextile fabric and covered with an additional foot of clean soil prior to planting.Current Zoning/Use:The Fulton Street Fish Market is currently open. The site is zoned for business district, light commercial, light industrial, and local service district.Historical Uses:Con Edison operated a coal gasification facility at the site from 1925 through the early 1950's. Much of the property was subsequently redeveloped into the Hunts Point Food Distribution Center (HPFDC), a wholesale food complex. Parcel B was historically used for the storage of large quantities of petroleum and tar compounds. Site Geology and Hydrogeology:The southeastern portion of the site is underlain by approximately 2 to 7 feet of fill, consisting of silty sand and gravel with fragments of brick, coal, coke slag and ash. The thickness of fill decreases to the northeast. The fill is underlain by micaceous silty sand and gravel, with intermittent layers of well sorted sand, gravel, and clayey silt. Site groundwater is generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.
Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete, and the Department issued a Release letter on August 6, 2010.Prior to remediation, the primary contaminants of concern at the site included volatile organic compounds, polyaromatic hydrocarbons (PAHs), cyanide and lead. Coal tar and purifier wastes were also found on-site. Exceedances of standards, criteria and

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

guidance included lead and naphthalene and other PAHs in soil, and benzene, toluene, ethylbenzene and xylenes in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soils contaminated with coal tar, purifier waster and fuel oil were excavated and disposed of properly. A newly constructed building and pavement minimize the potential for exposure to residually contaminated soil. A soil vapor extraction/air sparge system is in place to remediate on-site contamination. This system, in conjunction with the positive pressure in the building, will minimize the potential for exposures via soil vapor intrusion. Groundwater is not used as a source for drinking water, therefore, exposures via ingestion are unlikely.

VCP:

Program Type:	VCP
Site Code:	58441
HW Code:	V00436
Site Class:	C
SWIS:	0301
Region:	2
Town:	New York City
Acres:	30.000
Date Record Added:	02/13/2001
Date Record Updated:	10/25/2013
Updated By:	JAMORAS
Site Description:	Location:The site is approximately 29 acres in size and lies on the Hunts Point peninsula in the Borough and County of the Bronx. It is located at the intersection of Food Center Drive/Ryawa Avenue and Halleck Street approximately one mile south of the Bruckner Expressway's Bronx River crossing. The site is bounded to the north by the Hunts Point Cooperative (Meat Market), to the west (across Halleck Street) by the NYC Department of Environmental Protection's Hunts Point Water Pollution Control Plant (Sewage Treatment Plant), to the east by Farragut Street and a property owned by the NYC Department of Sanitation which includes a recycling facility, a salt storage facility and a Marine Transfer Station which has been out of use since 1997, and to the south by the East River. Also to the south, on a barge in the East River, is the NYC Department of Corrections Vernon C. Bain Floating Detention Facility, an 800-bed maximum security facility, and its associated parking lot. Site Features:A 325,000 square foot two-story state-of-the art wholesale seafood distribution facility (the new "Fulton Street Fish Market") was constructed on the site. An asphalt parking lot was constructed on most of the remainder of the site. Any open or landscaped areas were demarcated with geotextile fabric and covered with an additional foot of clean soil prior to planting.Current Zoning/Use:The Fulton Street Fish Market is currently open. The site is zoned for business district, light commercial, light industrial, and local service district.Historical Uses:Con Edison operated a coal gasification facility at the site from 1925 through the early 1950's. Much of the property was subsequently redeveloped into the Hunts Point Food Distribution Center (HPFDC), a wholesale food complex. Parcel B was historically used for the storage of large quantities of petroleum and tar compounds. Site Geology and Hydrogeology:The southeastern portion of the site is underlain by approximately 2 to 7 feet of fill, consisting of silty sand and gravel with fragments of brick, coal, coke slag and ash. The thickness of fill decreases to

HUNTS POINT FOOD DIST. CTR. (PARCEL B) (Continued) **S105114386**

the northeast. The fill is underlain by micaceous silty sand and gravel, with intermittent layers of well sorted sand, gravel, and clayey silt. Site groundwater is generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete, and the Department issued a Release letter on August 6, 2010.Prior to remediation, the primary contaminants of concern at the site included volatile organic compounds, polyaromatic hydrocarbons (PAHs), cyanide and lead. Coal tar and purifier wastes were also found on-site. Exceedances of standards, criteria and guidance included lead and naphthalene and other PAHs in soil, and benzene, toluene, ethylbenzene and xylenes in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soils contaminated with coal tar, purifier waster and fuel oil were excavated and disposed of properly. A newly constructed building and pavement minimize the potential for exposure to residually contaminated soil. A soil vapor extraction/air sparge system is in place to remediate on-site contamination. This system, in conjunction with the positive pressure in the building, will minimize the potential for exposures via soil vapor intrusion. Groundwater is not used as a source for drinking water, therefore, exposures via ingestion are unlikely.

A26 **HUNTS POINT SUBWAY TUNNEL** **NY Spills** **S108637099**
Target **HUNTS POINT AVE** **N/A**
Property **BRONX, NY**

Site 26 of 26 in cluster A

Actual: 17 ft.

SPILLS:

Facility ID:	0701773
Facility Type:	ER
DER Facility ID:	192379
Site ID:	381371
DEC Region:	2
Spill Date:	5/12/2007
Spill Number/Closed Date:	0701773 / 5/29/2007
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	5/12/2007
CID:	41
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	5/15/2007
Spill Record Last Update:	5/29/2007
Spiller Name:	Not reported

HUNTS POINT SUBWAY TUNNEL (Continued) **S108637099**

Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: ABOVE
Contact Phone: Not reported
DEC Memo: Sharif responded on 05/12/07 night.Gasoline mixed water coming out of a hole on the subway wall and pouring onto the truck.This continued about seven hours.TA hydraulics also responded to do the clean up.It was raining heavily and rain water carried gasoline from somewhere-ended up in the tunnel.NYC system safety (george Cunningham@646-252-3607) investigating the source.05/29/07 Sharif spoke with George and learned that the water inflow has stopped.However, the crack/hole needs to be closed in order to prevent the water flow(with contamination) onto the track.Considering the industrial nature of the neighborhood, it is not unlikely for the rain run off to carry numerous types of contamination.Therefore, I recommended George Cunningham to take steps to close out the hole/cracks on the wall.Spill closed.
Remarks: either diesel or gasoline mixed with water

Material:
Site ID: 381371
Operable Unit ID: 1138826
Operable Unit: 01
Material ID: 2128829
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

B27 **DRUM RUN - ON SIDEWALK** **NY Spills** **S106699666**
North **FARAGAUT STREE/FOOD CNT D** **N/A**
< 1/8 **BRONX, NY**
0.007 mi.
39 ft. **Site 1 of 5 in cluster B**

Relative:
Higher

Actual:
18 ft.

SPILLS:
Facility ID: 0407093
Facility Type: ER
DER Facility ID: 122289
Site ID: 143375
DEC Region: 2
Spill Date: 9/27/2004
Spill Number/Closed Date: 0407093 / 11/1/2004
Spill Cause: Abandoned Drums
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required.
SWIS: 0301

DRUM RUN - ON SIDEWALK (Continued) **S106699666**

Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	9/27/2004
CID:	444
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	9/27/2004
Spill Record Last Update:	11/1/2004
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	CHRISS HAAS
Contact Phone:	(718) 595-4784
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "DEMEO"11/1/04 TJDDrum emptied as part of Drum Run on 10/29/04. Spill closed
Remarks:	ONE DRUM NEEDS TO BE PICKED UP: NOT LEAKING:

Material:

Site ID:	143375
Operable Unit ID:	889700
Operable Unit:	01
Material ID:	484934
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Not reported
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	143375
Operable Unit ID:	889700
Operable Unit:	01
Material ID:	484935
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

B28
North
< 1/8
0.007 mi.
39 ft.

SPILL NUMBER 0211696
HUNTS POINT AV/FARRAGOT
BRONX, NY

Site 2 of 5 in cluster B

NY Spills **S106011737**
N/A

Relative:
Higher

Actual:
18 ft.

SPILLS:

Facility ID:	0211696
Facility Type:	ER
DER Facility ID:	173095
Site ID:	208600
DEC Region:	2
Spill Date:	2/25/2003
Spill Number/Closed Date:	0211696 / 2/25/2003
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	JHOCONNE
Referred To:	Not reported
Reported to Dept:	2/25/2003
CID:	281
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2/25/2003
Spill Record Last Update:	2/25/2003
Spiller Name:	Not reported
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	BILL MURPHY
Contact Phone:	(212) 580-6763
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL"e2mis no. 147-287:25-FEB-2003 12:03 while on location to perform a flush on a TM the door to flush truck tank on vehicle 60587 opened and 300 gallons of lead hazardous waste spilled to asphalt. Will attempt to close the door and barricade the spill. Cleanup in progress.25-FEB-2003 15:20 cleanup complete 13:35. The debris impacted an area 15' X 40'. The debris was vactured back into the same vactor that it was originally spilled from. Then the area was double washed and rinsed. 350 gallons of lead hazardous waste and wash water gnerated and taken in to the flush truck. Debris transported to Hellgate flush pit for disposal. A further inspection of the structure revealed that there was no lead cable in the structure only 2 neoprene cables. Cleanup performed and waste disposed of as lead hazardous as a precaution.
Remarks:	300 GALLONS OF LEAD TAINTED WATER SPILLED AT ABOVE LOCATION. CLEANUP IS IN PROGRESS AT TIME OF CALL. FLUSH TRUCK #60587WAS ON LOCATION TO PUMP OUT MANHOLE AND DOOR OPENED RELEASING MATERIAL. CON ED # 147287.

Material:

Site ID:	208600

SPILL NUMBER 0211696 (Continued) **S106011737**

Operable Unit ID:	865017
Operable Unit:	01
Material ID:	511485
Material Code:	0030A
Material Name:	LEAD
Case No.:	07439921
Material FA:	Hazardous Material
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

B29 **CONSOLIDATED EDISON - MH 28552** **MANIFEST** **S110709319**
NNE **FOOD CENTER DR & FARRAGUT** **N/A**
< 1/8 **BRONX, NY 10451**
0.009 mi.
48 ft. **Site 3 of 5 in cluster B**

Relative:
Higher

Actual:
18 ft.

NY MANIFEST:

EPA ID:	NYP004218737
Country:	USA
Mailing Name:	CONSOLIDATED EDISON - MH 28552
Mailing Contact:	TOM TEELING
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-3770

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2010-10-24
Trans1 Recv Date:	2010-10-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2010-10-28
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004218737
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	250.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.

CONSOLIDATED EDISON - MH 28552 (Continued) **S110709319**

Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	006874877JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H111

B30 **CON EDISON MANHOLE 28552** **RCRA NonGen / NLR** **1014918262**
NNE **FOOD CENTER DR & FARRAGUT ST** **NYP004218737**
< 1/8 **BRONX, NY 10474**
0.009 mi.
48 ft. **Site 4 of 5 in cluster B**

Relative:
Higher

Actual:
18 ft.

RCRA NonGen / NLR:

Date form received by agency:	11/23/2010
Facility name:	CON EDISON MANHOLE 28552
Facility address:	FOOD CENTER DR & FARRAGUT ST BRONX, NY 10474
EPA ID:	NYP004218737
Mailing address:	IRVING PL RM 828 NEW YORK, NY 10003
Contact:	GINO FRABASILE
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	(914) 925-6219
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

CON EDISON MANHOLE 28552 (Continued) **1014918262**

Historical Generators:
Date form received by agency: 10/24/2010
Facility name: CON EDISON MANHOLE 28552
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

B31 **CON EDISON MANHOLE 28552** **FINDS** **1014809503**
NNE **FOOD CENTER DR & FARRAGUT ST** **N/A**
< 1/8 **BRONX, NY**
0.009 mi.
48 ft. **Site 5 of 5 in cluster B**

Relative:
Higher

Actual:
18 ft.

FINDS:

Registry ID: 110043666208

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

C32 **CON EDISON** **MANIFEST** **S116294948**
NE **655 FOOD CENTER DR** **N/A**
< 1/8 **BRONX, NY 10461**
0.034 mi.
182 ft. **Site 1 of 7 in cluster C**

Relative:
Lower

Actual:
15 ft.

NY MANIFEST:
EPA ID: NYP004461737
Country: USA
Mailing Name: Not reported
Mailing Contact: Not reported
Mailing Address: Not reported
Mailing Address 2: Not reported
Mailing City: Not reported
Mailing State: Not reported
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: Not reported
Mailing Phone: Not reported

NY MANIFEST:
No Manifest Records Available

C33 **N/S 600 FOODCENTER DR** **NY Spills** **S106468818**
NE **600 FOODCENTER DR** **N/A**
< 1/8 **BRONX, NY**
0.074 mi.
391 ft. **Site 2 of 7 in cluster C**

Relative:
Lower

Actual:
14 ft.

SPILLS:

Facility ID:	0401327
Facility Type:	ER
DER Facility ID:	239490
Site ID:	295945
DEC Region:	2
Spill Date:	5/7/2004
Spill Number/Closed Date:	0401327 / 2/25/2005
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	CESAWYER
Referred To:	Not reported
Reported to Dept:	5/7/2004
CID:	444
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	5/7/2004
Spill Record Last Update:	2/25/2005
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ERT DESK
Contact Phone:	(212) 580-8383
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER"5/10/04: Third party spill - referred to Sawyer for follow up. (JHO)~~~~~~~~~~~~~~~~~~~~e2mis no. 153244:FOD Sr. Field Oper. reports discovering a third party private property spill of 3 qt. of motor oil 3'x6' area from apparent "backyard" veh. repair on the property of 600 Food Center Drive, Bx in the Hunt's Point area. the actual spill is on the N/S of "no name street" e/o Ryawa Av, Bx on the pathway to 460 volt transformer vault # 2625. Andrew Fiore recommends issuing spill report for DEC investigation and action. Notifications will be made to DEC. No cleanup by Con Edison.02/25/05 - Sawyer - No further information available and there is no one to follow up with. Due to time and amount of spill no further action needed. Closed.
Remarks:	CREWS ENROUTE TO LOCATION AND THEY FOUND THE SPILL AND CALLED IT IN: DOH DOING AN INVESTIGATION :

Material:

Site ID:	295945
Operable Unit ID:	883164
Operable Unit:	01

N/S 600 FOODCENTER DR (Continued) **S106468818**

Material ID:	492538
Material Code:	0015
Material Name:	Motor Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

C34 **ERNS** **2003636304**
NE **600 FOOD CENTER DR** **N/A**
< 1/8 **HUNTS POINT, NY**
0.074 mi.
391 ft. **Site 3 of 7 in cluster C**

Relative:
Lower

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual:
14 ft.

C35 **NYC ECONOMIC DEVELOPMENT CORP** **FINDS** **1016200233**
NE **600-A FOOD CENTER DR** **N/A**
< 1/8 **BRONX, NY**
0.074 mi.
391 ft. **Site 4 of 7 in cluster C**

Relative:
Lower

FINDS:

Registry ID: 110004500503

Actual:
14 ft.

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

C36 **NATIONAL FOODS** **RCRA NonGen / NLR** **1000694269**
NE **600 FOOD CENTER DR** **FINDS** **NYD987005725**
< 1/8 **BRONX, NY 10474** **UST**
0.074 mi. **HIST UST**
391 ft. **Site 5 of 7 in cluster C**

Relative:
Lower

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NATIONAL FOODS
Facility address:	600 FOOD CENTER DR BRONX, NY 104747084
EPA ID:	NYD987005725
Mailing address:	FOOD CENTER DR

Actual:
14 ft.

NATIONAL FOODS (Continued) **1000694269**

BRONX, NY 10474
Contact: Not reported
Contact address: FOOD CENTER DR
BRONX, NY 10474
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: NYC ECONOMIC DEVELOP CORP S GOLDFINGER
Owner/operator address: 110 WILLIAM ST
NEW YORK, NY 10038
Owner/operator country: US
Owner/operator telephone: (212) 341-5900
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYC ECONOMIC DEVELOP CORP S GOLDFINGER
Owner/operator address: 110 WILLIAM ST
NEW YORK, NY 10038
Owner/operator country: US
Owner/operator telephone: (212) 341-5900
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: NATIONAL FOODS
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: NATIONAL FOODS

NATIONAL FOODS (Continued) **1000694269**

Classification: Not a generator, verified

Date form received by agency: 06/05/1992
Facility name: NATIONAL FOODS
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004491194

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

UST:
Id/Status: 2-600687 / Unregulated
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: 1997-03-19
UTM X: 595156.39263999998
UTM Y: 4517679.7723599998
Site Type: Trucking/Transportation/Fleet Operation

Affiliation Records:
Site Id: 22667
Affiliation Type: Facility Owner
Company Name: NYC DEPT. OF DESIGN & CONSTRUCTION
Contact Type: Not reported
Contact Name: Not reported
Address1: ONE CENTER STREET, 15TH FLOOR
Address2: Not reported
City: NEW YORK
State: NY
Zip Code: 10007
Country Code: 001
Phone: (212) 442-1471
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 22667
Affiliation Type: Mail Contact
Company Name: NATIONAL FOODS INCORPORATED
Contact Type: Not reported
Contact Name: GENE PINES
Address1: 600 FOOD CENTER DRIVE
Address2: Not reported
City: BRONX
State: NY

NATIONAL FOODS (Continued) **1000694269**

Zip Code:	10474
Country Code:	001
Phone:	(212) 842-5000
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	22667
Affiliation Type:	On-Site Operator
Company Name:	NATIONAL FOODS INCORPORATED
Contact Type:	Not reported
Contact Name:	GENE PINES
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(212) 842-5000
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	22667
Affiliation Type:	Emergency Contact
Company Name:	NYC DEPT. OF DESIGN & CONSTRUCTION
Contact Type:	Not reported
Contact Name:	GENE PINES
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(212) 842-5000
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Tank Info:

Tank Number:	001
Tank ID:	43291
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	4000
Install Date:	01/01/1986
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

NATIONAL FOODS (Continued) **1000694269**

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 03/04/2004

Equipment Records:

A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground

Tank Number: 002
Tank ID: 43292
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 01/01/1986
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 03/04/2004

Equipment Records:

A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction Dispenser
I00 - Overfill - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None

Tank Number: 003
Tank ID: 168741
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 6000
Install Date: Not reported
Date Tank Closed: 10/01/1993

NATIONAL FOODS (Continued) **1000694269**

Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 03/04/2004

Equipment Records:

I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G10 - Tank Secondary Containment - Impervious Underlayment
J02 - Dispenser - Suction Dispenser
C03 - Pipe Location - Aboveground/Underground Combination
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

Tank Number: 003-A
Tank ID: 168743
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 03/04/2004

Equipment Records:

F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground

Tank Number: 004

NATIONAL FOODS (Continued) **1000694269**

Tank ID:	48776
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	03/04/2004

Equipment Records:

A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
F00 - Pipe External Protection - None

HIST UST:

PBS Number:	2-600687
SPDES Number:	Not reported
Emergency Contact:	GENE PINES
Emergency Telephone:	(212) 842-5000
Operator:	GENE PINES
Operator Telephone:	(212) 842-5000
Owner Name:	NYC DEPT. OF DESIGN & CONSTRUCTION
Owner Address:	ONE CENTER STREET, 15TH FLOOR
Owner City,St,Zip:	NEW YORK, NY 10007
Owner Telephone:	(212) 442-1471
Owner Type:	Local Government
Owner Subtype:	Not reported
Mailing Name:	NATIONAL FOODS INCORPORATED
Mailing Address:	600 FOOD CENTER DRIVE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BRONX, NY 10474
Mailing Contact:	GENE PINES
Mailing Telephone:	(212) 842-5000
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	600 FOOD CENTER DRIVE
SWIS ID:	6001
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported

NATIONAL FOODS (Continued) **1000694269**

Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	11/29/1994
Expiration Date:	03/19/1997
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	60
Town or City:	01
Region:	2

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	6000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	Synthetic Liner
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	10/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	2000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground

NATIONAL FOODS (Continued) **1000694269**

Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	2000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

C37 **NYC DEPT OF GEN SER/NATIONAL FOOD** **LTANKS** **S102672647**
NE **600 FOOD CENTER DRIVE** **MANIFEST** **N/A**
< 1/8 **BRONX, NY** **NY Spills**
0.074 mi.
391 ft. **Site 6 of 7 in cluster C**

Relative:
Lower

Actual:
14 ft.

LTANKS:

Site ID:	304593
Spill Number/Closed Date:	9409882 / 7/18/1996
Spill Date:	10/21/1994
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported

NYC DEPT OF GEN SER/NATIONAL FOOD (Continued) **S102672647**

Cleanup Meets Standard:	False
SWIS:	0301
Investigator:	MCTIBBE
Referred To:	Not reported
Reported to Dept:	10/24/1994
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	12/1/1994
Spill Record Last Update:	7/18/1996
Spiller Name:	Not reported
Spiller Company:	NATIONAL FOOD INC
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	275293
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIBBE"10/10/95: This is additional information about material spilled from the translation of the old spill file: CONTAMINATED SOIL. Not reported
Remarks:	TANKS INCASED IN CONCRETE-NOTICED CONTAMINATED SPILL-WILL EXCAVATE & DISPOSE OF

Material:

Site ID:	304593
Operable Unit ID:	1003856
Operable Unit:	01
Material ID:	375755
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

NY MANIFEST:

EPA ID:	NYD987005725
Country:	USA
Mailing Name:	NYC DEPT OF GEN SER/NATIONAL FOOD
Mailing Contact:	MICHAEL L PICCIRILLO
Mailing Address:	ONE CENTRE ST/15TH FLOOR
Mailing Address 2:	Not reported

NYC DEPT OF GEN SER/NATIONAL FOOD (Continued) **S102672647**

Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10007
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	908-862-6633

NY MANIFEST:

No Manifest Records Available

SPILLS:

Facility ID:	0503472
Facility Type:	ER
DER Facility ID:	294442
Site ID:	348094
DEC Region:	2
Spill Date:	6/22/2005
Spill Number/Closed Date:	0503472 / 7/13/2005
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	6/22/2005
CID:	409
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	6/22/2005
Spill Record Last Update:	7/13/2005
Spiller Name:	UNKNOWN
Spiller Company:	UNKNOWN, 3RD PARTY SPILL
Spiller Address:	UNKNOWN
Spiller City,St,Zip:	UNKNOWN, ZZ
Spiller Company:	001
Contact Name:	SAINT-JEAN
Contact Phone:	(718) 595-4653
DEC Memo:	DEP says there is a 1 gal and a 5 gal jug of waste oil on the sidewalk at this address07/13/05-SR// No jug of waste oil found there. Not reported
Remarks:	DISPOSAL OF THE CONTAINERS OF MOTOR OIL

Material:

Site ID:	348094
Operable Unit ID:	1105764
Operable Unit:	01
Material ID:	1558473
Material Code:	0015
Material Name:	Motor Oil
Case No.:	Not reported

NYC DEPT OF GEN SER/NATIONAL FOOD (Continued) **S102672647**

Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Facility ID:	9414540
Facility Type:	ER
DER Facility ID:	246036
Site ID:	304594
DEC Region:	2
Spill Date:	2/3/1995
Spill Number/Closed Date:	9414540 / 7/18/1996
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	GUTIERREZ
Referred To:	Not reported
Reported to Dept:	2/3/1995
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2/3/1995
Spill Record Last Update:	1/7/1998
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	Not reported
Remarks:	RESIDUAL CONTAMINATION POSSIBLY FROM PREVIOUS TANK REMOVAL - CALLER WAS

Material:

Site ID:	304594
Operable Unit ID:	1008117
Operable Unit:	01
Material ID:	373275
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0

NYC DEPT OF GEN SER/NATIONAL FOOD (Continued) **S102672647**

Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Facility ID:	0210026
Facility Type:	ER
DER Facility ID:	226240
Site ID:	278625
DEC Region:	2
Spill Date:	1/3/2003
Spill Number/Closed Date:	0210026 / 1/31/2003
Spill Cause:	Equipment Failure
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	MXTIPPLE
Referred To:	Not reported
Reported to Dept:	1/3/2003
CID:	365
Water Affected:	EAST RIVER
Spill Source:	Vessel
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1/3/2003
Spill Record Last Update:	10/31/2003
Spiller Name:	DAVID FONTAINE
Spiller Company:	IROQUOIS GAS TRANSMISSION
Spiller Address:	1 CORPORTATE DR SUITE 600
Spiller City,St,Zip:	SHELTON, CT 06484-
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE"called David Fontaine of Iroquois. He stated that Stephanie Robins (Essex Environmental) saw the sheen, she put oil absorbent boom on the water. The barge is unmanned at this time. Weeks marine (owner of the barge) was contacted. They will conduct a deck inspection to determine possible source. ARS
Remarks:	rain coming off a barge - there was a piece of equip on the vessell that was leaking - hydrocarbon absorbant booms were placed on the deck Not reported

Material:

Site ID:	278625
Operable Unit ID:	861269
Operable Unit:	01
Material ID:	513433

NYC DEPT OF GEN SER/NATIONAL FOOD (Continued) **S102672647**

Material Code:	0010
Material Name:	Hydraulic Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	Yes
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

C38 **NYC ECONOMIC DEVELOPMENT CORP** **RCRA NonGen / NLR** **1000791225**
NE **600-A FOOD CENTER DR** **MANIFEST** **NYD987027315**
< 1/8 **BRONX, NY 10474**
0.074 mi.
391 ft. **Site 7 of 7 in cluster C**

Relative:
Lower

Actual:
14 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NYC ECONOMIC DEVELOPMENT CORP
Facility address:	600-A FOOD CENTER DR BRONX, NY 104747037
EPA ID:	NYD987027315
Mailing address:	WILLIAM ST NEW YORK, NY 10038
Contact:	Not reported
Contact address:	WILLIAM ST NEW YORK, NY 10038
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	NYC ECONOMIC DEVELOPMENT CORP
Owner/operator address:	110 WILLIAM ST NEW YORK, NY 10038
Owner/operator country:	US
Owner/operator telephone:	(212) 312-3724
Legal status:	County
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	NYC ECONOMIC DEVELOPMENT CORP
Owner/operator address:	110 WILLIAM ST NEW YORK, NY 10038
Owner/operator country:	US
Owner/operator telephone:	(212) 312-3724
Legal status:	County
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

NYC ECONOMIC DEVELOPMENT CORP (Continued) **1000791225**

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: NYC ECONOMIC DEVELOPMENT CORP
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: NYC ECONOMIC DEVELOPMENT CORP
Classification: Not a generator, verified

Date form received by agency: 02/02/1993
Facility name: NYC ECONOMIC DEVELOPMENT CORP
Classification: Small Quantity Generator

Violation Status: No violations found

NY MANIFEST:
EPA ID: NYD987027315
Country: USA
Mailing Name: NEW YORK CITY ECONOMIC DEVELOPMENT
Mailing Contact: STEVEN PLOFKER
Mailing Address: 100 WILLIAM ST
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10038
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-312-3724

Document ID: NJA1666149
Manifest Status: Completed copy
Trans1 State ID: NJDEPS103
Trans2 State ID: NJDEPS103
Generator Ship Date: 930216
Trans1 Recv Date: 930216
Trans2 Recv Date: 930217
TSD Site Recv Date: 930217
Part A Recv Date: 930226
Part B Recv Date: 930301

NYC ECONOMIC DEVELOPMENT CORP (Continued) **1000791225**

Generator EPA ID:	NYD987027315
Trans1 EPA ID:	NJD982280851
Trans2 EPA ID:	NJD982280851
TSDF ID:	NJD002200046
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00085
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00750
Units:	P - Pounds
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	93

---

39 **HUNSTPOINT** **NY Spills** **S102240311**
WNW **REGULATOR 2** **N/A**
< 1/8 **BRONX, NY**
0.088 mi.
466 ft.

Relative:
Lower

Actual:
12 ft.

SPILLS:

Facility ID:	9603962
Facility Type:	ER
DER Facility ID:	182550
Site ID:	220693
DEC Region:	2
Spill Date:	6/22/1996
Spill Number/Closed Date:	9603962 / 7/3/1996
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
SWIS:	0301
Investigator:	CAENGELH
Referred To:	Not reported
Reported to Dept:	6/22/1996
CID:	196
Water Affected:	LONGISLAND SOUND
Spill Source:	Unknown
Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	6/22/1996
Spill Record Last Update:	7/8/1996
Spiller Name:	MR MCAULIFFE
Spiller Company:	DEP NYC
Spiller Address:	HUNTSPOINT
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	001

HUNSTPOINT (Continued) **S102240311**

Contact Name: MR MCAULIFFE
Contact Phone: (718) 372-7193
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"Passed on to Tim Burns of the Water Division.
Remarks: on going problem. rep on scene.

Material:
Site ID: 220693
Operable Unit ID: 1031619
Operable Unit: 01
Material ID: 350234
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

D40 **CE - GAS COMPRESSOR STATION** **MANIFEST** **S105684655**
NNW **FOOD CENTER DRIVE** **ENG CONTROLS** **N/A**
< 1/8 **BRONX, NY 10474** **INST CONTROL**
0.123 mi. **VCP**
652 ft. **Site 1 of 2 in cluster D**

Relative:
Lower

Actual:
14 ft.

NY MANIFEST:
EPA ID: NYP004236958
Country: USA
Mailing Name: CONSOLIDATED EDISON
Mailing Contact: TOM TEELING
Mailing Address: 4 IRVING PLACE RM 828
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10003
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-460-3770

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: MAD039322250
Trans2 State ID: MAD039322250
Generator Ship Date: 2011-06-14
Trans1 Recv Date: 2011-06-14
Trans2 Recv Date: 2011-06-15
TSD Site Recv Date: 2011-06-15
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP004236958
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	200.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2011
Manifest Tracking Num:	003949063FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

ENG CONTROLS:

Site Code:	57554
HW Code:	V00605
Control Code:	15
Control Type:	ENG
Date Record Added:	10/26/2006
Date Rec Updated:	03/25/2014
Updated By:	RSLEE
Site Description:	Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

Site Code: 57554
HW Code: V00605
Control Code: 22
Control Type: ENG
Date Record Added: 10/26/2006
Date Rec Updated: 03/25/2014
Updated By: RSLEE
Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

Site Code: 57554
HW Code: V00605
Control Code: 18
Control Type: ENG
Date Record Added: 10/26/2006
Date Rec Updated: 03/25/2014

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

Updated By: RSLEE

Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

INST CONTROL:
Site Code: 57554
Control Name: Deed Restriction
HW Code: V00605
Control Code: A
Control Type: INST
Dt record added: 10/26/2006
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57554
Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

Site Code: 57554
Control Name: Landuse Restriction
HW Code: V00605
Control Code: 25
Control Type: INST
Dt record added: 10/26/2006
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57554

Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

Site Code: 57554
Control Name: Ground Water Use Restriction
HW Code: V00605
Control Code: 08
Control Type: INST
Dt record added: 10/26/2006
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57554
Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site,

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

Site Code: 57554
Control Name: Soil Management Plan
HW Code: V00605
Control Code: 14
Control Type: INST
Dt record added: 10/26/2006
Dt rec updated: 03/25/2014
Updated By: RSLEE
Site Code: 57554
Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison's former Hunts Point Gas Works - a coal and carburetted water gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

VCP:

Program Type:	VCP
Site Code:	57552
HW Code:	V00671
Site Class:	A
SWIS:	0301
Region:	2
Town:	New York City
Acres:	Not reported
Date Record Added:	08/29/2003
Date Record Updated:	01/13/2014
Updated By:	JAMORAS
Site Description:	Location:Site F is a 2.16-acre site is located within a parcel leased and operated by Krasdale Foods. The Krasdale parcel is located at 400 Food Center Drive, in the southeastern section of the Hunts Point Food Distribution Center (HPFDC) in NYSDEC Region 2, Bronx County. It is bounded to the north by Krasdale Food's distribution warehouse, to the west by Food Center Drive and railroad spur, to the east by Krasdale Food's tractor-trailer parking and the Bronx River, and to the south by Krasdale Food's tractor-trailer parking and the HPFDC Site C (Greenway), Site No. V00412. Site Features:The site is relatively level and vegetated with tall grass and weeds. A large area of purifier waste, measuring approximately 75 by 90 feet is exposed at the ground surface near the northwest corner and the central portion of the site. There are also several smaller purifier waste areas near the northeast portion of the site. At the southeast corner of the site there are several areas with purifier waste mixed with asphalt debris. A large elevated mound of slag is situated near the center of the site, and several asphalt piles are located near the east side of the site. In addition, there are also patches of stressed vegetation or areas devoid of vegetation across the site. The stressed vegetation appears to be associated with the purifier waste and slag areas.Current Zoning/Uses:The site is currently undeveloped (open and unused) and zoned for commercial use. The remainder of the Krasdale parcel is developed and is the location for one of Krasdale's warehouse and office facilities as well as vehicle storage and staging for wholesale food distribution. The surrounding parcels within the HPFDC are used for a combination of commercial and heavy manufacturing uses.Historical Uses:Contamination exists on the site due to the historical occupancy of the HPFDC by the Consolidated Edison coal gasification facility or manufactured gas plant (MGP)

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

which operated from 1925 through the early 1950s. Based on reviews of historic photographs, prior to development, Site F appears to be located under water within a triangular-shaped inlet from the Bronx River. Site F remained this way unti the MGP facility was modified and upgraded to produce carburetted water gas from coke resulting in a significant expansion. 1951 and 1954 photos show the MGP facility covering the entire Hunts Point peninsula with the Parcel F area being used for coal storage. The gasification process has been known to yield large quantities of by-products including polycyclic aromatic hydrocarbons (PAHs), light aromatic hydrocarbons, phenolic compounds, miscellaneous organic compounds, and various inorganic compounds such as iron, lead, copper, zinc, sulfides, cyanides and nitrates.The US Army Corps of Engineers constructed the existing stone bulkhead between 1966 and 1974. Along the 1966 shoreline, an area approximately 100 feet wide appears to have been filled to bridge the gap between the historic bulkhead and new bulkhead. In November 1969, a lease was signed with K.F.I. Food Distributors, Inc. (K.F.I.), an affiliate of Krasdale Foods, the current lessee. The original leased parcel was 10.13 acres, and did not include Site F. A building was later constructed on the Krasdale parcel. In 1979, the leased parcel was expanded to include a total of 16.92 acres, incorporating the 2.16-acre Site F parcel into the lease. While the Krasdale Foods buildings have been expanded, Site F was never developed. Site Geology and Hydrogeology:Generally the surface of Site F consists of fill composed of a silty sand and containing coal, ash and slag. Additionally there are a number of areas where purifier waste is visible at the surface. The thickness of the surface fill layer varies extending to a depth of 3 to 11 feet bgs with an average thickness of approximately 5.5 feet. Underlying the surface fill is a purifier waste deposit consisting of bleu/green stained woodchips and sand. The purifier waste deposit appears to be present over the entire footprint of the site and extends from 3 to 17 feet bgs with an average thickness of approximately 6.3 feet thick. A consistent olive-green silty clay was encountered immediately beneath the purifier waste deposit. The clay was observed between 10 and 20 feet below the current ground surface. It appears to extended beyond the boundaries of Site F with an average thickness of approximately 3 feet. Clay was encountered below all areas containing purifier bed material. A sand unit with discrete, discontinuous silt lenses lies immediately beneath the clay. This layer was shown to extend from approximately 17 to 45 feet bgs. The sand layer thickness varies from 26 to 28 feet with and average thickness of approximately 27 feet. Bedrock underlies the sand unit. Within the Site F parcel, groundwater is approximately 4 feet bgs and ranges from 4.3 to 3.4 feet above mean sea level (amsl). The water levels drop off to approximate mean sea level towards the east, adjacent to the Bronx River. Groundwater across the Site F parcel is relatively flat and appears to flow radially to the east and south (to the Bronx River). The average horizontal gradient across the entire site was determined to be approximately 0.004 feet/feet. Tidal influence was observed in deep monitoring wells to the east of the historical bulkhead indicating that the sand fill to the east of Site F parcel is hydraulically connected to the Bronx River. Tidal influence was not observed in the shallower fill/purifier waste deposit indicating that the portion of the Site F parcel west of the former bulkhead has a limited hydraulic connection to the Bronx River.

Env Problem: Nature and Extent of Contamination:Based upon investigations

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

conducted to date, the primary contaminants of concern at the site known at this time include cyanide, carbon disulfide, naphthalene and polyaromatic hydrocarbons (PAHs). The investigations indicated the presence of groundwater, as well as subsurface soil contamination associated with historic manufactured gas plant operations. Naphthalene, carbon disulfide and cyanide were detected in groundwater at maximum concentrations of 2,300 ppb, 16,000 ppb, and 10,300 ppb, respectively. The groundwater standard for each of these constituents is 10 ppb, 50 ppb, and 200 ppb, respectively. Due to the presence of purifier waste across a major portion of the site, concentrations of cyanide found on-site (as high as 1,620 ppm)significantly exceeded the soil cleanup objective (SCO) for the protection of groundwater (40 ppm). In addition, due to the presence of coal tar in on-site soils, the concentration of PAHs found on-site mostly exceeded the SCO for Track 2 commercial use, particularly along the northern property boundary.

Health Problem: Persons who enter the site could contact contaminants in the soil by walking on the soil, or digging or otherwise disturbing the soil. People are not drinking the contaminated groundwater because the area is served by a public water supply that is not affected by this contamination. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Breathing site contaminants in indoor air due to soil vapor intrusion does not represent a concern for this site in its current condition because there is no on-site building. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site development and for current off-site buildings.

Program Type: VCP
Site Code: 57554
HW Code: V00605
Site Class: C
SWIS: 0301
Region: 2
Town: New York City
Acres: 3.500
Date Record Added: 08/09/2002
Date Record Updated: 10/25/2013
Updated By: JAMORAS
Site Description: Location:The 3.5-acre site is located near the intersection of Halleck Street, East Bay Avenue and Hunts Point Avenue at 332 Old Hunts Point Avenue in the Borough and County of the Bronx. Site Features:The main site features include buildings, above-ground piping, and various underground natural gas and water pipelines associated with the metering and regulating station at the Con Edison Gas Compressor Station site. A chain-link fence surrounds the site, with access through a security gate located on Halleck Street.Current Zoning/Use:The site is currently active and is zoned for industrial use. Nearby properties include municipal and private solid waste facilities, sewage treatment plants, auto service/wrecking establishments, and manufacturing facilities.Historical Uses:Between 1924 and the early 1960s, the site was part of the grounds of Con Edison’s former Hunts Point Gas Works - a coal and carburetted water

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

gas manufactured gas plant (MGP) complex that encompassed more than 200 acres. Insurance maps indicate that former MGP gas manufacturing or storage structures were not present on the site property. However, several MGP-related structures including a large 15,000,000 cubic foot waterless gasholder, pump tanks, filters, a waste oil tank, and a tar separator were located on the adjacent property to the east of the site. A former Con Edison substation and associated structures were located on the adjacent property to the south of the site. An August 2002 Preliminary Site Assessment performed by Con Edison showed that on-site soils were contaminated with semi-volatile organic compounds, primarily polyaromatic hydrocarbons (PAHs), and volatile organic compounds such as benzene, as well as copper, lead and zinc at levels above regulatory guidelines. The groundwater was found to contain carcinogenic PAHs as well as some metals including iron, lead, and manganese at levels above NYSDEC Class GA groundwater standards.In order to more adequately assess the extent of contamination in on-site soils and groundwater, the NYSDEC requested that Con Edison perform additional site investigation under the Voluntary Cleanup Program pursuant to a Voluntary Cleanup Agreement which was executed between the NYSDEC and Con Edison on October 17, 2002.Site Geology and Hydrogeology:The site is underlain by approximately 3 to 11 feet of fill material, consisting of sand, gravel, coal ash/cinders, and debris (wood, bricks, glass, etc.). In general, the fill is underlain by a layer of sand and gravel, which in turn is underlain by clay. The thickness of the clay ranges from approximately 4 feet in the southwestern portion of the site to 13 feet in the southeastern portion of the site. A deeper sand layer is located beneath the clay at depths ranging from approximately 11 feet below ground surface (bgs). Bedrock is encountered beneath the deeper sand layer in the southeastern portion of the property at approximately 27 feet bgs.Shallow groundwater has been encountered within fill materials on the eastern portion of the site at depths between 2 and 5 feet bgs. This shallow water appears to be perched within the fill and sand materials above the clay. The depth of the shallow perched water increases towards the western portion of the site. A deeper water-bearing zone exists within the deeper sand layer where groundwater is located at 10 to 15 feet bgs. The groundwater flows in a southwesterly direction.

Env Problem: Nature and Extent of Contamination:Post-RemediationRemediation at the site is complete. Prior to remediation, the primary contaminants of concern at the site included polyaromatic hydrocarbons (PAHs), benzene, copper, lead, and zinc in soil, and PAHs, iron, lead and manganese in groundwater.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste. Soil contaminated with polycyclic aromatic hydrocarbons and coal tar has been excavated and removed from the site. Soil, gravel cover and a fence will prevent exposure to residually contaminated soil. The area is served by public water, therefore, exposures via ingestion are not expected.

Program Type: VCP
Site Code: 57189
HW Code: V00681
Site Class: A
SWIS: 0301
Region: 2
Town: New York City

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

Acres: Not reported
Date Record Added: 10/20/2003
Date Record Updated: 10/25/2013
Updated By: JAMORAS
Site Description: Location:Parcel E, OU2 is located within the Hunts Point Food Distribution Center (HPFDC) which lies on the Hunts Point peninsula in the South Bronx. The 3.69-acre site is an L-shaped portion of land located in the northwestern portion of the HPFDC in NYSDEC Region 2, Bronx County. It is bounded to the north by Food Center Drive (formerly East Bay Avenue), to the west by Halleck Street, to the east by Hunt Point Parcel E,OU1 (Site No. V00414), and to the south by the Con Edison Gas Compressor Station Easement Area, the Con Edison Gas Compressor Station Site (Site No. V00605), and the Meat Market portion of the HPFDC. The HPFDC was the former location of the Con Edison Hunts Point Manufactured Gas Plant (MGP), also known as the Hunts Point Coking Station. Current Zoning/Uses:The site is currently inactive, and is zoned for business district, light commercial, light industrial, and local service district. Historical Uses:While the site is currently inactive, the Con Edison MGP (coal gasification facility) operated from 1925 through the early 1950s. The site is located generally upgradient of the main MGP facility, but on-site contamination appears to be associated with the gasification process which has been known to yield large quantities of contaminants including polycyclic aromatic hydrocarbons (PAHs), light aromatic hydrocarbons, phenolic compounds, miscellaneous organic compounds, and various inorganic compounds such as iron, lead, copper, zinc, sulfides, cyanides and nitrates. A Remedial Investigation was completed in 2006. An Interim Remedial Measure Work Plan for the limited excavation of coal tar and purifier waste hot spots on the site was approved on January 16, 2008 and will be implemented as part of the final remedy for this site.Site Geology and Hydrogeology:The soil stratigraphy varies across the HPFDC as a result of previous filling activities. Typically, a 1- to 2-foot thick layer of sandy topsoil/fill overlays fill material that consistently includes soil, construction and demolition debris, ash, cinders, residual coal, and material that is moderately to significantly impacted by MGP waste (coal tar and purifier waste). The underlying MGP fill layer varies in thickness across the site, but is generally 5 to 7 feet thick. Underlying the MGP fill layer is a native clay layer.Site groundwater was generally encountered on top of the native clay whose depth varies from 7 to 12 feet below ground surface. The depth to groundwater changes throughout the year.
Env Problem: Nature and Extent of Contamination:The primary contaminants of concern at the site include benzene, naphthalene, polyaromatic hydrocarbons (PAHs), arsenic and cyanide. Investigations conducted at the site indicate subsurface soil contamination associated with historic on-site manufactured gas plant operations. The underlying groundwater, on the other hand, does not appear to be significantly impacted. The subsurface soils exceeded soils guidance values for benzene, naphthalene, PAHs, arsenic and cyanide.
Health Problem: The site is completely fenced, which restricts public access. However, persons who enter the site could contact contaminants in the soil by walking on the site, digging or otherwise disturbing the soil. Contaminated groundwater at the site is not used for drinking or other purposes and the area is served by a public water supply that obtains water from a different source not affected by this contamination. Volatile organic compounds in the groundwater may move

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Currently there are no occupied buildings on the site. A vapor barrier and passive sub-slab depressurization system (systems that ventilate/remove the air beneath the building) will be installed in future on-site buildings to prevent soil vapor intrusion from occurring.

Program Type:	VCP
Site Code:	57191
HW Code:	V00683
Site Class:	A
SWIS:	0301
Region:	2
Town:	New York City
Acres:	Not reported
Date Record Added:	10/20/2003
Date Record Updated:	10/25/2013
Updated By:	JAMORAS
Site Description:	Location:Parcel D is a 9-acre site located in the northeastern portion of the Hunts Point Food Distribution Center (HPFDC) which lies on the Hunts Point peninsula in the South Bronx. It is bounded to the north by the New York City Terminal Market, to the south by Krasdale Food Industries, to the west by Food Center Drive, and to the east by the Bronx River. Site Features:The site is relatively level with some debris piles located sporadically across the site. Most of the site is vegetated with small brush and trees with the exception of a large area devoid of vegetation near the center of the site. The area devoid of vegetation has purifier waste exposed at the surface. Upon entering the area which is devoid of vegation, the sulfuric odor characteristic of purifier waste is immediately noticeable.Current Zoning/Uses:The site is currently inactive and zoned for commercial use. The surrounding parcels within the HPFDC are used for a combination of commercial and heavy manufacturing uses.Historical Uses:Contamination exists on the site due to the historical occupancy of the HPFDC by the Consolidated Edison coal gasification facility (coking station) or manufactured gas plant (MGP)which was constructed between 1924 and 1932, and operated until the early 1960s. Much of the property was subsequently developed into the HPFDC, a wholesale food complex. Site Geology and Hydrogeology:The Site is relatively flat with a slight surface topography change, lowering the site to the east (adjacent to the Bronx River). A significant portion of the Site falls within the FEMA AE flood zone and a very small portion along the south east corner is within the VE flood zone. Based on historic aerial photos dating back to 1928, the site appears to be filled with man-made materials, waste from the former manufactured gas plant and other material that appears to have originated from dredging operations. The MGP waste consists mainly of material that clearly resembles purifier bed material. This purifier waste extends from the surface to a maximum depth of approximately 16 feet with some deposits as thick as 15 feet. Much of the waste is obvious and can be clearly seen at the surface where no vegetation has grown since it was deposited. The material exhibits a clearly acrid or sulfurous odor when approached and the surface blue color is clearly differentiated from other fill

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

areas. Other areas also contain coal tar and other waste material. Depth to groundwater varies across the site but in general the overall gradient is believed to be toward the Bronx River as this is the base of the drainage basin. A large stone rip rap bulkhead exists along the Rivers edge. There are no construction documents available for the bulkhead but it does not appear to prevent water from moving inward at high tide or back during low tide or storm events. There is a consistent layer of clay beneath the fill material across the site which has been observed several feet below the water table. This clay layer is believed to be part of reason for the fluctuating groundwater contours in the area, as it helps promote more horizontal flow through the site. Bedrock has not been encountered in the investigation but is expected to be at depths greater than 50 ft below grade beneath the site.

Env Problem: Nature and Extent of Contamination:The primary contaminants of concern at the site known at this time include volatile organic compounds, semi-volatile organic compounds including polyaromatic hydrocarbons (PAHs)and metals.The completed investigation indicates the presence of groundwater and soil contamination.Exceedances of standards, criteria and guidance include benzene, naphthalene, arsenic, chromium, lead, manganese and selenium in groundwater, and benzene, PAHs, and cyanide in soil.

Health Problem: Soil and groundwater are contaminated with manufactured gas plant waste including purifier waste and coal tar. Groundwater is not used as a source for drinking water, therefore, expsoures are not expected. Currently, there is a potential for expsosure to contaminated soil, however, it is a commercial/industrial area and public exposures are unlikely. The proposed remedy includes removal of coal tar boils and purifier waste. In addition, new construction and an associated parking lot will prevent exposure to residual soil contamination .

Program Type: VCP
Site Code: 57190
HW Code: V00682
Site Class: A
SWIS: 0301
Region: 2
Town: New York City
Acres: 6.050
Date Record Added: 10/20/2003
Date Record Updated: 02/20/2013
Updated By: JAMORAS
Site Description: Location:The 6-acre site is located in the northwestern portion of the Hunts Point Food Distribution Center (HPFDC) in NYSDEC Region 2, Bronx County. It is bounded to the north by the Con Ed Gas Compressor Station Voluntary Cleanup Program (VCP) Site (VCP Site No. V00605), to the west by Halleck Street, to the east by HPFDC Site E, Operable Unit No. 2 (VCP Site No. 00681), and to the south by HPFDC Site A (VCP Site No. V00233). Site Features:The land is flat and graded. The western portion of the site is covered with approximately 6 inches or more of gravel. The central portion of the site contains a vegetated area, and a large concrete pad which is surrounded by a nearly finished concrete foundation wall on the north, west and east sides. The easternmost portion of the site is paved and graded.Current Zoning/Uses:The site is currently inactive and zoned for commercial use. The surrounding parcels within the HPFDC are used for a

CE - GAS COMPRESSOR STATION (Continued) **S105684655**

combination of commercial and heavy manufacturing uses.Historic Uses:Contamination exists on the site due to the historical occupancy of the HPFDC by the Consolidated Edison coal gasification facility or manufactured gas plant (MGP) which operated from 1925 through the early 1950s. The gasification process has been known to yield large quantities of by-products including polycyclic aromatic hydrocarbons (PAHs), light aromatic hydrocarbons, phenolic compounds, miscellaneous organic compounds, and various inorganic compounds such as iron, lead, copper, zinc, sulfides, cyanides and nitrates. The site is located upgradient of the former location of the main MGP facility, and, therefore, does not appear to be significantly impacted by MGP wastes. Site Geology and Hydrogeology:Generally, a 6-inch to 1.5-foot gravel layer overlays most of the site. Under the gravel is a 2.5 to 5-foot thick layer of brown sand/siltwhich is underlain by 2 to 6 feet of coal ash. Below the coal ash layer is the native clay layer which appears at various depths below the ground surface (bgs). Groundwater is typically encountered just above the clay layer at a depth of approximately 7 to 12 feets bgs.

Env Problem: Nature and Extent of Contamination:Based on the Remedial Investigation, the primary contaminants of concern at the site include polychlorinated biphenyls (PCBs), methyl tert-butyl ether (MTBE), benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, and chrysene.Groundwater - MTBE was found in groundwater at concentrations exceeding the groundwater standard (10 parts per billion [ppb]), with a maximum concentration of 370 ppb. Soils - Concentrations of PCBs found in surface soils on-site (as high as 15 parts per million [ppm]) exceeded the Track 2 soil cleanup objective for restricted commercial use (1 ppm).

Health Problem: The site is completely fenced, which restricts public access. However, persons who enter the site could contact contaminants in the soil by digging or otherwise disturbing the soil. People are not drinking the contaminated groundwater because the area is served by a public water supply that is not contaminated by the site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because the site is vacant, the inhalation of site-related contaminants due to soil vapor intrusion does not represent a current concern.

D41 **SPILL NUMBER 0201619** **NY Spills** **S106003582**
NNW **801 FOOD CENTER DRIVE** **N/A**
1/8-1/4 **BRONX, NY**
0.138 mi.
729 ft. **Site 2 of 2 in cluster D**

Relative:
Lower

Actual:
14 ft.

SPILLS:

Facility ID:	0201619
Facility Type:	ER
DER Facility ID:	197860
Site ID:	240588
DEC Region:	2
Spill Date:	5/14/2002
Spill Number/Closed Date:	0201619 / 5/14/2002
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.

SPILL NUMBER 0201619 (Continued) **S106003582**

	Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	JBVOUGHT
Referred To:	Not reported
Reported to Dept:	5/14/2002
CID:	396
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	5/14/2002
Spill Record Last Update:	5/30/2002
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	NN
Spiller Company:	999
Contact Name:	PATRICIA FEENEY
Contact Phone:	(718) 956-8778
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "VOUGHT"5/14/02- 801 FOOD CENTER DRIVE- STRONG TAR LIKE ODOR- NEW FULTON FISH MARKET SITE, FORMER LANDFILL- HUNTS POINTS- RONNIE LEE ALBANY DEC- 518-402-9622- VCA- NY ECD CORP
Remarks:	caller says that they are doing excavation work next to them and the workers are wearing tyvek suits and respirators...there is a smell which smells like tar...caller is concerend for her employees...they have been told not to worry about anything

Material:

Site ID:	240588
Operable Unit ID:	854824
Operable Unit:	01
Material ID:	523032
Material Code:	0018A
Material Name:	TAR
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

42 NNW 1/8-1/4 0.184 mi. 972 ft. **NYCEDC - SITE B**
800 FOOD CENTER DR
BRONX, NY 10474

RCRA NonGen / NLR **1005444240**
FINDS **NYR000105601**

Relative: Lower

Actual: 15 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NYCEDC - SITE B
Facility address:	800 FOOD CENTER DR BRONX, NY 104747040
EPA ID:	NYR000105601
Mailing address:	FOOD CENTER DR BRONX, NY 104747040
Contact:	ADRIAN ESPARRAGOZA
Contact address:	FOOD CENTER DR BRONX, NY 104747040
Contact country:	US
Contact telephone:	(212) 312-3748
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	NYC ECONOMIC DEVELOPMENT CORP
Owner/operator address:	110 WILLIAM ST NEW YORK, NY 10038
Owner/operator country:	US
Owner/operator telephone:	(212) 312-3600
Legal status:	Municipal
Owner/Operator Type:	Operator
Owner/Op start date:	01/01/2001
Owner/Op end date:	Not reported

Owner/operator name:	NYC ECONOMIC DEVELOPMENT CORP
Owner/operator address:	110 WILLIAM ST NEW YORK, NY 10038
Owner/operator country:	US
Owner/operator telephone:	(212) 312-3600
Legal status:	Municipal
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/2001
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No

NYCEDC - SITE B (Continued) **1005444240**

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: NYCEDC - SITE B
Classification: Not a generator, verified

Date form received by agency: 04/22/2002
Facility name: NYCEDC - SITE B
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110012201599

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

E43 **NYC DEPT OF CORRECTION** **RCRA NonGen / NLR** **1000552003**
WNW **1 HALLECK ST** **FINDS** **NYD986943942**
1/8-1/4 **BRONX, NY 10474**
0.209 mi.
1105 ft. **Site 1 of 4 in cluster E**

Relative:
Lower

Actual:
8 ft.

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: NYC DEPT OF CORRECTION
Facility address: 1 HALLECK ST
BRONX, NY 104747085
EPA ID: NYD986943942
Mailing address: HALLECK ST
BRONX, NY 10474
Contact: Not reported
Contact address: HALLECK ST
BRONX, NY 10474
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: CITY OF NY-DIV OF REAL PROPERTY
Owner/operator address: 2 LAFAYETTE ST
NEW YORK, NY 10007

NYC DEPT OF CORRECTION (Continued) **1000552003**

Owner/operator country: US
Owner/operator telephone: (212) 566-7530
Legal status: Municipal
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: CITY OF NY DIV OF REAL PROPERTY
Owner/operator address: 2 LAFAYETTE ST
NEW YORK, NY 10007
Owner/operator country: US
Owner/operator telephone: (212) 566-7530
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: NYC DEPT OF CORRECTION
Classification: Not a generator, verified

Date form received by agency: 09/07/1999
Facility name: NYC DEPT OF CORRECTION
Classification: Not a generator, verified

Date form received by agency: 03/19/1991
Facility name: NYC DEPT OF CORRECTION
Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 08/31/1999
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

NYC DEPT OF CORRECTION (Continued) **1000552003**

FINDS:

Registry ID: 110004462313

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

E44 **NYC DEPT OF CORRECTION** **MANIFEST** **S105057385**
WNW **1 HALLECK ST** **NY Spills** **N/A**
1/8-1/4 **BRONX, NY 10474**
0.209 mi.
1105 ft. **Site 2 of 4 in cluster E**

Relative:
Lower

Actual:
8 ft.

NY MANIFEST:

EPA ID:	NYD986943942
Country:	USA
Mailing Name:	NYC DEPT OF CORRECTION
Mailing Contact:	JOHN SHANAHAN
Mailing Address:	1 HALLECK ST
Mailing Address 2:	Not reported
Mailing City:	BRONX
Mailing State:	NY
Mailing Zip:	10474
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-579-8300

NY MANIFEST:
No Manifest Records Available

SPILLS:

Facility ID:	0101731
Facility Type:	ER
DER Facility ID:	245185
Site ID:	62061
DEC Region:	2
Spill Date:	5/15/2001
Spill Number/Closed Date:	0101731 / 6/23/2003
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	5/15/2001
CID:	396
Water Affected:	LONG ISLAND SOUND
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported

NYC DEPT OF CORRECTION (Continued) **S105057385**

Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	5/15/2001
Spill Record Last Update:	6/23/2003
Spiller Name:	VINCENT CARA
Spiller Company:	NYC CORRECTIONS
Spiller Address:	60 HUDSON ST
Spiller City,St,Zip:	MANHATTAN, NY
Spiller Company:	001
Contact Name:	GERARD OGARRA
Contact Phone:	(718) 579-8300
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND"
Remarks:	COAST GUARD ON SITE NOW...CLEAN UP INPROGRESS...NRC #566058.

Material:

Site ID:	62061
Operable Unit ID:	840555
Operable Unit:	01
Material ID:	537438
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	300
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Facility ID:	0313151
Facility Type:	ER
DER Facility ID:	245185
Site ID:	107538
DEC Region:	2
Spill Date:	3/1/2004
Spill Number/Closed Date:	0313151 / 3/19/2004
Spill Cause:	Other
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	CESAWYER
Referred To:	Not reported
Reported to Dept:	3/1/2004
CID:	403
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported

NYC DEPT OF CORRECTION (Continued) **S105057385**

Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	3/1/2004
Spill Record Last Update:	3/19/2004
Spiller Name:	PATRICIA FEENEY
Spiller Company:	VERNON C. BAIN CENTER
Spiller Address:	1 HALLECK ST.
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	001
Contact Name:	PATRICIA FEENEY
Contact Phone:	(718) 546-3090
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER"3/1/04 - Sawyer -This was release of between 50-100 gallons of #2 fuel oil that spilled in to the the East River between the Barge at 1 Halleck Street in the Bronx and the shore line. The Barge has a fuel capacity of 85,000 gallons of fuel. The facility is not registered as a PBS facility.The spill was caused by an overfill of the the day tank from one of the two 40,000 gallon main tanks. The plant operator, in the process of transfering 575 gallons of fuel to the day tank left the tank area to do some boiler work and did not hear the alarm right away. The day tank overfilled and backed out through the vent, a small amount of about 10 gallons was contained in the secondary lip and the rest sprayed down the side of the vessel.The Department of Corrections Assistant Commissioner of Environmental Health Patricia Feeney called in the release and met me at 10:30 am at the Barge. The US Coast Guard aslo had four representatives onsite.Milro Associates were contracted to do the cleanup.When I left on Monday 2:00 pm the spilled fuel that had not gone out into the East River was contained by hard booms and absorbent pads.I talked to BM3 Hawkins of USCG today (3/5) and he notified me that most of the contained product has either been sucked up by the booms or dissipated.3/19/04 - Sawyer - Closed.
Remarks:	about 50 gallons of #2 oil spilled. they think that about 40 gallons went into the bronx river. they have millro associates on the way. the facility made note to the NRC

Material:

Site ID:	107538
Operable Unit ID:	878397
Operable Unit:	01
Material ID:	498309
Material Code:	0001A
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Facility ID:	0011512
Facility Type:	ER

NYC DEPT OF CORRECTION (Continued) **S105057385**

DER Facility ID:	245185
Site ID:	303487
DEC Region:	2
Spill Date:	1/24/2001
Spill Number/Closed Date:	0011512 / 2/13/2003
Spill Cause:	Other
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	0301
Investigator:	JMROMMEL
Referred To:	Not reported
Reported to Dept:	1/24/2001
CID:	266
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1/24/2001
Spill Record Last Update:	2/13/2003
Spiller Name:	PATRICIA FENNEY
Spiller Company:	NEW YORK CITY CORRECTIONS
Spiller Address:	60 HUDSON STREET
Spiller City,St,Zip:	NEW YORK, NY 10013-
Spiller Company:	001
Contact Name:	CAPTAIN BORGES
Contact Phone:	(718) 579-8357
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL"2/13/2003 - Closed Due To The Nature / Extent Of The Spill Report
Remarks:	SOMEONE KNOCKED A WALL-MOUNTED SPHYGMOMANOMETER OFF OF THE WALL. SPILLED ONTO CONCRETE FLOOR. NEW YORK CITY FIRE DEPARTMENT HAZ-MAT RESPONDED AND CLEANED UP THE SPILL.

Material:

Site ID:	303487
Operable Unit ID:	833008
Operable Unit:	01
Material ID:	566059
Material Code:	0031A
Material Name:	MERCURY
Case No.:	07439976
Material FA:	Hazardous Material
Quantity:	1
Units:	Gallons
Recovered:	Yes
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

E45
WNW
1/8-1/4
0.209 mi.
1105 ft.

1 HALLECK STREET
BRONX, NY 10474

Site 3 of 4 in cluster E

ERNS **2001566058**
N/A

Relative:
Lower

Actual:
8 ft.

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

E46
WNW
1/8-1/4
0.209 mi.
1105 ft.

VERNON. C. BAIN CENTER
1 HALLECK STREET
BRONX, NY 10474

Site 4 of 4 in cluster E

AST **A100296558**
N/A

Relative:
Lower

Actual:
8 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-609626
Program Type:	PBS
UTM X:	594606.25208000001
UTM Y:	4517619.8119099997
Expiration Date:	2014-06-28
Site Type:	Municipality (Incl. Waste Water Treatment Plants,

Affiliation Records:

Site Id:	55725
Affiliation Type:	Facility Owner
Company Name:	N.Y.C. DEPARTMENT OF CORRECTION
Contact Type:	ASST. COMMISSIONER
Contact Name:	PATRICIA FEENEY
Address1:	75-20 ASTORIA BLVD.
Address2:	Not reported
City:	E. ELMHURST
State:	NY
Zip Code:	11370
Country Code:	001
Phone:	(718) 546-3090
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	4/26/2011

Site Id:	55725
Affiliation Type:	Mail Contact
Company Name:	N.Y.C. DEPARTMENT OF CORRECTION
Contact Type:	Not reported
Contact Name:	PATRICIA FEENEY
Address1:	17-41 HAZEN ST
Address2:	Not reported
City:	E. ELMHURST
State:	NY
Zip Code:	11370
Country Code:	001
Phone:	(718) 546-3090
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	4/26/2011

VERNON. C. BAIN CENTER (Continued) **A100296558**

Site Id:	55725
Affiliation Type:	On-Site Operator
Company Name:	VERNON. C. BAIN CENTER
Contact Type:	Not reported
Contact Name:	JIM SORRELL
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 579-8306
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	4/26/2011

Site Id:	55725
Affiliation Type:	Emergency Contact
Company Name:	N.Y.C. DEPARTMENT OF CORRECTION
Contact Type:	Not reported
Contact Name:	TOUR COMMANDER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 579-8340/41
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	4/26/2011

Tank Info:

Tank Number:	1
Tank Id:	179315
Material Code:	0008
Common Name of Substance:	Diesel

Equipment Records:

L00 - Piping Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
K00 - Spill Prevention - None
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity

Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron

VERNON. C. BAIN CENTER (Continued) **A100296558**

Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1992
Capacity Gallons:	40000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	CGFREEDM
Last Modified:	04/29/2011
Material Name:	Diesel

Tank Number:	2
Tank Id:	179316
Material Code:	0008
Common Name of Substance:	Diesel

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity
L00 - Piping Leak Detection - None

Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1992
Capacity Gallons:	40000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	CGFREEDM
Last Modified:	04/29/2011
Material Name:	Diesel

Tank Number:	3
Tank Id:	238989
Material Code:	0008
Common Name of Substance:	Diesel

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)

VERNON. C. BAIN CENTER (Continued) **A100296558**

G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
K00 - Spill Prevention - None
L00 - Piping Leak Detection - None

Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1992
Capacity Gallons:	2500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	04/26/2011
Material Name:	Diesel

Tank Number:	4
Tank Id:	238990
Material Code:	0008
Common Name of Substance:	Diesel

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
L00 - Piping Leak Detection - None
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity

Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1992
Capacity Gallons:	2500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	04/26/2011

VERNON. C. BAIN CENTER (Continued) **A100296558**

Material Name: Diesel

Tank Number: 5
Tank Id: 238991
Material Code: 0015
Common Name of Substance: Motor Oil

Equipment Records:
L00 - Piping Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
K00 - Spill Prevention - None
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity

Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 01/01/1992
Capacity Gallons: 1500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: MSBAPTIS
Last Modified: 04/26/2011
Material Name: Motor Oil

Tank Number: 6
Tank Id: 238992
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Equipment Records:
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity
K00 - Spill Prevention - None
B01 - Tank External Protection - Painted/Asphalt Coating
I02 - Overfill - High Level Alarm
L00 - Piping Leak Detection - None

Tank Location: 6

VERNON. C. BAIN CENTER (Continued) **A100296558**

Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1992
Capacity Gallons:	1000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	04/26/2011
Material Name:	Waste Oil/Used Oil

Tank Number:	7
Tank Id:	238993
Material Code:	0008
Common Name of Substance:	Diesel

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J03 - Dispenser - Gravity
L00 - Piping Leak Detection - None

Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1992
Capacity Gallons:	250
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	04/26/2011
Material Name:	Diesel

F47
NE
1/8-1/4
0.222 mi.
1172 ft.

CON EDISON MANHOLE 28852
500 FOOD CENTER DR FRONT OF
BRONX, NY

FINDS **1014809374**
N/A

Site 1 of 3 in cluster F

Relative:
Lower

Actual:
13 ft.

FINDS:

Registry ID: 110043666155

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

F48
NE
1/8-1/4
0.222 mi.
1172 ft.

CON EDISON MANHOLE 28852
500 FOOD CENTER DR FRONT OF
BRONX, NY 10474

RCRA NonGen / NLR **1014918256**
NYP004218679

Site 2 of 3 in cluster F

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	11/22/2010
Facility name:	CON EDISON MANHOLE 28852
Facility address:	500 FOOD CENTER DR FRONT OF BRONX, NY 10474
EPA ID:	NYP004218679
Mailing address:	IRVING PL RM 828 NEW YORK, NY 10003
Contact:	GINO FRABASILE
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	(914) 925-6219
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

CON EDISON MANHOLE 28852 (Continued) **1014918256**

Historical Generators:
Date form received by agency: 10/23/2010
Facility name: CON EDISON MANHOLE 28852
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

F49 **CONSOLIDATED EDISON - MH 28552** **MANIFEST** **S110709313**
NE **500 FOOD CENTER DRIVE** **N/A**
1/8-1/4 **BRONX, NY 10451**
0.222 mi.
1172 ft. **Site 3 of 3 in cluster F**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:
EPA ID: NYP004218679
Country: USA
Mailing Name: CONSOLIDATED EDISON - MH 28552
Mailing Contact: TOM TEELING
Mailing Address: 4 IRVING PLACE RM 828
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10003
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-460-3770

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 2010-10-23
Trans1 Recv Date: 2010-10-23
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2010-10-25
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP004218679
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NJD002200046
Waste Code: Not reported
Quantity: 250.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 1.0
Year: 2010
Manifest Tracking Num: 006874872JJK
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: Y
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

CONSOLIDATED EDISON - MH 28552 (Continued) **S110709313**

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H111

G50 **CONSOLIDATED EDISON COMPRESSOR STATION** **EDR MGP** **1008407873**
North **FOOD CENTER DRIVE** **N/A**
1/8-1/4 **BRONX, NY 10474**
0.233 mi.
1228 ft. **Site 1 of 2 in cluster G**

Relative:
Higher

Manufactured Gas Plants:
No additional information available

Actual:
17 ft.

G51 **ERNS** **2007302068**
North **HUNTS POINT WATER POLLUTION CONTROLPLANT** **N/A**
1/8-1/4 **BRONX, NY 10474**
0.246 mi.
1301 ft. **Site 2 of 2 in cluster G**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual:
17 ft.

Count: 20 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BRONX	1007820395	NYS DOT-OAK POINT LINK	145TH ST BRG OVER THE HARLEM R		FINDS
BRONX	S108763840	DRUM RUN	RTE 95 RAMP TO 87		NY Spills
BRONX	S116156237	QUEENS BOUND AT THE TOLL PLAZA AT	CROSS BRONX EXPSY OR ROUTE 95		NY Spills
BRONX	1010488291	NYSDOT BIN 1066220	EDWARD L GRANT HWY CBG		FINDS, MANIFEST
BRONX	A100386239	ANHEUSER-BUSCH DISTRIBUTORS OF NEW	550 FOOD CENTER DRIVE	10474	AST
BRONX	S110540770	TRAFFIC ACCIDENT	GRANT HWY AND W 170TH ST		NY Spills
BRONX	1016199163	POINT TRANSPORTATION CORP	421-A HUNTS POINT TERM MKT		FINDS
BRONX	1014918683	CON EDISON OTHER - SPECIFY TUNNELS	332 HUNTS POINT AVE	10474	RCRA NonGen / NLR
BRONX	1014813686	GOLD MEDAL PRODUCE INC	164 HUNTS POINT AVE	10474	US AIRS
BRONX	1011494325	NYCDOS - SOUTH BRONX MARINE TRANSF	HUNTS POINT AVE & E RIVER B	10474	ICIS
BRONX	1010438940	VERIZON NEW YORK INC. MANHOLE	HUNTS POINT MARKET		FINDS, MANIFEST
BRONX	1016030562	FERRY POINT PARK GOLF COURSE	500 HUTCHINSON PARKWAY		FINDS
BRONX	1012241816	NYCP&R - FERRY POINT WATERFRONT PA	500 HUTCHINSON PARKWAY		FINDS
BRONX	1000694477	SHELL OIL-ANGAMA AUTO CTR INC	1263 E L GRANT HWY	10452	RCRA NonGen / NLR, FINDS, MANIFEST, US AIRS
BRONX	1014812734	ATLANTIC EXPRESS - OAK POINT	500 OAK POINT AVENUE		FINDS
BRONX	S109414309	MILE MARKER IS POSSIBLY 2.6 THE CA	87N OFF ROUTE 100 NORTH EXIT.		NY Spills
BRONX	1011444945	NYC DPR-CLASON POINT PARK	SOUNDVIEW AVE		FINDS
BRONX	S107488594	IFO TASK FORCE	STATE 87 EXIT - I 95 HWY		NY Spills
BRONX	1009242736	CONSOLIDATED EDISON	WHITTIER & HUNTS POINT MH15838		MANIFEST
HUNTS POINT	1000889995	NYCDOT	HUNTS POINT AVE BRG OVER	10474	RCRA NonGen / NLR, MANIFEST

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 10/25/2013
Date Data Arrived at EDR: 11/11/2013
Date Made Active in Reports: 01/28/2014
Number of Days to Update: 78

Source: EPA
Telephone: N/A
Last EDR Contact: 04/08/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 10/25/2013
Date Data Arrived at EDR: 11/11/2013
Date Made Active in Reports: 01/28/2014
Number of Days to Update: 78

Source: EPA
Telephone: N/A
Last EDR Contact: 04/08/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 10/25/2013
Date Data Arrived at EDR: 11/11/2013
Date Made Active in Reports: 01/28/2014
Number of Days to Update: 78

Source: EPA
Telephone: N/A
Last EDR Contact: 04/08/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 10/25/2013
Date Data Arrived at EDR: 11/11/2013
Date Made Active in Reports: 02/13/2014
Number of Days to Update: 94

Source: EPA
Telephone: 703-412-9810
Last EDR Contact: 02/28/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 05/31/2013
Date Data Arrived at EDR: 07/08/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 151

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 04/11/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 10/25/2013
Date Data Arrived at EDR: 11/11/2013
Date Made Active in Reports: 02/13/2014
Number of Days to Update: 94

Source: EPA
Telephone: 703-412-9810
Last EDR Contact: 02/28/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/11/2014
Date Data Arrived at EDR: 03/13/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 27

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 03/13/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 03/11/2014
Date Data Arrived at EDR: 03/13/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 27

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 03/13/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/11/2014
Date Data Arrived at EDR: 03/13/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 27

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 03/13/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 03/11/2014
Date Data Arrived at EDR: 03/13/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 27

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 03/13/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/11/2014
Date Data Arrived at EDR: 03/13/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 27

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 03/13/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 12/17/2013
Date Data Arrived at EDR: 01/14/2014
Date Made Active in Reports: 01/28/2014
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 03/10/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 12/17/2013
Date Data Arrived at EDR: 01/14/2014
Date Made Active in Reports: 01/28/2014
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 03/10/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 02/26/2014
Date Data Arrived at EDR: 02/28/2014
Date Made Active in Reports: 04/24/2014
Number of Days to Update: 55

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 02/14/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 09/30/2013
Date Data Arrived at EDR: 10/01/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 66

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 04/04/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Annually

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Annually

VAPOR REOPENED: Vapor Intrustion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 02/17/2014
Date Data Arrived at EDR: 02/19/2014
Date Made Active in Reports: 03/31/2014
Number of Days to Update: 40

Source: Department of Environmenal Conservation
Telephone: 518-402-9814
Last EDR Contact: 02/19/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Varies

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 12/12/2013
Date Data Arrived at EDR: 01/07/2014
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-457-2051
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Semi-Annually

State and tribal leaking storage tank lists

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 02/17/2014
Date Data Arrived at EDR: 02/19/2014
Date Made Active in Reports: 04/02/2014
Number of Days to Update: 42

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 02/19/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 08/27/2012
Date Data Arrived at EDR: 08/28/2012
Date Made Active in Reports: 10/16/2012
Number of Days to Update: 49

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Quarterly

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land
Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 02/13/2014
Date Data Arrived at EDR: 02/14/2014
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 10
Source: EPA, Region 5
Telephone: 312-886-7439
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 11/06/2013
Date Data Arrived at EDR: 11/07/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 29
Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 03/01/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 42
Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Quarterly

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 02/01/2013
Date Data Arrived at EDR: 05/01/2013
Date Made Active in Reports: 11/01/2013
Number of Days to Update: 184
Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/30/2014
Next Scheduled EDR Contact: 05/12/2014
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 11/21/2013
Date Data Arrived at EDR: 11/26/2013
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 90
Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 04/22/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Semi-Annually

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 09/12/2011
Date Data Arrived at EDR: 09/13/2011
Date Made Active in Reports: 11/11/2011
Number of Days to Update: 59
Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 02/21/2014
Next Scheduled EDR Contact: 05/12/2014
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 02/20/2014
Date Data Arrived at EDR: 02/21/2014
Date Made Active in Reports: 04/24/2014
Number of Days to Update: 62
Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Varies

State and tribal registered storage tank lists

TANKS: Storage Tank Faciliy Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 12/30/2013
Date Data Arrived at EDR: 01/02/2014
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 40

Source: Department of Environmental Conservation
Telephone: 518-402-9543
Last EDR Contact: 04/02/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 03/31/2014
Date Data Arrived at EDR: 04/02/2014
Date Made Active in Reports: 05/01/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 04/02/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: Varies

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 03/31/2014
Date Data Arrived at EDR: 04/02/2014
Date Made Active in Reports: 05/01/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 04/02/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 03/31/2014
Date Data Arrived at EDR: 04/02/2014
Date Made Active in Reports: 04/29/2014
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 04/02/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 03/31/2014
Date Data Arrived at EDR: 04/02/2014
Date Made Active in Reports: 04/29/2014
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 04/02/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 02/05/2013
Date Data Arrived at EDR: 02/06/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 65

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 07/29/2013
Date Data Arrived at EDR: 07/30/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 129

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Quarterly

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 07/29/2013
Date Data Arrived at EDR: 08/01/2013
Date Made Active in Reports: 11/01/2013
Number of Days to Update: 92

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Quarterly

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 02/20/2014
Date Data Arrived at EDR: 02/21/2014
Date Made Active in Reports: 04/24/2014
Number of Days to Update: 62

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 02/01/2013
Date Data Arrived at EDR: 05/01/2013
Date Made Active in Reports: 01/27/2014
Number of Days to Update: 271

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/30/2014
Next Scheduled EDR Contact: 05/12/2014
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 02/13/2014
Date Data Arrived at EDR: 02/14/2014
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 10

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 11/21/2013
Date Data Arrived at EDR: 11/26/2013
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 90

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 04/22/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Semi-Annually

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 01/29/2014
Date Data Arrived at EDR: 01/29/2014
Date Made Active in Reports: 03/12/2014
Number of Days to Update: 42

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 01/27/2014
Next Scheduled EDR Contact: 05/12/2014
Data Release Frequency: Semi-Annually

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010
Date Data Arrived at EDR: 02/16/2010
Date Made Active in Reports: 04/12/2010
Number of Days to Update: 55

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 04/15/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

ENG CONTROLS: Registry of Engineering Controls
Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls
Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Quarterly

RES DECL: Restrictive Declarations Listing
A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 03/13/2014
Date Data Arrived at EDR: 04/01/2014
Date Made Active in Reports: 04/29/2014
Number of Days to Update: 28

Source: NYC Department of City Planning
Telephone: 212-720-3401
Last EDR Contact: 03/24/2014
Next Scheduled EDR Contact: 07/07/2014
Data Release Frequency: No Update Planned

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements
New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9711
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Semi-Annually

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 09/17/2013
Date Data Arrived at EDR: 10/01/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 66

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 04/01/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

State and tribal Brownfields sites

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Quarterly

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 03/20/2014
Date Data Arrived at EDR: 03/20/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 20

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 03/20/2014
Next Scheduled EDR Contact: 07/07/2014
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: No Update Planned

SWTIRE: Registered Waste Tire Storage & Facility List
A listing of facilities registered to accept waste tires.

Date of Government Version: 08/01/2006
Date Data Arrived at EDR: 11/15/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 15

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 04/22/2014
Next Scheduled EDR Contact: 08/04/2014
Data Release Frequency: Annually

SWRCY: Registered Recycling Facility List
A listing of recycling facilities.

Date of Government Version: 12/12/2013
Date Data Arrived at EDR: 01/07/2014
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-8705
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Semi-Annually

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands
Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 11/04/2013
Next Scheduled EDR Contact: 02/17/2014
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs
A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 12/04/2013
Date Data Arrived at EDR: 12/10/2013
Date Made Active in Reports: 02/13/2014
Number of Days to Update: 65

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/04/2014
Next Scheduled EDR Contact: 06/16/2014
Data Release Frequency: Quarterly

DEL SHWS: Delisted Registry Sites
A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 03/27/2014
Date Data Arrived at EDR: 03/27/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Annually

US HIST CDL: National Clandestine Laboratory Register
A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007
Date Data Arrived at EDR: 11/19/2008
Date Made Active in Reports: 03/30/2009
Number of Days to Update: 131

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/04/2014
Next Scheduled EDR Contact: 06/16/2014
Data Release Frequency: No Update Planned

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/18/2014
Date Data Arrived at EDR: 03/18/2014
Date Made Active in Reports: 04/24/2014
Number of Days to Update: 37

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Varies

LIENS: Spill Liens Information

Lien information from the Oil Spill Fund.

Date of Government Version: 02/11/2014
Date Data Arrived at EDR: 02/13/2014
Date Made Active in Reports: 03/31/2014
Number of Days to Update: 46

Source: Office of the State Comptroller
Telephone: 518-474-9034
Last EDR Contact: 02/10/2014
Next Scheduled EDR Contact: 05/26/2014
Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/2013
Date Data Arrived at EDR: 01/03/2014
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 52

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 04/01/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Annually

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 02/17/2014
Date Data Arrived at EDR: 02/19/2014
Date Made Active in Reports: 04/02/2014
Number of Days to Update: 42
Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 02/19/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6
Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/12/2013
Number of Days to Update: 40
Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/07/2013
Number of Days to Update: 63
Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 03/11/2014
Date Data Arrived at EDR: 03/13/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 27
Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 03/13/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 07/31/2012
Date Data Arrived at EDR: 08/07/2012
Date Made Active in Reports: 09/18/2012
Number of Days to Update: 42

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 02/06/2014
Next Scheduled EDR Contact: 05/19/2014
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 11/10/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 62

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 04/18/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 02/28/2014
Date Made Active in Reports: 04/24/2014
Number of Days to Update: 55

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 03/10/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2013
Date Data Arrived at EDR: 01/24/2014
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 31

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 03/27/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 11/25/2013
Date Data Arrived at EDR: 12/12/2013
Date Made Active in Reports: 02/24/2014
Number of Days to Update: 74

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 03/11/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010
Date Data Arrived at EDR: 10/07/2011
Date Made Active in Reports: 03/01/2012
Number of Days to Update: 146

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 02/25/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/01/2013
Date Data Arrived at EDR: 09/05/2013
Date Made Active in Reports: 10/03/2013
Number of Days to Update: 28

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 03/05/2014
Next Scheduled EDR Contact: 06/16/2014
Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/31/2013
Date Made Active in Reports: 09/13/2013
Number of Days to Update: 44

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 02/26/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 09/29/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 64

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 03/28/2014
Next Scheduled EDR Contact: 07/07/2014
Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 02/24/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 02/24/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 04/29/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 07/20/2011
Date Data Arrived at EDR: 11/10/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 61

Source: Environmental Protection Agency
Telephone: 202-564-5088
Last EDR Contact: 10/09/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 06/01/2013
Date Data Arrived at EDR: 07/17/2013
Date Made Active in Reports: 11/01/2013
Number of Days to Update: 107

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 04/18/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/22/2013
Date Data Arrived at EDR: 08/02/2013
Date Made Active in Reports: 11/01/2013
Number of Days to Update: 91

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 03/10/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 01/09/2014
Date Data Arrived at EDR: 01/10/2014
Date Made Active in Reports: 03/12/2014
Number of Days to Update: 61

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 04/09/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 11/18/2013
Date Data Arrived at EDR: 02/27/2014
Date Made Active in Reports: 03/12/2014
Number of Days to Update: 13

Source: EPA
Telephone: (212) 637-3000
Last EDR Contact: 03/14/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 11/01/2013
Date Data Arrived at EDR: 12/12/2013
Date Made Active in Reports: 02/13/2014
Number of Days to Update: 63

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 02/26/2013
Date Made Active in Reports: 04/19/2013
Number of Days to Update: 52

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 02/28/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Biennially

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 03/07/2014
Date Data Arrived at EDR: 03/12/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 44

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 03/12/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Quarterly

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 02/28/2014
Date Data Arrived at EDR: 03/12/2014
Date Made Active in Reports: 04/29/2014
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 03/12/2014
Next Scheduled EDR Contact: 05/19/2014
Data Release Frequency: Annually

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 01/21/2014
Date Data Arrived at EDR: 01/22/2014
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 20

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 03/17/2014
Next Scheduled EDR Contact: 06/30/2014
Data Release Frequency: Varies

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 02/25/2014
Date Data Arrived at EDR: 02/27/2014
Date Made Active in Reports: 04/04/2014
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

AIRS: Air Emissions Data
Point source emissions inventory data.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 11/01/2013
Date Made Active in Reports: 01/09/2014
Number of Days to Update: 69
Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 04/28/2014
Next Scheduled EDR Contact: 08/11/2014
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING
The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 03/12/2014
Date Data Arrived at EDR: 03/28/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 28
Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 03/24/2014
Next Scheduled EDR Contact: 07/07/2014
Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations
This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34
Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 04/18/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing
The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 03/07/2011
Date Data Arrived at EDR: 03/09/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 54
Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 04/21/2014
Next Scheduled EDR Contact: 08/04/2014
Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing
Financial assurance information.

Date of Government Version: 01/07/2014
Date Data Arrived at EDR: 01/07/2014
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 35
Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List
The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 11/11/2011
Date Data Arrived at EDR: 05/18/2012
Date Made Active in Reports: 05/25/2012
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 02/14/2014
Next Scheduled EDR Contact: 05/26/2014
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 01/29/2013
Date Data Arrived at EDR: 02/14/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 04/04/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 04/15/2013
Date Data Arrived at EDR: 07/03/2013
Date Made Active in Reports: 09/13/2013
Number of Days to Update: 72

Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 04/04/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Quarterly

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 02/06/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 339

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 04/18/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: N/A

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/23/2013
Date Data Arrived at EDR: 11/06/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 30

Source: EPA
Telephone: 202-564-5962
Last EDR Contact: 03/31/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US AIRS MINOR: Air Facility System Data
A listing of minor source facilities.

Date of Government Version: 10/23/2013
Date Data Arrived at EDR: 11/06/2013
Date Made Active in Reports: 12/06/2013
Number of Days to Update: 30

Source: EPA
Telephone: 202-564-5962
Last EDR Contact: 03/31/2014
Next Scheduled EDR Contact: 07/14/2014
Data Release Frequency: Annually

COAL ASH DOE: Sleam-Electric Plan Operation Data
A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 08/07/2009
Date Made Active in Reports: 10/22/2009
Number of Days to Update: 76

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 04/18/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information
All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 02/25/2014
Date Data Arrived at EDR: 02/27/2014
Date Made Active in Reports: 04/09/2014
Number of Days to Update: 41

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 02/14/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Quarterly

Financial Assurance 2: Financial Assurance Information Listing
A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 11/01/2013
Date Data Arrived at EDR: 12/05/2013
Date Made Active in Reports: 02/17/2014
Number of Days to Update: 74

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 02/01/2011
Date Data Arrived at EDR: 10/19/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 83

Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 01/30/2014
Next Scheduled EDR Contact: 05/12/2014
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010
Date Data Arrived at EDR: 01/03/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 77

Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 03/11/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Varies

COAL ASH: Coal Ash Disposal Site Listing
A listing of coal ash disposal site locations.

Date of Government Version: 01/07/2014
Date Data Arrived at EDR: 01/09/2014
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 33

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: Varies

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 06/30/2013
Date Data Arrived at EDR: 08/13/2013
Date Made Active in Reports: 09/13/2013
Number of Days to Update: 31

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 02/10/2014
Next Scheduled EDR Contact: 05/26/2014
Data Release Frequency: Quarterly

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR US Hist Auto Stat: EDR Exclusive Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR US Hist Cleaners: EDR Exclusive Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR US Hist Auto Stat: EDR Proprietary Historic Gas Stations - Cole

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: N/A
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR US Hist Cleaners: EDR Proprietary Historic Dry Cleaners - Cole

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: N/A
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/10/2014
Number of Days to Update: 193

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 02/24/2014
Date Data Arrived at EDR: 02/25/2014
Date Made Active in Reports: 04/01/2014
Number of Days to Update: 35

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 02/05/2014
Next Scheduled EDR Contact: 05/19/2014
Data Release Frequency: Quarterly

Cortland County Storage Tank Listing
A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 02/24/2014
Date Data Arrived at EDR: 02/25/2014
Date Made Active in Reports: 04/01/2014
Number of Days to Update: 35
Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 02/05/2014
Next Scheduled EDR Contact: 05/19/2014
Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 11/20/2013
Date Data Arrived at EDR: 11/22/2013
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 81
Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34
Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 11/04/2013
Next Scheduled EDR Contact: 02/17/2014
Data Release Frequency: Varies

Registered Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 11/20/2013
Date Data Arrived at EDR: 11/22/2013
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 81
Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 04/07/2014
Next Scheduled EDR Contact: 07/21/2014
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34
Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 11/04/2013
Next Scheduled EDR Contact: 02/17/2014
Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database
A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 12/17/2013
Date Data Arrived at EDR: 12/18/2013
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 55
Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 03/10/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Quarterly

Petroleum Bulk Storage Database
A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 12/17/2013
Date Data Arrived at EDR: 12/18/2013
Date Made Active in Reports: 02/11/2014
Number of Days to Update: 55
Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 03/10/2014
Next Scheduled EDR Contact: 06/23/2014
Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database
A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 01/30/2014
Date Data Arrived at EDR: 02/28/2014
Date Made Active in Reports: 04/03/2014
Number of Days to Update: 34
Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 02/18/2014
Next Scheduled EDR Contact: 05/19/2014
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 01/30/2014
Date Data Arrived at EDR: 02/28/2014
Date Made Active in Reports: 04/03/2014
Number of Days to Update: 34
Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 02/18/2014
Next Scheduled EDR Contact: 05/19/2014
Data Release Frequency: No Update Planned

WESTCHESTER COUNTY:

Listing of Storage Tanks
A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 03/18/2014
Date Data Arrived at EDR: 03/20/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 36
Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 11/04/2013
Next Scheduled EDR Contact: 02/17/2014
Data Release Frequency: Varies

Listing of Storage Tanks
A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 03/18/2014
Date Data Arrived at EDR: 03/20/2014
Date Made Active in Reports: 04/25/2014
Number of Days to Update: 36
Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 11/04/2013
Next Scheduled EDR Contact: 02/17/2014
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 07/30/2013
Date Data Arrived at EDR: 08/19/2013
Date Made Active in Reports: 10/03/2013
Number of Days to Update: 45

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 02/21/2014
Next Scheduled EDR Contact: 06/02/2014
Data Release Frequency: Annually

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/19/2012
Date Made Active in Reports: 08/28/2012
Number of Days to Update: 40

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 04/18/2014
Next Scheduled EDR Contact: 07/28/2014
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 07/24/2013
Date Made Active in Reports: 08/19/2013
Number of Days to Update: 26

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 04/21/2014
Next Scheduled EDR Contact: 08/04/2014
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 06/21/2013
Date Made Active in Reports: 08/05/2013
Number of Days to Update: 45

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 02/24/2014
Next Scheduled EDR Contact: 06/09/2014
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 12/30/2013
Date Data Arrived at EDR: 02/11/2014
Date Made Active in Reports: 03/11/2014
Number of Days to Update: 28

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 04/21/2014
Next Scheduled EDR Contact: 08/04/2014
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 08/09/2013
Date Made Active in Reports: 09/27/2013
Number of Days to Update: 49

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 03/17/2014
Next Scheduled EDR Contact: 06/30/2014
Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: Rextag Strategies Corp.
Telephone: (281) 769-2247
U.S. Electric Transmission and Power Plants Systems Digital GIS Data

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers
Source: Department of Health
Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)
Source: United States Geologic Survey
A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

HUNTS POINT
HUNTS POINT
BRONX, NY 10474

TARGET PROPERTY COORDINATES

Latitude (North):	40.8024926701848 - 40° 48' 8.97''
Longitude (West):	73.87419220044 - 73° 52' 27.09''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	594967.7
UTM Y (Meters):	4517230.5
Elevation:	17 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	40073-G7 FLUSHING, NY
Most Recent Revision:	1995
West Map:	40073-G8 CENTRAL PARK, NY NJ
Most Recent Revision:	1995

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General South

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

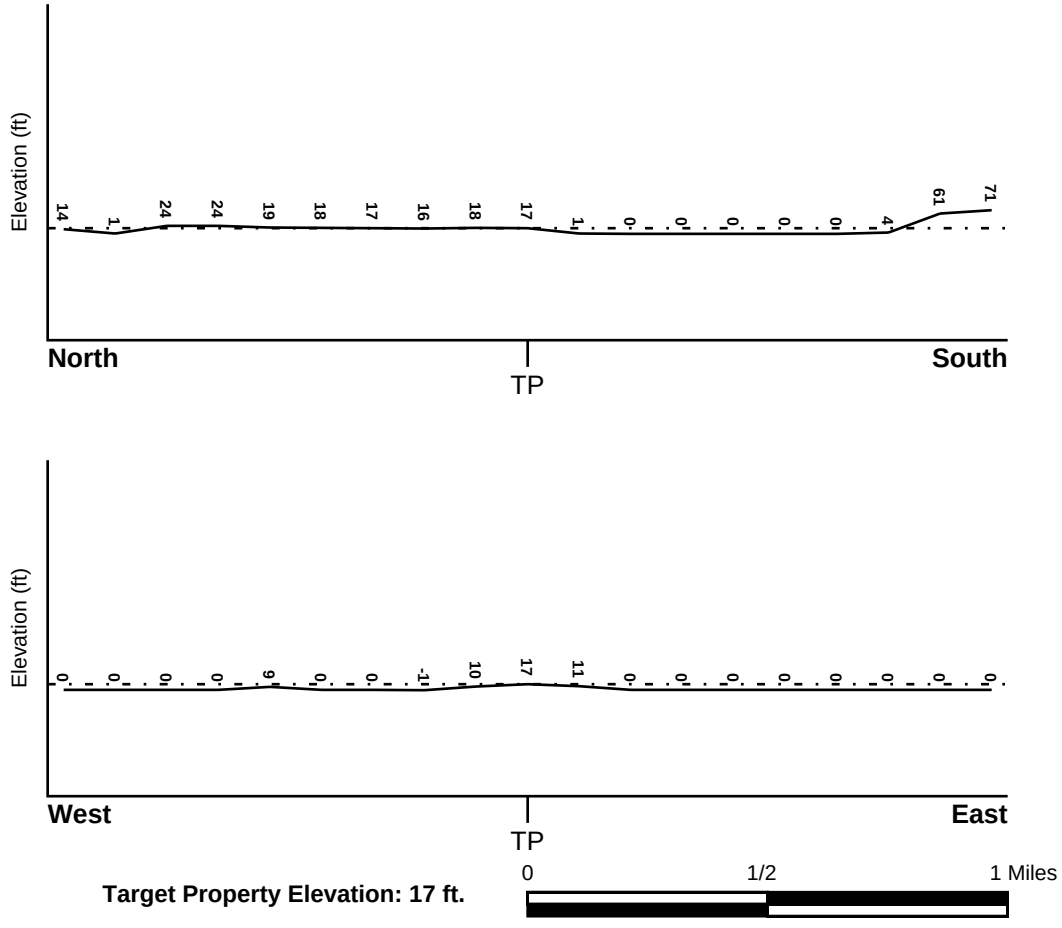

Target Property Elevation: 17 ft.

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County	FEMA Flood Electronic Data
BRONX, NY	YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 360497 - FEMA DFIRM Flood data

Additional Panels in search area: Not Reported

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
FLUSHING	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
Not Reported		

* ©1996 Site−specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT **GEOLOGIC AGE IDENTIFICATION**

Era:	Paleozoic	Category:	Stratified Sequence
System:	Ordovician		
Series:	Middle Ordovician (Mohawkian)		
Code:	O2 *(decoded above as Era, System & Series)*		

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
	Boundary			Classification			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: silt loam
loamy sand
sandy loam
fine sandy loam

Surficial Soil Types: silt loam
loamy sand
sandy loam
fine sandy loam

Shallow Soil Types: sandy loam

Deeper Soil Types: unweathered bedrock
very gravelly - loamy sand
stratified
sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	0.250
Federal FRDS PWS	Nearest PWS within 0.250 miles
State Database	0.250

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No Wells Found		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP

No PWS System Found

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP

No Wells Found

PHYSICAL SETTING SOURCE MAP - 3929425.2s

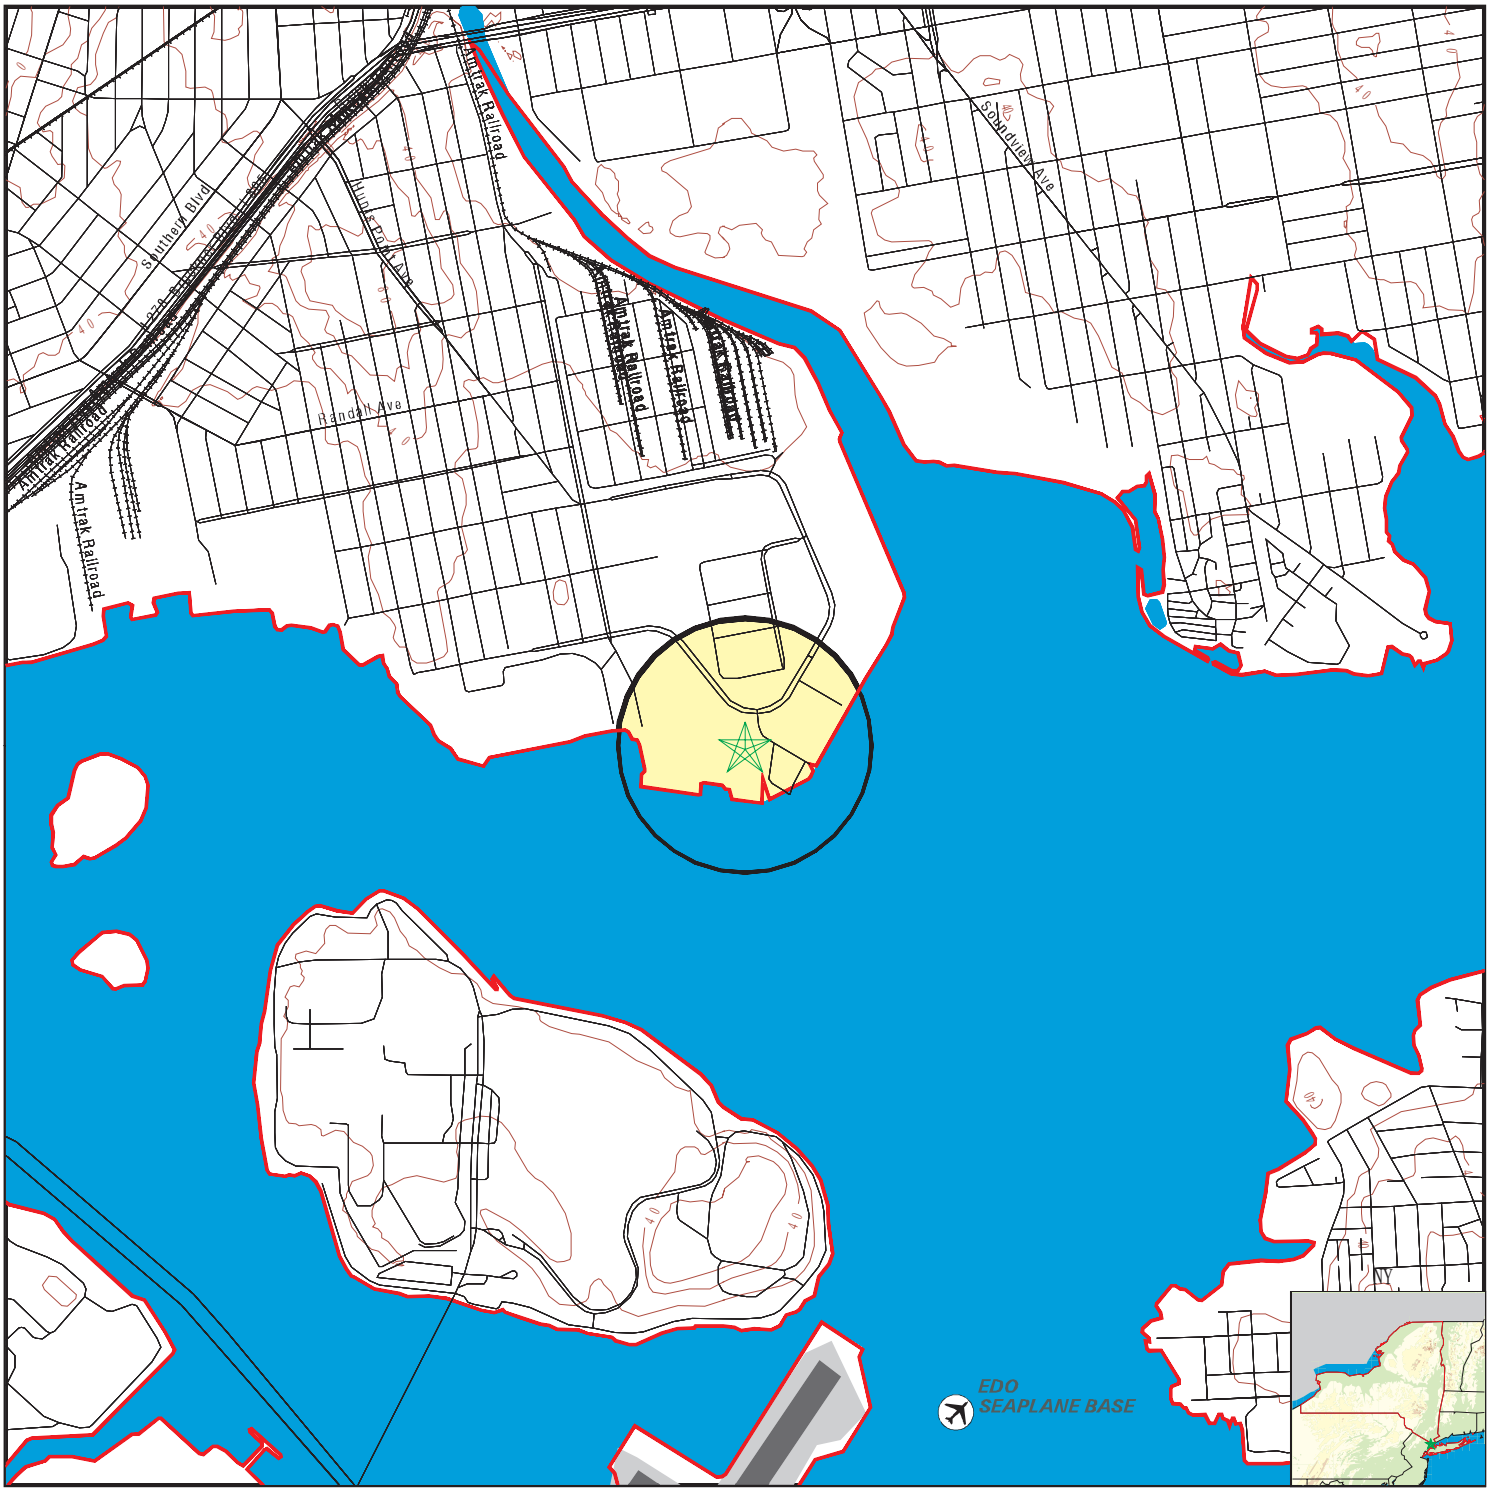

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- GI Indeterminate Groundwater Flow at Location
- GV Groundwater Flow Varies at Location
- HD Closest Hydrogeological Data
- Oil, gas or related wells

SITE NAME:	Hunts Point	CLIENT:	STV Inc.
ADDRESS:	Hunts Point Bronx NY 10474	CONTACT:	Doug Glorie
		INQUIRY #:	3929425.2s
LAT/LONG:	40.8024926701848 / 73.8741922004371	DATE:	May 02, 2014 8:54 am

Copyright © 2014 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

Federal EPA Radon Zone for BRONX County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for BRONX COUNTY, NY

Number of sites tested: 31

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	0.670 pCi/L	96%	4%	0%
Basement	1.110 pCi/L	42%	58%	0%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)
Source: United States Geologic Survey
A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Services
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells
Source: New York Department of Health
Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database
Department of Environmental Conservation
Telephone: 518-402-8072
These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon
Source: Department of Health
Telephone: 518-402-7556
Radon Test Results

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Maspeth Expansion - Cross Harbor
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Inquiry Number: 3164153.12
September 12, 2011

The EDR-City Directory Abstract

Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1922 through 2005. This report compiles information gathered in this review by geocoding the latitude and longitude of properties identified and gathering information about properties within 100 feet of the target property.

A summary of the information obtained is provided in the text of this report.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

Year	*Source*	*TP*	*Adjoining*	*Text Abstract*	*Source Image*
2005	Hill-Donnelly Information Services	-	X	X	-
2000	Cole Information Services	-	X	X	-
1996	NYNEX	-	-	-	-
1991	NYNEX Information Resource Company	-	X	X	-
1983	New York Telephone	-	X	X	-
1976	New York Telephone	-	X	X	-
1970	New York Telephone	-	X	X	-
1967	New York Telephone	-	X	X	-
1962	New York Telephone Directory	-	-	-	-
1950	New York Telephone	-	-	-	-
1945	New York Telephone	-	-	-	-
1939	New York Telephone Company	-	-	-	-
1934	R. L. Polk Co.	-	-	-	-
1922	The Metropolitan Directory Co.	-	-	-	-

FINDINGS

TARGET PROPERTY INFORMATION

ADDRESS

Maspeth Avenue / Rust Street
Maspeth, NY 11378

FINDINGS DETAIL

Target Property research detail.

No Addresses Found

FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

49TH ST

5671 49TH ST

Year	Uses	Source
1991	Manhattan & Bronx Lodge	NYNEX Information Resource Company
	MANHATTAN BRASS & COPPER CO INC	NYNEX Information Resource Company
	Manhattan Aluminum Corp	NYNEX Information Resource Company
	Edelman Sydney P	NYNEX Information Resource Company
1983	Manhattan Aluminum Corp	New York Telephone
	Edelman Sydney P	New York Telephone
	MANHATTAN BRASS & COPPER CO INC	New York Telephone
1976	Edelman Sydney P	New York Telephone
1970	MANHATN BRASS & COPPER CO INC	New York Telephone
	MANHATH ALUMINUM CORP	New York Telephone
	Edelman Sydney P	New York Telephone
1967	Manhatn Brass & Copper Co Inc	New York Telephone
	Manhatn Aluminum Corp	New York Telephone
	Edelman Sydney P	New York Telephone

5672 49TH ST

Year	Uses	Source
1991	Warehouse	NYNEX Information Resource Company
1983	Leviton Mfg Co Inc	New York Telephone
	Leviton Mfg Co	New York Telephone
1976	Leviton Mfs Co Inc	New York Telephone
1970	Leviton Mfg Co Inc	New York Telephone
	Colony Dstrbtrs Inc	New York Telephone
1967	NY Delivry & Rentl Corp truk rentl	New York Telephone
	NY Piano Delivry Co	New York Telephone
	M & L Co ofc	New York Telephone
	Beegee Transptn Corp	New York Telephone
	Max Louis Co Inc piano movrs	New York Telephone

FINDINGS

5675 49TH ST

Year	Uses	Source
2005	El Dorado Coffee Distributors	Hill-Donnelly Information Services
	Tyrone Import Inc 10 o	Hill-Donnelly Information Services
	WBLaw&Son	Hill-Donnelly Information Services
1991	Armen Dstrbtrs Inc	NYNEX Information Resource Company
1983	Armen Dstrbtrs Inc	New York Telephone
	Itzkowitz J Inc	New York Telephone
1970	Whirlaway Warehousing Inc	New York Telephone
	Ocean Cargo Warehouse & Container Station Inc	New York Telephone
	Domel Trucking & Warehousing	New York Telephone

5685 49TH ST

Year	Uses	Source
2005	Benjo General Trucking Inc	Hill-Donnelly Information Services
	Maspeth Exhibit Terminal Inc	Hill-Donnelly Information Services
2000	Fentech Inc	Cole Information Services
	Benjo Gen Trckng	Cole Information Services
	57TH AV INTS FROM	Cole Information Services
	Maspeth Exhbt Inc	Cole Information Services
1983	Hemingway Transport Inc	New York Telephone
1976	JOHNSON MOTOR LINES INC	New York Telephone
1970	JOHNSON MOTOR LINES SYSTEM	New York Telephone

FINDINGS

TARGET PROPERTY: ADDRESS NOT IDENTIFIED IN RESEARCH SOURCE

The following Target Property addresses were researched for this report, and the addresses were not identified in the research source.

Address Researched	Address Not Identified in Research Source
Maspeth Avenue / Rust Street	2005, 2000, 1996, 1991, 1983, 1976, 1970, 1967, 1962, 1950, 1945, 1939, 1934, 1922

ADJOINING PROPERTY: ADDRESSES NOT IDENTIFIED IN RESEARCH SOURCE

The following Adjoining Property addresses were researched for this report, and the addresses were not identified in research source.

Address Researched	Address Not Identified in Research Source
5671 49TH ST	2005, 2000, 1996, 1962, 1950, 1945, 1939, 1934, 1922
5672 49TH ST	2005, 2000, 1996, 1962, 1950, 1945, 1939, 1934, 1922
5675 49TH ST	2000, 1996, 1976, 1967, 1962, 1950, 1945, 1939, 1934, 1922
5685 49TH ST	1996, 1991, 1967, 1962, 1950, 1945, 1939, 1934, 1922

Maspeth Expansion - Cross Harbor
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Inquiry Number: 3164153.2s
September 12, 2011

The EDR Radius Map™ Report with GeoCheck®

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	7
Orphan Summary	943
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-7
Physical Setting Source Map Findings	A-8
Physical Setting Source Records Searched	A-11

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

MASPETH AVENUE / RUST STREET
MASPETH, NY 11378

COORDINATES

Latitude (North):	40.725100 - 40° 43' 30.4''
Longitude (West):	73.919500 - 73° 55' 10.2''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	591251.4
UTM Y (Meters):	4508591.5
Elevation:	11 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	40073-F8 BROOKLYN, NY
Most Recent Revision:	1995

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	2006, 2008
Source:	USDA

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL ---------- National Priority List

EXECUTIVE SUMMARY

Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL ---------- National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY ---------- Federal Facility Site Information listing

Federal CERCLIS NFRAP site List

CERC-NFRAP ---------- CERCLIS No Further Remedial Action Planned

Federal RCRA CORRACTS facilities list

CORRACTS ---------- Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Federal institutional controls / engineering controls registries

US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROL ---------- Sites with Institutional Controls

State- and tribal - equivalent CERCLIS

VAPOR REOPENED ---------- Vapor Intrusion Legacy Site List

State and tribal leaking storage tank lists

INDIAN LUST ---------- Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

TANKS ---------- Storage Tank Faciliy Listing
CBS UST ---------- Chemical Bulk Storage Database
MOSF UST ---------- Major Oil Storage Facilities Database
CBS AST ---------- Chemical Bulk Storage Database
MOSF AST ---------- Major Oil Storage Facilities Database
MOSF ---------- Major Oil Storage Facility Site Listing
INDIAN UST ---------- Underground Storage Tanks on Indian Land
FEMA UST ---------- Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

ENG CONTROLS ---------- Registry of Engineering Controls
INST CONTROL ---------- Registry of Institutional Controls
RES DECL ---------- Restrictive Declarations Listing

State and tribal voluntary cleanup sites

INDIAN VCP ---------- Voluntary Cleanup Priority Listing

EXECUTIVE SUMMARY

State and tribal Brownfields sites

BROWNFIELDS ---------- Brownfields Site List

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS ---------- A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

ODI ---------- Open Dump Inventory
DEBRIS REGION 9 ---------- Torres Martinez Reservation Illegal Dump Site Locations
SWTIRE ---------- Registered Waste Tire Storage & Facility List
INDIAN ODI ---------- Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL ---------- Clandestine Drug Labs
DEL SHWS ---------- Delisted Registry Sites
US HIST CDL ---------- National Clandestine Laboratory Register

Local Land Records

LIENS 2 ---------- CERCLA Lien Information
LUCIS ---------- Land Use Control Information System

Other Ascertainable Records

DOT OPS ---------- Incident and Accident Data
DOD ---------- Department of Defense Sites
FUDS ---------- Formerly Used Defense Sites
CONSENT ---------- Superfund (CERCLA) Consent Decrees
ROD ---------- Records Of Decision
UMTRA ---------- Uranium Mill Tailings Sites
MINES ---------- Mines Master Index File
TRIS ---------- Toxic Chemical Release Inventory System
TSCA ---------- Toxic Substances Control Act
MLTS ---------- Material Licensing Tracking System
RADINFO ---------- Radiation Information Database
RAATS ---------- RCRA Administrative Action Tracking System
HSWDS ---------- Hazardous Substance Waste Disposal Site Inventory
UIC ---------- Underground Injection Control Wells
DRYCLEANERS ---------- Registered Drycleaners
NPDES ---------- State Pollutant Discharge Elimination System
AIRS ---------- Air Emissions Data
E DESIGNATION ---------- E DESIGNATION SITE LISTING
INDIAN RESERV ---------- Indian Reservations
SCRD DRYCLEANERS ---------- State Coalition for Remediation of Drycleaners Listing
PCB TRANSFORMER ---------- PCB Transformer Registration Database
COAL ASH EPA ---------- Coal Combustion Residues Surface Impoundments List
COAL ASH ---------- Coal Ash Disposal Site Listing

EXECUTIVE SUMMARY

COAL ASH DOE..... Sleam-Electric Plan Operation Data

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants..... EDR Proprietary Manufactured Gas Plants
EDR Historical Auto Stations.. EDR Proprietary Historic Gas Stations
EDR Historical Cleaners..... EDR Proprietary Historic Dry Cleaners

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS list

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 02/25/2011 has revealed that there is 1 CERCLIS site within approximately 0.189 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
PHELPS DODGE REFINING CORP	***42-02 56TH RD***	***0 - 1/8 (0.000 mi.)***	***A4***	***13***

Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity

generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/15/2011 has revealed that there are 4 RCRA-LQG sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON - MANHOLE 288	56 RD & 50 ST	N 0 - 1/8 (0.007 mi.)	K300	297
CON EDISON - MASPETH FORMER SU	***57-77 RUST STREET***	***SSE 0 - 1/8 (0.119 mi.)***	***Y406***	***542***
CON EDISON - MANHOLE 168	43-01 43 ST & 55 AVE	NNE 1/8 - 1/4 (0.177 mi.)	AE537	822

Lower Elevation	Address	Direction / Distance	Map ID	Page
PHELPS DODGE REFINING CORP	***42-02 56TH RD***	***0 - 1/8 (0.000 mi.)***	***A4***	***13***

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/15/2011 has revealed that there are 5 RCRA-SQG sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
UNITED PARCEL SERVICE	***46-05 56TH RD***	***NNE 0 - 1/8 (0.003 mi.)***	***I139***	***182***
CONWAY CENTRAL EXPRESS	***49-15 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z432***	***609***
ELECTRONICS PLATING CORP	***58-15 57TH DR***	***ESE 1/8 - 1/4 (0.157 mi.)***	***AI476***	***741***
UNITED PARCEL SERVICE	***43-22 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AE542***	***836***
S & L METAL PRODUCTS	***58-29 57TH DR***	***ESE 1/8 - 1/4 (0.184 mi.)***	***AI549***	***883***

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 06/15/2011 has revealed that there are 2 RCRA-CESQG sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
VIACOM	***49-29 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***AA423***	***585***
CON EDISON	LAUREL HILL BLVD & REVI	NW 1/8 - 1/4 (0.152 mi.)	AG468	724

Federal ERNS list

ERNS: The Emergency Response Notification System records and stores information on reported releases of oil and hazardous substances. The source of this database is the U.S. EPA.

A review of the ERNS list, as provided by EDR, and dated 04/05/2011 has revealed that there are 2

ERNS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
15 RAIL ROAD PL	15 RAIL ROAD PL	SSW 0 - 1/8 (0.026 mi.)	C319	374
43RD STREET & 56 ROAD / LONG I	43RD STREET & 56 ROAD /	NNE 0 - 1/8 (0.060 mi.)	R349	439

State- and tribal - equivalent CERCLIS

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the SHWS list, as provided by EDR, and dated 07/12/2011 has revealed that there is 1 SHWS site within approximately 0.189 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
PHELPS DODGE REFINING CORPORAT	42-02 56TH ROAD	0 - 1/8 (0.000 mi.)	A1	7

Class Code: Significant threat to the public health or environment - action required.

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the SWF/LF list, as provided by EDR, and dated 07/11/2011 has revealed that there are 6 SWF/LF sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
EVANS CONTAINER CORP.	1880 19 AVENUE	0 - 1/8 (0.000 mi.)	C9	58
WASTE MANAGEMENT OF NY;LLC (75	***75 THOMAS ST.;(485 SCOT***	***WSW 0 - 1/8 (0.086 mi.)***	***V360***	***456***
WASTE MANAGEMENT NY (BQE	***485 SCOTT AVENUE***	***WSW 0 - 1/8 (0.086 mi.)***	***V364***	***465***
R.A.W. TIRES INC.	57-77 RUST STREET	SSE 0 - 1/8 (0.119 mi.)	Y411	560
MASPETH RECYCLING CIPICO	58-08 48 STREET	SSW 1/8 - 1/4 (0.184 mi.)	AK555	907

Lower Elevation	Address	Direction / Distance	Map ID	Page
GALASSO TRUCKING; INC.	***2 GALASSO PLACE***	***ESE 0 - 1/8 (0.005 mi.)***	***E294***	***284***

State and tribal leaking storage tank lists

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 07/05/2011 has revealed that there are 17

EXECUTIVE SUMMARY

LTANKS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CLOSED-LACKOF RECENT INFO Date Closed: 3/5/2003	***56071 49TH STREET***	***0 - 1/8 (0.000 mi.)***	***B18***	***79***
55-04 MASPETH AVE Date Closed: 5/11/2004	***55-04 MASPETH AVE***	***WSW 0 - 1/8 (0.009 mi.)***	***F305***	***307***
58-50 57TH RD/NYC DOT Date Closed: 6/14/1995	***58-50 57TH RD/NYC DOT***	***SE 0 - 1/8 (0.039 mi.)***	***N325***	***387***
NYCDOT MASPETH SIGN SHOP Date Closed: 6/14/1995	***58-50 57TH RD/DOT GARAG***	***SE 0 - 1/8 (0.039 mi.)***	***N326***	***390***
GAS STATION Date Closed: 3/8/2007	57-59 MASPETH AVE	ENE 0 - 1/8 (0.074 mi.)	U359	455
WALLACE PACKAGING CORP Date Closed: 3/25/1991	***57-01 49TH ST***	***SE 0 - 1/8 (0.105 mi.)***	***W392***	***506***
1 RAILROAD PL/QUEENS Date Closed: 3/4/2003	***1 RAILROAD PLACE***	***SSW 0 - 1/8 (0.106 mi.)***	***Z395***	***512***
57-15 49TH ST Date Closed: 6/18/2004	***57-15 49TH ST***	***SSE 0 - 1/8 (0.122 mi.)***	***W419***	***577***
COMMERCIAL Date Closed: 7/28/2003	49-15 MASPETH AV	SSW 0 - 1/8 (0.124 mi.)	Z427	594
CCX RAILROAD Date Closed: 3/6/2006	***49-15 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z437***	***636***
WASTE MANAG. Date Closed: 8/29/2006	475 SCOTT AVE	WSW 1/8 - 1/4 (0.127 mi.)	V451	680
58-24 MAURICE Date Closed: 9/1/2005	58-24 MAURICE AV	ENE 1/8 - 1/4 (0.145 mi.)	X457	697
39-90 REVIEW AVENUE Date Closed: 3/28/1995	***39-90 REVIEW AVENUE***	***WNW 1/8 - 1/4 (0.165 mi.)***	***AG523***	***783***

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported Date Closed: 9/3/2003	***57-01 49TH ST***	***0 - 1/8 (0.000 mi.)***	***B17***	***76***
1 RAILROAD PL AKA Date Closed: 4/8/2004	***2 GALASSO PLACE***	***ESE 0 - 1/8 (0.005 mi.)***	***E292***	***278***
49-40 MASPETH AVE/PRESTON Date Closed: 8/2/1991	***49-40 MASPETH AVE/PREST***	***S 0 - 1/8 (0.048 mi.)***	***O330***	***401***
Not reported Date Closed: 2/24/2003	***5703 48TH ST***	***SSW 0 - 1/8 (0.058 mi.)***	***O342***	***425***

HIST LTANKS: A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database.

A review of the HIST LTANKS list, as provided by EDR, and dated 01/01/2002 has revealed that there

are 14 HIST LTANKS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CLOSED-LACKOF RECENT INFO Date Closed: / /	***56071 49TH STREET***	***0 - 1/8 (0.000 mi.)***	***B18***	***79***
46-05 56TH RD/UPS Date Closed: / /	46005 56TH RD/UPS	0 - 1/8 (0.000 mi.)	D27	108
55-04 MASPETH AVE Date Closed: / /	***55-04 MASPETH AVE***	***WSW 0 - 1/8 (0.009 mi.)***	***F305***	***307***
NEW STYLE WASTE Date Closed: / /	***3 RAILROAD PL***	***SSW 0 - 1/8 (0.009 mi.)***	***C308***	***331***
58-50 57TH RD/NYC DOT Date Closed: 06/14/95	***58-50 57TH RD/NYC DOT***	***SE 0 - 1/8 (0.039 mi.)***	***N325***	***387***
NYCDOT MASPETH SIGN SHOP Date Closed: 06/14/95	***58-50 57TH RD/DOT GARAG***	***SE 0 - 1/8 (0.039 mi.)***	***N326***	***390***
WALLACE PACKAGING CORP Date Closed: 03/25/91	***57-01 49TH ST***	***SE 0 - 1/8 (0.105 mi.)***	***W392***	***506***
1 RAILROAD PL/QUEENS Date Closed: / /	***1 RAILROAD PLACE***	***SSW 0 - 1/8 (0.106 mi.)***	***Z395***	***512***
57-15 49TH ST Date Closed: / /	***57-15 49TH ST***	***SSE 0 - 1/8 (0.122 mi.)***	***W419***	***577***
CCX RAILROAD Date Closed: / /	***49-15 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z437***	***636***
39-90 REVIEW AVENUE Date Closed: 03/28/95	***39-90 REVIEW AVENUE***	***WNW 1/8 - 1/4 (0.165 mi.)***	***AG523***	***783***

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported Date Closed: / /	***57-01 49TH ST***	***0 - 1/8 (0.000 mi.)***	***B17***	***76***
1 RAILROAD PL AKA Date Closed: / /	***2 GALASSO PLACE***	***ESE 0 - 1/8 (0.005 mi.)***	***E292***	***278***
49-40 MASPETH AVE/PRESTON Date Closed: 08/02/91	***49-40 MASPETH AVE/PREST***	***S 0 - 1/8 (0.048 mi.)***	***O330***	***401***

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 07/05/2011 has revealed that there are 43 UST sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PJL REALTY CORP.	***56-72 49TH PLACE***	***0 - 1/8 (0.000 mi.)***	***B6***	***52***
ELDORADO COFFEE, LTD	***56-75 49TH STREET***	***0 - 1/8 (0.000 mi.)***	***B10***	***59***
GALASSO TRUCKING, INC.	***1 RAILROAD PLACE (49TH***	***0 - 1/8 (0.000 mi.)***	***C20***	***83***
56-01 MASPETH AVENUE	56-01 MASPETH AVENUE	0 - 1/8 (0.000 mi.)	F22	91

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PEPSI-COLA/CANADA DRY	***50-35 56TH ROAD***	***0 - 1/8 (0.000 mi.)***	***G25***	***94***
UNITED PARCEL SERVICE	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I223	215
S.B. THOMAS, INC	***56-07 48TH STREET***	***N 0 - 1/8 (0.005 mi.)***	***J269***	***251***
MARLBORO ELEMENTARY SCHOOL	***RTE 9W***	***NNE 0 - 1/8 (0.005 mi.)***	***H273***	***262***
BORO-WIDE RECYCLING CORP.	***3 RAILROAD PLACE***	***SSW 0 - 1/8 (0.009 mi.)***	***C307***	***317***
CERRO WIRE & CABLE CO	***5500 MASPETH AVE***	***WSW 0 - 1/8 (0.013 mi.)***	***F311***	***343***
BRADCO SUPPLY CORPORATION	***7 RAILROAD PLACE***	***SSW 0 - 1/8 (0.014 mi.)***	***C314***	***366***
PHELPS DODGE LAUREL HILL SITE	40-02 56TH ROAD	NNE 0 - 1/8 (0.054 mi.)	M338	416
THE CATALANO CO	***34-02 LAUREL HILL BOULE***	***NNW 0 - 1/8 (0.070 mi.)***	***T354***	***444***
LEHIGH CARTING CO INC	***485 SCOTT AVE***	***WSW 0 - 1/8 (0.086 mi.)***	***V361***	***458***
WASTE MANAGEMENT OF NEW YORK,	485 SCOTT AVENUE	WSW 0 - 1/8 (0.086 mi.)	V367	472
ACME SKILLMAN CONCRETE CO. INC	***56-22 58TH STREET***	***ENE 0 - 1/8 (0.099 mi.)***	***X370***	***479***
P-I-E NATIONWIDE INC VACANT TR	***500 SCOTT AVE***	***WSW 0 - 1/8 (0.104 mi.)***	***V388***	***493***
ROSENTHOL WINE	56-43 58TH STREET	ENE 0 - 1/8 (0.111 mi.)	X398	518
58-75 MAURICE AVE	58-75 MAURICE AVENUE	ENE 0 - 1/8 (0.112 mi.)	X401	529
DRY ICE CORP	34-52 LAUREL HILL BLVD	NW 0 - 1/8 (0.120 mi.)	414	569
MASPETH	57-15 49TH STREET	SSE 0 - 1/8 (0.122 mi.)	W420	583
CON-WAY FREIGHT-XBY	***49-15 MASPETH AVENUE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z431***	***599***
PRESTON TRUCKING COMPANY	***49-40 MASPETH AVENUE***	***SSW 0 - 1/8 (0.125 mi.)***	***Z440***	***639***
CBS OUTDOOR INC	49-29 MASPETH AVENUE	SSW 1/8 - 1/4 (0.126 mi.)	AA446	664
NABISCO	***58-19 MASPETH AVENUE***	***E 1/8 - 1/4 (0.132 mi.)***	***AD452***	***681***
VIKING CRITERION	***55-30 46TH STREET***	***NNE 1/8 - 1/4 (0.135 mi.)***	***454***	***688***
RIDGEWOOD ART WOODCRAFT INC	58-24 MAURICE AVENUE	ENE 1/8 - 1/4 (0.145 mi.)	X458	699
ALLMANDINGER PROPERTIES, INC.	***55-15 43RD STREET***	***NNE 1/8 - 1/4 (0.146 mi.)***	***AE462***	***705***
GEYSER REALTY LLC	57-65 48TH STREET	SSW 1/8 - 1/4 (0.156 mi.)	AB471	728
CANOVER INDUSTRIES, INC.	***57-65 48TH STREET***	***SSW 1/8 - 1/4 (0.156 mi.)***	***AB472***	***730***
GEYSER REALTY LLC	***57-65 48TH STREET***	***SSW 1/8 - 1/4 (0.156 mi.)***	***AB473***	***734***
YELLOW TRANSPORTATION (QNS)	***57-54 PAGE PLACE***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ518***	***770***
CANOVER INDASTIES , INC	***57-85 48TH ST***	***SSW 1/8 - 1/4 (0.169 mi.)***	***AK527***	***787***
COYNE FAMILY SERV STA INC	***58-09 RUST ST***	***SSE 1/8 - 1/4 (0.170 mi.)***	***AH531***	***795***
NEWTOWN CREEK PLANT	33-05 LAUREL HILL BLVD	NNE 1/8 - 1/4 (0.171 mi.)	AL533	804
TRIBORO PLATERS INC	***44-11 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AM538***	***823***
DSNY QUEENS DISTRICT 5A GARAGE	***58-02 48TH STREET***	***SSW 1/8 - 1/4 (0.180 mi.)***	***AK544***	***862***
CIPICO CONSTRUCTION, INC.	***58-08 48TH STREET***	***SSW 1/8 - 1/4 (0.184 mi.)***	***AK554***	***902***
DUANE READE DISTRIBUTION CENTE	***50-02 55TH AVE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN560***	***920***
E GREENE & CO, INC	***57-00 49 ST***	***S 1/8 - 1/4 (0.187 mi.)***	***AO565***	***932***
57-00 49TH STREET	***57-00 49TH STREET***	***S 1/8 - 1/4 (0.187 mi.)***	***AO566***	***936***

Lower Elevation	Address	Direction / Distance	Map ID	Page
BEN-JO GENERAL TRUCKING, INC.	***56-85 49TH STREET (1 RA***	***0 - 1/8 (0.000 mi.)***	***B5***	***37***
DAVIS & WARSHOW	***57-22 49TH ST***	***0 - 1/8 (0.000 mi.)***	***E13***	***65***

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the AST list, as provided by EDR, and dated 07/05/2011 has revealed that there are 10 AST sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
UNITED PARCEL SERVICE	***46-05 56TH ROAD***	***NNE 0 - 1/8 (0.003 mi.)***	***I56***	***125***
BORO-WIDE RECYCLING CORP.	3 RAILROAD PLACE	SSW 0 - 1/8 (0.009 mi.)	C306	312
WASTE MANAGEMENT OF NEW YORK,	485 SCOTT AVENUE	WSW 0 - 1/8 (0.086 mi.)	V366	468
WALLACE PACKAGING CORP	***57-01 49TH ST***	***SE 0 - 1/8 (0.105 mi.)***	***W391***	***500***

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
58-75 MAURICE AVE	58-75 MAURICE AVENUE	ENE 0 - 1/8 (0.112 mi.)	X400	525
PRESTON TRUCKING COMPANY	***49-40 MASPETH AVENUE***	***SSW 0 - 1/8 (0.125 mi.)***	***Z440***	***639***
CBS OUTDOOR INC	49-29 MASPETH AVENUE	SSW 1/8 - 1/4 (0.126 mi.)	AA447	670
NEWTOWN CREEK PLANT	***33-05 LAUREL HILL BLVD***	***NNE 1/8 - 1/4 (0.171 mi.)***	***AL534***	***809***
UNITED PARCEL SERVICE	***43-22 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AE542***	***836***

Lower Elevation	Address	Direction / Distance	Map ID	Page
BEN-JO GENERAL TRUCKING, INC.	***56-85 49TH STREET (1 RA***	***0 - 1/8 (0.000 mi.)***	***B5***	***37***

CBS: These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

A review of the CBS list, as provided by EDR, and dated 07/05/2011 has revealed that there is 1 CBS site within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
DUANE READE DISTRIBUTION CENTE	***50-02 55TH AVE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN560***	***920***

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the VCP list, as provided by EDR, and dated 07/12/2011 has revealed that there is 1 VCP site within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MASPETH SUBSTATION	57-77 RUST STREET	SSE 0 - 1/8 (0.119 mi.)	Y405	541

State and tribal Brownfields sites

ERP: In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

A review of the ERP list, as provided by EDR, and dated 07/12/2011 has revealed that there is 1 ERP site within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MASPETH PROJECT	57-15 49TH STREET	SSE 0 - 1/8 (0.122 mi.)	W418	576

EXECUTIVE SUMMARY

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

Registered Recycling Facility List from the Department of Environmental Conservation.

A review of the SWRCY list, as provided by EDR, and dated 07/11/2011 has revealed that there are 5 SWRCY sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NEW STYLE WASTE	***3 RAILROAD PL***	***SSW 0 - 1/8 (0.009 mi.)***	***C308***	***331***
WASTE MANAGEMENT OF NY;LLC (75	***75 THOMAS ST.;(485 SCOT***	***WSW 0 - 1/8 (0.086 mi.)***	***V360***	***456***
WASTE MANAGEMENT NY (BQE	***485 SCOTT AVENUE***	***WSW 0 - 1/8 (0.086 mi.)***	***V364***	***465***
TREASURE ISLAND RECOVERY	55-06 43RD STREET	NNE 1/8 - 1/4 (0.164 mi.)	AE522	783

Lower Elevation	Address	Direction / Distance	Map ID	Page
GALASSO TRUCKING; INC.	***2 GALASSO PLACE***	***ESE 0 - 1/8 (0.005 mi.)***	***E294***	***284***

Local Lists of Registered Storage Tanks

HIST UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the HIST UST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 40 HIST UST sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PJL REALTY CORP.	***56-72 49TH PLACE***	***0 - 1/8 (0.000 mi.)***	***B6***	***52***
ELDORADO COFFEE, LTD	***56-75 49TH STREET***	***0 - 1/8 (0.000 mi.)***	***B10***	***59***
GALASSO TRUCKING, INC.	***1 RAILROAD PLACE (49TH***	***0 - 1/8 (0.000 mi.)***	***C20***	***83***
56-01 MASPETH AVENUE	56-01 MASPETH AVENUE	0 - 1/8 (0.000 mi.)	F21	89
PEPSI-COLA/CANADA DRY	***50-35 56TH ROAD***	***0 - 1/8 (0.000 mi.)***	***G25***	***94***
UNITED PARCEL SERVICE	***46-05 56TH ROAD***	***NNE 0 - 1/8 (0.003 mi.)***	***I56***	***125***
S.B. THOMAS, INC	***56-07 48TH STREET***	***N 0 - 1/8 (0.005 mi.)***	***J269***	***251***
MARLBORO ELEMENTARY SCHOOL	***RTE 9W***	***NNE 0 - 1/8 (0.005 mi.)***	***H273***	***262***
BORO-WIDE RECYCLING CORP.	***3 RAILROAD PLACE***	***SSW 0 - 1/8 (0.009 mi.)***	***C307***	***317***
CERRO WIRE & CABLE CO	***5500 MASPETH AVE***	***WSW 0 - 1/8 (0.013 mi.)***	***F311***	***343***
BRADCO SUPPLY CORPORATION	***7 RAILROAD PLACE***	***SSW 0 - 1/8 (0.014 mi.)***	***C314***	***366***
THE CATALANO CO	***34-02 LAUREL HILL BOULE***	***NNW 0 - 1/8 (0.070 mi.)***	***T354***	***444***
LEHIGH CARTING CO INC	***485 SCOTT AVE***	***WSW 0 - 1/8 (0.086 mi.)***	***V361***	***458***
ACME SKILLMAN CONCRETE CO. INC	***56-22 58TH STREET***	***ENE 0 - 1/8 (0.099 mi.)***	***X370***	***479***
P-I-E NATIONWIDE INC VACANT TR	***500 SCOTT AVE***	***WSW 0 - 1/8 (0.104 mi.)***	***V388***	***493***
WALLACE PACKAGING CORP	***57-01 49TH ST***	***SE 0 - 1/8 (0.105 mi.)***	***W391***	***500***
SCHEDULED TRUCKING	58-75 MAURICE AVENUE	ENE 0 - 1/8 (0.112 mi.)	X399	521
CON-WAY FREIGHT-XBY	***49-15 MASPETH AVENUE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z431***	***599***
PRESTON TRUCKING COMPANY	***49-40 MASPETH AVENUE***	***SSW 0 - 1/8 (0.125 mi.)***	***Z440***	***639***
TRANSPORTATION DISPLAYS INC.	49-29 MASPETH AVENUE	SSW 1/8 - 1/4 (0.126 mi.)	AA445	660
WASTE MANAGEMENT OF NEW YORK,	***475 SCOTT AVENUE AKA***	***WSW 1/8 - 1/4 (0.127 mi.)***	***V450***	***676***
NABISCO	***58-19 MASPETH AVENUE***	***E 1/8 - 1/4 (0.132 mi.)***	***AD452***	***681***
VIKING CRITERION	***55-30 46TH STREET***	***NNE 1/8 - 1/4 (0.135 mi.)***	***454***	***688***
ALLMANDINGER PROPERTIES, INC.	***55-15 43RD STREET***	***NNE 1/8 - 1/4 (0.146 mi.)***	***AE462***	***705***

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GEYSER REALTY LLC	57-65 48TH STREET	SSW 1/8 - 1/4 (0.156 mi.)	AB470	727
CANOVER INDUSTRIES, INC.	***57-65 48TH STREET***	***SSW 1/8 - 1/4 (0.156 mi.)***	***AB472***	***730***
GEYSER REALTY LLC	***57-65 48TH STREET***	***SSW 1/8 - 1/4 (0.156 mi.)***	***AB473***	***734***
YELLOW TRANSPORTATION (QNS)	***57-54 PAGE PLACE***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ518***	***770***
CANOVER INDASTIES , INC	***57-85 48TH ST***	***SSW 1/8 - 1/4 (0.169 mi.)***	***AK527***	***787***
COYNE FAMILY SERV STA INC	***58-09 RUST ST***	***SSE 1/8 - 1/4 (0.170 mi.)***	***AH531***	***795***
NEWTOWN CREEK PLANT	***33-05 LAUREL HILL BLVD***	***NNE 1/8 - 1/4 (0.171 mi.)***	***AL534***	***809***
TRIBORO PLATERS INC	***44-11 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AM538***	***823***
UNITED PARCEL SERVICE	***43-22 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AE542***	***836***
DSNY QUEENS DISTRICT 5A GARAGE	***58-02 48TH STREET***	***SSW 1/8 - 1/4 (0.180 mi.)***	***AK544***	***862***
CIPICO CONSTRUCTION, INC.	***58-08 48TH STREET***	***SSW 1/8 - 1/4 (0.184 mi.)***	***AK554***	***902***
DUANE READE DISTRIBUTION CENTE	***50-02 55TH AVE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN560***	***920***
E GREENE & CO, INC	***57-00 49 ST***	***S 1/8 - 1/4 (0.187 mi.)***	***AO565***	***932***
57-00 49TH STREET	***57-00 49TH STREET***	***S 1/8 - 1/4 (0.187 mi.)***	***AO566***	***936***

Lower Elevation	Address	Direction / Distance	Map ID	Page
BEN-JO GENERAL TRUCKING, INC.	***56-85 49TH STREET (1 RA***	***0 - 1/8 (0.000 mi.)***	***B5***	***37***
DAVIS & WARSHOW	***57-22 49TH ST***	***0 - 1/8 (0.000 mi.)***	***E13***	***65***

HIST AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the HIST AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 8 HIST AST sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
UNITED PARCEL SERVICE	***46-05 56TH ROAD***	***NNE 0 - 1/8 (0.003 mi.)***	***I56***	***125***
WALLACE PACKAGING CORP	***57-01 49TH ST***	***SE 0 - 1/8 (0.105 mi.)***	***W391***	***500***
PRESTON TRUCKING COMPANY	***49-40 MASPETH AVENUE***	***SSW 0 - 1/8 (0.125 mi.)***	***Z440***	***639***
TRANSPORTATION DISPLAYS INC.	49-29 MASPETH AVENUE	SSW 1/8 - 1/4 (0.126 mi.)	AA444	659
WASTE MANAGEMENT OF NEW YORK,	***475 SCOTT AVENUE AKA***	***WSW 1/8 - 1/4 (0.127 mi.)***	***V450***	***676***
NEWTOWN CREEK PLANT	***33-05 LAUREL HILL BLVD***	***NNE 1/8 - 1/4 (0.171 mi.)***	***AL534***	***809***
UNITED PARCEL SERVICE	***43-22 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AE542***	***836***

Lower Elevation	Address	Direction / Distance	Map ID	Page
BEN-JO GENERAL TRUCKING, INC.	***56-85 49TH STREET (1 RA***	***0 - 1/8 (0.000 mi.)***	***B5***	***37***

Records of Emergency Release Reports

HMIRS: The Hazardous Materials Incident Report System contains hazardous material spill incidents reported to the Department of Transportation. The source of this database is the U.S. EPA.

A review of the HMIRS list, as provided by EDR, and dated 12/31/2010 has revealed that there are 313 HMIRS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	45-05 56TH ROAD	NNE 0 - 1/8 (0.002 mi.)	H32	118
Not reported	45-05 56TH ROAD	NNE 0 - 1/8 (0.002 mi.)	H33	119
Not reported	46-06 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I34	119

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	46-06 56T ROAD	NNE 0 - 1/8 (0.003 mi.)	I35	119
Not reported	46-05 56TH RD, 11378	NNE 0 - 1/8 (0.003 mi.)	I36	119
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I38	122
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I39	122
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I40	122
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I41	122
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I42	122
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I43	123
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I44	123
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I45	123
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I46	123
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I47	123
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I48	123
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I49	124
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I50	124
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I51	124
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I52	124
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I53	124
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I54	124
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I55	125
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I57	163
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I58	164
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I59	164
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I60	164
Not reported	46-05 56 ROAD	NNE 0 - 1/8 (0.003 mi.)	I61	164
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I62	164
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I63	164
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I64	165
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I65	165
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I66	165
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I67	165
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I68	165
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I69	165
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I70	166
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I71	166
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I72	166
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I73	166
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I74	166
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I75	166
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I76	167
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I77	167
Not reported	46-05 56 ROAD	NNE 0 - 1/8 (0.003 mi.)	I78	167
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I79	167
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I80	167
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I81	167
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I82	168
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I83	168
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I84	168
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I85	168
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I86	168
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I87	168
Not reported	46-05 56TH RD.	NNE 0 - 1/8 (0.003 mi.)	I88	169
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I89	169
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I90	169
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I91	169
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I92	169

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I93	169
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I94	170
Not reported	46-05 56HT ROAD	NNE 0 - 1/8 (0.003 mi.)	I95	170
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I96	170
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I97	170
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I98	170
Not reported	46-05 56TH ROAD MASPETH	NNE 0 - 1/8 (0.003 mi.)	I99	170
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I100	171
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I101	171
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I102	171
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I103	171
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I104	171
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I105	171
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I107	174
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I108	174
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I109	174
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I110	175
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I111	175
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I112	175
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I113	175
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I114	175
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I115	175
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I116	176
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I117	176
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I118	176
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I119	176
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I120	176
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I121	176
Not reported	46-05 56TH ST	NNE 0 - 1/8 (0.003 mi.)	I122	177
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I123	177
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I124	177
Not reported	46-05 56HT ROAD	NNE 0 - 1/8 (0.003 mi.)	I126	180
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I127	180
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I128	181
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I129	181
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I130	181
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I131	181
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I132	181
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I133	181
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I134	182
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I135	182
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I136	182
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I137	182
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I138	182
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I140	199
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I141	199
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I142	199
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I143	200
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I144	200
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I146	202
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I147	203
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I148	203
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I149	203
Not reported	46-05 56TH RD.	NNE 0 - 1/8 (0.003 mi.)	I150	203
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I151	203
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I152	203

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I153	204
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I154	204
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I155	204
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I156	204
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I157	204
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I158	204
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I159	205
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I160	205
Not reported	46-05 56 ROAD	NNE 0 - 1/8 (0.003 mi.)	I161	205
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I162	205
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I163	205
Not reported	46-05 56TH ROAD 11378	NNE 0 - 1/8 (0.003 mi.)	I164	205
Not reported	46-05 56TH ROAD MASPETH	NNE 0 - 1/8 (0.003 mi.)	I165	206
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I166	206
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I167	206
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I168	206
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I169	206
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I170	206
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I171	207
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I172	207
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I173	207
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I174	207
Not reported	46-05 56TH ROAD 11378	NNE 0 - 1/8 (0.003 mi.)	I175	207
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I176	207
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I177	208
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I178	208
Not reported	46-05 56 RD	NNE 0 - 1/8 (0.003 mi.)	I179	208
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I180	208
Not reported	46-05 56RD	NNE 0 - 1/8 (0.003 mi.)	I181	208
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I182	208
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I183	209
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I184	209
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I185	209
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I186	209
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I187	209
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I188	209
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I189	210
Not reported	46-05 56 ROAD	NNE 0 - 1/8 (0.003 mi.)	I190	210
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I191	210
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I192	210
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I193	210
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I194	210
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I195	211
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I196	211
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I197	211
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I198	211
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I199	211
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I200	211
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I201	212
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I202	212
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I203	212
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I204	212
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I205	212
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I206	212
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I207	213
Not reported	46-05 56TH ROAD MASPETH	NNE 0 - 1/8 (0.003 mi.)	I208	213

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I209	213
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I210	213
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I211	213
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I212	213
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I213	214
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I214	214
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I215	214
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I216	214
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I217	214
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I218	214
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I219	215
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I220	215
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I221	215
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I222	215
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I224	241
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I225	241
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I226	241
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I227	242
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I228	242
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I229	242
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I230	242
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I231	242
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I232	242
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I233	243
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I234	243
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I235	243
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I236	243
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I237	243
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I238	243
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I239	244
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I240	244
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I241	244
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I242	244
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I243	244
46-05 56TH RD	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I244	244
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I245	245
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I246	245
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I247	245
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I248	245
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I249	245
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I250	245
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I251	246
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I252	246
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I253	246
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I254	246
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I255	246
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I256	246
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I257	247
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I258	247
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I259	247
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I260	247
Not reported	46-05 56TH RD 11378	NNE 0 - 1/8 (0.003 mi.)	I261	247
Not reported	46-05 56TH RD	NNE 0 - 1/8 (0.003 mi.)	I262	247
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I263	248
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I264	248
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I265	248

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	46-05 56TH ROAD	NNE 0 - 1/8 (0.003 mi.)	I266	248
Not reported	46-25 56TH ROAD MASPETH	NNE 0 - 1/8 (0.004 mi.)	I268	251
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I274	266
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I276	268
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I277	269
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I278	269
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I279	269
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I280	269
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I281	269
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I282	269
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I283	270
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I284	270
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I285	270
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I286	270
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I287	270
Not reported	4605 56TH ROAD	NNE 0 - 1/8 (0.005 mi.)	I288	270
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I289	271
Not reported	4605 56TH RD	NNE 0 - 1/8 (0.005 mi.)	I290	271
Not reported	55-90 48TH STREET	N 0 - 1/8 (0.021 mi.)	J316	372
Not reported	56-13 48TH ST	SSW 0 - 1/8 (0.059 mi.)	O345	432
Not reported	56-13 48TH ST	SSW 0 - 1/8 (0.059 mi.)	O346	433
Not reported	56-73 58 ST	ENE 0 - 1/8 (0.087 mi.)	U368	476
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V372	486
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V373	486
Not reported	500 SCOTT AVE	WSW 0 - 1/8 (0.104 mi.)	V374	486
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V375	486
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V376	486
Not reported	500 SCOTT AVE	WSW 0 - 1/8 (0.104 mi.)	V377	486
Not reported	500 SCOTT AVE	WSW 0 - 1/8 (0.104 mi.)	V378	487
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V379	487
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V381	489
Not reported	500 SCOTT AVE	WSW 0 - 1/8 (0.104 mi.)	V382	490
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V383	490
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V386	493
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V387	493
Not reported	500 SCOTT AVENUE	WSW 0 - 1/8 (0.104 mi.)	V389	499
4915 MASPETH AVE	4915 MASPETH AVE	SSW 0 - 1/8 (0.123 mi.)	Z421	585
Not reported	4915 MASPETH AVENUE	SSW 0 - 1/8 (0.123 mi.)	Z422	585
49-15 MASPETH AVE	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z425	594
49-15 MASPETH AVE	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z426	594
Not reported	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z430	599
Not reported	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z433	635
Not reported	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z434	635
49-15 MASPETH AVE	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z435	636
Not reported	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z436	636
49-15 MASPETH AVE	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z439	639
5754 PAGE PLACE	5754 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ479	755
57 54 PAGE PLACE	57 54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ480	755
Not reported	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ481	755
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ482	755
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ483	755
57-54 PAGE PLACE	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ484	755
Not reported	5754 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ485	756
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ486	756
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ487	756
Not reported	5754 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ488	756

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	5754 PAGE	WSW 1/8 - 1/4 (0.163 mi.)	AJ489	756
57 54 PAGE PL.	57 54 PAGE PL.	WSW 1/8 - 1/4 (0.163 mi.)	AJ490	756
Not reported	5754 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ491	757
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ492	757
Not reported	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ493	757
57-54 PAGE PLACE	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ494	757
57 54 PAGE PLACE	57 54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ495	757
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ496	757
57 54 PAGE PLACE	57 54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ497	758
Not reported	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ498	758
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ500	758
57-54 PAGE PL	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ501	759
Not reported	5754 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ502	759
Not reported	57-54 PAG PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ503	759
Not reported	5754 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ504	759
57 54 PAGE PLACE	57 54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ505	759
57 54 PAGE PLACE	57 54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ506	759
Not reported	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ507	760
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ508	760
Not reported	5754 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ509	760
Not reported	5754 PAGE	WSW 1/8 - 1/4 (0.163 mi.)	AJ510	760
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ511	760
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ513	769
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ514	769
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ515	769
Not reported	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ516	770
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ517	770
Not reported	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ519	782
Not reported	5754 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ520	782
Not reported	57-54 PAGE PLACE	WSW 1/8 - 1/4 (0.163 mi.)	AJ521	782

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 07/05/2011 has revealed that there are 80 NY Spills sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
J AND J FARM Date Closed: 8/26/2002	5710 49TH PL	0 - 1/8 (0.000 mi.)	B8	57
3 OZ HYDRAULIC FLUID FROM COMP Date Closed: 8/5/2008	55-77 RUST STREET	0 - 1/8 (0.000 mi.)	D11	62
57-10 49TH STOR PLACE Date Closed: 2/22/1994	***57-10 49TH ST OR PLACE***	***0 - 1/8 (0.000 mi.)***	***B15***	***72***
S&S WAREHOUSE Date Closed: 4/14/2004	57-10 49TH PLACE	0 - 1/8 (0.000 mi.)	B16	75
S AND S WAREHOUSE Date Closed: 12/16/2003	57-10 49TH PL	0 - 1/8 (0.000 mi.)	B19	81
CANADA DRY Date Closed: 7/25/2007	***50-35 56TH ROAD***	***0 - 1/8 (0.000 mi.)***	***G26***	***101***

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MASPETH AVE & RUST AVE Date Closed: 1/6/1998	MASPETH AVE & RUST AVE	0 - 1/8 (0.001 mi.)	F28	110
MASPETH AVE & RUST AVE Date Closed: 4/29/2004	***MASPETH AVE & RUST AVE***	***0 - 1/8 (0.001 mi.)***	***F29***	***111***
LIRR Date Closed: 5/7/1992	***LIRR/MASPETH AVE CROSSI***	***SSE 0 - 1/8 (0.001 mi.)***	***F30***	***114***
Not reported Date Closed: 3/3/2003	***RUST ST / MASPETH AV***	***ESE 0 - 1/8 (0.001 mi.)***	***F31***	***116***
Not reported Date Closed: 9/15/2003	***4605 56TH RD***	***NNE 0 - 1/8 (0.003 mi.)***	***I37***	***119***
UPS ***TRACTOR TRAILER*** Date Closed: 11/16/2000	46-05 56TH RD ***46-05 56TH ROAD***	NNE 0 - 1/8 (0.003 mi.) ***NNE 0 - 1/8 (0.003 mi.)***	I125 ***I145***	177 ***200***
56TH ROAD & 48TH ST Date Closed: 7/3/1995	***56TH ROAD & 48TH ST***	***N 0 - 1/8 (0.004 mi.)***	***J267***	***248***
HUB TRUCK RENTAL Date Closed: 12/9/2008	56-07 48TH ST	N 0 - 1/8 (0.005 mi.)	J271	259
AERIAL CABLE LEAK AT POLE # 10 Date Closed: 12/21/2006	56 ROAD & 48 STREET	N 0 - 1/8 (0.005 mi.)	J272	261
4605 56TH ROAD Date Closed: 11/22/1994	***4605 56TH ROAD***	***NNE 0 - 1/8 (0.005 mi.)***	***I275***	***266***
Not reported Date Closed: 5/29/2003	***50TH ST & 56TH RD***	***N 0 - 1/8 (0.006 mi.)***	***K296***	***288***
WAREHOUSE Date Closed: 2/22/2011	56-45 58TH STREET/58-11	ENE 0 - 1/8 (0.006 mi.)	D297	290
MANHOLE #284 Date Closed: 3/28/2002	***56 DRIVE & 43RD ST***	***NNE 0 - 1/8 (0.006 mi.)***	***298***	***294***
Not reported Date Closed: 8/29/2003	49 AND 56 ROAD	N 0 - 1/8 (0.008 mi.)	L301	299
POLE #10113 Date Closed: 7/25/2005	56TH RD AND 49TH ST	N 0 - 1/8 (0.008 mi.)	L302	300
Not reported Date Closed: 3/3/2003	***55-04 MASPETH AVE***	***WSW 0 - 1/8 (0.009 mi.)***	***F303***	***302***
55-05 MASPETH AVE. Date Closed: 10/24/1997	***55-05 MASPETH AVE.***	***WSW 0 - 1/8 (0.009 mi.)***	***F304***	***304***
55-04 MASPETH AVE Date Closed: 10/23/1992	***55-04 MASPETH AVE***	***WSW 0 - 1/8 (0.009 mi.)***	***F305***	***307***
NEW STYLE WASTE Date Closed: 2/5/1997	***3 RAILROAD PL***	***SSW 0 - 1/8 (0.009 mi.)***	***C308***	***331***
BROOKLYN QUEENS EXPRESSWA Date Closed: 6/12/1987	***B.Q.X-WAY/ KOSCIOSKO BR***	***N 0 - 1/8 (0.011 mi.)***	***M309***	***340***
BRADCO SUPPLY CORP Date Closed: 6/13/2005	***7 RAILROAD PL***	***SSW 0 - 1/8 (0.014 mi.)***	***C313***	***361***
OVERHEAD TRANSFORMER Date Closed: 4/5/2005	15 RAILROAD PL	SSW 0 - 1/8 (0.026 mi.)	C320	374
56-25 56TH ST Date Closed: 8/12/1992	***56-25 56TH ST***	***NE 0 - 1/8 (0.033 mi.)***	***D322***	***382***

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
POLE 84561 Date Closed: 2/12/2002	***56-16 56TH DR***	***ENE 0 - 1/8 (0.045 mi.)***	***P329***	***398***
MTA RAIL STATION Date Closed: 12/22/2010 Date Closed: 6/1/1998	***56TH ST 43RD ST***	***NNE 0 - 1/8 (0.059 mi.)***	***R347***	***433***
POLE 77383 Date Closed: 2/28/2002	***43RD ST/56TH RD***	***NNE 0 - 1/8 (0.059 mi.)***	***R348***	***437***
LAURELHILL SITE Date Closed: 8/9/2005	4202 56 ROAD	NNE 0 - 1/8 (0.061 mi.)	S350	439
34-02 LAUREL HILL BLVD Date Closed: 12/15/1995	***34-02 LAURAL HILL BLVD***	***NNW 0 - 1/8 (0.070 mi.)***	***T355***	***447***
34-02 LAUREL HILL ROAD Date Closed: 1/26/1995	***34-02 LAUREL HILL ROAD***	***NNW 0 - 1/8 (0.070 mi.)***	***T356***	***450***
Not reported Date Closed: 5/15/2002	56TH RD & LAUREL HILL B	NNW 0 - 1/8 (0.073 mi.)	T358	453
POLE #87904 Date Closed: 3/28/2002	***48-80 MASPETH AVE***	***SSE 0 - 1/8 (0.088 mi.)***	***W369***	***477***
MANHOLE # 10106 Date Closed: 9/21/2004	58TH ST / 56 ROAD	ENE 0 - 1/8 (0.105 mi.)	X393	508
WONDER INTERNATIONAL TRAI Date Closed: 3/6/2008	56-45 58TH STREET	ENE 0 - 1/8 (0.108 mi.)	X396	514
57-65 48TH ST/CANOVER IND Date Closed: 6/21/1989	***57-65 48TH STREET***	***N 0 - 1/8 (0.111 mi.)***	***397***	***516***
TEMO SALES Date Closed: 11/28/2005	***57-03 48TH ST***	***SSW 0 - 1/8 (0.116 mi.)***	***AB404***	***539***
SUBSTATION	57-77 RUST STREET	SSE 0 - 1/8 (0.119 mi.)	Y408	556
FORMER SUBSTATION Date Closed: 9/18/2009	57-77 RUST STREET	SSE 0 - 1/8 (0.119 mi.)	Y409	557
GLENDALE SUB STATION Date Closed: 6/13/2003	57-77 RUST ST	SSE 0 - 1/8 (0.119 mi.)	Y410	559
MASPETH SUBSTATION Date Closed: 7/7/2000	***57-77 RUST AVE***	***SSE 0 - 1/8 (0.119 mi.)***	***Y412***	***561***
FORMER MASPETH SUBSTATION Date Closed: 1/29/2003	***5777 RUST ST***	***SSE 0 - 1/8 (0.119 mi.)***	***Y413***	***566***
POLE NUMBER P-65912 Date Closed: 2/11/2011	473 SCOTT AVE	SW 0 - 1/8 (0.121 mi.)	AC415	572
CONTAM. ADJ. TO NYC ERP SITE	2 GALASSO PLACE / 1 RAI	SSE 0 - 1/8 (0.122 mi.)	W416	573
NYC ERP SITE Date Closed: 3/28/2011	57-15 49TH ST	SSE 0 - 1/8 (0.122 mi.)	W417	574
57-15 49TH ST Date Closed: 6/18/2004	***57-15 49TH ST***	***SSE 0 - 1/8 (0.122 mi.)***	***W419***	***577***
4929 MASPETH AVE Date Closed: 2/22/2007	***4929 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***AA424***	***590***
CONWAY CENTRAL EXPRESS Date Closed: 3/6/2006	***49-15 MASPETH AVENUE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z428***	***595***
5-GAL NOS,QUEENS Date Closed: 7/23/1986	***4940 MASPETH AVE.***	***SSW 0 - 1/8 (0.125 mi.)***	***Z441***	***655***

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CHERRY ST. & SCOTT ST. Date Closed: 12/26/2002	***CHERRY ST/SCOTT ST***	***SW 1/8 - 1/4 (0.126 mi.)***	***AC448***	***673***
INDUSTRIAL BUILDING Date Closed: 6/28/2007	58-24 MAURICE AVE	ENE 1/8 - 1/4 (0.145 mi.)	X459	701
MANHOLE 180 Date Closed: 9/29/2004	58T AVE/RUST ST	SSE 1/8 - 1/4 (0.156 mi.)	AH469	725
YELLOW FREIGHT SYSTEMS / Date Closed: 4/1/1987	***57-54 PAGE PLACE***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ478***	***752***
YELLOW FREIGHT SYSTEM INC - QN	***57-54 PAGE PL***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ512***	***760***
MANHOLE 17302 Date Closed: 9/26/2005	58 PLACE / MASPETH AVE	E 1/8 - 1/4 (0.169 mi.)	AD528	790
251 LOMBARDI STREET Date Closed: 12/16/1993	***251 LOMBARDI STREET***	***SW 1/8 - 1/4 (0.171 mi.)***	***532***	***801***
UPS Date Closed: 11/14/2003	43-22 55TH AVE	NNE 1/8 - 1/4 (0.177 mi.)	AE541	835
VS #6040 Date Closed: 10/22/2004	57-34 58 PLACE	ESE 1/8 - 1/4 (0.183 mi.)	AI546	877
SV 640 Date Closed: 5/17/2001 Date Closed: 2/21/2003	***57-34 58TH PLACE***	***ESE 1/8 - 1/4 (0.183 mi.)***	***AI547***	***878***
POLE 7652 Date Closed: 8/24/2001	***55TH AVE/ 50TH ST***	***N 1/8 - 1/4 (0.184 mi.)***	***AN551***	***894***
POLE 7491 Date Closed: 8/24/2001	***50TH AVE/50TH ST***	***N 1/8 - 1/4 (0.184 mi.)***	***AN552***	***897***
POLE 7651 Date Closed: 8/23/2001	***55TH AVE/50TH ST***	***N 1/8 - 1/4 (0.184 mi.)***	***AN553***	***900***
Not reported Date Closed: 8/1/2003	***50-02 55TH AVE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN557***	***908***
Not reported Date Closed: 8/1/2003	***50-02 55TH AVE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN563***	***927***
Not reported Date Closed: 4/21/2003	***56 DR & 58 PL***	***ENE 1/8 - 1/4 (0.186 mi.)***	***564***	***930***

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported Date Closed: 9/27/2004	42-02 56TH RD	0 - 1/8 (0.000 mi.)	A2	10
DAVIS AND WARSOH INC Date Closed: 8/23/2010	57-22 49TH ST	0 - 1/8 (0.000 mi.)	E12	64
DAVID AND WARSAOW Date Closed: 11/28/2007	57-02 48TH ST	0 - 1/8 (0.000 mi.)	E14	71
2 GALASSO PLACE Date Closed: 12/17/1999	***2 GALLASO PLACE***	***ESE 0 - 1/8 (0.005 mi.)***	***E295***	***285***
DEP DRUMS Date Closed: 4/11/1986	***48TH ST.&MASPETH AVE.***	***SSW 0 - 1/8 (0.041 mi.)***	***O327***	***393***
NEWTOWN CREEK Date Closed: 4/29/2004	***NEWTOWN CREEK***	***SSW 0 - 1/8 (0.053 mi.)***	***Q332***	***404***

EXECUTIVE SUMMARY

Lower Elevation	Address	Direction / Distance	Map ID	Page
NEWTOWN CREEK Date Closed: 9/5/1995	***NEWTOWN CREEK***	***SSW 0 - 1/8 (0.053 mi.)***	***Q333***	***406***
NEWTOWN CREEK Date Closed: 1/13/1995	***NEWTON CREEK***	***SSW 0 - 1/8 (0.053 mi.)***	***Q334***	***409***
Not reported Date Closed: 11/14/2000	***57-02 48TH ST***	***SSW 0 - 1/8 (0.058 mi.)***	***O343***	***427***
POLE 92057 Date Closed: 6/24/2003	***57-03 48TH ST***	***SSW 0 - 1/8 (0.058 mi.)***	***O344***	***430***

NY Hist Spills: This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database.

A review of the NY Hist Spills list, as provided by EDR, and dated 01/01/2002 has revealed that there are 50 NY Hist Spills sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
57-10 49TH STOR PLACE	***57-10 49TH ST OR PLACE***	***0 - 1/8 (0.000 mi.)***	***B15***	***72***
CANADA DRY	***50-35 56TH ROAD***	***0 - 1/8 (0.000 mi.)***	***G26***	***101***
MASPETH AVE & RUST AVE	***MASPETH AVE & RUST AVE***	***0 - 1/8 (0.001 mi.)***	***F29***	***111***
LIRR	***LIRR/MASPETH AVE CROSSI***	***SSE 0 - 1/8 (0.001 mi.)***	***F30***	***114***
Not reported	***RUST ST / MASPETH AV***	***ESE 0 - 1/8 (0.001 mi.)***	***F31***	***116***
Not reported	***4605 56TH RD***	***NNE 0 - 1/8 (0.003 mi.)***	***I37***	***119***
TRACTOR TRAILER	***46-05 56TH ROAD***	***NNE 0 - 1/8 (0.003 mi.)***	***I145***	***200***
56TH ROAD & 48TH ST	***56TH ROAD & 48TH ST***	***N 0 - 1/8 (0.004 mi.)***	***J267***	***248***
4605 56TH ROAD	***4605 56TH ROAD***	***NNE 0 - 1/8 (0.005 mi.)***	***I275***	***266***
Not reported	***50TH ST & 56TH RD***	***N 0 - 1/8 (0.006 mi.)***	***K296***	***288***
MANHOLE #284	***56 DRIVE & 43RD ST***	***NNE 0 - 1/8 (0.006 mi.)***	***298***	***294***
Not reported	***55-04 MASPETH AVE***	***WSW 0 - 1/8 (0.009 mi.)***	***F303***	***302***
55-05 MASPETH AVE.	***55-05 MASPETH AVE.***	***WSW 0 - 1/8 (0.009 mi.)***	***F304***	***304***
55-04 MASPETH AVE	***55-04 MASPETH AVE***	***WSW 0 - 1/8 (0.009 mi.)***	***F305***	***307***
NEW STYLE WASTE	***3 RAILROAD PL***	***SSW 0 - 1/8 (0.009 mi.)***	***C308***	***331***
BROOKLYN QUEENS EXPRESSWA	***B.Q.X-WAY/ KOSCIOSKO BR***	***N 0 - 1/8 (0.011 mi.)***	***M309***	***340***
BRADCO SUPPLY CORP	***7 RAILROAD PL***	***SSW 0 - 1/8 (0.014 mi.)***	***C313***	***361***
56-25 56TH ST	***56-25 56TH ST***	***NE 0 - 1/8 (0.033 mi.)***	***D322***	***382***
POLE 84561	***56-16 56TH DR***	***ENE 0 - 1/8 (0.045 mi.)***	***P329***	***398***
MTA RAIL STATION	***56TH ST 43RD ST***	***NNE 0 - 1/8 (0.059 mi.)***	***R347***	***433***
POLE 77383	***43RD ST/56TH RD***	***NNE 0 - 1/8 (0.059 mi.)***	***R348***	***437***
34-02 LAUREL HILL BLVD	***34-02 LAURAL HILL BLVD***	***NNW 0 - 1/8 (0.070 mi.)***	***T355***	***447***
34-02 LAUREL HILL ROAD	***34-02 LAUREL HILL ROAD***	***NNW 0 - 1/8 (0.070 mi.)***	***T356***	***450***
POLE #87904	***48-80 MASPETH AVE***	***SSE 0 - 1/8 (0.088 mi.)***	***W369***	***477***
57-65 48TH ST/CANOVER IND	***57-65 48TH STREET***	***N 0 - 1/8 (0.111 mi.)***	***397***	***516***
TEMO SALES	***57-03 48TH ST***	***SSW 0 - 1/8 (0.116 mi.)***	***AB404***	***539***
MASPETH SUBSTATION	***57-77 RUST AVE***	***SSE 0 - 1/8 (0.119 mi.)***	***Y412***	***561***
FORMER MASPETH SUBSTATION	***5777 RUST ST***	***SSE 0 - 1/8 (0.119 mi.)***	***Y413***	***566***
57-15 49TH ST	***57-15 49TH ST***	***SSE 0 - 1/8 (0.122 mi.)***	***W419***	***577***
4929 MASPETH AVE	***4929 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***AA424***	***590***
CONWAY CENTRAL EXPRESS	***49-15 MASPETH AVENUE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z428***	***595***
5-GAL NOS,QUEENS	***4940 MASPETH AVE.***	***SSW 0 - 1/8 (0.125 mi.)***	***Z441***	***655***

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CHERRY ST. & SCOTT ST.	*CHERRY ST/SCOTT ST*	*SW 1/8 - 1/4 (0.126 mi.)*	*AC448*	*673*
YELLOW FREIGHT SYSTEMS /	*57-54 PAGE PLACE*	*WSW 1/8 - 1/4 (0.163 mi.)*	*AJ478*	*752*
251 LOMBARDI STREET	*251 LOMBARDI STREET*	*SW 1/8 - 1/4 (0.171 mi.)*	*532*	*801*
SV 640	*57-34 58TH PLACE*	*ESE 1/8 - 1/4 (0.183 mi.)*	*AI547*	*878*
POLE 7652	*55TH AVE/ 50TH ST*	*N 1/8 - 1/4 (0.184 mi.)*	*AN551*	*894*
POLE 7491	*50TH AVE/50TH ST*	*N 1/8 - 1/4 (0.184 mi.)*	*AN552*	*897*
POLE 7651	*55TH AVE/50TH ST*	*N 1/8 - 1/4 (0.184 mi.)*	*AN553*	*900*
Not reported	*50-02 55TH AVE*	*N 1/8 - 1/4 (0.185 mi.)*	*AN557*	*908*
Not reported	*50-02 55TH AVE*	*N 1/8 - 1/4 (0.185 mi.)*	*AN563*	*927*
Not reported	*56 DR & 58 PL*	*ENE 1/8 - 1/4 (0.186 mi.)*	*564*	*930*

Lower Elevation	Address	Direction / Distance	Map ID	Page
2 GALASSO PLACE	*2 GALLASO PLACE*	*ESE 0 - 1/8 (0.005 mi.)*	*E295*	*285*
DEP DRUMS	*48TH ST.&MASPETH AVE.*	*SSW 0 - 1/8 (0.041 mi.)*	*O327*	*393*
NEWTOWN CREEK	*NEWTOWN CREEK*	*SSW 0 - 1/8 (0.053 mi.)*	*Q332*	*404*
NEWTOWN CREEK	*NEWTOWN CREEK*	*SSW 0 - 1/8 (0.053 mi.)*	*Q333*	*406*
NEWTOWN CREEK	*NEWTON CREEK*	*SSW 0 - 1/8 (0.053 mi.)*	*Q334*	*409*
Not reported	*5703 48TH ST*	*SSW 0 - 1/8 (0.058 mi.)*	*O342*	*425*
Not reported	*57-02 48TH ST*	*SSW 0 - 1/8 (0.058 mi.)*	*O343*	*427*
POLE 92057	*57-03 48TH ST*	*SSW 0 - 1/8 (0.058 mi.)*	*O344*	*430*

Other Ascertainable Records

RCRA-NonGen: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA-NonGen list, as provided by EDR, and dated 06/15/2011 has revealed that there are 30 RCRA-NonGen sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
UNITED PARCEL SERVICE	*46-05 56TH RD*	*NNE 0 - 1/8 (0.003 mi.)*	*I106*	*172*
BEST FOODS BAKING GROUP	*56-07 48TH ST*	*N 0 - 1/8 (0.005 mi.)*	*J270*	*257*
CERRO WIRE & CABLE CO	*5500 MASPETH AVE*	*WSW 0 - 1/8 (0.013 mi.)*	*F311*	*343*
DIAMANDIS BROTHERS INC	*56-17 56TH DR*	*ENE 0 - 1/8 (0.014 mi.)*	*D312*	*358*
BRADCO SUPPLY CORP	*7 RAILROAD PL*	*SSW 0 - 1/8 (0.014 mi.)*	*C313*	*361*
DIAMANDIS BROS INC	*56-27 56TH DR*	*ENE 0 - 1/8 (0.019 mi.)*	*D315*	*369*
WHIRLPOOL FACTORY SERVICE	*56-34 56TH ST*	*NE 0 - 1/8 (0.025 mi.)*	*D318*	*373*
EURO MOTORS	*56-24 56TH ST*	*NE 0 - 1/8 (0.032 mi.)*	*D321*	*377*
CIAMPA ORGANIZATION	*136-26 37TH AVE*	*NE 0 - 1/8 (0.038 mi.)*	*D324*	*385*
DICKARD WIDDER INDUSTRIES	*56-02 MASPETH AVE*	*SSE 0 - 1/8 (0.042 mi.)*	*F328*	*395*
DIAMOND AUTO BODY INC	*57-50 MASPETH AVE*	*ENE 0 - 1/8 (0.066 mi.)*	*N352*	*442*
PRESTON TRUCKING CO	*500 SCOTT AVE*	*WSW 0 - 1/8 (0.104 mi.)*	*V380*	*487*
JOHN KNICK REALTY CORP	*500 SCOTT AVE*	*WSW 0 - 1/8 (0.104 mi.)*	*V384*	*490*
SPIRAL METAL CO INC	*497 SCOTT AVE*	*WSW 0 - 1/8 (0.106 mi.)*	*V394*	*510*
BROOKLYN UNION GAS	*PAGE PL & MASPETH AVE*	*WSW 0 - 1/8 (0.113 mi.)*	*AA402*	*534*
RIDGEWOOD ART WOODCRAFT	*58-24 MAURICE AVE*	*E 1/8 - 1/4 (0.132 mi.)*	*AD453*	*685*
ELM COATED FABRICS DIVISION	*57-27 49TH ST*	*SSE 1/8 - 1/4 (0.139 mi.)*	*455*	*694*
VEHICARE NORTHERN NJ CO INC	*58-15 MAURICE AVE*	*ENE 1/8 - 1/4 (0.140 mi.)*	*X456*	*696*
AWTSCO NEW YORK CORP	*55-15 43RD ST*	*NNE 1/8 - 1/4 (0.146 mi.)*	*AE461*	*704*

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
INTERSTATE ENVELOPE MFG CORP	***56-15 55TH DR***	***NE 1/8 - 1/4 (0.149 mi.)***	***AF466***	***712***
YELLOW FREIGHT SYSTEM INC - QN	***57-54 PAGE PL***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ512***	***760***
COYNE FAMILY SS INC	***58-09 RUST ST***	***SSE 1/8 - 1/4 (0.170 mi.)***	***AH530***	***792***
Z & V REALTY	***44-11 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AM540***	***828***
BLOOMINGDALES WAREHOUSE	***50-02 55TH AVENUE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN558***	***910***
MASPETH DISTRIBUTION CENTER	50-02 55TH AVE	N 1/8 - 1/4 (0.185 mi.)	AN559	919

Lower Elevation	Address	Direction / Distance	Map ID	Page
DAVIS & WARSHOW	***57-22 49TH ST***	***0 - 1/8 (0.000 mi.)***	***E13***	***65***
DIAMANDIS BROS INC	***1 GALASSO PL***	***ESE 0 - 1/8 (0.005 mi.)***	***E291***	***271***
GALASSO TRUCKING INC	***2 GALASSO PL***	***ESE 0 - 1/8 (0.005 mi.)***	***E293***	***281***
LARSTAN PROCESSING CO INC	***48-85 MASPETH AVE***	***SSW 0 - 1/8 (0.053 mi.)***	***O336***	***412***
CANOVER INDUSTRIES INC	***48TH ST & MASPETH AVE***	***SSW 0 - 1/8 (0.056 mi.)***	***O341***	***419***

FTTS: FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act) over the previous five years. To maintain currency, EDR contacts the Agency on a quarterly basis.

A review of the FTTS list, as provided by EDR, and dated 04/09/2009 has revealed that there are 2 FTTS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
RADHASWAMY INC, DBA RAJA FOODS	***56-05 55TH DR***	***NE 1/8 - 1/4 (0.147 mi.)***	***AF465***	***711***
ELECTRONICS PLATING CORP	***58-15 57TH DRIVE***	***ESE 1/8 - 1/4 (0.157 mi.)***	***AI477***	***752***

HIST FTTS: A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

A review of the HIST FTTS list, as provided by EDR, and dated 10/19/2006 has revealed that there are 2 HIST FTTS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
RADHASWAMY INC, DBA RAJA FOODS	***56-05 55TH DR***	***NE 1/8 - 1/4 (0.147 mi.)***	***AF465***	***711***
ELECTRONICS PLATING CORP	***58-15 57TH DRIVE***	***ESE 1/8 - 1/4 (0.157 mi.)***	***AI477***	***752***

SSTS: Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

A review of the SSTS list, as provided by EDR, and dated 12/31/2009 has revealed that there is 1 SSTS

site within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
AIRACTOR CORP.	5 RAILROAD PLACE	SSW 0 - 1/8 (0.012 mi.)	C310	343

ICIS: The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

A review of the ICIS list, as provided by EDR, and dated 01/07/2011 has revealed that there are 4 ICIS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
WASTE MGMT-485 SCOTT AVE	485 SCOTT AVENUE BRO	WSW 0 - 1/8 (0.086 mi.)	V365	467
RAJA FOODS	56-05 55TH DRIVE MAS	NE 1/8 - 1/4 (0.147 mi.)	AF463	710
ELECTRONICS PLATING CORP	5815 57TH DR MASPETH	ESE 1/8 - 1/4 (0.157 mi.)	AI474	738
Lower Elevation	**Address**	**Direction / Distance**	**Map ID**	**Page**
PHELPS DODGE REFINING CORP	42-02 56TH RD MASPET	0 - 1/8 (0.000 mi.)	A3	11

PADS: The PCB Activity Database identifies generators, transporters, commercial storers and/or brokers and disposers of PCBs who are required to notify the United States Environmental Protection Agency of such activities. The source of this database is the U.S. EPA.

A review of the PADS list, as provided by EDR, and dated 11/01/2010 has revealed that there is 1 PADS site within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON - MASPETH FORMER SU	***57-77 RUST STREET***	***SSE 0 - 1/8 (0.119 mi.)***	***Y406***	***542***

FINDS: The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 04/14/2010 has revealed that there are 62 FINDS sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HOMEBAY TRADING CORP.	56-75 49TH STREET	0 - 1/8 (0.000 mi.)	B7	56
NORDIC INTERIORS INC-56-01 MAS	56-01 MASPETH AVENUE	0 - 1/8 (0.000 mi.)	F23	93
CANADA DRY CORP	50-35 56 ROAD	0 - 1/8 (0.000 mi.)	G24	94
UNITED PARCEL SERVICE	***46-05 56TH RD***	***NNE 0 - 1/8 (0.003 mi.)***	***I139***	***182***
BEST FOODS BAKING GROUP	***56-07 48TH ST***	***N 0 - 1/8 (0.005 mi.)***	***J270***	***257***
CERRO WIRE & CABLE CO	***5500 MASPETH AVE***	***WSW 0 - 1/8 (0.013 mi.)***	***F311***	***343***
BRADCO SUPPLY CORP	***7 RAILROAD PL***	***SSW 0 - 1/8 (0.014 mi.)***	***C313***	***361***
FEDEX GROUND - QUEENS	55-90 48TH ST	N 0 - 1/8 (0.021 mi.)	J317	372

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
WHIRLPOOL FACTORY SERVICE	***56-34 56TH ST***	***NE 0 - 1/8 (0.025 mi.)***	***D318***	***373***
EURO MOTORS	***56-24 56TH ST***	***NE 0 - 1/8 (0.032 mi.)***	***D321***	***377***
APKON INC	57-15 57TH PLACE	ESE 0 - 1/8 (0.035 mi.)	N323	385
CIAMPA ORGANIZATION	***136-26 37TH AVE***	***NE 0 - 1/8 (0.038 mi.)***	***D324***	***385***
DICKARD WIDDER INDUSTRIES	***56-02 MASPETH AVE***	***SSE 0 - 1/8 (0.042 mi.)***	***F328***	***395***
BROADWAY BODY WORK	56-26 56TH DR	ENE 0 - 1/8 (0.048 mi.)	P331	404
UNITED PARCEL SERVICE INC	55-55 48TH ST	N 0 - 1/8 (0.055 mi.)	339	418
DIAMOND AUTO BODY INC	***57-50 MASPETH AVE***	***ENE 0 - 1/8 (0.066 mi.)***	***N352***	***442***
SWING STAGING INC	55-51 43RD ST	NNE 0 - 1/8 (0.069 mi.)	R353	444
WASTE MGMT-485 SCOTT AVE	485 SCOTT AVENUE	WSW 0 - 1/8 (0.086 mi.)	V362	464
BQE TANSFER STATION	485 SCOTT AVE	WSW 0 - 1/8 (0.086 mi.)	V363	465
PRESTON TRUCKING CO	***500 SCOTT AVE***	***WSW 0 - 1/8 (0.104 mi.)***	***V380***	***487***
JOHN KNICK REALTY CORP	***500 SCOTT AVE***	***WSW 0 - 1/8 (0.104 mi.)***	***V384***	***490***
SCOTT AVENUE FACILITY	500 SCOTT AVE	WSW 0 - 1/8 (0.104 mi.)	V385	492
SAMJIN AMERRICA INC.	49-01 MASPETH AVE.	SE 0 - 1/8 (0.105 mi.)	W390	500
SPIRAL METAL CO INC	***497 SCOTT AVE***	***WSW 0 - 1/8 (0.106 mi.)***	***V394***	***510***
BROOKLYN UNION GAS	***PAGE PL & MASPETH AVE***	***WSW 0 - 1/8 (0.113 mi.)***	***AA402***	***534***
CON ED-RUST ST EMER GEN	57-77 RUST ST	SSE 0 - 1/8 (0.119 mi.)	Y407	555
VIACOM	***49-29 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***AA423***	***585***
CON-WAY FREIGHT-XBY	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z429	598
CONWAY CENTRAL EXPRESS	***49-15 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z432***	***609***
CON WAY CENTRAL EXPRESS XBY	49-15 MASPETH AVE	SSW 0 - 1/8 (0.124 mi.)	Z438	638
NOMAD MEDIA LLC - 49-29 MASPET	49-29 MASPETH AVE	SSW 1/8 - 1/4 (0.126 mi.)	AA443	658
BQE SERVICES INC-475 SCOTT AVE	475 SCOTT AVENUE	WSW 1/8 - 1/4 (0.127 mi.)	V449	675
RIDGEWOOD ART WOODCRAFT	***58-24 MAURICE AVE***	***E 1/8 - 1/4 (0.132 mi.)***	***AD453***	***685***
ELM COATED FABRICS DIVISION	***57-27 49TH ST***	***SSE 1/8 - 1/4 (0.139 mi.)***	***455***	***694***
VEHICARE NORTHERN NJ CO INC	***58-15 MAURICE AVE***	***ENE 1/8 - 1/4 (0.140 mi.)***	***X456***	***696***
RIDGEWOOD FURNITURE-MAURICE AV	58-24 MAURICE AVENUE	ENE 1/8 - 1/4 (0.145 mi.)	X460	703
AWTSCO NEW YORK CORP	***55-15 43RD ST***	***NNE 1/8 - 1/4 (0.146 mi.)***	***AE461***	***704***
RAJA FOODS	56-05 55TH DRIVE	NE 1/8 - 1/4 (0.147 mi.)	AF464	711
INTERSTATE ENVELOPE MFG CORP	***56-15 55TH DR***	***NE 1/8 - 1/4 (0.149 mi.)***	***AF466***	***712***
ELECTRONICS PLATING CORP	5815 57TH DR	ESE 1/8 - 1/4 (0.157 mi.)	AI475	740
YELLOW TRANSPORTATION - QNS	57-54 PAGE PL	WSW 1/8 - 1/4 (0.163 mi.)	AJ499	758
YELLOW FREIGHT SYSTEM INC - QN	***57-54 PAGE PL***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ512***	***760***
ASTORIA RUBBISH-177-187 CHERRY	177-187 CHERRY STREET	SW 1/8 - 1/4 (0.167 mi.)	AC524	786
HADSON TOKO TRADING CO, INC	55-05 43RD ST	NNE 1/8 - 1/4 (0.168 mi.)	AE525	786
WELLINGTON CLUB AUTO BODY	56-15 58TH STREET	ENE 1/8 - 1/4 (0.169 mi.)	526	786
COYNE FAMILY SVCE STA	58-09 RUST ST	SSE 1/8 - 1/4 (0.170 mi.)	AH529	792
COYNE FAMILY SS INC	***58-09 RUST ST***	***SSE 1/8 - 1/4 (0.170 mi.)***	***AH530***	***792***
OLD COUNTRY-AUTOBODY	58-02 58TH AVENUE	SE 1/8 - 1/4 (0.171 mi.)	AH535	821
Z & V REALTY	***44-11 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AM540***	***828***
UNITED PARCEL SERVICE	***43-22 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AE542***	***836***
S & L METAL PRODUCTS	***58-29 57TH DR***	***ESE 1/8 - 1/4 (0.184 mi.)***	***AI549***	***883***
RR ENTERPRISES USA INC	58-29 57TH DR	ESE 1/8 - 1/4 (0.184 mi.)	AI550	894
CIPICO CONST INC	58-08 48TH STREET	SSW 1/8 - 1/4 (0.184 mi.)	AK556	907
BLOOMINGDALES WAREHOUSE	***50-02 55TH AVENUE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN558***	***910***

Lower Elevation	Address	Direction / Distance	Map ID	Page
PHELPS DODGE REFINING CORP	***42-02 56TH RD***	***0 - 1/8 (0.000 mi.)***	***A4***	***13***
DAVIS & WARSHOW	***57-22 49TH ST***	***0 - 1/8 (0.000 mi.)***	***E13***	***65***
DIAMANDIS BROS INC	***1 GALASSO PL***	***ESE 0 - 1/8 (0.005 mi.)***	***E291***	***271***
GALASSO TRUCKING INC	***2 GALASSO PL***	***ESE 0 - 1/8 (0.005 mi.)***	***E293***	***281***
SPREADING MACHINE INC-48-85 MA	48-85 MASPETH AVE	SSW 0 - 1/8 (0.053 mi.)	O335	411
LARSTAN PROCESSING CO INC	***48-85 MASPETH AVE***	***SSW 0 - 1/8 (0.053 mi.)***	***O336***	***412***
CANOVER INDUSTRIES	48TH ST & MASPETH AVE	SSW 0 - 1/8 (0.056 mi.)	O340	418

EXECUTIVE SUMMARY

Lower Elevation	Address	Direction / Distance	Map ID	Page
CANOVER INDUSTRIES INC	***48TH ST & MASPETH AVE***	***SSW 0 - 1/8 (0.056 mi.)***	***O341***	***419***

MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the MANIFEST list, as provided by EDR, and dated 12/31/2010 has revealed that there are 41 MANIFEST sites within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
UNITED PARCEL SERVICE	***46-05 56TH RD***	***NNE 0 - 1/8 (0.003 mi.)***	***I106***	***172***
UNITED PARCEL SERVICE	***46-05 56TH RD***	***NNE 0 - 1/8 (0.003 mi.)***	***I139***	***182***
CONSOLIDATED EDISON MH288	56 RD & 50 ST	N 0 - 1/8 (0.007 mi.)	K299	296
CERRO WIRE & CABLE CO	***5500 MASPETH AVE***	***WSW 0 - 1/8 (0.013 mi.)***	***F311***	***343***
DIAMANDIS BROTHERS INC	***56-17 56TH DR***	***ENE 0 - 1/8 (0.014 mi.)***	***D312***	***358***
DIAMANDIS BROS INC	***56-27 56TH DR***	***ENE 0 - 1/8 (0.019 mi.)***	***D315***	***369***
EURO MOTORS	***56-24 56TH ST***	***NE 0 - 1/8 (0.032 mi.)***	***D321***	***377***
CIAMPA ORGANIZATION	***136-26 37TH AVE***	***NE 0 - 1/8 (0.038 mi.)***	***D324***	***385***
DICKARD WIDDER INDUSTRIES	***56-02 MASPETH AVE***	***SSE 0 - 1/8 (0.042 mi.)***	***F328***	***395***
PHELPS DODGE REFINING CORP	42-04 56TH RD	NNE 0 - 1/8 (0.054 mi.)	M337	414
CONSOLIDATED EDISON	56 RD & LAUREL HILL BLV	NNW 0 - 1/8 (0.073 mi.)	T357	452
CONSOLIDATED EDISON	RUST ST AND 57 PL	SSE 0 - 1/8 (0.101 mi.)	Y371	484
PRESTON TRUCKING CO	***500 SCOTT AVE***	***WSW 0 - 1/8 (0.104 mi.)***	***V380***	***487***
JOHN KNICK REALTY CORP	***500 SCOTT AVE***	***WSW 0 - 1/8 (0.104 mi.)***	***V384***	***490***
BROOKLYN UNION GAS	***PAGE PL & MASPETH AVE***	***WSW 0 - 1/8 (0.113 mi.)***	***AA402***	***534***
CONSOLIDATED EDISON	MASPETH AVE & PAGE PL	WSW 0 - 1/8 (0.114 mi.)	AA403	537
CON EDISON - MASPETH FORMER SU	***57-77 RUST STREET***	***SSE 0 - 1/8 (0.119 mi.)***	***Y406***	***542***
VIACOM	***49-29 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***AA423***	***585***
CONWAY CENTRAL EXPRESS	***49-15 MASPETH AVE***	***SSW 0 - 1/8 (0.124 mi.)***	***Z432***	***609***
PRESTON TRUCKING COMPANY	***49-40 MASPETH AVENUE***	***SSW 0 - 1/8 (0.125 mi.)***	***Z440***	***639***
PRESTON TRUCKING COMPANY	4940 MASPETH AVENUE	SSW 1/8 - 1/4 (0.125 mi.)	Z442	658
RIDGEWOOD ART WOODCRAFT	***58-24 MAURICE AVE***	***E 1/8 - 1/4 (0.132 mi.)***	***AD453***	***685***
INTERSTATE ENVELOPE MFG CORP	***56-15 55TH DR***	***NE 1/8 - 1/4 (0.149 mi.)***	***AF466***	***712***
CONSOLIDATED EDISON	LAUREL HILL BLVD & 56 R	NW 1/8 - 1/4 (0.152 mi.)	AG467	722
ELECTRONICS PLATING CORP	***58-15 57TH DR***	***ESE 1/8 - 1/4 (0.157 mi.)***	***AI476***	***741***
YELLOW FREIGHT SYSTEM INC - QN	***57-54 PAGE PL***	***WSW 1/8 - 1/4 (0.163 mi.)***	***AJ512***	***760***
COYNE FAMILY SS INC	***58-09 RUST ST***	***SSE 1/8 - 1/4 (0.170 mi.)***	***AH530***	***792***
CONSOLIDATED EDISON	43-01 43 ST & 55 AVE	NNE 1/8 - 1/4 (0.177 mi.)	AE536	821
Z & V REALTY	***44-11 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AM540***	***828***
UNITED PARCEL SERVICE	***43-22 55TH AVE***	***NNE 1/8 - 1/4 (0.177 mi.)***	***AE542***	***836***
CONSOLIDATED EDISON	57-34 58TH PL	ESE 1/8 - 1/4 (0.183 mi.)	AI545	876
S & L METAL PRODUCTS	***58-29 57TH DR***	***ESE 1/8 - 1/4 (0.184 mi.)***	***AI549***	***883***
BLOOMINGDALES WAREHOUSE	***50-02 55TH AVENUE***	***N 1/8 - 1/4 (0.185 mi.)***	***AN558***	***910***
CONSOLIDATED EDISON	50TH ST & 55TH AVE	N 1/8 - 1/4 (0.185 mi.)	AN561	926
CON ED	50 ST & 55 AVE	N 1/8 - 1/4 (0.185 mi.)	AN562	926

Lower Elevation	Address	Direction / Distance	Map ID	Page
PHELPS DODGE REFINING CORP	***42-02 56TH RD***	***0 - 1/8 (0.000 mi.)***	***A4***	***13***
DAVIS & WARSHOW	***57-22 49TH ST***	***0 - 1/8 (0.000 mi.)***	***E13***	***65***
DIAMANDIS BROS INC	***1 GALASSO PL***	***ESE 0 - 1/8 (0.005 mi.)***	***E291***	***271***
GALASSO TRUCKING INC	***2 GALASSO PL***	***ESE 0 - 1/8 (0.005 mi.)***	***E293***	***281***
LARSTAN PROCESSING CO INC	***48-85 MASPETH AVE***	***SSW 0 - 1/8 (0.053 mi.)***	***O336***	***412***
CANOVER INDUSTRIES INC	***48TH ST & MASPETH AVE***	***SSW 0 - 1/8 (0.056 mi.)***	***O341***	***419***

EXECUTIVE SUMMARY

FINANCIAL ASSURANCE: Financial assurance information.

A review of the FINANCIAL ASSURANCE list, as provided by EDR, and dated 07/11/2011 has revealed that there is 1 FINANCIAL ASSURANCE site within approximately 0.189 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
WASTE MANAGEMENT NY (BQE	***485 SCOTT AVENUE***	***WSW 0 - 1/8 (0.086 mi.)***	***V364***	***465***

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 20 records.

Site Name	Database(s)
NYCDEP	MANIFEST
CONSOLIDATED EDISON	RCRA-NLR,MANIFEST
TDI ATT - PETER VELAZQUEZ	FINDS,MANIFEST,RCRA-NLR
CONSOLIDATED EDISON	RCRA-NLR,MANIFEST
CONSOLIDATED EDISON	RCRA-NLR,MANIFEST
CONSOLIDATED EDISON	RCRA-NLR,MANIFEST
CON EDISON - VAULT V8319	RCRA-NLR
CON EDISON - MH MH-17573	FINDS
CON ED - VS 9335	FINDS
CON ED - VS 8549	FINDS
CON ED - M/H 17826	FINDS
CON EDISON - MH 206	FINDS
CON EDISION - VS9095	FINDS
CON EDISON - VAULT V8319	FINDS
CON ED - MANHOLE 13829	FINDS
CON ED - MH 1276	FINDS
CON ED - MH 11276	FINDS
NYC-TA CENTRAL WAREHOUSE-55 MASPET	FINDS
DICKARD WIDDER IND-56-02 MASPETH A	FINDS
DEMOLITION TRANSFER - MASPETH FACI	FINDS

OVERVIEW MAP - 3164153.2s

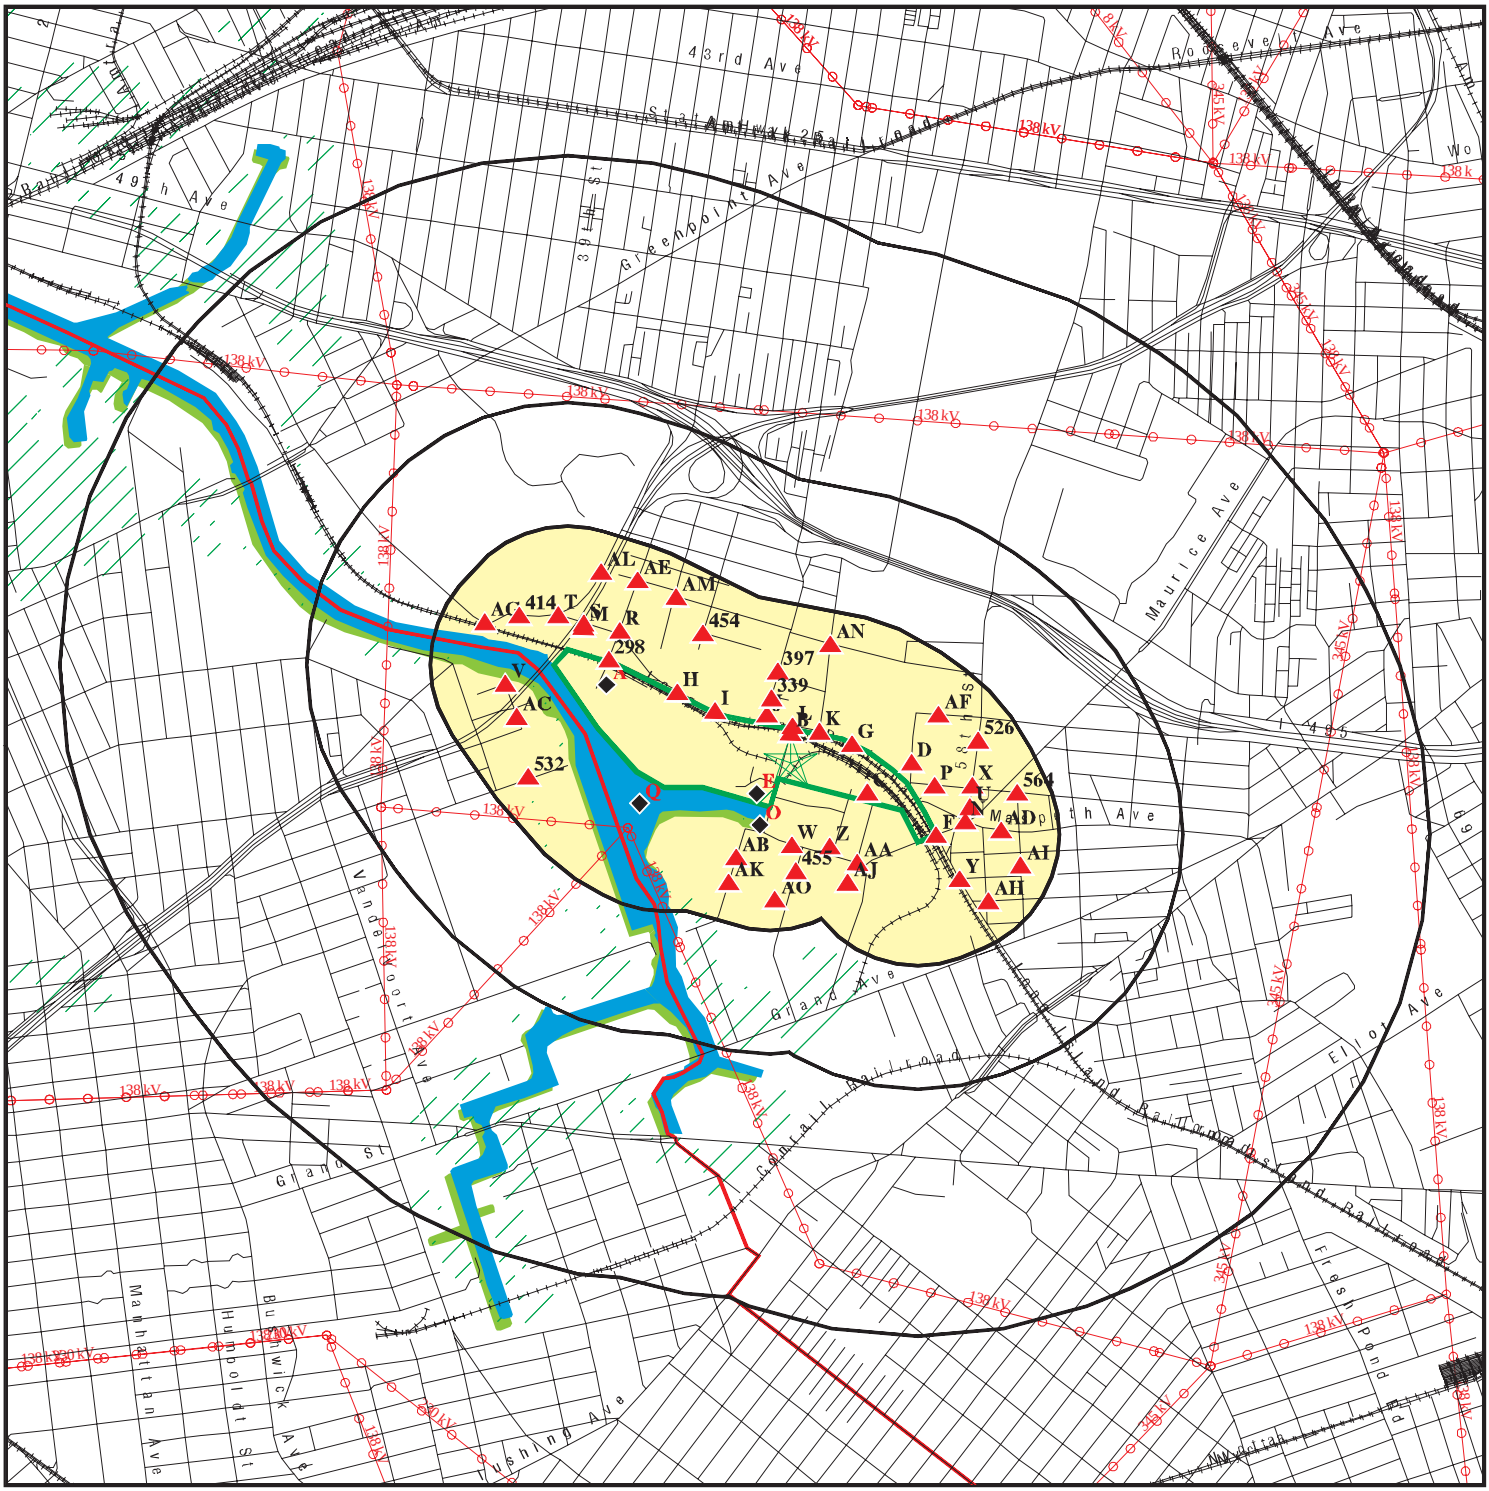

0 1/4 1/2 1 Miles

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- County Boundary
- Power transmission lines
- Oil & Gas pipelines from USGS
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Maspeth Expansion - Cross Harbor	CLIENT:	STV Inc.
ADDRESS:	Maspeth Avenue / Rust Street Maspeth NY 11378	CONTACT:	Doane E. Cafferty
LAT/LONG:	40.7251 / 73.9195	INQUIRY #:	3164153.2s
		DATE:	September 12, 2011 10:45 am

Copyright © 2011 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

DETAIL MAP - 3164153.2s

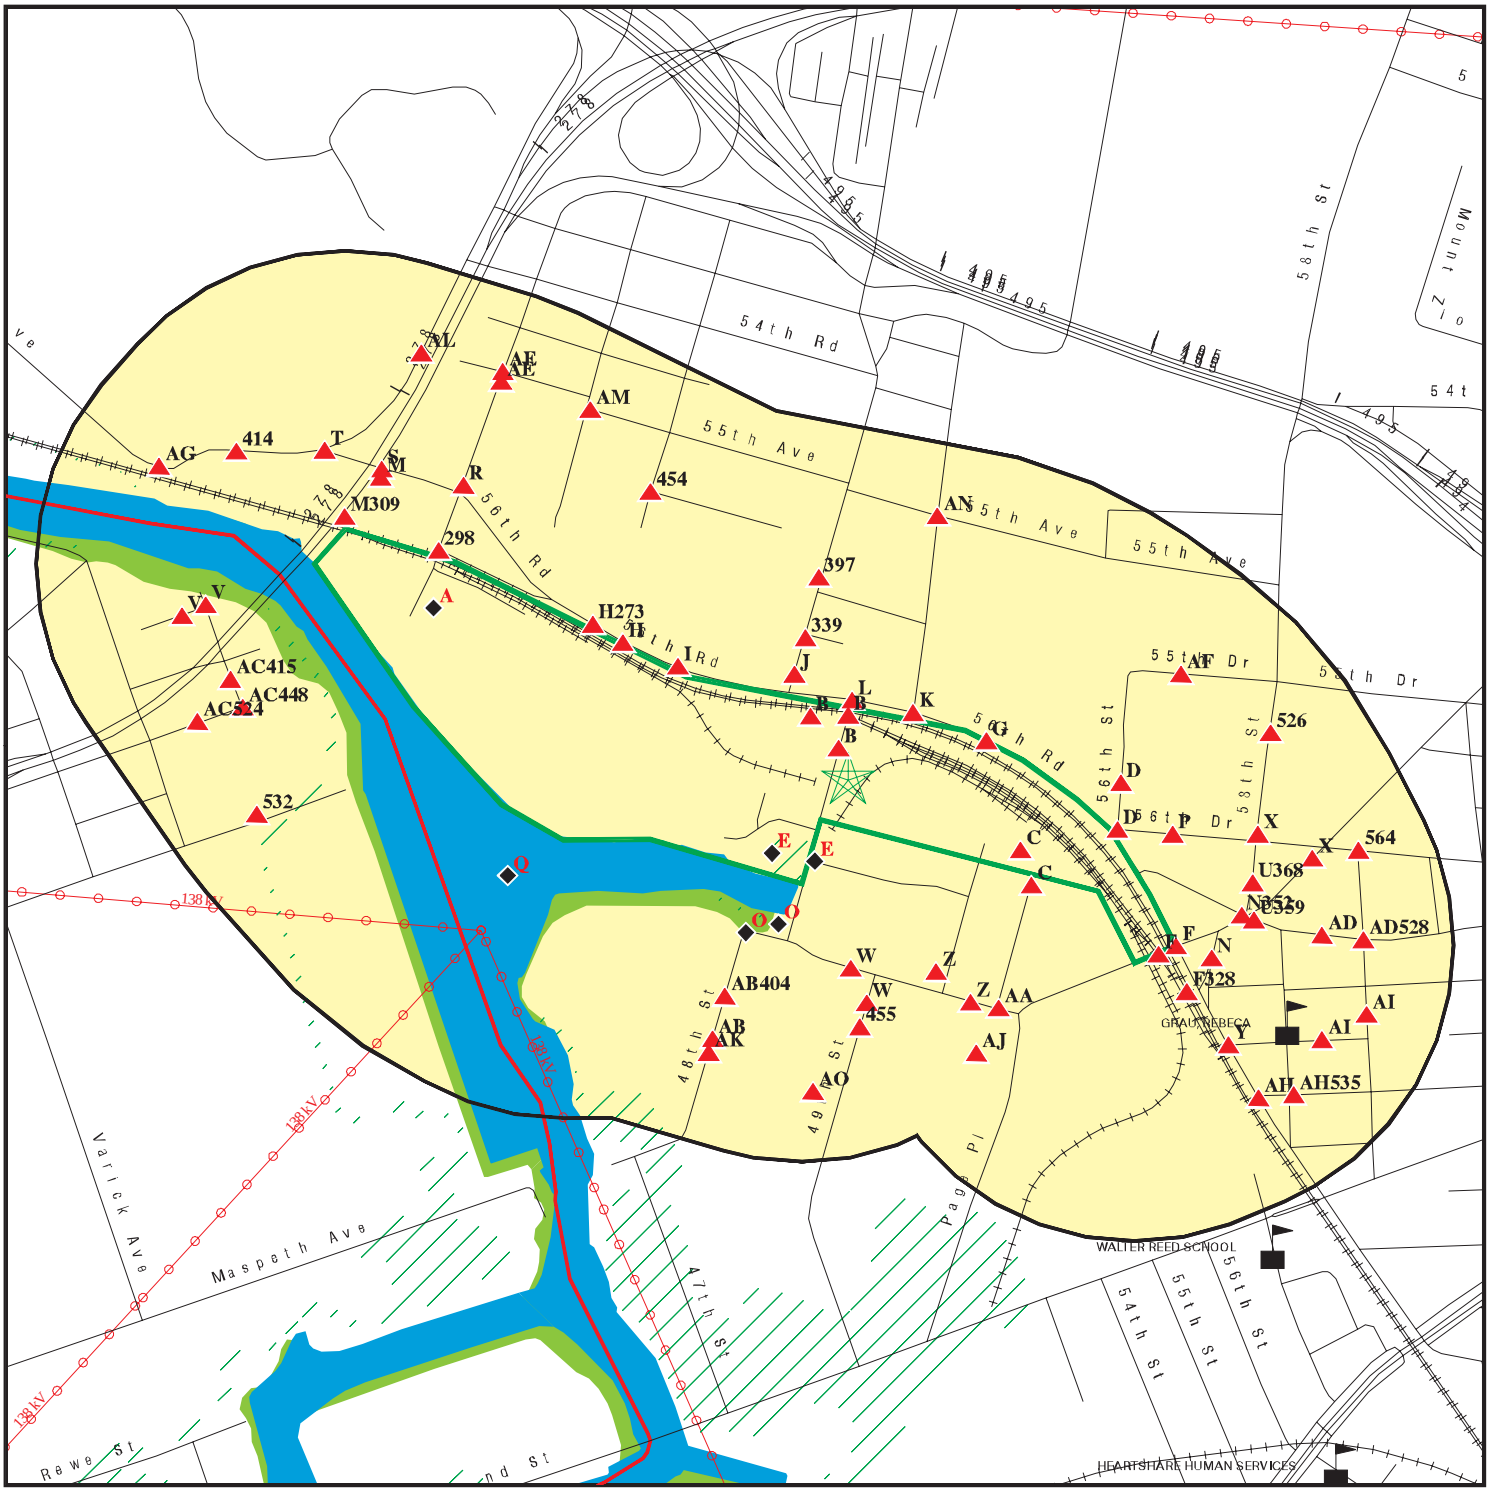

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- County Boundary
- Power transmission lines
- Oil & Gas pipelines from USGS
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Maspeth Expansion - Cross Harbor	CLIENT:	STV Inc.
ADDRESS:	Maspeth Avenue / Rust Street Maspeth NY 11378	CONTACT:	Doane E. Cafferty
LAT/LONG:	40.7251 / 73.9195	INQUIRY #:	3164153.2s
		DATE:	September 12, 2011 10:47 am

Copyright © 2011 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Federal NPL site list								
NPL		0.189	0	0	NR	NR	NR	0
Proposed NPL		0.189	0	0	NR	NR	NR	0
NPL LIENS		0.189	0	0	NR	NR	NR	0
Federal Delisted NPL site list								
Delisted NPL		0.189	0	0	NR	NR	NR	0
Federal CERCLIS list								
CERCLIS		0.189	1	0	NR	NR	NR	1
FEDERAL FACILITY		0.189	0	0	NR	NR	NR	0
Federal CERCLIS NFRAP site List								
CERC-NFRAP		0.189	0	0	NR	NR	NR	0
Federal RCRA CORRACTS facilities list								
CORRACTS		0.189	0	0	NR	NR	NR	0
Federal RCRA non-CORRACTS TSD facilities list								
RCRA-TSDF		0.189	0	0	NR	NR	NR	0
Federal RCRA generators list								
RCRA-LQG		0.189	3	1	NR	NR	NR	4
RCRA-SQG		0.189	2	3	NR	NR	NR	5
RCRA-CESQG		0.189	1	1	NR	NR	NR	2
Federal institutional controls / engineering controls registries								
US ENG CONTROLS		0.189	0	0	NR	NR	NR	0
US INST CONTROL		0.189	0	0	NR	NR	NR	0
Federal ERNS list								
ERNS		0.189	2	0	NR	NR	NR	2
State- and tribal - equivalent CERCLIS								
SHWS		0.189	1	0	NR	NR	NR	1
VAPOR REOPENED		0.189	0	0	NR	NR	NR	0
State and tribal landfill and/or solid waste disposal site lists								
SWF/LF		0.189	5	1	NR	NR	NR	6
State and tribal leaking storage tank lists								
LTANKS		0.189	14	3	NR	NR	NR	17
HIST LTANKS		0.189	13	1	NR	NR	NR	14
INDIAN LUST		0.189	0	0	NR	NR	NR	0
State and tribal registered storage tank lists								
TANKS		0.189	0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
UST		0.189	25	18	NR	NR	NR	43
CBS UST		0.189	0	0	NR	NR	NR	0
MOSF UST		0.189	0	0	NR	NR	NR	0
AST		0.189	7	3	NR	NR	NR	10
CBS AST		0.189	0	0	NR	NR	NR	0
MOSF AST		0.189	0	0	NR	NR	NR	0
MOSF		0.189	0	0	NR	NR	NR	0
CBS		0.189	0	1	NR	NR	NR	1
INDIAN UST		0.189	0	0	NR	NR	NR	0
FEMA UST		0.189	0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
ENG CONTROLS		0.189	0	0	NR	NR	NR	0
INST CONTROL		0.189	0	0	NR	NR	NR	0
RES DECL		0.189	0	0	NR	NR	NR	0
State and tribal voluntary cleanup sites								
INDIAN VCP		0.189	0	0	NR	NR	NR	0
VCP		0.189	1	0	NR	NR	NR	1
State and tribal Brownfields sites								
ERP		0.189	1	0	NR	NR	NR	1
BROWNFIELDS		0.189	0	0	NR	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS		0.189	0	0	NR	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
ODI		0.189	0	0	NR	NR	NR	0
DEBRIS REGION 9		0.189	0	0	NR	NR	NR	0
SWTIRE		0.189	0	0	NR	NR	NR	0
SWRCY		0.189	4	1	NR	NR	NR	5
INDIAN ODI		0.189	0	0	NR	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL		0.189	0	0	NR	NR	NR	0
DEL SHWS		0.189	0	0	NR	NR	NR	0
US HIST CDL		0.189	0	0	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
HIST UST		0.189	21	19	NR	NR	NR	40
HIST AST		0.189	4	4	NR	NR	NR	8
Local Land Records								
LIENS 2		0.189	0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
LUCIS		0.189	0	0	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS		0.189	273	40	NR	NR	NR	313
NY Spills		0.189	64	16	NR	NR	NR	80
NY Hist Spills		0.189	40	10	NR	NR	NR	50
Other Ascertainable Records								
RCRA-NonGen		0.189	20	10	NR	NR	NR	30
DOT OPS		0.189	0	0	NR	NR	NR	0
DOD		0.189	0	0	NR	NR	NR	0
FUDS		0.189	0	0	NR	NR	NR	0
CONSENT		0.189	0	0	NR	NR	NR	0
ROD		0.189	0	0	NR	NR	NR	0
UMTRA		0.189	0	0	NR	NR	NR	0
MINES		0.189	0	0	NR	NR	NR	0
TRIS		0.189	0	0	NR	NR	NR	0
TSCA		0.189	0	0	NR	NR	NR	0
FTTS		0.189	0	2	NR	NR	NR	2
HIST FTTS		0.189	0	2	NR	NR	NR	2
SSTS		0.189	1	0	NR	NR	NR	1
ICIS		0.189	2	2	NR	NR	NR	4
PADS		0.189	1	0	NR	NR	NR	1
MLTS		0.189	0	0	NR	NR	NR	0
RADINFO		0.189	0	0	NR	NR	NR	0
FINDS		0.189	38	24	NR	NR	NR	62
RAATS		0.189	0	0	NR	NR	NR	0
HSWDS		0.189	0	0	NR	NR	NR	0
UIC		0.189	0	0	NR	NR	NR	0
MANIFEST		0.189	27	18	NR	NR	NR	45
DRYCLEANERS		0.189	0	0	NR	NR	NR	0
NPDES		0.189	0	0	NR	NR	NR	0
AIRS		0.189	0	0	NR	NR	NR	0
E DESIGNATION		0.189	0	0	NR	NR	NR	0
INDIAN RESERV		0.189	0	0	NR	NR	NR	0
SCRD DRYCLEANERS		0.189	0	0	NR	NR	NR	0
PCB TRANSFORMER		0.189	0	0	NR	NR	NR	0
COAL ASH EPA		0.189	0	0	NR	NR	NR	0
COAL ASH		0.189	0	0	NR	NR	NR	0
FINANCIAL ASSURANCE		0.189	1	0	NR	NR	NR	1
COAL ASH DOE		0.189	0	0	NR	NR	NR	0
EDR PROPRIETARY RECORDS								
EDR Proprietary Records								
Manufactured Gas Plants		0.189	0	0	NR	NR	NR	0
EDR Historical Auto Stations		0.189	0	0	NR	NR	NR	0
EDR Historical Cleaners		0.189	0	0	NR	NR	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

A1 **PHELPS DODGE REFINING CORPORATION** **SHWS** **S103350610**
42-02 56TH ROAD **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 1 of 4 in cluster A

Relative: SHWS:
Lower
Program: HW
Site Code: 58835
Actual: Classification: SIGNIFICANT THREAT TO THE PUBLIC HEALTH OR ENVIRONMENT - ACTION REQUIRED.
7 ft.
Region: 2
Acres: 35.800
HW Code: 241002
Record Add: 11/18/1999 12:00:00 PM
Record Upd: 11/29/2010 1:49:00 PM
Updated By: JHOCONNE
Site Description: This site has been industrialized since 1891. It is surrounded by other industries and is located east of the Kosciuszko Bridge. Newtown Creek flows along the southern boundary of the facility. Phelps Dodge Refining Corporation used the facility from 1920-1983 for the production of tri-basic copper sulfate (pesticides), copper and sulfate pentahydrate, and as a copper refinery. Waste sludges from the processes were stored in an unlined lagoon. Plant operations at the Laurel Hill facility have been discontinued since 1983. In 1986, the Phelps Dodge Refining Corp. excavated more than 10,000 cubic yards of contaminated soils from a 3.5 acre hotspot area, and transported and disposed this material in a chemical waste facility in Ohio. The New York City Department of Environmental Protection completed a Remedial Investigation/Feasibility Study (RI/FS) in 1994 and indicated contamination on other areas of the site. Phelps Dodge entered into a Consent Agreement with NYSDEC for RI/FS and IRMs for this site. IRMs involving asbestos abatement, waste removal and building demolition were completed in October 2000. An RI/FS was completed in 2002 and a Record of Decision (ROD) was signed on January 23, 2003. The ROD divided the property into six Operable Units (OU-1 through OU-5 were land based, and OU-6 for surface waters and sediments of Newtown Creek). The ROD selected a remedy including hotspot soil removal; capping of the entire property; installation of a groundwater barrier wall along the creek; a groundwater extraction and disposal system; and institutional controls. The hotspot soil removal portion of the remedy was completed in 2004. In 2004, Phelps Dodge sold the property to a developer (Sagres Partners) which has further subdivided the site into various parcels. Site redevelopment is continuing in phases. Capping of several Operable Units is completed and various parcels have been developed for industrial uses. Phelps Dodge has designed a sheet steel barrier wall and groundwater treatment system. Construction of barrier wall and groundwater extraction and treatment system is completed. The Groundwater treatment system began operating in 2006.
Env Problem: The primary contaminants of concern at the site are heavy metals (including cadmium, chromium, copper, lead, mercury, and others), petroleum related hydrocarbons, and PCBs. Investigations indicate a plume of groundwater contaminated with metals exists underneath the property. Even though hot-spot soil removal has been completed, the property still contains elevated levels of heavy metal and semi-volatile contamination of soils. Under the ROD, these will be managed through placement of a site cap, a site management plan, and institutional controls. The property is fenced and secured and is

PHELPS DODGE REFINING CORPORATION (Continued) **S103350610**

	undergoing remediation. A groundwater extraction and treatment system is operational.
Health Problem:	The potential for human exposure is limited to physical contact with contaminated soils on-site. Access to the site is restricted by fences and security personnel. Remediation of the site includes a site-specific cap, which will minimize the potential for expsoures. Areas adjacent to the site are heavily developed with commercial/industrial facilities. Off-site exposures to site related contaminants are not expected. The surrounding area is served by public water.
Dump:	False
Structure:	False
Lagoon:	True
Landfill:	False
Pond:	False
Disp Start:	1940
Disp Term:	1983
Lat/Long:	40:43:34:0 / 73:55:32:0
Dell:	False
Record Add:	11/18/1999 12:00:00 PM
Record Upd:	12/23/2004 9:55:00 AM
Updated By:	JMOCONNE
Own Op:	Owner
Sub Type:	D
Owner Name:	Not reported
Owner Company:	PHELPS DODGE REFINING CORPORATION
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	ZZ
Owner Country:	United States of America
Own Op:	Disp. Owner
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	PHELPS DODGE REFINING CORPORATION
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	ZZ
Owner Country:	United States of America
Own Op:	On-Site Operator
Sub Type:	D
Owner Name:	Not reported
Owner Company:	PHELPS DODGE REFINING CORPORATION
Owner Address:	42-02 56TH RD.
Owner Addr2:	Not reported
Owner City,St,Zip:	MASPETH, NY
Owner Country:	United States of America
Own Op:	On-Site Operator
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Phelps Dodge Refining Corporation
Owner Address:	42-02 56th Road
Owner Addr2:	Not reported
Owner City,St,Zip:	Maspeth, NY 11378
Owner Country:	United States of America
Own Op:	Owner
Sub Type:	01
Owner Name:	MR. MICHAEL WOOD

PHELPS DODGE REFINING CORPORATION (Continued) **S103350610**

Owner Company:	PHELPS DODGE REFINING CORPORATION
Owner Address:	ONE NORTH CENTRAL AVENUE
Owner Addr2:	Not reported
Owner City,St,Zip:	PHOENIX, AZ 85004
Owner Country:	United States of America
HW Code:	241002
Waste Type:	ASBESTOS
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	MERCURY
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	CADMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	241002
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	015
Cross Ref Type Code:	13
Cross Ref Type:	Senate District
Record Added Date:	11/18/1999 12:00:00 PM
Record Updated:	2/24/2005 3:54:00 PM
Updated By:	INITIAL
Crossref ID:	09
Cross Ref Type Code:	15
Cross Ref Type:	Congressional District
Record Added Date:	11/18/1999 12:00:00 PM
Record Updated:	2/24/2005 3:54:00 PM
Updated By:	INITIAL
Crossref ID:	NYD039138789
Cross Ref Type Code:	05
Cross Ref Type:	EPA Site ID
Record Added Date:	11/18/1999 12:00:00 PM
Record Updated:	5/10/2001 4:31:00 PM
Updated By:	REGTRANS

A2 **NY Spills** **S106014814**
N/A

42-02 56TH RD
< 1/8 **MASPETH, NY**
1 ft.

Site 2 of 4 in cluster A

Relative:
Lower

Actual:
7 ft.

NY Spills:

Site ID:	273576
Facility Addr2:	Not reported
Facility ID:	0302512
Spill Number:	0302512
Facility Type:	ER
SWIS:	4101
Investigator:	CHAWLA
Referred To:	Not reported
Spill Date:	6/9/2003
Reported to Dept:	6/9/2003
CID:	207
Spill Cause:	Other
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/27/2004
Remediation Phase:	0
Date Entered In Computer:	6/9/2003
Spill Record Last Update:	9/27/2004
Spiller Name:	ANN WILLIAMSON
Spiller Company:	PHELPS DODGE REFINING
Spiller Address:	1 NORTH CENTRAL AVE
Spiller City,St,Zip:	PHOENIX, AZ 85004-
Spiller Company:	001
Contact Name:	ANN WILLIAMSON
Contact Phone:	(602) 366-8270
DEC Region:	2
DER Facility ID:	222564
DEC Memo:	Not reported
Remarks:	class 2 inactive haz waste site - petro contamination identified during remedial investigation - remedial plan currently under review by dec and petro was encountered by a buyers due dilligence investigation - excavation was filled back in

Material:

Site ID:	273576
Operable Unit ID:	870265
Operable Unit:	01
Material ID:	562861
Material Code:	0003
Material Name:	#6 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No

(Continued) **S106014814**

Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

A3 **PHELPS DODGE REFINING CORP** **ICIS 1011590982**
42-02 56TH RD MASPETH NY 113782003 **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 3 of 4 in cluster A

Relative: Lower

Actual: 7 ft.

ICIS:
Enforcement Action ID: 02-1982-0049
FRS ID: 110004333445
Program ID: RCRAINFO NYD001293489
Action Name: PHELPS DODGE REFIN
Facility Name: PHELPS DODGE REFINING CORP
Facility Address: 42-02 56TH RD MASPETH NY 113782003
MASPETH, New York 113782003
Enforcement Action Type: Civil Judicial Action
Facility County: Queens
EPA Region #: 3

Enforcement Action ID: 02-1982-0049
FRS ID: 110004333445
Program ID: CERCLIS NYD039138789
Action Name: PHELPS DODGE REFIN
Facility Name: PHELPS DODGE REFINING CORP
Facility Address: 42-02 56TH RD MASPETH NY 113782003
MASPETH, New York 113782003
Enforcement Action Type: Civil Judicial Action
Facility County: Queens
EPA Region #: 3

Enforcement Action ID: 02-1982-0049
FRS ID: 110004333445
Program ID: FRS 110004333445
Action Name: PHELPS DODGE REFIN
Facility Name: PHELPS DODGE CORP
Facility Address: 42-02 56TH RD MASPETH NY 113782003
MASPETH, New York 113782003
Enforcement Action Type: Civil Judicial Action
Facility County: Queens
EPA Region #: 3

PHELPS DODGE REFINING CORP (Continued) **1011590982**

Program ID: CERCLIS NYD039138789
Facility Name: PHELPS DODGE CORP
Address: 42-02 56TH RD
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 2819

Program ID: CERCLIS NYD039138789
Facility Name: PHELPS DODGE CORP
Address: 42-02 56TH RD
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3331

Program ID: FRS 110004333445
Facility Name: PHELPS DODGE CORP
Address: 42-02 56TH RD
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 2819

Program ID: FRS 110004333445
Facility Name: PHELPS DODGE CORP
Address: 42-02 56TH RD
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3331

Program ID: RCRAINFO NYD001293489
Facility Name: PHELPS DODGE CORP
Address: 42-02 56TH RD
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 2819

Program ID: RCRAINFO NYD001293489
Facility Name: PHELPS DODGE CORP
Address: 42-02 56TH RD
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3331

A4
< 1/8
1 ft.

PHELPS DODGE REFINING CORP
42-02 56TH RD
MASPETH, NY 11378

Site 4 of 4 in cluster A

CERCLIS **1000291443**
RCRA-LQG **NYD001293489**
FINDS
MANIFEST
MANIFEST

Relative:
Lower

Actual:
7 ft.

CERCLIS:

Site ID:	0201528
EPA ID:	NYD039138789
Facility County:	QUEENS
Short Name:	PHELPS DODGE REFINING COR
Congressional District:	09
IFMS ID:	Not reported
SMSA Number:	5600
USGC Hydro Unit:	02030201
Federal Facility:	Not a Federal Facility
DMNSN Number:	Not reported
Site Orphan Flag:	N
RCRA ID:	Not reported
USGS Quadrangle:	Not reported
Site Init By Prog:	Not reported
NFRAP Flag:	Not reported
Parent ID:	Not reported
RST Code:	Not reported
EPA Region:	02
Classification:	Not reported
Site Settings Code:	Not reported
NPL Status:	Not on the NPL
DMNSN Unit Code:	Not reported
RBRAC Code:	Not reported
RResp Fed Agency Code:	Not reported
Non NPL Status:	Other Cleanup Activity: State-Lead Cleanup
Non NPL Status Date:	19990831
Site Fips Code:	36081
CC Concurrence Date:	Not reported
CC Concurrence FY:	Not reported
Alias EPA ID:	Not reported
Site FUDS Flag:	Not reported
Alias Comments:	Not reported

Site Description: Not reported

CERCLIS Assessment History:

Action Code:	001
Action:	DISCOVERY
Date Started:	Not reported
Date Completed:	05/01/1979
Priority Level:	Not reported
Operable Unit:	SITEWIDE
Primary Responsibility:	EPA Fund-Financed
Planning Status:	Not reported
Urgency Indicator:	Not reported
Action Anomaly:	Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code:	001
Action:	SITE INSPECTION

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Date Started:	08/01/1983
Date Completed:	08/01/1983
Priority Level:	Low priority for further assessment
Operable Unit:	SITEWIDE
Primary Responsibility:	State, Fund Financed
Planning Status:	Not reported
Urgency Indicator:	Not reported
Action Anomaly:	Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code:	001
Action:	PRELIMINARY ASSESSMENT
Date Started:	Not reported
Date Completed:	08/01/1983
Priority Level:	Low priority for further assessment
Operable Unit:	SITEWIDE
Primary Responsibility:	EPA Fund-Financed
Planning Status:	Not reported
Urgency Indicator:	Not reported
Action Anomaly:	Not reported

For detailed financial records, contact EDR for a Site Report.:

Click this hyperlink while viewing on your computer to access additional US CERCLIS Financial: detail in the EDR Site Report.

RCRA-LQG:

Date form received by agency:	01/01/2007
Facility name:	PHELPS DODGE REFINING CORPORATION
Facility address:	56TH ROAD MASPETH, NY 11378
EPA ID:	NYD001293489
Contact:	RONALD J BUCHANAN
Contact address:	Not reported Not reported
Contact country:	US
Contact telephone:	(602) 366-8301
Contact email:	RBUCHANAN@PHELPSDODGE.COM
EPA Region:	02
Land type:	Private
Classification:	Large Quantity Generator
Description:	Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Owner/Operator Summary:

Owner/operator name:	PHELPS DODGE REFINING CORPORATION
Owner/operator address:	PO BOX 20001
	EL PASO, TX 79998
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	08/10/1885
Owner/Op end date:	Not reported

Owner/operator name:	PHELPS DODGE REFINING CORPORATION
Owner/operator address:	P.O.BOX
	EL PASO, NY 79998
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/1928
Owner/Op end date:	Not reported

Owner/operator name:	PHELPS DODGE REFINING CORPORATION
Owner/operator address:	Not reported
	Not reported
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	01/01/1928
Owner/Op end date:	Not reported

Owner/operator name:	PHELPS DODGE REFINING CORPORATION
Owner/operator address:	PO BOX 20001
	EL PASO, TX 79998
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/1920
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Used oil transporter: No

Historical Generators:
Date form received by agency: 04/20/2006
Facility name: PHELPS DODGE REFINING CORPORATION
Classification: Large Quantity Generator

Date form received by agency: 04/19/2006
Facility name: PHELPS DODGE REFINING CORPORATION
Classification: Large Quantity Generator

Date form received by agency: 06/22/2004
Facility name: PHELPS DODGE REFINING CORPORATION
Classification: Large Quantity Generator

Date form received by agency: 01/01/2001
Facility name: PHELPS DODGE REFINING CORPORATION
Classification: Large Quantity Generator

Date form received by agency: 07/08/1999
Facility name: PHELPS DODGE REFINING CORPORATION
Site name: PHELPS DODGE REFINING CORP
Classification: Not a generator, verified

Date form received by agency: 08/30/1984
Facility name: PHELPS DODGE REFINING CORPORATION
Site name: PHELPS DODGE REFINING CORP
Classification: Small Quantity Generator

Hazardous Waste Summary:
Waste code: D003
Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

Waste code: D008
Waste name: LEAD

Waste code: D010
Waste name: SELENIUM

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 11/06/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004333445

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NJ MANIFEST:

Manifest Code:	NJA5066698
EPA ID:	NYD001293489
Date Shipped:	20040309
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	040309
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	040310
Tranporter 1 Decal:	Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Tranporter 2 Decal: Not reported
Data Entry Number: 04020422
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA2952099
EPA ID: NYD001293489
Date Shipped: 20051116
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJ0000027193
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 051116
Date Trans2 Transported Waste: 000000
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 051116
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 02140622
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: 001385312FLE
EPA ID: NYD001293489
Date Shipped: 2/15/2008
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJ0000027193
Transporter 2 EPA ID: Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	2/15/2008
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	2/15/2008
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	D008
Manifest Year:	2008 New Jersey Manifest Data
Quantity:	1500
Unit:	P
Hand Code:	H111

NY MANIFEST:

EPA ID:	NYP000784819
Country:	USA
Mailing Name:	PHELPS DODGE REFINING CORP
Mailing Contact:	PHELPS DODGE REFINING CORP
Mailing Address:	1501 W FOUNTAINHEAD PKWY
Mailing Address 2:	Not reported
Mailing City:	FLUSHING
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-729-8043

Document ID:	NYB9270567
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/16/1999
Trans1 Recv Date:	12/16/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/17/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XB47596PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 48320
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270576
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/28/1999
Trans1 Recv Date: 12/28/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/29/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: TM84346PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 44500
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270585
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/28/1999
Trans1 Recv Date: 12/28/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/29/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XH47239PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 45480
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270594
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/28/1999
Trans1 Recv Date:	12/28/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/29/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XG93530PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	31820
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270603
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/28/1999
Trans1 Recv Date:	12/28/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/29/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XB47591PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	51860
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270612
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Generator Ship Date:	12/29/1999
Trans1 Recv Date:	12/29/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/30/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XD73450PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	48860
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270621
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/29/1999
Trans1 Recv Date:	12/29/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/30/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XA24562PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	52200
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270819
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/15/1999
Trans1 Recv Date:	12/15/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/17/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

TSDF ID: XD73448PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 49220
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270828
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XE53087PA
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 21020
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270837
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XA25347PA
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 19196
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Document ID:	NYB9270846
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/29/1999
Trans1 Recv Date:	12/29/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/30/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XK49181PA
Waste Code:	B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity:	23251
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9271008
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/29/1999
Trans1 Recv Date:	12/29/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/30/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XC58810PA
Waste Code:	B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity:	19650
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NJA2952099
Manifest Status:	Not reported
Trans1 State ID:	NJD00027193
Trans2 State ID:	Not reported
Generator Ship Date:	11/16/2005
Trans1 Recv Date:	11/16/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/16/2005
Part A Recv Date:	Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: S5811
Trans2 EPA ID: Not reported
TSDF ID: NJD002200046
Waste Code: D003 - NON-LISTED REACTIVE WASTES
Quantity: 02700
Units: P - Pounds
Number of Containers: 009
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYG2785563
Manifest Status: Not reported
Trans1 State ID: NJD054126164
Trans2 State ID: Not reported
Generator Ship Date: 07/16/2003
Trans1 Recv Date: 07/16/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/29/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: 0448290ME
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00197
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 01.00
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00198
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 03

Document ID: NYH1306323
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Trans1 EPA ID: AD65298NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 31153
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1306332
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: AE94114NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 34155
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1306341
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: AC40405NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 28486
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1306359
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: XBA4463PA
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 29194
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1332387
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: XW63964PA
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 33176
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1332396
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/05/2005

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Trans1 Recv Date:	10/05/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/06/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	AE94114NY
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	35290
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	Not reported

Click this hyperlink while viewing on your computer to access
1328 additional NY_MANIFEST: record(s) in the EDR Site Report.

EPA ID:	NYD001293489
Country:	USA
Mailing Name:	PHELPS DODGE REFINING CORP
Mailing Contact:	ROBERT BAUGHMAN
Mailing Address:	42-02 56TH ROAD
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	2003
Mailing Country:	USA
Mailing Phone:	718-392-2853

Document ID:	NYB9270567
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/16/1999
Trans1 Recv Date:	12/16/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/17/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XB47596PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	48320
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Document ID:	NYB9270576
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/28/1999
Trans1 Recv Date:	12/28/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/29/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	TM84346PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	44500
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270585
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/28/1999
Trans1 Recv Date:	12/28/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/29/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001293489
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	XH47239PA
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	45480
Units:	P - Pounds
Number of Containers:	001
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	99

Document ID:	NYB9270594
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	12/28/1999
Trans1 Recv Date:	12/28/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/29/1999
Part A Recv Date:	Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XG93530PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 31820
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270603
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/28/1999
Trans1 Recv Date: 12/28/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/29/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XB47591PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 51860
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270612
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XD73450PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 48860
Units: P - Pounds
Number of Containers: 001

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270621
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XA24562PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 52200
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270819
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/15/1999
Trans1 Recv Date: 12/15/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/17/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XD73448PA
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 49220
Units: P - Pounds
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270828
Manifest Status: Not reported
Trans1 State ID: PAD146714878

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XE53087PA
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 21020
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270837
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XA25347PA
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 19196
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9270846
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Trans2 EPA ID: Not reported
TSDF ID: XK49181PA
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 23251
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NYB9271008
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/29/1999
Trans1 Recv Date: 12/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: XC58810PA
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 19650
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 99

Document ID: NJA2952099
Manifest Status: Not reported
Trans1 State ID: NJD00027193
Trans2 State ID: Not reported
Generator Ship Date: 11/16/2005
Trans1 Recv Date: 11/16/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/16/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: S5811
Trans2 EPA ID: Not reported
TSDF ID: NJD002200046
Waste Code: D003 - NON-LISTED REACTIVE WASTES
Quantity: 02700
Units: P - Pounds
Number of Containers: 009
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Year: Not reported

Document ID: NYG2785563
Manifest Status: Not reported
Trans1 State ID: NJD054126164
Trans2 State ID: Not reported
Generator Ship Date: 07/16/2003
Trans1 Recv Date: 07/16/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/29/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSDF ID: 0448290ME
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00197
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 01.00
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00198
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 03

Document ID: NYH1306323
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: AD65298NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 31153
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Document ID: NYH1306332
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: AE94114NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 34155
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1306341
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: AC40405NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 28486
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1306359
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: XBA4463PA
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 29194
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1332387
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/03/2005
Trans1 Recv Date: 10/03/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/04/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: XW63964PA
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 33176
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYH1332396
Manifest Status: Not reported
Trans1 State ID: PAD987347515
Trans2 State ID: Not reported
Generator Ship Date: 10/05/2005
Trans1 Recv Date: 10/05/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/06/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001293489
Trans1 EPA ID: AE94114NY
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 35290
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001

PHELPS DODGE REFINING CORP (Continued) **1000291443**

Container Type: DT - Dump trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: Not reported

Click this hyperlink while viewing on your computer to access
1328 additional NY_MANIFEST: record(s) in the EDR Site Report.

B5 **BEN-JO GENERAL TRUCKING, INC.** **UST** **U003074656**
56-85 49TH STREET (1 RAILROAD PLACE) **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378** **AST**
1 ft. **HIST AST**

Site 1 of 10 in cluster B

Relative: Lower

Actual: 10 ft.

UST:
Facility Id: 2-339067
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2012/10/29
UTM X: 591233.86204000004
UTM Y: 4508799.1536800005

Affiliation Records:
Site Id: 16321
Affiliation Type: Owner
Company Name: J.T. ENTERPRISES LTD.
Contact Type: PRESIDENT
Contact Name: KENNETH YASHIAN
Address1: 56-85 49TH STREET (1 RAILROAD PLACE)
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 456-4134
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 5/14/2008

Site Id: 16321
Affiliation Type: On-Site Operator
Company Name: BEN-JO GENERAL TRUCKING, INC.
Contact Type: Not reported
Contact Name: KENNETH YASHIAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY
Zip Code: Not reported
Country Code: 001
Phone: (718) 456-4134
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Modified By:	NRLOMBAR
Date Last Modified:	5/14/2008

Site Id:	16321
Affiliation Type:	Emergency Contact
Company Name:	J.T. ENTERPRISES LTD.
Contact Type:	Not reported
Contact Name:	KENNETH YASHIAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 698-2094
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	5/14/2008

Site Id:	16321
Affiliation Type:	Mail Contact
Company Name:	BEN-JO GENERAL TRUCKING, INC.
Contact Type:	Not reported
Contact Name:	MR. KENNTH YASHIAN
Address1:	56-85 49TH STREET
Address2:	(1 RAILROAD PLACE)
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 456-4134
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
L09 - Piping Leak Detection - Exempt Suction Piping
L09 - Piping Leak Detection - Exempt Suction Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
F01 - Pipe External Protection - Painted/Asphalt Coating
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
C03 - Pipe Location - Aboveground/Underground Combination
F00 - Pipe External Protection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
C03 - Pipe Location - Aboveground/Underground Combination
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
I00 - Overfill - None
I00 - Overfill - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
I01 - Overfill - Float Vent Valve
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
I01 - Overfill - Float Vent Valve
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
B01 - Tank External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
C03 - Pipe Location - Aboveground/Underground Combination
I01 - Overfill - Float Vent Valve

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

C03 - Pipe Location - Aboveground/Underground Combination
H00 - Tank Leak Detection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
I01 - Overfill - Float Vent Valve
F01 - Pipe External Protection - Painted/Asphalt Coating
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I01 - Overfill - Float Vent Valve
G00 - Tank Secondary Containment - None

Tank Info:

Site ID:	16321
Tank Number:	001
Tank ID:	27968
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/9/1968
Capacity Gallons:	550
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	5/12/2010
Register:	True
Modified By:	BKFALVEY
Last Modified:	6/8/2010
Site ID:	16321
Tank Number:	002
Tank ID:	27969
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/9/1968
Capacity Gallons:	550
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	5/12/2010
Register:	True
Modified By:	BKFALVEY
Last Modified:	6/8/2010
Site ID:	16321
Tank Number:	003
Tank ID:	27970
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/9/1968

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Capacity Gallons: 550
Tightness Test Method: 21
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 5/12/2010
Register: True
Modified By: BKFALVEY
Last Modified: 6/8/2010

Site ID: 16321

Tank Number: 004
Tank ID: 27971
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 4/9/1968
Capacity Gallons: 1080
Tightness Test Method: 21
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 5/14/2010
Register: True
Modified By: BKFALVEY
Last Modified: 6/8/2010

Site ID: 16321

Tank Number: 005
Tank ID: 27972
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 4/9/1968
Capacity Gallons: 550
Tightness Test Method: 21
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 5/14/2010
Register: True
Modified By: BKFALVEY
Last Modified: 6/8/2010

HIST UST:
PBS Number: 2-339067
SPDES Number: Not reported
Emergency Contact: KENNETH YASHIAN
Emergency Telephone: (718) 698-2094
Operator: KENNETH YASHIAN
Operator Telephone: (718) 456-4134
Owner Name: J.T. ENTERPRISES LTD.

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Owner Address:	56-85 49TH STREET (1 RAILROAD PLACE)
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 456-4134
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	BEN-JO GENERAL TRUCKING, INC.
Mailing Address:	56-85 49TH STREET (1 RAILROAD PLACE)
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	MR. KENNTH YASHIAN
Mailing Telephone:	(718) 456-4134
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	56-85 49TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	10/07/1997
Expiration Date:	10/29/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	1650
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Float Vent Valve
Dispenser:	Suction

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Date Tested:	12/01/1993
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Horner EZ Check
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Float Vent Valve
Dispenser:	Suction
Date Tested:	12/01/1993
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Horner EZ Check
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Float Vent Valve
Dispenser:	Suction
Date Tested:	12/01/1993
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Date Closed:	Not reported
Test Method:	Horner EZ Check
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Tank Converted To Non-Regulated Use
Install Date:	Not reported
Capacity (gals):	1080
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Float Vent Valve
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	08/01/1996
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	Tank Converted To Non-Regulated Use
Install Date:	Not reported
Capacity (gals):	275
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Float Vent Valve
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	08/01/1996
Test Method:	Not reported
Deleted:	False

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Updated: True
Lat/long: Not reported

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-339067
Program Type: PBS
UTM X: 591233.86204000004
UTM Y: 4508799.1536800005
Expiration Date: 2012/10/29

Affiliation Records:
Site Id: 16321
Affiliation Type: Owner
Company Name: J.T. ENTERPRISES LTD.
Contact Type: PRESIDENT
Contact Name: KENNETH YASHIAN
Address1: 56-85 49TH STREET (1 RAILROAD PLACE)
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 456-4134
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 5/14/2008

Site Id: 16321
Affiliation Type: On-Site Operator
Company Name: BEN-JO GENERAL TRUCKING, INC.
Contact Type: Not reported
Contact Name: KENNETH YASHIAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY
Zip Code: Not reported
Country Code: 001
Phone: (718) 456-4134
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 5/14/2008

Site Id: 16321
Affiliation Type: Emergency Contact
Company Name: J.T. ENTERPRISES LTD.
Contact Type: Not reported
Contact Name: KENNETH YASHIAN
Address1: Not reported
Address2: Not reported

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 698-2094
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	5/14/2008

Site Id:	16321
Affiliation Type:	Mail Contact
Company Name:	BEN-JO GENERAL TRUCKING, INC.
Contact Type:	Not reported
Contact Name:	MR. KENNTH YASHIAN
Address1:	56-85 49TH STREET
Address2:	(1 RAILROAD PLACE)
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 456-4134
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
L09 - Piping Leak Detection - Exempt Suction Piping
L09 - Piping Leak Detection - Exempt Suction Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

B01 - Tank External Protection - Painted/Asphalt Coating
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
F01 - Pipe External Protection - Painted/Asphalt Coating
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
C03 - Pipe Location - Aboveground/Underground Combination
F00 - Pipe External Protection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
C03 - Pipe Location - Aboveground/Underground Combination
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
I00 - Overfill - None
I00 - Overfill - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
I01 - Overfill - Float Vent Valve
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
I01 - Overfill - Float Vent Valve
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
B01 - Tank External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
C03 - Pipe Location - Aboveground/Underground Combination
I01 - Overfill - Float Vent Valve
C03 - Pipe Location - Aboveground/Underground Combination
H00 - Tank Leak Detection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
I01 - Overfill - Float Vent Valve
F01 - Pipe External Protection - Painted/Asphalt Coating
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I01 - Overfill - Float Vent Valve
G00 - Tank Secondary Containment - None

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Tank Info:

Tank Number:	006
Tank Id:	27973
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	007
Tank Id:	27974
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	008
Tank Id:	27975
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	3000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	009

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Tank Id:	27976
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5169
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST AST:

PBS Number:	2-339067
SWIS Code:	6301
Operator:	KENNETH YASHIAN
Facility Phone:	(718) 456-4134
Facility Addr2:	56-85 49TH STREET
Facility Type:	TRUCKING/TRANSPORTATION
Emergency:	KENNETH YASHIAN
Emergency Tel:	(718) 698-2094
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	J.T. ENTERPRISES LTD.
Owner Address:	56-85 49TH STREET (1 RAILROAD PLACE)
Owner City,St,Zip:	MASPETH, NY 11378
Federal ID:	Not reported
Owner Tel:	(718) 456-4134
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	MR. KENNTH YASHIAN
Mailing Name:	BEN-JO GENERAL TRUCKING, INC.
Mailing Address:	56-85 49TH STREET (1 RAILROAD PLACE)
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Telephone:	(718) 456-4134
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	False
Certification Date:	10/07/1997
Expiration:	10/29/2002
Renew Flag:	False
Renew Date:	Not reported
Total Capacity:	1650
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 63
Town or City Code: 01
Region: 2

Tank ID: 006
Tank Location: ABOVEGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (Gal): 275
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: Not reported
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Tank ID: 007
Tank Location: ABOVEGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (Gal): 275
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: Not reported
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	008
Tank Location:	ABOVEGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (Gal):	3000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	009
Tank Location:	ABOVEGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (Gal):	5169
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True

BEN-JO GENERAL TRUCKING, INC. (Continued) **U003074656**

SPDES Number: Not reported
Lat/Long: Not reported

B6 **PJL REALTY CORP.** **UST** **U003758120**
56-72 49TH PLACE **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 2 of 10 in cluster B

Relative: Higher

Actual: 15 ft.

UST:

Facility Id:	2-604832
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591226.93995999999
UTM Y:	4508833.1529000001

Affiliation Records:

Site Id:	26701
Affiliation Type:	On-Site Operator
Company Name:	PJL REALTY CORP.
Contact Type:	Not reported
Contact Name:	PHILIP CHEUNG
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 417-1668
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	26701
Affiliation Type:	Mail Contact
Company Name:	PJL REALTY CORP.
Contact Type:	Not reported
Contact Name:	JEFFREY WU
Address1:	56-72 49TH PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 417-1668
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	26701
Affiliation Type:	Owner

PJL REALTY CORP. (Continued) **U003758120**

Company Name:	PJL REALTY CORP.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	56-72 49TH PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 417-1668
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	26701
Affiliation Type:	Emergency Contact
Company Name:	PJL REALTY CORP.
Contact Type:	Not reported
Contact Name:	PHILIP CHEUNG
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 417-1668
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction

Tank Info:

Site ID: 26701

PJL REALTY CORP. (Continued) **U003758120**

Tank Number:	001
Tank ID:	58975
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	11/1/2000
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	26701
Tank Number:	002
Tank ID:	58976
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	11/1/2000
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-604832
SPDES Number:	Not reported
Emergency Contact:	PHILIP CHEUNG
Emergency Telephone:	(718) 417-1668
Operator:	PHILIP CHEUNG
Operator Telephone:	(718) 417-1668
Owner Name:	PJL REALTY CORP.
Owner Address:	56-72 49TH PLACE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 417-1668
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	PJL REALTY CORP.
Mailing Address:	56-72 49TH PLACE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	JEFFREY WU
Mailing Telephone:	(718) 417-1668
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

PJL REALTY CORP. (Continued) **U003758120**

	and Subpart 360-14.
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER RETAIL SALES
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	Not reported
Expiration Date:	11/22/2005
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	11/01/2000
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed

PJL REALTY CORP. (Continued) **U003758120**

Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	11/01/2000
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

B7 **HOMEBAY TRADING CORP.** **FINDS** **1011849366**
56-75 49TH STREET **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 3 of 10 in cluster B

Relative: Higher

FINDS:

Registry ID: 110037085800

Actual: 24 ft.

Environmental Interest/Information System

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

B8 **J AND J FARM** **NY Spills** **S106004420**
5710 49TH PL **N/A**
< 1/8 **QUEENS, NY**
1 ft.

Site 4 of 10 in cluster B

Relative:
Higher

Actual:
21 ft.

NY Spills:

Site ID:	126865
Facility Addr2:	Not reported
Facility ID:	0202615
Spill Number:	0202615
Facility Type:	ER
SWIS:	4101
Investigator:	AERODRIG
Referred To:	Not reported
Spill Date:	6/11/2002
Reported to Dept:	6/11/2002
CID:	398
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/26/2002
Remediation Phase:	0
Date Entered In Computer:	6/11/2002
Spill Record Last Update:	8/26/2002
Spiller Name:	Not reported
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	ANDREW MORRIS
Contact Phone:	(212) 580-6763
DEC Region:	2
DER Facility ID:	109594
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "RODRIGUEZ" e2MIS no. 143-297: 11-JUN-2002 16:00 HRS. DISTRIBUTION ENG. DEPT. MECH-A JEFF HAUFMANN EMP# 17219 REPORTS: EMERGENCY DIESEL GENERATOR TRAILER # 80050, BEING SUPPLIED TO J&J FARMS CREAMERY DUE TO A TRANSFORMER REPLACEMENT IN STREET BEGAN TO OVERHEAT WHEN THE DAIRIES BACKUP GENERATOR FAILED LEAKING APPROX. 10 GAL'S OF ANTIFREEZE HAD LEAKED ON TO ASPHALT. SPILL IS CONTAINED. NO SEWERS OR WATER WAYS AFFECTED. THERE IS NOT NOW NOR WAS THERE PRIOR FIRE INVOLVEMENT .THERE IS NOT NOW NOR WAS THERE PRIOR SMOKE INVOLVEMENT. NO PRIVATE PROPERTY AFFECTED. OWNER OF SUBSTANCES IS CONED. CLEANUP STARTED : 11-JUN-2002 15:30 HRS. ABSORBENT PAD'S PLACED AND OIL ABSORBENT PLACED ON SPILL. PIG'S PLACED TO CONTAIN SPILL. UPDATE - 11-JUN-2002 16: 59 HRS. CIG MR. A. MORRIS NOTIFIED UPDATE - 11-JUN-2002 17: 50 HRS. ENVIR. FLUSH DEPT. OPER. SUPV. R. WALTER EMP# 75865 REPORTS: DUE TO EXCESSIVE LOAD, CLEANUP WILL RESUME WHEN UNIT IS OFF LINE. ASPER MECH- A I. AHLUWALIA EMP# 13903 : SUBSTANCE QUANITY IS APPROX. 2 GAL. 6/12/02 03: 05 HRS. -- C. COTSIFAS OF

J AND J FARM (Continued) **S106004420**

QUEENS ENV. OPS. REPORTS GENERATOR WAS TAKEN OFF SYSTEM, AND TURNED OFF, THE LEAK STOPPED. THE GENERATOR WAS TAKEN TO TRANSPROTATION. HE & A. STUBBS COMPLETED CLEANUP USING SLIX, ABSORBANT ABD DIAPERS AS OF THIS TIME. 6/13/02 This generator is owned by building 82 in Astoria.
Transportation department is not the responsible party for this unit.
Transportation garage will possibly make repairs for them.

Remarks: BACK UP GEN FAILED. CLEAN UP IN PROGRESS. CON ED 143297.

Material:

Site ID:	126865
Operable Unit ID:	853461
Operable Unit:	01
Material ID:	520463
Material Code:	0043A
Material Name:	ANTIFREEZE
Case No.:	Not reported
Material FA:	Other
Quantity:	10
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

C9 **EVANS CONTAINER CORP.** **SWF/LF** **S105841774**
1880 19 AVENUE **N/A**
< 1/8 **WOODSIDE, NY 11105**
1 ft.

Site 1 of 10 in cluster C

Relative:
Higher

Actual:
13 ft.

SWF/LF:

Flag:	INACTIVE
Region Code:	2
Phone Number:	7189370707
Owner Name:	Not reported
Owner Type:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	PETER EVANGELISTA
Contact Address:	Not reported
Contact Addr2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported

EVANS CONTAINER CORP. (Continued) **S105841774**

Contact Phone:	Not reported
Activity Desc:	Transfer station - regulated
Activity Number:	[41T34]
Active:	No
East Coordinate:	591500
North Coordinate:	4508700
Accuracy Code:	Not reported
Regulatory Status:	Not reported
Waste Type:	Not reported
Authorization #:	2-6304-00150
Authorization Date:	Not reported
Expiration Date:	Not reported

B10 **ELDORADO COFFEE, LTD** **UST U000406778**
56-75 49TH STREET **HIST UST N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 5 of 10 in cluster B

Relative: Higher

Actual: 24 ft.

UST:

Facility Id:	2-243949
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591237.36488000001
UTM Y:	4508816.5165200001

Affiliation Records:

Site Id:	9419
Affiliation Type:	Owner
Company Name:	MARTOS REALTY LLC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1440 160 TH STREET
Address2:	Not reported
City:	BEECHHURST
State:	NY
Zip Code:	11357
Country Code:	001
Phone:	(718) 418-4100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	9419
Affiliation Type:	Mail Contact
Company Name:	MARTOS REALTY LLC
Contact Type:	Not reported
Contact Name:	SEGUNDO MARTIN
Address1:	1440 160TH STREET
Address2:	Not reported
City:	BEECHHURST
State:	NY
Zip Code:	11357

ELDORADO COFFEE, LTD (Continued) **U000406778**

Country Code:	001
Phone:	(718) 418-4100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	9419
Affiliation Type:	Emergency Contact
Company Name:	MARTOS REALTY LLC
Contact Type:	Not reported
Contact Name:	SEQUNDO MARTIN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 767-5767
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	9419
Affiliation Type:	On-Site Operator
Company Name:	ELDORADO COFFEE, LTD
Contact Type:	Not reported
Contact Name:	MARTOS REALTY LLC
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 418-4100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None
B02 - Tank External Protection - Original Sacrificial Anode
C02 - Pipe Location - Underground/On-ground
D02 - Pipe Type - Galvanized Steel
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H03 - Tank Leak Detection - Vapor Well
I00 - Overfill - None
F02 - Pipe External Protection - Original Sacrificial Anode
J02 - Dispenser - Suction

Tank Info:

Site ID:	9419

ELDORADO COFFEE, LTD (Continued) **U000406778**

Tank Number:	001
Tank ID:	25388
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	2000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/13/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-243949
SPDES Number:	Not reported
Emergency Contact:	SEQUNDO MARTIN
Emergency Telephone:	(718) 767-5767
Operator:	MARTOS REALTY LLC
Operator Telephone:	(718) 418-4100
Owner Name:	MARTOS REALTY LLC
Owner Address:	1440 160 TH STREET
Owner City,St,Zip:	BEECHHURST, N.Y. 11357
Owner Telephone:	(718) 418-4100
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	MARTOS REALTY LLC
Mailing Address:	1440 160TH STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BEECHHURST, NY 11357
Mailing Contact:	SEGUNDO MARTIN
Mailing Telephone:	(718) 418-4100
Owner Mark:	Second Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	56-75 49 TH ST
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	05/04/2001
Expiration Date:	05/01/2006
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0

ELDORADO COFFEE, LTD (Continued) **U000406778**

Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	2000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Sacrificial Anode
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Rubber Liner
Pipe External:	Sacrificial Anode
Second Containment:	None
Leak Detection:	Vapor Well
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	05/13/2001
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

D11 **3 OZ HYDRAULIC FLUID FROM COMPRESSOR** **NY Spills** **S109205488**
55-77 RUST STREET **N/A**
< 1/8 **MASPETH, NY**
1 ft.

Site 1 of 9 in cluster D

Relative: Higher

Actual: 18 ft.

NY Spills:

Site ID:	400013
Facility Addr2:	Not reported
Facility ID:	0803297
Spill Number:	0803297
Facility Type:	ER
SWIS:	4101
Investigator:	gdbreen
Referred To:	Not reported
Spill Date:	6/19/2008
Reported to Dept:	6/19/2008
CID:	444
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported

3 OZ HYDRAULIC FLUID FROM COMPRESSOR (Continued) **S109205488**

Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/5/2008
Remediation Phase:	0
Date Entered In Computer:	6/19/2008
Spill Record Last Update:	8/5/2008
Spiller Name:	ERTSDESK
Spiller Company:	CON EDISON
Spiller Address:	55-77 RUST STREET
Spiller City,St,Zip:	MASBETH, NY
Spiller Company:	999
Contact Name:	ERTSDESK
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	349319
DEC Memo:	08/05/08 - See eDocs for Con Ed report detailing cleanup and closure. 212031. see eDocs
Remarks:	ABOUT 3 OUNCES LEAKED FROM A COMPRESSOR. 212031

Material:

Site ID:	400013
Operable Unit ID:	1156860
Operable Unit:	01
Material ID:	2147852
Material Code:	0010
Material Name:	Hydraulic Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

E12 **DAVIS AND WARSOH INC** **NY Spills** **S110488122**
57-22 49TH ST **N/A**
< 1/8 **MASPETH, NY**
1 ft.

Site 1 of 8 in cluster E

Relative: NY Spills:
Lower

Site ID:	435273
Facility Addr2:	5722 49TH ST
Actual: Facility ID:	1002167
2 ft. Spill Number:	1002167
Facility Type:	ER
SWIS:	4101
Investigator:	SFRAHMAN
Referred To:	Not reported
Spill Date:	5/26/2010
Reported to Dept:	5/26/2010
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/23/2010
Remediation Phase:	0
Date Entered In Computer:	5/26/2010
Spill Record Last Update:	8/23/2010
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	JOLENE LOZEWSKI
Contact Phone:	(518) 877-7101 118
DEC Region:	2
DER Facility ID:	390173
DEC Memo:	06/08/10 Phase II investigation performed by HRP Associates.HRP was retained by Davis & Warshaw.A total of eleven borings were installed to collect soil and ground water samples.Ground water flow direction is to the south-southwest.The site has an extensive history of industrial operation on site including enameling operations and stamping.Ground water encountered at 4' below the grade.No obvious evidence of gross contamination observed in the soil sample.No NAPL observed in any of the ground water samples.In one ground water samples, Napthalene and 1,2,4 trimethylbenzene were detected above TOGS value.As per HRP, the presence of these constituents can be attributable to urban fill.Some metals also detected in soil/ground water samples.Considering the site's previous usage and industrial nature of the neighborhood, HRP recommended no action at this time.(sr) PBS: 2-214264, a 2,000 gallon UST was closed in 2001. 08/20/10 Additional investigation was performed by HRP.Four monitoring wells were advanced on site on July 7, 2010.Ground water was encountered at 5 ft bgs.No obvious gross contamination was

DAVIS AND WARSOH INC (Continued) **S110488122**

observed in soil borings.Four ground water samples were collected from four monitoring wells.VOCs/SVOCs were below the TOGs value.The site located in a industrial neighborhood. Based on the HRP's site investigation, the VOCs/SVOCs and metals are not considered a significant threat to the environment, as per HRP.Case closed.Report in edocs.(sr)

Remarks: soil & groundwater samples showed elevated readings - clean up pending

Material:

Site ID:	435273
Operable Unit ID:	1186058
Operable Unit:	01
Material ID:	2180824
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

E13 **DAVIS & WARSHOW** **RCRA-NonGen** **1000261803**
57-22 49TH ST **FINDS** **NYD005907621**
< 1/8 **MASPETH, NY 11378** **UST**
1 ft. **HIST UST**
Site 2 of 8 in cluster E **MANIFEST**

Relative: Lower

Actual: 2 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	DAVIS & WARSHOW
Facility address:	57-22 49TH ST MASPETH, NY 113782107
EPA ID:	NYD005907621
Mailing address:	49TH ST MASPETH, NY 11378
Contact:	Not reported
Contact address:	49TH ST MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator

DAVIS & WARSHOW (Continued) **1000261803**

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: ERVING FINKLE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: ERVING FINKLE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: DAVIS & WARSHOW
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: DAVIS & WARSHOW
Classification: Not a generator, verified

Date form received by agency: 11/01/1988
Facility name: DAVIS & WARSHOW
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

DAVIS & WARSHOW (Continued) **1000261803**

Registry ID: 110004342471

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

UST:
Facility Id: 2-214264
Region: STATE
DEC Region: 2
Site Status: Administratively Closed
Program Type: PBS
Expiration Date: N/A
UTM X: 591093.08068999997
UTM Y: 4508536.0727700004

Affiliation Records:
Site Id: 7947
Affiliation Type: Mail Contact
Company Name: DAVIS AND WARSHOW INC MSPETH
Contact Type: Not reported
Contact Name: FRANK FINKEL
Address1: 57-22 48TH ST
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 937-9500
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 7947
Affiliation Type: Owner
Company Name: DAVIS J WARSHOW INC MSPETH
Contact Type: Not reported
Contact Name: Not reported
Address1: 57-22 48TH ST
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 937-9500
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

DAVIS & WARSHOW (Continued) **1000261803**

Site Id:	7947
Affiliation Type:	On-Site Operator
Company Name:	DAVIS AND WARSHOW INC MSPETH
Contact Type:	Not reported
Contact Name:	FRANK FINKEL
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 937-9500
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	7947
Affiliation Type:	Emergency Contact
Company Name:	DAVIS J WARSHOW INC MSPETH
Contact Type:	Not reported
Contact Name:	PETER ROLANDY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 335-2546
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
I00 - Overfill - None
B00 - Tank External Protection - None

Tank Info:

Site ID:	7947

Tank Number:	001
Tank ID:	9864
Tank Status:	Administratively Closed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	8/1/1974
Capacity Gallons:	2000

DAVIS & WARSHOW (Continued) **1000261803**

Tightness Test Method:	01
Next Test Date:	Not reported
Date Tank Closed:	3/28/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/1/1989
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-214264
SPDES Number:	Not reported
Emergency Contact:	PETER ROLANDY
Emergency Telephone:	(718) 335-2546
Operator:	FRANK FINKEL
Operator Telephone:	(718) 937-9500
Owner Name:	DAVIS J WARSHOW INC MSPETH
Owner Address:	57-22 48TH ST
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 937-9500
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	DAVIS AND WARSHOW INC MSPETH
Mailing Address:	57-22 48TH ST
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	FRANK FINKEL
Mailing Telephone:	(718) 937-9500
Owner Mark:	First Owner
Facility Status:	3 - Administratively closed (reasons include business is closed and/or mail is undeliverable, and staff cannot check if tanks were removed; or a duplicate registration was generated).
Facility Addr2:	57022 48TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER RETAIL SALES
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	06/23/1997
Expiration Date:	06/30/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

DAVIS & WARSHOW (Continued) **1000261803**

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Undefined
Install Date:	19740801
Capacity (gals):	2000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	09/01/1989
Next Test Date:	09/01/1994
Missing Data for Tank:	Minor Data Missing
Date Closed:	03/28/2001
Test Method:	Petro-Tite
Deleted:	False
Updated:	False
Lat/long:	Not reported

NY MANIFEST:

EPA ID:	NYD005907621
Country:	USA
Mailing Name:	DAVIS & WARSHOW
Mailing Contact:	DAVIS & WARSHOW
Mailing Address:	5722 49TH STREET
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-937-9500

Document ID:	NYA7101189
Manifest Status:	Completed copy
Trans1 State ID:	000000000
Trans2 State ID:	000000000
Generator Ship Date:	881206
Trans1 Recv Date:	881206
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	881206
Part A Recv Date:	881209
Part B Recv Date:	881213
Generator EPA ID:	NYD005907621
Trans1 EPA ID:	NYD082785429
Trans2 EPA ID:	Not reported
TSDF ID:	NYD082785429
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	00350

DAVIS & WARSHOW (Continued) **1000261803**

Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	007
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	155
Year:	88

E14 **DAVID AND WARSAOW** **NY Spills** **S108956608**
57-02 48TH ST **N/A**
< 1/8 **QUEENS, NY**
1 ft.

Site 3 of 8 in cluster E

Relative: **Lower**

Actual: **2 ft.**

NY Spills:

Site ID:	389697
Facility Addr2:	Not reported
Facility ID:	0708746
Spill Number:	0708746
Facility Type:	ER
SWIS:	4101
Investigator:	RMPIPER
Referred To:	Not reported
Spill Date:	11/12/2007
Reported to Dept:	11/12/2007
CID:	77
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	11/28/2007
Remediation Phase:	0
Date Entered In Computer:	11/12/2007
Spill Record Last Update:	11/28/2007
Spiller Name:	Not reported
Spiller Company:	DAVID AND WARSAOW
Spiller Address:	57-02 48TH ST
Spiller City,St,Zip:	QUEENS, NY
Spiller Company:	001
Contact Name:	FDNY HAZMAT
Contact Phone:	(347) 203-6886 CELL
DEC Region:	2
DER Facility ID:	240357
DEC Memo:	Jeffrey Ferara 57-02 48TH Street LLC 5602 Arnold Ave Maspeth NY 11378-3322 Pat- 718-894- 7000 11/26/07- Piper inspected spill. Spill was at subletted property, Ferarra Cement. Approx 30 gal form a ruptured saddletank spilled to concrete roadway. The area was speedy dried and removed. As seen upon in inspection, water is frequently used and enters separator before being discharges to sewer. Closed.
Remarks:	Spill in yard of above business and address. Per caller no further information available at this time.

DAVID AND WARSAOW (Continued) **S108956608**

Material:

Site ID:	389697
Operable Unit ID:	1146830
Operable Unit:	01
Material ID:	2137217
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

B15 **57-10 49TH STOR PLACE** **NY Spills** **S102102832**
57-10 49TH ST OR PLACE **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
1 ft.

Site 6 of 10 in cluster B

Relative: Higher

Actual: 21 ft.

NY Spills:

Site ID:	125692
Facility Addr2:	Not reported
Facility ID:	9300462
Spill Number:	9300462
Facility Type:	ER
SWIS:	4101
Investigator:	O'DOWD
Referred To:	Not reported
Spill Date:	4/9/1993
Reported to Dept:	4/9/1993
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	2/22/1994
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

57-10 49TH STOR PLACE (Continued) **S102102832**

Spill Closed Dt:	2/22/1994
Remediation Phase:	0
Date Entered In Computer:	4/13/1993
Spill Record Last Update:	2/22/1994
Spiller Name:	Not reported
Spiller Company:	ST THERESA PROPERTIES INC
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	108713
DEC Memo:	Not reported
Remarks:	CALLER IS WAITING FOR F.D.I.C SOIL FOUND IN TEST .FROM PHASR II INVESTIGATION.

Material:

Site ID:	125692
Operable Unit ID:	979121
Operable Unit:	01
Material ID:	401218
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Not reported
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9300462
Investigator:	O'DOWD
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	04/09/1993 15:00
Reported to Dept Date/Time:	04/09/93 16:08

57-10 49TH STOR PLACE (Continued) **S102102832**

SWIS: 63
Spiller Name: ST THERESA PROPERTIES INC
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 02/22/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/22/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/13/93
Date Spill Entered In Computer Data File: Not reported
Update Date: 02/22/94
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 02/22/94: REMOVED 5K UST, TOOK SOIL SAMPLES AND WATER SAMPLE. SEE K.O DOWD S LATTER A:THERESA.DOC. SOIL BACKGROUND LEVELS FOR CINDER ASH AND WATER ND.
Remark: CALLER IS WAITING FOR F.D.I.C SOIL FOUND IN TEST .FROM PHASR II INVESTIGATION.

B16 **S&S WAREHOUSE** **NY Spills** **S106383842**
57-10 49TH PLACE **N/A**
< 1/8 **MASPETH, NY**
1 ft.

Site 7 of 10 in cluster B

Relative:
Higher

Actual:
21 ft.

NY Spills:

Site ID:	111876
Facility Addr2:	Not reported
Facility ID:	0313743
Spill Number:	0313743
Facility Type:	ER
SWIS:	4101
Investigator:	CESAWYER
Referred To:	Not reported
Spill Date:	3/16/2004
Reported to Dept:	3/16/2004
CID:	444
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	4/14/2004
Remediation Phase:	0
Date Entered In Computer:	3/16/2004
Spill Record Last Update:	4/14/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN TANK COMPANY
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	EDDIE CASSIO
Contact Phone:	(718) 381-8300
DEC Region:	2
DER Facility ID:	97802
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER" 4/14/04 - Sawyer - Called S&S and inquired about the spill out side their gate. I was informed that a pile of sawdust was still their containing the spilled diesel fuel. I notified DEP and a Mr. Cotton was going to send sanitation out to pick it up. No further action. Closed.
Remarks:	A HYDRANT WAS BROKEN AND THE TRUCK RIPPED ITS OIL PAN ON HYDRANT, UNSURE IF OIL WENT DOWN HYDRANT LINE: PLACED SAW DUST DOWN, UNSURE IF IT:

Material:

Site ID:	111876
Operable Unit ID:	879030
Operable Unit:	01
Material ID:	495335
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported

S&S WAREHOUSE (Continued) **S106383842**

Material FA:	Petroleum
Quantity:	0
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

B17 **LTANKS S106703197**
57-01 49TH ST **HIST LTANKS N/A**
< 1/8 **MASPETH, NY**
1 ft.

Site 8 of 10 in cluster B

Relative: LTANKS:
Lower

Site ID:	255185
Spill No:	8710202
Actual: Spill Date:	3/5/1988
8 ft. Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/3/2003
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	RWAUSTIN
Referred To:	Not reported
Reported to Dept:	3/5/1988
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	3/18/1988
Spill Record Last Update:	4/21/2004
Spiller Name:	Not reported
Spiller Company:	MARYLU, LLP
Spiller Address:	57-01 49TH ST
Spiller City,St,Zip:	MASPETH, NY
Spiller County:	001
Spiller Contact:	Not reported

(Continued) **S106703197**

Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 209012
Remarks: (2) 5K TANKS WERE TESTED, 1ST FAILED WITH A LEAK RATE OF -0.114GPH, 2ND TANK FAILED WITH A LEAK RATE OF -0.167GPH, RECOMMENDING TO UNCOVERAND RETEST.CLOSED DUE TO LACK OF ANY RECENT INFO- DOES NOT MEET ANY CLEAN UP REQUIREMENTS.

Material:
Site ID: 255185
Operable Unit ID: 915138
Operable Unit: 01
Material ID: 461979
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 255185
Spill Tank Test: 1533386
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:
Region of Spill: 2
Spill Number: 8710202
Spill Date: 03/05/1988
Spill Time: 16:30
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: BATTISTA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported

(Continued) **S106703197**

Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/05/88
Reported to Department Time: 17:22
SWIS: 63
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: VALLACE PACKING CORP.
Spiller Address: 157-04 49TH ST
Spiller City,St,Zip: MASPETH, NY
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 386-1881
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-189758
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/18/88
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/20/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: 2) 5K TANKS WERE TESTED, 1ST FAILED WITH A LEAK RATE OF -0.114GPH, 2ND TANK FAILED WITH A LEAK RATE OF -0.167GPH, RECOMMENDING TO UNCOVERAND RETEST.

B18 **CLOSED-LACKOF RECENT INFO** **LTANKS** **S100145198**
56071 49TH STREET **HIST LTANKS** **N/A**
< 1/8 **NEW YORK CITY, NY**
1 ft.

Site 9 of 10 in cluster B

Relative:
Higher

Actual:
18 ft.

LTANKS:

Site ID:	108870
Spill No:	8804417
Spill Date:	8/19/1988
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/5/2003
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	ADMIN. CLOSED
Referred To:	Not reported
Reported to Dept:	8/19/1988
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	8/22/1988
Spill Record Last Update:	3/19/2003
Spiller Name:	Not reported
Spiller Company:	MANHATTAN BRASS
Spiller Address:	56-71 49TH STREET
Spiller City,St,Zip:	MASPETH, NY
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	95662
Remarks:	3K TANK, PRODUCT WOULDN'T STABILIZE, UNCOVER TANK AND INVESTIGATE. CLOSED DUE TO LACK OF ANY RECENT INFO- DOES NOT MEET ANY CLEAN UP REQUIREMENTS.

Material:

Site ID:	108870
Operable Unit ID:	919397
Operable Unit:	01
Material ID:	456360
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

CLOSED-LACKOF RECENT INFO (Continued) **S100145198**

Tank Test:

Site ID:	108870
Spill Tank Test:	1534491
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/1/2004
Test Method:	Unknown

HIST LTANKS:

Region of Spill:	2
Spill Number:	8804417
Spill Date:	08/19/1988
Spill Time:	09:29
Spill Cause:	Tank Test Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Investigator:	BATTISTA
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	08/19/88
Reported to Department Time:	09:30
SWIS:	63
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	MANHATTAN BRASS
Spiller Address:	56-71 49TH STREET
Spiller City,St,Zip:	MASPETH, NY
Spiller Cleanup Date:	/ /
Facility Contact:	Not reported
Facility Phone:	(718) 639-0536
Facility Extention:	Not reported
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False

CLOSED-LACKOF RECENT INFO (Continued) **S100145198**

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/22/88
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/03/95
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: 3K TANK, PRODUCT WOULDN T STABILIZE, UNCOVER TANK AND INVESTIGATE.

B19 **S AND S WAREHOUSE** **NY Spills** **S106018822**
57-10 49TH PL **N/A**
< 1/8 **QUEENS, NY**
1 ft.

Site 10 of 10 in cluster B

Relative: Higher

Actual: 21 ft.

NY Spills:
Site ID: 327829
Facility Addr2: Not reported
Facility ID: 0307208
Spill Number: 0307208
Facility Type: ER
SWIS: 4101
Investigator: CESAWYER
Referred To: Not reported
Spill Date: 10/8/2003
Reported to Dept: 10/8/2003
CID: 270
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

S AND S WAREHOUSE (Continued) **S106018822**

	Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/16/2003
Remediation Phase:	0
Date Entered In Computer:	10/8/2003
Spill Record Last Update:	3/29/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	263907
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER" 10/7/03 1700 Hrs - Sawyer - Responded to the site. Met FDNY on their way out and talked to FF Carbone as well as the owner Mr. Stephen Duffy. He explained that the FDNY had traced the smell all the way up to the roof before they lost PID reading. I was thoroughly through the warehouse and could not find the source. The smell was strongest in a catch basin and the bathroom. It may have been a loose cap or pipe. NYCDEP's Celeste Okoli showed up near the end of my visit and I thought he was going to request an industrial waste audit on the sewers in the area. He did not. 10/8/03 1000 Hrs - Sawyer - The owner Mr. Duffy called metoday to say that his neighbor's bathroom was now being impacted and was saturated with the smell. I went back to the site and waited 1 hour for Andy Kelly to show and PID meter the same catch basin. I think DEP will handle the situation from here on. Closed.
Remarks:	unknown fumes coming from building. request call back

Material:

Site ID:	327829
Operable Unit ID:	875960
Operable Unit:	01
Material ID:	500769
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

C20 **GALASSO TRUCKING, INC.** **UST** **U003178543**
1 RAILROAD PLACE (49TH LANE) **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 2 of 10 in cluster C

Relative:
Higher

Actual:
13 ft.

UST:

Facility Id:	2-602925
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591480.48987000005
UTM Y:	4508594.57711

Affiliation Records:

Site Id:	24880
Affiliation Type:	Emergency Contact
Company Name:	NEW PENN MOTOR EXPRESS, INC.
Contact Type:	Not reported
Contact Name:	PHILIP GALASSO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(516) 626-1500
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	24880
Affiliation Type:	Mail Contact
Company Name:	E.E.A.
Contact Type:	Not reported
Contact Name:	NICK RECCIA
Address1:	55 HILTON AVENUE
Address2:	Not reported
City:	GARDEN CITY
State:	NY
Zip Code:	11530
Country Code:	001
Phone:	(516) 746-4400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	24880
Affiliation Type:	Owner
Company Name:	NEW PENN MOTOR EXPRESS, INC.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1 RAILROAD PLACE
Address2:	Not reported

GALASSO TRUCKING, INC. (Continued) **U003178543**

City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 456-1800
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	24880
Affiliation Type:	On-Site Operator
Company Name:	GALASSO TRUCKING, INC.
Contact Type:	Not reported
Contact Name:	NEW PENN MOTOR EXPRESS, INC.
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 456-1800
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
H04 - Tank Leak Detection - Groundwater Well
H04 - Tank Leak Detection - Groundwater Well
H04 - Tank Leak Detection - Groundwater Well
H04 - Tank Leak Detection - Groundwater Well
J00 - Dispenser - None
B00 - Tank External Protection - None
J00 - Dispenser - None
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
D01 - Pipe Type - Steel/Carbon Steel/Iron
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

GALASSO TRUCKING, INC. (Continued) **U003178543**

D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
J00 - Dispenser - None
G03 - Tank Secondary Containment - Vault (w/o access)
J00 - Dispenser - None
G03 - Tank Secondary Containment - Vault (w/o access)

Tank Info:

Site ID:	24880
Tank Number:	001
Tank ID:	52109
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	2/1/1997
Tank Location:	6
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	24880
Tank Number:	002
Tank ID:	52110
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	2/1/1997
Tank Location:	6
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	24880
Tank Number:	003
Tank ID:	52111
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550

GALASSO TRUCKING, INC. (Continued) **U003178543**

Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	2/1/1997
Tank Location:	6
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	24880
Tank Number:	004
Tank ID:	52112
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	2/1/1997
Tank Location:	6
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-602925
SPDES Number:	Not reported
Emergency Contact:	PHILIP GALASSO
Emergency Telephone:	(516) 626-1500
Operator:	NEW PENN MOTOR EXPRESS, INC.
Operator Telephone:	(718) 456-1800
Owner Name:	NEW PENN MOTOR EXPRESS, INC.
Owner Address:	1 RAILROAD PLACE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 456-1800
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	E.E.A.
Mailing Address:	55 HILTON AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	GARDEN CITY, NY 11530
Mailing Contact:	NICK RECCIA
Mailing Telephone:	(516) 746-4400
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER
Inspected Date:	Not reported
Inspector:	Not reported

GALASSO TRUCKING, INC. (Continued) **U003178543**

Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	Not reported
Expiration Date:	02/13/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	Diking
Leak Detection:	Groundwater Well
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	02/01/1997
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON

GALASSO TRUCKING, INC. (Continued) **U003178543**

Pipe Internal:	None
Pipe External:	None
Second Containment:	Diking
Leak Detection:	Groundwater Well
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	02/01/1997
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	Diking
Leak Detection:	Groundwater Well
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	02/01/1997
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	Diking

GALASSO TRUCKING, INC. (Continued) **U003178543**

Leak Detection:	Groundwater Well
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	02/01/1997
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

F21 **56-01 MASPETH AVENUE** **HIST UST** **U003127202**
56-01 MASPETH AVENUE **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 1 of 12 in cluster F

Relative: Higher

Actual: 20 ft.

HIST UST:

PBS Number:	2-602775
SPDES Number:	Not reported
Emergency Contact:	JON DAN
Emergency Telephone:	(718) 821-5461
Operator:	JON DAN
Operator Telephone:	(718) 456-7000
Owner Name:	H.L.H. REALTY ASSOC.
Owner Address:	56-01 MASPETH AVENUE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 456-7000
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	H.L.H. REALTY ASSOC.
Mailing Address:	56-01 MASPETH AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	Not reported
Mailing Telephone:	(718) 456-7000
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	True
Certification Date:	Not reported
Expiration Date:	09/13/2006
Renew Flag:	False
Renewal Date:	20011220
Total Capacity:	11500
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data

56-01 MASPETH AVENUE (Continued) **U003127202**

Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS
Tank Status:	In Service
Install Date:	19631201
Capacity (gals):	6500
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Float Vent Valve
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported

56-01 MASPETH AVENUE (Continued) **U003127202**

Deleted: False
Updated: True
Lat/long: Not reported

F22 **56-01 MASPETH AVENUE** **UST** **U004078250**
56-01 MASPETH AVENUE **N/A**
< 1/8 **MASPETH, NY 11378**
1 ft.

Site 2 of 12 in cluster F

Relative:
Higher

Actual:
20 ft.

UST:
Facility Id: 2-602775
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2011/09/13
UTM X: 591719.79929
UTM Y: 4508566.2241900004

Affiliation Records:
Site Id: 24731
Affiliation Type: Owner
Company Name: H.L.H. REALTY ASSOCIATES
Contact Type: MAINTENANCE MAN
Contact Name: JON DAN
Address1: 56-01 MASPETH AVENUE
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 456-7000
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: msbaptis
Date Last Modified: 10/5/2006

Site Id: 24731
Affiliation Type: Emergency Contact
Company Name: H.L.H. REALTY ASSOCIATES
Contact Type: Not reported
Contact Name: JON DAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 821-5461
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 24731

56-01 MASPETH AVENUE (Continued) **U004078250**

Affiliation Type:	Mail Contact
Company Name:	H.L.H. REALTY ASSOCIATES
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	56-01 MASPETH AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 456-7000
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	24731
Affiliation Type:	On-Site Operator
Company Name:	56-01 MASPETH AVENUE
Contact Type:	Not reported
Contact Name:	JON DAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 456-7000
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

L09 - Piping Leak Detection - Exempt Suction Piping
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
I05 - Overfill - Vent Whistle
G03 - Tank Secondary Containment - Vault (w/o access)
C01 - Pipe Location - Aboveground
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F01 - Pipe External Protection - Painted/Asphalt Coating
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
G03 - Tank Secondary Containment - Vault (w/o access)
L09 - Piping Leak Detection - Exempt Suction Piping
H00 - Tank Leak Detection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
C01 - Pipe Location - Aboveground
I01 - Overfill - Float Vent Valve

56-01 MASPETH AVENUE (Continued) **U004078250**

Tank Info:

Site ID:	24731
Tank Number:	001
Tank ID:	51464
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	6500
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	6
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	24731
Tank Number:	002
Tank ID:	51465
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	6
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

F23 **NORDIC INTERIORS INC-56-01 MASPETH AVE** **FINDS** **1007810611**
56-01 MASPETH AVENUE **N/A**
< 1/8 **QUEENS, NY 11378**
1 ft.

Site 3 of 12 in cluster F

Relative: Higher

Actual: 20 ft.

FINDS:

Registry ID: 110019731511

Environmental Interest/Information System

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

G24 **CANADA DRY CORP** **FINDS** **1007782198**
50-35 56 ROAD **N/A**
< 1/8 **MASPETH, NY 11378**
0.000 mi.
2 ft. **Site 1 of 3 in cluster G**

Relative:
Higher

Actual:
23 ft.

FINDS:

Registry ID: 110019446642

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

G25 **PEPSI-COLA/CANADA DRY** **UST** **U001835219**
50-35 56TH ROAD **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.000 mi.
2 ft. **Site 2 of 3 in cluster G**

Relative:
Higher

Actual:
23 ft.

UST:

Facility Id:	2-277010
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2016/06/29
UTM X:	591155.625
UTM Y:	4508924

Affiliation Records:

Site Id:	11952
Affiliation Type:	On-Site Operator
Company Name:	PEPSI-COLA/CANADA DRY
Contact Type:	Not reported
Contact Name:	PHIL IANORA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 392-1000
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	kakyer
Date Last Modified:	3/11/2008

Site Id:	11952
Affiliation Type:	Mail Contact
Company Name:	PEPSI COLA BOTTLING CO. OF NEW YORK
Contact Type:	Not reported
Contact Name:	ROBERT SHERMAN
Address1:	112-02 15 AVE
Address2:	Not reported
City:	COLLEGE PT
State:	NC

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

Zip Code:	11356
Country Code:	001
Phone:	(718) 392-1000
Phone Ext:	Not reported
Email:	SHERMANR@PEPSI-NY.COM
Fax Number:	Not reported
Modified By:	kakyer
Date Last Modified:	3/11/2008

Site Id:	11952
Affiliation Type:	Owner
Company Name:	NY MASPETH, LLC.
Contact Type:	VP OPERATIONS
Contact Name:	ROBERT SHERMAN
Address1:	8275 RTE 103
Address2:	Not reported
City:	PENNSANKEN
State:	NJ
Zip Code:	08110
Country Code:	001
Phone:	(856) 665-6200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	kakyer
Date Last Modified:	3/11/2008

Site Id:	11952
Affiliation Type:	Emergency Contact
Company Name:	NY MASPETH, LLC.
Contact Type:	Not reported
Contact Name:	PHIL IANORA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 392-1000
Phone Ext:	2539
Email:	Not reported
Fax Number:	Not reported
Modified By:	kakyer
Date Last Modified:	3/11/2008

Equipment Records:

J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
J00 - Dispenser - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

I00 - Overfill - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
D00 - Pipe Type - No Piping
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
I00 - Overfill - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
K00 - Spill Prevention - None
K00 - Spill Prevention - None
K00 - Spill Prevention - None
I04 - Overfill - Product Level Gauge (A/G)
E00 - Piping Secondary Containment - None
I00 - Overfill - None
B00 - Tank External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
G00 - Tank Secondary Containment - None
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
D00 - Pipe Type - No Piping
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
E00 - Piping Secondary Containment - None
I00 - Overfill - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
K00 - Spill Prevention - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
D00 - Pipe Type - No Piping
J00 - Dispenser - None
D00 - Pipe Type - No Piping
H00 - Tank Leak Detection - None

Tank Info:
Site ID: 11952

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

Tank Number:	001
Tank ID:	14044
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	11952
Tank Number:	002
Tank ID:	14045
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	11952
Tank Number:	003
Tank ID:	208273
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/30/2005
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	10/11/2005
Site ID:	11952

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

Tank Number: 004
Tank ID: 208271
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 550
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 9/30/2005
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 10/11/2005

Site ID: 11952

Tank Number: 005
Tank ID: 208272
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 550
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 9/30/2005
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 10/11/2005

Site ID: 11952

Tank Number: 006
Tank ID: 14046
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 8/1/1955
Capacity Gallons: 15000
Tightness Test Method: 21
Next Test Date: 1/14/2013
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 1/14/2008
Register: True
Modified By: BVCAMPBE
Last Modified: 4/6/2011

HIST UST:
PBS Number: 2-277010

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

SPDES Number:	Not reported
Emergency Contact:	STEVEN KUCERAK
Emergency Telephone:	(718) 670-3300
Operator:	CANADA DRY
Operator Telephone:	(718) 786-8550
Owner Name:	219 CORP
Owner Address:	111 BROADWAY -SUITE 900
Owner City,St,Zip:	NEW YORK, NY 10003
Owner Telephone:	(718) 784-7793
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	CANADA DRY BOTTLING CO OF NY
Mailing Address:	112-02 15TH AVE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	COLLEGE POINT, NY 11356
Mailing Contact:	MR. STEVEN KUCERAK
Mailing Telephone:	(718) 670-3300
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	50035 56TH AVE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	08/05/1998
Expiration Date:	07/10/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	15000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19550801
Capacity (gals):	15000
Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None

PEPSI-COLA/CANADA DRY (Continued) **U001835219**

Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	10/01/1988
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Horner EZ Check
Deleted:	False
Updated:	False
Lat/long:	Not reported

G26 **CANADA DRY** **NY Spills S103573870**
50-35 56TH ROAD **NY Hist Spills N/A**
< 1/8 **MASPETH, NY**
0.000 mi.
2 ft. **Site 3 of 3 in cluster G**

Relative: Higher

Actual: 23 ft.

NY Spills:

Site ID:	113227
Facility Addr2:	Not reported
Facility ID:	9809793
Spill Number:	9809793
Facility Type:	ER
SWIS:	4101
Investigator:	aaobliga
Referred To:	NFA
Spill Date:	11/4/1998
Reported to Dept:	11/4/1998
CID:	266
Spill Cause:	Housekeeping
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	7/25/2007
Remediation Phase:	0
Date Entered In Computer:	11/4/1998
Spill Record Last Update:	10/2/2007
Spiller Name:	PHIL IANORA
Spiller Company:	CANADA DRY
Spiller Address:	Not reported
Spiller City,St,Zip:	COLLEGE POINT, NY
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	98812
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "VOUGHT" 05/18/01 Reassigned from Saccacio to Sangesland. 4/27/04 transferred from Sangesland to Vought. 5/28/04-Vought-File review by Vought: Closure Report for 2-4,000 Gallon Capacity Diesel USTs at

CANADA DRY (Continued) **S103573870**

50-36 56th Avenue (NAC Environmental Brian Costello)- January 21, 1999. Four post excavation soil samples and one groundwater sample were collected from the limits of the overexcavation. "The examination of the piping revealed signs of corrosion and loose fittings". "Approximately 380 tons of contaminated soil was removed...". "Petroleum contaminated soil and free petroleum product was observed in the excavation and on the groundwater after the tanks were removed from their subsurface location". "NAC recommends a remedial investigation to fully delineate the soil and groundwater contamination". Approximately 60 feet of piping connected the USTs to the dispenser at the pump island. Groundwater at a depth of 13' below grade. Soil analyticals show no TAGM 4046 Required Soil Cleanup Objective exceedences. Groundwater analyticals show up to 39ppb xylene, 140ppb 1,2,4-trimethylbenzene, 270ppb napthalene, 21ppb MTBE, 590ppb benzo(a)anthracene(S1), 590ppb chrysene(S1), 490ppb benzo(b,k)flouranthene(S1) and 530ppb benzo(a)pyrene(S1). NAC recommends installation of three monitoring wells. Letter from NAC(Costello) to DEC(O'Dowd)-2/25/99. "NAC Environmental is proposing the implementation of the following remedial investigation activities"...determination if impacted soils remain in place, determine if groundwater has been impacted and to prepare reports for submital to DEC via the installation of twelve Geoprobe borings and the collection of four groundwater samples. Letter from DEC(O'Dowd) to Pepsi-3/19/99. "Additional investigation if warranted". DEC requires Pepsi to delineate the full extent of diesel contamination of soil and groundwater on and off-site. Report must be submitted to the DEC by 6/30/99. Site Investigation Activities (EnSolutions Robert Lynch)-6/6/99. Property is currently operated as a warehouse/distribution center for soft drinks. Tanks were located on the northeastern side of property . Excavation of USTs extended to 13' below grade. Nine delineation borings performed in April 1999 with two attempts to collect groundwater samples. " A sample was not collected at boring B-3a since the PID detector indicated the presence of volatile organic compounds and petroleum odors, and a sheen was evident at approximately 5.5 feet below ground surface". "The data indicates that residual diesel fuel is present near the former dispenser island and near the expected water table". Strong petroleum odors at B3a, B4 and B6. Soil analyticals minor PAH exceedences attributable to fill (up to 320ppb benzo(a)anthracene(B4), 3800ppb chrysene(B4) and 3900ppb benzo(b)floranthene(B4)). "it is expected that the residual diesel fuel in soils near the former dispenser will naturally biodegrade". Report also recommends the installation of three monitoring wells and determination of groundwater flow direction. Groundwater Investigation and Remedial Action Plan (Ensolutions)- 11/30/99. Three monitoring wells were installed via air rotary. "Free product at a thickness of .84 feet was encountered in MW1". Groundwater analyticals show up to 22ppb ethylbenzene(MW1), 260ppb 1,2,4-trimethylbenzene(MW1), 300ppb napthalene(MW1), 240ppb xylene(MW1), 7.2ppb sec-butylbenzene(MW2) and 7.3ppb n-butylbenzene(MW2). Report recommends no further action with respect to soils because "it is expected that the residual diesel components in these soils will naturally biodegrade". Report also recommends no active groundwater remediation because "it is anticipated that the groundwater will naturally attenuate". Report also recommends bio-slurping of free product in MW1 via vaccum truck and semi-annual groundwater monitoring for two years. Semi-Annual Progress Report

CANADA DRY (Continued) **S103573870**

(EnSolutions)-4/26/00. "Enhanced fluid recovery, bio-slurping, was also implemented...". Free product at a thickness of .39' was encountered in MW1. Depth to water from 14-16'. Groundwater analyticals show up to 5.3ppb ethylbenzene(MW1), 51ppb 1,2,4-trimethylbenzene(MW1), 250ppb napthalene(MW1), 17.9ppb xylene(MW1) and 8.1ppb sec-butylbenzene(MW2). Report recommends no active remediation of groundwater due to natural biodegradation, continuation of EFR on MW1, installation of ORC socks in MW2 and MW3. Semi-Annual Progress Report (EnSolutions)-3/28/01. "Product was noted on well MW1 and was measured at a thickness of .44'." Depth to water from 14-16'. Groundwater analyticals show up to 65ppb ethylbenzene(MW1), 230ppb n-propylbenzene(MW1), 430ppb 1,3,5-trimethylbenzene(MW1), 200ppb napthalene(MW1), 260ppb xylene(MW1), 9ppb toluene(MW2), 27ppb 1,2,4-trimethylbenzene(MW2), 13ppb napthalene(MW2), 5.5ppb napthalene(MW3) and 10.8ppb MTBE(MW3). Report recommends no active remediation of groundwater due to natural biodegradation and continuation of EFR on MW1. Semi-Annual Progress Report (Ensolutions)-9/30/01. "Product was noted on well MW2 and was measured at a thickness of .62'". Depth to water from 14-16'. Groundwater anayticals show up to 14ppb benzene(MW1), 18ppb ethylbenzene(MW1), 140ppb xylene(MW1), 13ppb toluene(MW2) and .6ppb benzene(MW3). Report recommends no active remediation of groundwater. Semi-Annual Progress Report (Ensolutions)-3/29/02. "Product was noted on well MW2 and was measured at a thickness of 2.97" ". Depth to water from 14-19'. Groundwater anayticals show up to 10ppb ethylbenzene(MW1), 100ppb xylene(MW1), 150ppb 1,2,4-trimethylbenzene(MW1) and 210ppb napthalene(MW1). "To continue to address the residual product in MW1, adsorbent socks were placed in well MW1 during December 2001. Report recommends no active groundwater remediation, continued use of adsorbent socks and groundwater monitoring. Fax Cover Letter from DEC Sangesland to Ensolutions(Lynch) 5/6/02. Sangesland required: 1)groundwater flow direction on site plan 2)short hand method to indicate BTEX levels in wells along with product thickness 3)on historical summary, a notation for product thickness. Semi-Annual Progress Report (EnSolutions)-9/29/02. "No further action is warranted with respect to the soils". "It is anticipated that the groundwater will naturally attenuate and no active remediation of groundwater is recommended". 2.24' of free product in well MW1. Depth to groundwater was 14-19'. Groundwater analyticals show 10ppb ethylbenzene(MW1), 150ppb 1,2,4-trimethylbenzene(MW1), 210ppb napthalene(MW1), 100ppb xylene(MW1) and 110ppb toluene(MW2). Groundwater flow direction to the southwest. Semi-Annual Progress Report (EnSolutions)-3/31/03. "No further action is warranted with respect to the soils". "It is anticipated that the groundwater will naturally attenuate and no active remediation of groundwater is recommended". .05' of free product in well MW1. Depth to groundwater was 13-15'. Groundwater analyticals show 59ppb 1,3,5-trimethylbenzene(MW1), 130ppb 1,2,4-trimethylbenzene(MW1), 260ppb napthalene(MW1), 90ppb xylene(MW1) and 180ppb toluene(MW2). Groundwater flow direction to the southwest. Semi-Annual Progress Report (EnSolutions)-9/28/03. "No further action is warranted with respect to the soils". "It is anticipated that the groundwater will naturally attenuate and no active remediation of groundwater is recommended". Depth to water is 12-14' and .04' of free product found in MW1. Groundwater analyticals show 220ppb 1,3,5-trimethylbenzene(MW1), 270ppb 1,2,4-trimethylbenzene(MW1), 340ppb napthalene(MW1) and 190ppb

CANADA DRY (Continued) **S103573870**

xylene(MW1). Groundwater flow direction to the southwest. Semi-Annual Progress Report (EnSolutions)-3/23/04. "No further action is warranted with respect to the soils". "It is anticipated that the groundwater will naturally attenuate and no active remediation of groundwater is recommended". Depth to water is 12-15' and .11' of free product found in MW1. Groundwater analyticals show 74ppb 1,3,5-trimethylbenzene(MW1), 140ppb 1,2,4-trimethylbenzene(MW1), 180ppb napthalene(MW1), 76ppb xylene(MW1) and 64ppb toluene(MW2). Groundwater flow direction to the South-southwest. DEC requires: 1)Installation of well at B3a, B4 and downgradient (Southsouthwest) of MW1 2)scaled site plan with tank excavation, all previous boring locations, former pump island location and well locations.
6/2/04-Vought-Sent letter with above requirments to site owner: Mr. Robert Sherman Pepsi Cola Bottling Company of New York 117-02 15th Avenue College Point, NY 11356 Fax: (718)460-1467
8/16/04-Vought-Spoke to Michael Mellinger 212-460-0047 (attorney for the property owner) and will fax him FOIL request.
11/1/04-Vought-Reviewed Progress Report-Request for No Further Action (EnSolutions) received on 7/28/04. "It is expected that the residual diesel fuel in the soils near the former dispenser island (boring B3b and B4 will naturally biodegrade. Therefore no further action is warranted with respect to the soils..." "It is anticipated that the groundwater will naturally attenuate and no active remediation of the groundwater is recommended at this time". Vought sent letter with same requirements as 6/10/04 letter including: 1)installation of sentinel wells 2)groundwater sampling for natural attenuation parameters 3)sensitive receptor survey and locations of fill ports and dispenser islands. 11/19/04-Vought-Site visit by Vought with Pepsi Sherman and Ensolutions Lynch. Letter dated 11/1/04 hand delivered to Sherman. Ensolutions received approval from DEC to: 1)take current round of groundwater samples 2)begin VEFR on site 3)install additional wells pending groundwater results.
12/2/05-Vought-Received numerous messages from Fredricks that he will be and then was at site. Vought returned call (561-684-9770) and spoke to Fredricks. Well that contained 6" of free product was clean and well at edge of property contained free product which was fingerprinting to show 20 year old diesel. DEC requires: 1)groundwater results with surrounding area site plan. Report will be received by 3/1/05. 4/7/05-Vought-Reviewed Progress Report (Ensolutions) dated 2/18/05 and received on 2/22/05. "The report provides the NYSDEC with the following information as requested: 1. Analytical results of the semi-annual groundwater monitoring at the site from December 2004.". "Although the results were not indicative of a source requiring active remediation one well did contain free product. Therefore since free product was limited to a small area around MW1 the only impacted well, enhanced fluid recovery, bioslurping and the installation of absorbent socks was implemented, in addition to the required monitoring activities, to address contamination at the site". "Due to heavy rain and runoff no groundwater sample could be collected from wells MW-3". .01" of free product in MW2. Three monitoring wells were installed in December 2004. .21" of free product was found in MW-6. "No sensitive receptors or wells were observed on the subject property and adjacent properties to the subject property". 2" of free product in MW2 in 11/04. Fingerprint analysis of free product from MW6 shows "it most closely resembles a degraded diesel #2 fuel oil". "The historic site plan,...indicates that the adjacent property, currently Duane Read

CANADA DRY (Continued) **S103573870**

had (2) 30,000 gallon AST fuel oil tanks within 100' feet of the subject property, along the northern boundary where MW2 and MW6 exist". A site inspection notes that one of the 30,000 gallon AST fuel oil tanks still exist within 100'feet of the subject property...". "Therefore based upon this information it appears that the free product in MW2 and MW6 would be from and offsite source". Report recommends: 1)evaluation of possible offsite sources 2)groundwater sampling should be performed in March 2005 3)future use of EFR should be evaluated. 4/8/05-Vought-Fax from Ensolutions dated 3/29/05. "As discussed after your site visit and on the phone this morning, we will be implementing the delineation soil and groundwater sampling, as requested, at the above site on April 14, 2005." "We expect to have a report to you including the March 2005 groundwater monitoring event results, by mid May 2005." Proposal for the installation of six borings (one upgradient, one downgradient and four cross gradient). After review DEC required: 1)Continued EFR on MW1, 2 and 6 2)quarterly groundwater monitoring 3)additional boring downgradient and one boring located between Duane Reade and well with free product. Vought spoke to Fredricks and and sent letter with above requirements. 5/27/05-Vought-Reviewed Quarterly Monitoring and Delineation Sampling Results Report (EnSolutions Lynch) dated 5/13/05 and received 5/17/05. .05' free product in MW2 and .12' of free product found in MW6. Eight monitoring wells were installed in April 2005. "A vacuum truck from AARCO environmental services was dispatched to the site on March 7, 2005 to implement the enhanced fluid recovery". EFR performed on MW1, MW2, MW3, MW4, MW5 and MW6. Groundwater analyticals from March monitoring show 51ppb xylene(MW2), 12ppb MTBE(MW4), 16ppb benzene(MW5), 52ppb ethylbenzene(MW5), 62ppb xylene(MW5), 15ppb benzene(MW6), 85ppb ethylbenzene(MW6), 160ppb xylene(MW6). Groundwater analyticals show: 32ppb 1,2,4-trimthylbenzene(W1), 13ppb 1,3,5-trimethylbenzene(W1), 15ppb 1,2,4-trimethylbenzene(W5), 240ppb xylene(W8), 380ppb 1,2,4-trimethylbenzene(W8), 140ppb 1,3,5-trimethylbenzene(W8). Report recommends that 1)EFR continue to remove any remaining free product 2)"the groundwater at the site has been monitored for more than 5 years given that no new source has been confirmed onsite and that EFR has been effective in removing free product, perform quarterly groundwater monitoring for one year". Note the following from UST Closure Report dated 1/21/99 "Petroleum contaminated soil and free petroleum product was observed in the excavation and on the groundwater after the tanks were removed from their subsurface location". 8/18/05-Vought-Received call from Balachandra Sudarshan (201-635-0023x107) and returned call and left second message. 9/21/05 - Obligado - File transfered from Vought to Obligado 9/29/05- Obligado- Received call from Balchandra Sudarshan (973) 489-3957 of 219 Corporation. Said 3 550gallon abandoned gasoline tanks were encountered and were in the process of being excavated. The tanks had been abandoned by filling with water, however the first tank pulled h had about 3" of producted floating in it. He said the tanks didn't appear to have any holes or leaks. Inquired about soil sample collection. Obligado instructed Sudarshan to take endpoint soil samples for 8260/8270 from the four sidewalls and the bottom of the excavation. Sudarshan said a UST Closure report would be sent to the Department. 9/30/05 - Obligado- Obligado site visit with DEC Sun and DEC Feng to inspect UST Excavation. Met with Sudarshan, two tanks had been excavated, one tank was still in the ground awaiting excavation. INformed Sudarshan to take sidewall and endpoint samples prior to

CANADA DRY (Continued) **S103573870**

back fill. 2/17/06 - Obligado - review Quarterly Monitoring and Delineation Sampling Results Report, for 6/22/05 and 9/21/05. Notable gw impacts in ppb: (6/22/05) - MW4 - sheen, MW5 - sheen, MW6 - 0.16 ft product MW2 - 120 napthalene, 110 1,2,4 trimethlybenzene, 57 xylenese, ... MW5 - 180 napthalene, 120 1,2,4 trimethalybenzene, 48 xylenese, ... (9/21/05) - MW4 - 0.02 ft product, MW6 - 0.03 ft product. MW2 - 240 napthalene, 92 1,2,4 trimethlybenzene, 27 1,3,5 trimethlybenzene MW6 - 150 napthalene, 93 1,2,4 trimethlybenzene Conclusions - minimum free product remaining. Constituents of concern only slightly above ground water standards. USTs have been closed. 380 tons of contaminate soil removed. No onsite sources at the site. Free product estimated to be 20 years old. Site is delineated. Recommendations - One additioanl EFR event before next quarterly event (December 05). After 2 quarterly monitoring events (12/05 and 3/06) will request closure request closure in May 2006. Called Ensolutions - (561) 684-9770 left message to call back NYSDEC. Spoke to Howard Fredricks, said I should expect a final monitoring report in May 06 if no product is encountered in the March 06 sampling event. In December sampling event, no measurable product was encountered, just a sheen. Informed him of eDocs requirement for next report submittal. 5/8/06 - Obligado - Received quarterly monitoring report for 4Q05 and 1Q06. Product encountered in MW5 (0.08 ft), and MW6 (0.04 ft). Recommended additional EFR events to remove product and monitoring. 5/16/06 - Obligado - Voice mail from Chandra, called back and left message to call DEC. 5/18/06 - Obligado - Received closure report. No VOCs in excess. PAHs exceedences probably from fill material. 1/5/07 - Obligado - Received Monitoring report for 2Q06 and 3Q06. Enhanced fluid reovery during each effent was less than 200 gallons and no product was observed in the tank truck. Sensitive receptor survey found no sensitive receptors. IN 6/22/06 - 0.39 ft of product found in MW6. On 9/25/06 - 0.96 ft of product found in MW2 (center of excavation footprint). The report also had an exposure assessment and requested annual monitoring instead of quarterly. Called Howard Fredrich and denied that request due to almost 1 foot of product. Asked him in the next report to include a trend analysis of product thickness with respect to water table elevation. He was suprised by the 0.96 ft product thickness in the report and said it was probably a typo because he didn't recall seeing that much product and he would review and correct the mistake. 1/5/07 - Obligado - Later that day receiveed a faxed from Fredericks of ensolutions. Sent me field report of work conducted by Terranova. Product thicknesses in 9/06 were 0.06 ft in MW2, 0.05 ft in MW5, and 0.03 ft in MW6. 6/28/07 - Obligado - Received phone call from Howard Fredericks. He wanted to know if I had reviewed the report yet. I hadn't. He will call back next week after Ive had a chance to review it. 7/25/07 - Obligado - REviewed 1Q07 and 2Q07 Progress Report and NFA request. 1Q07 gw results had max total BTEX 15 ppb (MW6), no MTBE exceedences, and a max total VOCs of 521 ppb in MW6. Only a sheen (0.01 ft) of product in 1 well. 2Q07 had total BTEX of 28 ppb (MW6), no MTBE above standards, and max total VOCs of 289 ppb in MW6 and no LNAPL. After review of gw data, exposure assessment, and discussion with DEC Joe Sun, decide to close the spill based on the following 1) source removed and 380 tons of contaminated soil 2) 6.5 years of monitoring and plume does not appear to be migrating off-site. 4) Sensitive receptor survey shows no public supply wells within 1 mile radius of site, industrial area with no residential units within .25 miles 5)only minor exceedences of TOGs for BTEX and MTBE and low

CANADA DRY (Continued) **S103573870**

total vocs of only 289 ppb 6) absence of free product. This site does not appear to be a threat to public health or the environment. This spill has been closed. An NFA letter has been sent to Pepsi Cola.

Remarks: SOIL CONTAMINATIOND FOUND REMOVAL REMOVAL OF TWO 4000 GALLON UNDERGROUND STORAGE TANKS. APPROXIMATELY 50 YARDS TO BE STOCKPILED SO FAR.

Material:

Site ID:	113227
Operable Unit ID:	1070878
Operable Unit:	01
Material ID:	313687
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9809793
Investigator:	SANGESLAND
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	11/04/1998 10:15
Reported to Dept Date/Time:	11/04/98 10:34
SWIS:	63
Spiller Name:	CANADA DRY
Spiller Contact:	PHIL IANORA
Spiller Phone:	(718) 392-1000
Spiller Phone:	( ) -
Spiller Address:	Not reported
Spiller City,St,Zip:	COLLEGE POINT, NY
Spill Cause:	Housekeeping
Reported to Dept:	On Land
Water Affected:	Not reported

CANADA DRY (Continued) **S103573870**

Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/04/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 05/18/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 05/18/01 Reassigned from Saccacio to Sangesland.
Remark: SOIL CONTAMINATIOND FOUND REMOVAL REMOVAL OF TWO 4000 GALLON UNDERGROUND STORAGE TANKS. APPROXIMATELY 50 YARDS TO BE STOCKPILED SO FAR.

D27 **46-05 56TH RD/UPS** **HIST LTANKS** **S100153854**
46005 56TH RD/UPS **N/A**
< 1/8 **MASPETH, NY**
0.000 mi.
2 ft. **Site 2 of 9 in cluster D**

Relative: Higher

Actual: 17 ft.

HIST LTANKS:
Region of Spill: 2
Spill Number: 9102712
Spill Date: 06/06/1991
Spill Time: 13:00
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported

46-05 56TH RD/UPS (Continued) **S100153854**

Spill Source:	Other Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Investigator:	sullivan
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	06/07/91
Reported to Department Time:	11:42
SWIS:	63
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	UPS
Spiller Address:	46-05 56TH RD
Spiller City,St,Zip:	JESSIE SADEJ
Spiller Cleanup Date:	/ /
Facility Contact:	Not reported
Facility Phone:	(212) 330-6533
Facility Extention:	Not reported
Spill Notifier:	Other
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	06/11/91
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	07/03/95
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	-1
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False

46-05 56TH RD/UPS (Continued) **S100153854**

Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: FOUND CONTAMINATED SOIL AROUND TANKS. DEC ON SCENE. EXCAVATING AT PRESENT TIME.

F28 **MASPETH AVE & RUST AVE** **NY Spills** **S107407344**
MASPETH AVE & RUST AVE **N/A**
< 1/8 **MASPETH, NY**
0.001 mi.
5 ft. **Site 4 of 12 in cluster F**

Relative: Higher

Actual: 23 ft.

NY Spills:
Site ID: 182776
Facility Addr2: Not reported
Facility ID: 9830019
Spill Number: 9830019
Facility Type: ER
SWIS: 4101
Investigator: SIGONA
Referred To: Not reported
Spill Date: 12/29/1998
Reported to Dept: 12/29/1998
CID: Not reported
Spill Cause: Abandoned Drums
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Unknown Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 1/6/1998
Remediation Phase: 0
Date Entered In Computer: 12/29/1998
Spill Record Last Update: 1/12/1999
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
DER Facility ID: 153120
DEC Memo: Not reported
Remarks: ONE 55-GALLON DRUM WITH A 35-GALLON DRUM INSIDE ABANDONED RIGHT ON THE STREET BY FEN. FIELD INVESTIGATION INDICATED NOT HARZARDOUS, APPEARENTLY IT IS SOME KIND OF PETROLIUM PRODUCT. DEP-HAZMAT WANT DEC SEND SOME ONE OVER THERE.

Material:
Site ID: 182776

MASPETH AVE & RUST AVE (Continued) **S107407344**

Operable Unit ID:	1073920
Operable Unit:	01
Material ID:	309049
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

F29 **MASPETH AVE & RUST AVE** **NY Spills** **S103575950**
MASPETH AVE & RUST AVE **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.001 mi.
5 ft. **Site 5 of 12 in cluster F**

Relative:
Higher

Actual:
23 ft.

NY Spills:

Site ID:	151952
Facility Addr2:	Not reported
Facility ID:	0400976
Spill Number:	0400976
Facility Type:	ER
SWIS:	4101
Investigator:	SMSANGES
Referred To:	Not reported
Spill Date:	4/28/2004
Reported to Dept:	4/28/2004
CID:	407
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	4/29/2004
Remediation Phase:	0

MASPETH AVE & RUST AVE (Continued) **S103575950**

Date Entered In Computer: 4/28/2004
Spill Record Last Update: 4/29/2004
Spiller Name: ROB LOWE
Spiller Company: KEYSPAN
Spiller Address: 175 EAST OLD COUNTRY ROAD
Spiller City,St,Zip: HICKSVILLE, NY 11801
Spiller Company: 001
Contact Name: ROB LOWE
Contact Phone: (516) 545-5589
DEC Region: 2
DER Facility ID: 128998
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND" minor spill from a vehicle onto paved area. All Cleaned
Remarks: Spill has been cleaned up.

Material:
Site ID: 151952
Operable Unit ID: 882921
Operable Unit: 01
Material ID: 492206
Material Code: 0010
Material Name: Hydraulic Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: Yes
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9830019
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/29/1998 10:05
Reported to Dept Date/Time: 12/29/98 10:05
SWIS: 63
Spiller Name: UNKNOWN

MASPETH AVE & RUST AVE (Continued) **S103575950**

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Abandoned Drums
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Unknown Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 01/06/98
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/29/98
Date Spill Entered In Computer Data File: 10:33
Update Date: 01/12/99
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: DEC SIGONA HIRED Miller Environmental Group to remove the abandoned drum. PIN 00826, T A C424 Cost Center 90008260--98. The contents were tested by DEP and found to contain petroleum. DEC Sigona) requested that DEP fax a copy of lab report. Spoke to Stanley Seidenberg on 1/6/99, and confirmed that lab report would be sent to DEC. ONE 55 GALLON DRUM WITH A 35 GALLON DRUM INSIDE ABANDONED. FIELD TEST INDICATED NO HAZARDOUS INSIDE APPARENTLY THE DRUM CONTAIN SOME KIND OF PETROLEUM PRODUCT. HAZMAT WANTS DEC TO SEND SOMEONE THERE.
Remark: ONE 55-GALLON DRUM WITH A 35-GALLON DRUM INSIDE ABANDONED RIGHT ON THE STREET BY FEN. FIELD INVESTIGATION INDICATED NOT HARZARDOUS, APPEARENTLY IT IS SOME KIND OF PETROLIUM PRODUCT. DEP-HAZMAT WANT DEC SEND SOME ONE OVER THERE.

F30 **LIRR** **NY Spills** **S102102726**
SSE **LIRR/MASPETH AVE CROSSING** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.001 mi.
7 ft. **Site 6 of 12 in cluster F**

Relative:
Higher

Actual:
21 ft.

NY Spills:

Site ID:	183201
Facility Addr2:	Not reported
Facility ID:	9201542
Spill Number:	9201542
Facility Type:	ER
SWIS:	4101
Investigator:	KSTANG
Referred To:	Not reported
Spill Date:	5/7/1992
Reported to Dept:	5/7/1992
CID:	Not reported
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Railroad Car
Spill Notifier:	Responsible Party
Cleanup Ceased:	5/7/1992
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	5/7/1992
Remediation Phase:	0
Date Entered In Computer:	5/11/1992
Spill Record Last Update:	4/30/2004
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	153477
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TANG" 10/10/95: This is additional information about material spilled from the translation of the old spill file: HYDRAULIC FLUID.
Remarks:	SORBENT APPLIED & PICKED UP.

Material:

Site ID:	183201
Operable Unit ID:	965627
Operable Unit:	01
Material ID:	412847
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported

LIRR (Continued) **S102102726**

Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9201542
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/07/1992 14:00
Reported to Dept Date/Time: 05/07/92 15:00
SWIS: 63
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 11
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 05/07/92
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/07/92
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/11/92
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

LIRR (Continued) **S102102726**

Tank:
- PBS Number: Not reported
- Tank Number: Not reported
- Tank Size: Not reported
- Test Method: Not reported
- Leak Rate Failed Tank: Not reported
- Gross Leak Rate: Not reported

Material:
- Material Class Type: Petroleum
- Quantity Spilled: 5
- Unkonwn Quantity Spilled: False
- Units: Gallons
- Quantity Recovered: 0
- Unkonwn Quantity Recovered: False
- Material: UNKNOWN PETROLEUM
- Class Type: UNKNOWN PETROLEUM
- Times Material Entry In File: 16414
- CAS Number: Not reported
- Last Date: 19940929
- DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: HYDRAULIC FLUID.
- Remark: SORBENT APPLIED PICKED UP.

F31 **NY Spills** **S104648385**
ESE **RUST ST / MASPETH AV** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.001 mi.
7 ft. **Site 7 of 12 in cluster F**

Relative:
Higher

Actual:
23 ft.

NY Spills:
- Site ID: 286111
- Facility Addr2: Not reported
- Facility ID: 9812104
- Spill Number: 9812104
- Facility Type: ER
- SWIS: 4101
- Investigator: TOMASELLO
- Referred To: Not reported
- Spill Date: 12/29/1998
- Reported to Dept: 12/29/1998
- CID: 312
- Spill Cause: Unknown
- Water Affected: Not reported
- Spill Source: Unknown
- Spill Notifier: Local Agency
- Cleanup Ceased: Not reported
- Cleanup Meets Std: False
- Last Inspection: Not reported
- Recommended Penalty: Penalty Not Recommended
- UST Trust: False
- Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Unable/unwilling Responsible Party. Corrective action taken. (ISR)
- Spill Closed Dt: 3/3/2003
- Remediation Phase: 0
- Date Entered In Computer: 12/29/1998
- Spill Record Last Update: 3/3/2003
- Spiller Name: Not reported

(Continued) **S104648385**

Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
DER Facility ID: 231887
DEC Memo: Not reported
Remarks: 55GAL DRUM SPILLED IN MIDDLE OF ROAD - FDNY HAZMAT ON SCENE

Material:
Site ID: 286111
Operable Unit ID: 1069360
Operable Unit: 01
Material ID: 312387
Material Code: 0063A
Material Name: UNKNOWN HAZARDOUS MATERIAL
Case No.: Not reported
Material FA: Hazardous Material
Quantity: 55
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9812104
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/29/1998 08:23
Reported to Dept Date/Time: 12/29/98 08:28
SWIS: 63
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported

(Continued) **S104648385**

Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/29/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/12/99
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Nonpetroleum/Nonhazardous
Quantity Spilled: 55
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN HAZARDOUS MATERIAL
Class Type: UNKNOWN HAZARDOUS MATERIAL
Times Material Entry In File: 2093
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: 55GAL DRUM SPILLED IN MIDDLE OF ROAD - FDNY HAZMAT ON SCENE

H32 **HMIRS** **94100589**
NNE **45-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.002 mi.
12 ft. **Site 1 of 3 in cluster H**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
24 ft.

H33 **HMIRS** **96100207**
NNE **45-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.002 mi.
12 ft. **Site 2 of 3 in cluster H**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
24 ft.

I34 **HMIRS** **96090284**
NNE **46-06 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 1 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I35 **HMIRS** **95110746**
NNE **46-06 56T ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 2 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I36 **HMIRS** **9998090219**
NNE **46-05 56TH RD, 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 3 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I37 **NY Spills** **S104951445**
NNE **4605 56TH RD** **NY Hist Spills** **N/A**
< 1/8 **MASPETH RD, NY**
0.003 mi.
16 ft. **Site 4 of 251 in cluster I**

Relative:
Higher

Actual:
25 ft.

NY Spills:

Site ID:	224080
Facility Addr2:	MASPETH RD
Facility ID:	0012721
Spill Number:	0012721
Facility Type:	ER
SWIS:	4101
Investigator:	RWAUSTIN
Referred To:	Not reported
Spill Date:	3/1/2001
Reported to Dept:	3/1/2001
CID:	207
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle

(Continued) **S104951445**

Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/15/2003
Remediation Phase:	0
Date Entered In Computer:	3/1/2001
Spill Record Last Update:	6/20/2008
Spiller Name:	PAUL VETRANO
Spiller Company:	UPS
Spiller Address:	46-05 56TH
Spiller City,St,Zip:	MASPETH, NY -
Spiller Company:	001
Contact Name:	PAUL VETRANO
Contact Phone:	(718) 706-3121
DEC Region:	2
DER Facility ID:	185201
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "AUSTIN" 9/15/03 - AUSTIN - STREET SPILL - CLOSE IN DATABASE - ORIG. ASSIGNED TO ROMMEL - END
Remarks:	PUNCTURED FUEL TANK - TRACTOR # 242689 CLEANUP COMPLETED

Material:

Site ID:	224080
Operable Unit ID:	834681
Operable Unit:	01
Material ID:	542988
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20
Units:	Gallons
Recovered:	20
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	0012721

(Continued) **S104951445**

Investigator: ROMMEL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/01/2001 02:00
Reported to Dept Date/Time: 03/01/01 09:14
SWIS: 63
Spiller Name: UPS
Spiller Contact: PAUL VETRANO
Spiller Phone: (718) 706-3121
Spiller Contact: PAUL VETRANO
Spiller Phone: (718) 706-3121
Spiller Address: 46-05 56TH
Spiller City,St,Zip: MASPETH, NY -
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 07
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/01/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/01/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 20
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL

(Continued) **S104951445**

Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: PUNCTURED FUEL TANK - TRACTOR 242689 CLEANUP COMPLETED

I38 **HMIRS** **96090523**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 5 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I39 **HMIRS** **95070208**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 6 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I40 **HMIRS** **95030417**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 7 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I41 **HMIRS** **96090143**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 8 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I42 **HMIRS** **95050189**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 9 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I43 **HMIRS** **9998051468**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 10 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I44 **HMIRS** **9998050200**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 11 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I45 **HMIRS** **96090274**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 12 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I46 **HMIRS** **9999030534**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 13 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I47 **HMIRS** **95110397**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 14 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I48 **HMIRS** **97010440**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 15 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I49 **HMIRS** **96020411**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 16 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I50 **HMIRS** **97070336**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 17 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I51 **HMIRS** **9999090486**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 18 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I52 **46-05 56TH RD** **HMIRS** **2008430046**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 19 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I53 **HMIRS** **9998100142**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 20 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I54 **HMIRS** **9998051145**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 21 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I55 **HMIRS** **9998050197**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 22 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I56 **UNITED PARCEL SERVICE** **HIST UST** **U001839996**
NNE **46-05 56TH ROAD** **AST** **N/A**
< 1/8 **MASPETH, NY 11378** **HIST AST**
0.003 mi.
16 ft. **Site 23 of 251 in cluster I**

Relative:
Higher

Actual:
25 ft.

HIST UST:

PBS Number:	2-356735
SPDES Number:	Not reported
Emergency Contact:	KIM BENSON
Emergency Telephone:	(718) 706-3105
Operator:	MARK MERCHANT
Operator Telephone:	(718) 706-3105
Owner Name:	UNITED PARCEL SERVICE
Owner Address:	46-05 56TH ROAD
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 706-3138
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	UNITED PARCEL SERVICE
Mailing Address:	46-05 56TH ROAD
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MESPETH, NY 11378
Mailing Contact:	PLANT ENGR.
Mailing Telephone:	(718) 706-3105
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	46005 56TH ROAD
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	02/19/1999
Expiration Date:	06/28/2003
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	64750
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63

UNITED PARCEL SERVICE (Continued) **U001839996**

Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19660601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1991
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19660601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1991
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed

UNITED PARCEL SERVICE (Continued) **U001839996**

Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	007
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE

UNITED PARCEL SERVICE (Continued) **U001839996**

Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	008
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	009
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	010
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	011
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	07/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	012
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	07/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	013
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None

UNITED PARCEL SERVICE (Continued) **U001839996**

Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	07/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	014
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	07/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	015
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 07/01/1991
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 016
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19660601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 07/01/1991
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 017
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19660601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 07/01/1991

UNITED PARCEL SERVICE (Continued) **U001839996**

Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	018
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	07/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	019
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	07/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True

UNITED PARCEL SERVICE (Continued) **U001839996**

Lat/long: Not reported

Tank Id: 020
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19660601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 07/01/1991
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 021
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19660601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1991
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Tank Id:	022
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	023
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	024
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed

UNITED PARCEL SERVICE (Continued) **U001839996**

Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	025
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	026
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE

UNITED PARCEL SERVICE (Continued) **U001839996**

Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	027
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	028
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	029
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	030
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	031
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19690601
Capacity (gals):	3000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	032
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	15000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None

UNITED PARCEL SERVICE (Continued) **U001839996**

Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	033
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	15000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	034
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19660601
Capacity (gals):	15000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1991
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	035
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	036
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	037
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	038
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True

UNITED PARCEL SERVICE (Continued) **U001839996**

Lat/long: Not reported

Tank Id: 039
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19910201
Capacity (gals): 4000
Product Stored: DIESEL
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: Fiberglass
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 040
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19910201
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: Fiberglass
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

UNITED PARCEL SERVICE (Continued) **U001839996**

Tank Id:	041
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	042
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	043
Tank Location:	UNDERGROUND
Tank Status:	In Service

UNITED PARCEL SERVICE (Continued) **U001839996**

Install Date:	19910201
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	044
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910201
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	045
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910601
Capacity (gals):	12000
Product Stored:	NOS 1,2, OR 4 FUEL OIL

UNITED PARCEL SERVICE (Continued) **U001839996**

Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Suction
Date Tested:	07/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	046
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19910601
Capacity (gals):	12000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm
Dispenser:	Suction
Date Tested:	07/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-356735
Program Type:	PBS
UTM X:	590902.68631999998
UTM Y:	4509011.8051000005
Expiration Date:	2013/06/28

UNITED PARCEL SERVICE (Continued) **U001839996**

Affiliation Records:

Site Id:	17831
Affiliation Type:	Owner
Company Name:	UNITED PARCEL SERVICE
Contact Type:	DISTRICT ENV. COORDINATOR
Contact Name:	MARK MERCHANT
Address1:	46-05 56TH ROAD
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 706-3121
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	dxliving
Date Last Modified:	4/4/2008

Site Id:	17831
Affiliation Type:	Emergency Contact
Company Name:	UNITED PARCEL SERVICE
Contact Type:	Not reported
Contact Name:	PAUL VETRANO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 706-3121
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	4/1/2008

Site Id:	17831
Affiliation Type:	On-Site Operator
Company Name:	UNITED PARCEL SERVICE
Contact Type:	Not reported
Contact Name:	HUMBERTO TORRES
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 706-3186
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	4/1/2008

Site Id:	17831
Affiliation Type:	Mail Contact

UNITED PARCEL SERVICE (Continued) **U001839996**

Company Name:	UNITED PARCEL SERVICE
Contact Type:	Not reported
Contact Name:	PLANT ENGR.
Address1:	46-05 56TH ROAD
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 706-3105
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
J02 - Dispenser - Suction
I02 - Overfill - High Level Alarm
D02 - Pipe Type - Galvanized Steel
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
G01 - Tank Secondary Containment - Diking (Aboveground)
I02 - Overfill - High Level Alarm
I02 - Overfill - High Level Alarm
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
D02 - Pipe Type - Galvanized Steel
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

UNITED PARCEL SERVICE (Continued) **U001839996**

I02 - Overfill - High Level Alarm
D02 - Pipe Type - Galvanized Steel
B01 - Tank External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
I04 - Overfill - Product Level Gauge (A/G)
J01 - Dispenser - Submersible
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
B00 - Tank External Protection - None
I00 - Overfill - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
D02 - Pipe Type - Galvanized Steel
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
F00 - Pipe External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
C01 - Pipe Location - Aboveground
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
F04 - Pipe External Protection - Fiberglass
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
L08 - Piping Leak Detection - Tank Top Sump
A01 - Tank Internal Protection - Epoxy Liner
D02 - Pipe Type - Galvanized Steel
J00 - Dispenser - None
E00 - Piping Secondary Containment - None
C01 - Pipe Location - Aboveground
B04 - Tank External Protection - Fiberglass
J01 - Dispenser - Submersible
H00 - Tank Leak Detection - None

UNITED PARCEL SERVICE (Continued) **U001839996**

D02 - Pipe Type - Galvanized Steel
A01 - Tank Internal Protection - Epoxy Liner
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
J02 - Dispenser - Suction
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
A01 - Tank Internal Protection - Epoxy Liner
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
I00 - Overfill - None
B04 - Tank External Protection - Fiberglass
E00 - Piping Secondary Containment - None
B04 - Tank External Protection - Fiberglass
L08 - Piping Leak Detection - Tank Top Sump
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
J00 - Dispenser - None
I00 - Overfill - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
J02 - Dispenser - Suction
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
I04 - Overfill - Product Level Gauge (A/G)
C01 - Pipe Location - Aboveground
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
I04 - Overfill - Product Level Gauge (A/G)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
B04 - Tank External Protection - Fiberglass

UNITED PARCEL SERVICE (Continued) **U001839996**

H00 - Tank Leak Detection - None
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
H00 - Tank Leak Detection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
C00 - Pipe Location - No Piping
F04 - Pipe External Protection - Fiberglass
C00 - Pipe Location - No Piping
C02 - Pipe Location - Underground/On-ground
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
J00 - Dispenser - None
A01 - Tank Internal Protection - Epoxy Liner
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
L08 - Piping Leak Detection - Tank Top Sump
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
J01 - Dispenser - Submersible
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
F04 - Pipe External Protection - Fiberglass
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
C01 - Pipe Location - Aboveground
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None

UNITED PARCEL SERVICE (Continued) **U001839996**

A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
D02 - Pipe Type - Galvanized Steel
F04 - Pipe External Protection - Fiberglass
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
A01 - Tank Internal Protection - Epoxy Liner
J00 - Dispenser - None
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
L08 - Piping Leak Detection - Tank Top Sump
G00 - Tank Secondary Containment - None
I00 - Overfill - None
J02 - Dispenser - Suction
J01 - Dispenser - Submersible
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
K00 - Spill Prevention - None
A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
I00 - Overfill - None
I00 - Overfill - None
L08 - Piping Leak Detection - Tank Top Sump
K00 - Spill Prevention - None
B00 - Tank External Protection - None

UNITED PARCEL SERVICE (Continued) **U001839996**

I00 - Overfill - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
J00 - Dispenser - None
I00 - Overfill - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F04 - Pipe External Protection - Fiberglass
G00 - Tank Secondary Containment - None
L08 - Piping Leak Detection - Tank Top Sump
J02 - Dispenser - Suction
J01 - Dispenser - Submersible
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
I02 - Overfill - High Level Alarm
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
D02 - Pipe Type - Galvanized Steel
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
I02 - Overfill - High Level Alarm
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
F04 - Pipe External Protection - Fiberglass
F00 - Pipe External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
I00 - Overfill - None
G00 - Tank Secondary Containment - None
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
I02 - Overfill - High Level Alarm

UNITED PARCEL SERVICE (Continued) **U001839996**

B00 - Tank External Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
I02 - Overfill - High Level Alarm
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
B00 - Tank External Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
I00 - Overfill - None
F04 - Pipe External Protection - Fiberglass
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
B00 - Tank External Protection - None
C01 - Pipe Location - Aboveground
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
B00 - Tank External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I02 - Overfill - High Level Alarm
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
J02 - Dispenser - Suction
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
D00 - Pipe Type - No Piping
I02 - Overfill - High Level Alarm
B00 - Tank External Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel

UNITED PARCEL SERVICE (Continued) **U001839996**

G04 - Tank Secondary Containment - Double-Walled (Underground)
A01 - Tank Internal Protection - Epoxy Liner
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
I00 - Overfill - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
L08 - Piping Leak Detection - Tank Top Sump
D01 - Pipe Type - Steel/Carbon Steel/Iron
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
B04 - Tank External Protection - Fiberglass
B00 - Tank External Protection - None
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
A01 - Tank Internal Protection - Epoxy Liner
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction
J02 - Dispenser - Suction
J02 - Dispenser - Suction
B00 - Tank External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
A01 - Tank Internal Protection - Epoxy Liner
C00 - Pipe Location - No Piping
I00 - Overfill - None
I04 - Overfill - Product Level Gauge (A/G)
A01 - Tank Internal Protection - Epoxy Liner

UNITED PARCEL SERVICE (Continued) **U001839996**

A01 - Tank Internal Protection - Epoxy Liner
L08 - Piping Leak Detection - Tank Top Sump
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
D02 - Pipe Type - Galvanized Steel
G04 - Tank Secondary Containment - Double-Walled (Underground)
K00 - Spill Prevention - None
I00 - Overfill - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G04 - Tank Secondary Containment - Double-Walled (Underground)
D02 - Pipe Type - Galvanized Steel
J01 - Dispenser - Submersible
D02 - Pipe Type - Galvanized Steel
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
G01 - Tank Secondary Containment - Diking (Aboveground)
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
H00 - Tank Leak Detection - None
J00 - Dispenser - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
A01 - Tank Internal Protection - Epoxy Liner
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
I03 - Overfill - Automatic Shut-Off
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
L08 - Piping Leak Detection - Tank Top Sump
B00 - Tank External Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None

UNITED PARCEL SERVICE (Continued) **U001839996**

F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass

Tank Info:

Tank Number:	047
Tank Id:	51589
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	12/1/1998
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	048
Tank Id:	54023
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	12/1/1998
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	049
Tank Id:	54024
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	12/1/1998
Register:	True

UNITED PARCEL SERVICE (Continued) **U001839996**

Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	050
Tank Id:	56050
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1998
Capacity Gallons:	150
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

Tank Number:	051
Tank Id:	56051
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1998
Capacity Gallons:	300
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

Tank Number:	052
Tank Id:	56052
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1998
Capacity Gallons:	300
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

UNITED PARCEL SERVICE (Continued) **U001839996**

HIST AST:

PBS Number:	2-356735
SWIS Code:	6301
Operator:	MARK MERCHANT
Facility Phone:	(718) 706-3105
Facility Addr2:	46005 56TH ROAD
Facility Type:	TRUCKING/TRANSPORTATION
Emergency:	KIM BENSON
Emergency Tel:	(718) 706-3105
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	UNITED PARCEL SERVICE
Owner Address:	46-05 56TH ROAD
Owner City,St,Zip:	MASPETH, NY 11378
Federal ID:	Not reported
Owner Tel:	(718) 706-3138
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	PLANT ENGR.
Mailing Name:	UNITED PARCEL SERVICE
Mailing Address:	46-05 56TH ROAD
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MESPETH, NY 11378
Mailing Telephone:	(718) 706-3105
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	False
Certification Date:	02/19/1999
Expiration:	06/28/2003
Renew Flag:	False
Renew Date:	Not reported
Total Capacity:	64750
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City Code:	01
Region:	2
Tank ID:	047
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (Gal):	275
Product Stored:	USED OIL
Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	01
Pipe Location:	None

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe Type:	NONE
Pipe Internal:	None
Pipe External:	00
Tank Containment:	None
Leak Detection:	00
Overfill Protection:	4
Dispenser Method:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	12/01/1998
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	048
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (Gal):	275
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	01
Pipe Location:	Aboveground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	00
Tank Containment:	None
Leak Detection:	00
Overfill Protection:	4
Dispenser Method:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	12/01/1998
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	049
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (Gal):	275
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	01
Pipe Location:	Aboveground
Pipe Type:	STEEL/IRON

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe Internal: None
Pipe External: 00
Tank Containment: None
Leak Detection: 00
Overfill Protection: 4
Dispenser Method: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1998
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Tank ID: 050
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: 19981201
Capacity (Gal): 150
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: 00
Tank Containment: Excavation/Tranch Liner
Leak Detection: 00
Overfill Protection: 04
Dispenser Method: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Tank ID: 051
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: 19981201
Capacity (Gal): 300
Product Stored: USED OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None

UNITED PARCEL SERVICE (Continued) **U001839996**

Pipe External:	00
Tank Containment:	Excavation/Tranch Liner
Leak Detection:	00
Overfill Protection:	03
Dispenser Method:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	052
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status:	In Service
Install Date:	19981201
Capacity (Gal):	300
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	01
Pipe Location:	Aboveground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	00
Tank Containment:	Excavation/Tranch Liner
Leak Detection:	00
Overfill Protection:	04
Dispenser Method:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

I57 **HMIRS** **97070330**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 24 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I58 **HMIRS** **9900014971**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 25 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I59 **HMIRS** **95110395**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 26 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I60 **HMIRS** **97040342**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 27 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I61 **HMIRS** **91081067**
NNE **46-05 56 ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 28 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I62 **HMIRS** **9998051147**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 29 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I63 **HMIRS** **97090398**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 30 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I64 **HMIRS** **2000020446**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 31 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I65 **HMIRS** **9999030538**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 32 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I66 **HMIRS** **96110413**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 33 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I67 **HMIRS** **9998100137**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 34 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I68 **HMIRS** **97070331**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 35 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I69 **HMIRS** **9999030536**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 36 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I70 **HMIRS** **94051273**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 37 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I71 **HMIRS** **94060589**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 38 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I72 **HMIRS** **97070335**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 39 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I73 **HMIRS** **2000020442**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 40 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I74 **HMIRS** **96071454**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 41 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I75 **HMIRS** **9998050170**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 42 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I76 **HMIRS** **97040173**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 43 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I77 **46-05 56TH RD** **HMIRS** **2008443022**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 44 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I78 **HMIRS** **91081061**
NNE **46-05 56 ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 45 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I79 **HMIRS** **96030502**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 46 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I80 **HMIRS** **9998051143**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 47 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I81 **HMIRS** **95070204**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 48 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I82 **HMIRS** **91090347**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 49 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I83 **HMIRS** **9900011711**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 50 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I84 **HMIRS** **9998050160**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 51 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I85 **HMIRS** **95111217**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 52 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I86 **HMIRS** **9900014966**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 53 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I87 **HMIRS** **9998050166**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 54 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I88 **HMIRS** **9998080373**
NNE **46-05 56TH RD.** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 55 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I89 **HMIRS** **96020417**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 56 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I90 **HMIRS** **95110393**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 57 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I91 **HMIRS** **95100378**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 58 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I92 **HMIRS** **95030889**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 59 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I93 **HMIRS** **9998050196**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 60 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I94 **HMIRS** **95111219**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 61 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I95 **HMIRS** **9800000138**
NNE **46-05 56HT ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 62 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I96 **HMIRS** **96050415**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 63 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I97 **HMIRS** **2000020443**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 64 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I98 **HMIRS** **95100173**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 65 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I99 **HMIRS** **9999030533**
NNE **46-05 56TH ROAD MASPETH** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 66 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I100 **HMIRS** **95100174**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 67 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I101 **HMIRS** **90080962**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 68 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I102 **HMIRS** **94050479**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 69 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I103 **HMIRS** **9998100141**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 70 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I104 **HMIRS** **90080601**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 71 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I105 **HMIRS** **96071452**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 72 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I106 **UNITED PARCEL SERVICE** **RCRA-NonGen** **1000398427**
NNE **46-05 56TH RD** **MANIFEST** **NYD986969426**
< 1/8 **MASPETH, NY 11378**
0.003 mi.
16 ft. **Site 73 of 251 in cluster I**

Relative:
Higher

Actual:
25 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	UNITED PARCEL SERVICE
Facility address:	46-05 56TH RD MASPETH, NY 11378
EPA ID:	NYD986969426
Mailing address:	E 69TH ST BROOKLYN, NY 11202
Contact:	Not reported
Contact address:	E 69TH ST BROOKLYN, NY 11202
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	FALCO CONSTRUCTION CORP
Owner/operator address:	2300 E 69TH ST BROOKLYN, NY 11202
Owner/operator country:	US
Owner/operator telephone:	(718) 241-2100
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	FALCO CONSTRUCTION CORP
Owner/operator address:	2300 E 69TH ST BROOKLYN, NY 11202
Owner/operator country:	US
Owner/operator telephone:	(718) 241-2100
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No

UNITED PARCEL SERVICE (Continued) **1000398427**

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: UNITED PARCEL SERVICE
Classification: Not a generator, verified

Date form received by agency: 05/15/1996
Facility name: UNITED PARCEL SERVICE
Classification: Not a generator, verified

Date form received by agency: 09/11/1991
Facility name: UNITED PARCEL SERVICE
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

NY MANIFEST:
EPA ID: NYD986969426
Country: USA
Mailing Name: UNITED PARCEL SERVICE
Mailing Contact: UNITED PARCEL SERVICE
Mailing Address: 643 WEST 43RD STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10036
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-330-6533

Document ID: NYB2849184
Manifest Status: Completed copy
Trans1 State ID: MK8837
Trans2 State ID: Not reported
Generator Ship Date: 910912
Trans1 Recv Date: 910912
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910912
Part A Recv Date: 910930
Part B Recv Date: 910930
Generator EPA ID: NYD986969426
Trans1 EPA ID: NYD006801245
Trans2 EPA ID: Not reported
TSDF ID: NYD000691949
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00330
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 006
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

UNITED PARCEL SERVICE (Continued) **1000398427**

Document ID:	INA1139650
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	970319
Trans1 Recv Date:	970319
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970324
Part A Recv Date:	Not reported
Part B Recv Date:	970417
Generator EPA ID:	NYD986969426
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	D035 - METHYL ETHYL KETONE 200.0 MG/L TCLP
Quantity:	00057
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	97

I107 **HMIRS** **96090519**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 74 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I108 **HMIRS** **9998050165**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 75 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I109 **HMIRS** **94060584**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 76 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I110 **HMIRS** **95070207**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 77 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I111 **HMIRS** **2000020397**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 78 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I112 **HMIRS** **96090289**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 79 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I113 **HMIRS** **95110394**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 80 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I114 **HMIRS** **96030500**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 81 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I115 **HMIRS** **95030890**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 82 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I116 **HMIRS** **95030891**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 83 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I117 **HMIRS** **96090152**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 84 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I118 **HMIRS** **95030893**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 85 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I119 **HMIRS** **96071436**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 86 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I120 **HMIRS** **9900011725**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 87 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I121 **HMIRS** **95101372**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 88 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I122 **HMIRS** **9998050199**
NNE **46-05 56TH ST** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 89 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I123 **HMIRS** **95030894**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 90 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I124 **46-05 56TH RD** **HMIRS** **2008438385**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 91 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I125 **UPS** **NY Spills** **S109064007**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 92 of 251 in cluster I**

Relative:
Higher

Actual:
25 ft.

NY Spills:

Site ID:	233871
Facility Addr2:	Not reported
Facility ID:	9102712
Spill Number:	9102712
Facility Type:	ER
SWIS:	4101
Investigator:	HRAHMED
Referred To:	Not reported
Spill Date:	6/6/1991
Reported to Dept:	6/7/1991
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	Not Closed
Remediation Phase:	1

UPS (Continued) **S109064007**

Date Entered In Computer: 6/11/1991
Spill Record Last Update: 12/10/2008
Spiller Name: JESSIE SADEJ
Spiller Company: UPS
Spiller Address: 46-05 56TH RD
Spiller City,St,Zip: MASPETH, NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
DER Facility ID: 192690
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "M TIBBE" TRANSFERED FROM SULLIVAN TO TIBBE. 8/2/005- lead temperary transferred to Woodward 8/26/05- file reveiwed and calls to UPS site contacts and contracters for this location showed they no longer exist. File contains letter dated 11/21/1991 from NYSDEC to contractor telling him how to dispose of minimal contaminated soil. Need to verify that consultant handled soil according to NYSDEC's letter to close site. Previous notes from Woodward Spill transferred back to R-2 3/5/08 - Austin - Assigned to Ketani for further investigation - end 5/7/08 - Raphael Ketani. There was no paper file for the case. From the spill report, the happened on 6/6/91 and was called in by Laurie Jodice of Tyree (516) 2493150. Contaminated soil was found in the process of removing some tanks. Jessie Sadej (212) 330-6533 of UPS was the contact person. Excavation of the surrounding soil was taking place at the time. From the PBS registration #2-356735 there were dozens of tanks at the site. Most were closed and removed. Presently, there are 15 tanks that are active. They are numbers 35 to 46, and 50 to 52. They contain diesel fuel, gasoline, lubricants, waste oil, and #2 oil. The local UPS phone number is (718) 706-3121/3105. The site was inspected by Veronica Zhune of the Region 2 PBS Unit on 3/25/08. The block and lot are 2550 and 90. From Property Shark, the main address is 5529 46 Street. The alternate addresses are 55-75 to 55-93 48 Street and 46-05 56 Road. The ZIP is 11378. I spoke to Ms. Zhune. She said that she met Humberto Torres, the Plant Engineering Supervisor, at UPS. His number is (718) 706-3119. His address is 46-05 56 Road. I tried to contact him, but he wasn't in. I was passed to Frank Teklits, Facilities Engineering Manager for Long Island (Queens and Brooklyn) (718) 706-3105. I explained to Mr. Teklits that the DEC didn't have any documentation proving that the spill was cleaned up. He said that the will make some phone calls and see whether anyone has a remediation/closure document. He will also contact the Manhattan main office of UPS and see if they have such a document. I told him to get back to me if he finds the document or if he doesn't. He said he will. I added that if the document can't be produced, then a new investigation will have to take place. He said he understood. 5/16/08 - Raphael Ketani. Mark Merchant, District Environmental Coordinator for UPS (718) 706-3121 (cell - best number - (516) 780-5518) called to say that he found a document from 1991 that has information regarding a soil removal operation at the site. I asked him whether it has manifests and soil end point results. He said he wasn't sure, but he will copy the entire document and send it to me. I told him that will be fine. 6/5/08 - Raphael Ketani. Today I received 4 documents from Mr. Merchant. One was a package of soil disposal manifests, another was a copy of a 11/21/91 DEC letter with a Hazardous Waste Manifest attached, a third was a package of copies of tank removal reports

UPS (Continued) **S109064007**

from Larry & Tyree Co. Inc., and the last was a copy of a letter from Groundwater Technology dated 12/3/91 showing a short list of SVOC hits for a soil sample. These documents showed that contaminated soil had been removed, but not whether the site was clean. I contacted Mr. Merchant to let him know that the investigation still has to take place. He said that he didn't understand why after all these years the DEC was asking UPS to do an investigation when all of the affected tanks were pulled and long gone. I told him that DEC didn't have any information showing that the contamination was completely cleaned up. He asked that DEC send a letter explaining what we want and why. I told him I will. I sent a letter requesting a soil investigation to Mark Merchant, District Environmental Coordinator, UPS, 46-05 56 Road, Maspeth, NY, 11378. 7/2/08 - Raphael Ketani. Mr. Merchant (516) 780-5518 left me a voice mail stating that he found more records for the soil excavation and remediation work. He will send me copies of the records. 7/10/08 - Raphael Ketani. I received the August 1991 Underground Storage Tank Closure Report from Mr. Merchant of UPS. I reviewed the report. There were maps that showed where the tanks had been removed and where soil grab samples had been taken. These samples had very high total VOC hits in the ppm range. There was also PID field screening of samples. No where did the report indicate that end point samples were taken. The analytical results were very limited and didn't list the full suite of VOCs. I spoke to Mr. Merchant and told him that the DEC considers the USTCR to be insufficient to describe the subsurface conditions, and that there isn't any information indicating that the contaminated soil was removed in the 4 UST locations. I told him that the contamination is high and that an environmental soil investigation has to take place in the 4 UST locations. He said that a regional meeting is taking place right now and he will bring up this subject in the meeting. I told him that DEC considers the UPS site to be heavily contaminated and that we can't close our case. 7/18/08 - Raphael Ketani. Bil Halubowich of ROUX Associates (631) 232-2600 called to say that DEC should get the investigation plan next week for the site. 7/24/08 - Raphael Ketani. Mr. Halubowich called to state that he is putting together an investigation plan for the one tank that had #4 oil. I told him that the spill involved the discovery of contaminated soil when 4 tanks were being removed, not just one. He said that he will change his plan to include an investigation of the former site of the 4 tanks. He added that there is a fiberglass tank that was recently emptied and filled with water. He said he will do borings around this tank, too. I told him that would be good idea. He will send me a plan soon. 8/15/08 - Raphael Ketani. In preparation for case transfer, I am annotating the database as regards what needs to be done at the site to resolve the alleged or known environmental contamination. The site investigation plan needs to be submitted and reviewed. 09/23/2008-HRAHMED-Received closure report from Roux Associates. 12/10/2008-HRAHMED-Discussed with DEC Austin. As per Austin the investigation performed by Tyree is not sufficient. Additional Investigation is needed: 1. Scaled site plan showing all the tanks that were removed in 1991 2. Installing atleast 3 wells in each group Dan from Sierra Pitmark (770 792 5999) called. As per him Julie Straub of UPS hired them to investigate the site. Ahmed told him to contact Julie to confirm who will be the consultant for this site, Sierra or Roux.

Remarks: FOUND CONTAMINATED SOIL AROUND TANKS. DEC ON SCENE. EXCAVATING AT PRESENT TIME.

UPS (Continued) **S109064007**

Material:
- Site ID: 233871
- Operable Unit ID: 953552
- Operable Unit: 01
- Material ID: 570525
- Material Code: 0002
- Material Name: #4 Fuel Oil
- Case No.: Not reported
- Material FA: Petroleum
- Quantity: -1
- Units: Gallons
- Recovered: No
- Resource Affected: Not reported
- Oxygenate: False

Tank Test:
- Site ID: Not reported
- Spill Tank Test: Not reported
- Tank Number: Not reported
- Tank Size: Not reported
- Test Method: Not reported
- Leak Rate: Not reported
- Gross Fail: Not reported
- Modified By: Not reported
- Last Modified: Not reported
- Test Method: Not reported

I126 **HMIRS** **9800000139**
NNE **46-05 56HT ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 93 of 251 in cluster I**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 25 ft.

I127 **HMIRS** **95070203**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 94 of 251 in cluster I**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 25 ft.

I128 **HMIRS** **2000020398**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 95 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I129 **HMIRS** **96071458**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 96 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I130 **46-05 56TH RD** **HMIRS** **2008442465**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 97 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I131 **HMIRS** **96110407**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 98 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I132 **HMIRS** **97070334**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 99 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I133 **HMIRS** **94100585**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 100 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I134 **46-05 56TH RD** **HMIRS** **2007443836**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 101 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I135 **HMIRS** **96020413**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 102 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I136 **HMIRS** **95030895**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 103 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I137 **HMIRS** **95071526**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 104 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I138 **HMIRS** **96110421**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 105 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I139 **UNITED PARCEL SERVICE** **RCRA-SQG** **1000708503**
NNE **46-05 56TH RD** **FINDS** **NYD981564354**
< 1/8 **QUEENS, NY 11378** **MANIFEST**
0.003 mi. **MANIFEST**
16 ft. **Site 106 of 251 in cluster I**

Relative:
Higher

RCRA-SQG:
Date form received by agency: 01/01/2007
Facility name: UNITED PARCEL SERVICE
Facility address: 46-05 56TH RD
QUEENS, NY 11378

Actual:
25 ft.

UNITED PARCEL SERVICE (Continued) **1000708503**

EPA ID:	NYD981564354
Mailing address:	56TH RD QUEENS, NY 11378
Contact:	T OTTENWALDER
Contact address:	56TH RD QUEENS, NY 11378
Contact country:	US
Contact telephone:	(718) 706-3045
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	UNITED PARCEL SERVICE
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	UNITED PARCEL SERVICE
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

UNITED PARCEL SERVICE (Continued) **1000708503**

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: UNITED PARCEL SERVICE
Classification: Small Quantity Generator

Date form received by agency: 02/10/1994
Facility name: UNITED PARCEL SERVICE
Site name: UNITED PARCEL SERVICE INC
Classification: Large Quantity Generator

Date form received by agency: 10/22/1986
Facility name: UNITED PARCEL SERVICE
Classification: Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 07/14/1998
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

FINDS:

Registry ID: 110008022763

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

MANIFEST:
GEN Cert Date: 4/10/2008
Transporter Recpt Date: 4/10/2008
Number Of Containers: 1

UNITED PARCEL SERVICE (Continued) **1000708503**

Container Type:	DM
Waste Code1:	D001
Waste Code2:	D018
Waste Code3:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	SAFETY-KLEEN SYSTEMS, INC
TSDF ID:	RID084802842
TSDF Date:	4/16/2008
Date Imported:	9/29/2008 4:08:25 PM
Transporter 2 Name:	Not reported
Transporter 2 ID:	Not reported
Manifest Docket Number:	000128252UIS
Waste Description:	RQ, WASTE GASOLINE, 3, UN1203, PGII
Quantity:	55
WT/Vol Units:	G
Item Number:	a
Transporter Name:	SAFETY-KLEEN SYSTEMS INC
Transporter EPA ID:	TXR000050930
GEN Cert Date:	4/10/2008
Transporter Recpt Date:	4/10/2008
Transporter 2 Recpt Date:	Not reported
TSDF Recpt Date:	4/16/2008
EPA ID:	NYD981564354
Transporter 2 ID:	Not reported

NY MANIFEST:

EPA ID:	NYD981564354
Country:	USA
Mailing Name:	UNITED PARCEL SERVICE
Mailing Contact:	MARK MERCHANT
Mailing Address:	46-05 56TH ROAD
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-706-3185

Document ID:	NYA7158933
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	A23341
Trans2 State ID:	Not reported
Generator Ship Date:	891009
Trans1 Recv Date:	891009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	891009
Part A Recv Date:	891128
Part B Recv Date:	891016
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	NYD050592807
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000691949
Waste Code:	D008 - LEAD 5.0 MG/L TCLP

UNITED PARCEL SERVICE (Continued) **1000708503**

Quantity:	01200
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	89

Document ID:	INA0930901
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	941207
Trans1 Recv Date:	941207
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	941214
Part A Recv Date:	941213
Part B Recv Date:	950103
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00035
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00065
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00036
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00051
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.

UNITED PARCEL SERVICE (Continued) **1000708503**

Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00109
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94

Document ID:	INA0930901
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	941207
Trans1 Recv Date:	941207
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	941214
Part A Recv Date:	941213
Part B Recv Date:	950103
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00081
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00082
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	94

Document ID:	INA0929142
Manifest Status:	Completed copy
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	940719
Trans1 Recv Date:	940719
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940726
Part A Recv Date:	940727
Part B Recv Date:	940808
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES

UNITED PARCEL SERVICE (Continued) **1000708503**

Quantity:	00124
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00079
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00090
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00095
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00084
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00010
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94

Document ID:	INA0929142
Manifest Status:	Completed copy
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	940719
Trans1 Recv Date:	940719
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940726
Part A Recv Date:	940727
Part B Recv Date:	940808
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported

UNITED PARCEL SERVICE (Continued) **1000708503**

TSDF ID: IND093219012
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00032
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00084
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00063
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00061
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00082
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 94

Document ID: NYC3120074
Manifest Status: Completed copy
Trans1 State ID: DL7754
Trans2 State ID: Not reported
Generator Ship Date: 941114
Trans1 Recv Date: 941114
Trans2 Recv Date: Not reported
TSD Site Recv Date: 941114
Part A Recv Date: 941215
Part B Recv Date: 941123
Generator EPA ID: NYD981564354
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D018 - BENZENE 0.5 MG/L TCLP
Quantity: 00060
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 004

UNITED PARCEL SERVICE (Continued) **1000708503**

Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	94

Document ID:	INA0953531
Manifest Status:	Completed copy
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	940817
Trans1 Recv Date:	940817
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940822
Part A Recv Date:	940825
Part B Recv Date:	940902
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00043
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00225
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00068
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00097
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00041
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00075

UNITED PARCEL SERVICE (Continued) **1000708503**

Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94

Document ID:	INA1028032
Manifest Status:	Completed copy
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	950524
Trans1 Recv Date:	950524
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950601
Part A Recv Date:	950602
Part B Recv Date:	950612
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	IND058484114
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00085
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00069
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00020
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	95

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-05-18
Trans1 Recv Date:	2009-05-18
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-05-26
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354

UNITED PARCEL SERVICE (Continued) **1000708503**

Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980613541
Waste Code:	Not reported
Quantity:	218.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000244677WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-06-16
Trans1 Recv Date:	2009-06-16
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-06-30
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980613541
Waste Code:	Not reported
Quantity:	164.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000245175WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported

UNITED PARCEL SERVICE (Continued) **1000708503**

Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-07-13
Trans1 Recv Date:	2009-07-13
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-07-25
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980613541
Waste Code:	Not reported
Quantity:	219.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000246278WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-03-24
Trans1 Recv Date:	2009-03-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-03-31
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980613541
Waste Code:	Not reported
Quantity:	213.0
Units:	P - Pounds

UNITED PARCEL SERVICE (Continued) **1000708503**

Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000232426WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-05-18
Trans1 Recv Date:	2009-05-18
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-05-26
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980613541
Waste Code:	Not reported
Quantity:	112.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000244677WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported

UNITED PARCEL SERVICE (Continued) **1000708503**

Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-06-16
Trans1 Recv Date:	2009-06-16
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-07-06
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	120.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000245174WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-03-24
Trans1 Recv Date:	2009-03-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-03-31
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980613541
Waste Code:	Not reported
Quantity:	185.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000232426WAS

UNITED PARCEL SERVICE (Continued) **1000708503**

Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-09-08
Trans1 Recv Date:	2009-09-08
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-09-18
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	195.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000211137WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-09-08
Trans1 Recv Date:	2009-09-08
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-09-18

UNITED PARCEL SERVICE (Continued) **1000708503**

Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	120.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000211137WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-01-26
Trans1 Recv Date:	2009-01-26
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-02-16
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981564354
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	187.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000229013WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N

UNITED PARCEL SERVICE (Continued) **1000708503**

Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: IND058484114
Trans2 State ID: Not reported
Generator Ship Date: 2009-09-08
Trans1 Recv Date: 2009-09-08
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2009-09-11
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981564354
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: OHD980613541
Waste Code: Not reported
Quantity: 212.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 1.0
Year: 09
Manifest Tracking Num: 000211138WAS
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H040

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: IND058484114
Trans2 State ID: Not reported
Generator Ship Date: 2009-05-18
Trans1 Recv Date: 2009-05-18
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2009-05-26
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981564354
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: OHD980613541

UNITED PARCEL SERVICE (Continued) **1000708503**

Waste Code:	Not reported
Quantity:	153.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000244677WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Click this hyperlink while viewing on your computer to access
608 additional NY_MANIFEST: record(s) in the EDR Site Report.

I140 **HMIRS** **95110392**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 107 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access
additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I141 **HMIRS** **96071449**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 108 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access
additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I142 **HMIRS** **96100196**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 109 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access
additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I143 **HMIRS** **2000020441**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 110 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I144 **HMIRS** **95100175**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 111 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I145 **TRACTOR TRAILER** **NY Spills** **S104790303**
NNE **46-05 56TH ROAD** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 112 of 251 in cluster I**

Relative:
Higher

Actual:
25 ft.

NY Spills:

Site ID:	194489
Facility Addr2:	Not reported
Facility ID:	0007947
Spill Number:	0007947
Facility Type:	ER
SWIS:	4101
Investigator:	SACCACIO
Referred To:	Not reported
Spill Date:	10/6/2000
Reported to Dept:	10/6/2000
CID:	255
Spill Cause:	Traffic Accident
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	11/16/2000
Remediation Phase:	0
Date Entered In Computer:	10/6/2000
Spill Record Last Update:	12/4/2000
Spiller Name:	Not reported
Spiller Company:	UPS
Spiller Address:	46-05 56TH
Spiller City,St,Zip:	MASPETH, NY -
Spiller Company:	001
Contact Name:	RICHARD SMITH
Contact Phone:	(917) 769-0483
DEC Region:	2

TRACTOR TRAILER (Continued) **S104790303**

DER Facility ID: 162080
DEC Memo: Not reported
Remarks: Tractor trailer jacknifed - punctured fuel tank which leaked onto street -Fire Dept prevented leakage into sewer and are off loading product from leaking tank

Material:
Site ID: 194489
Operable Unit ID: 828567
Operable Unit: 01
Material ID: 545465
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 50
Units: Gallons
Recovered: 50
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0007947
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 10/06/2000 04:24
Reported to Dept Date/Time: 10/06/00 04:45
SWIS: 63
Spiller Name: UPS
Spiller Contact: Not reported
Spiller Phone: (212) 643-6238
Spiller Contact: RICHARD SMITH
Spiller Phone: (917) 769-0483
Spiller Address: 46-05 56TH
Spiller City,St,Zip: MASPETH, NY -
Spill Cause: Traffic Accident
Reported to Dept: On Land
Water Affected: Not reported

TRACTOR TRAILER (Continued) **S104790303**

Spill Source: 07
Spill Notifier: Fire Department
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/16/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/06/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/04/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 50
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: Tractor trailer jacknifed - punctured fuel tank which leaked onto street -Fire Dept prevented leakage into sewer and are off loading product from leaking tank

---

I146 **HMIRS** **9998050163**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 113 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I147 **HMIRS** **96110408**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 114 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I148 **HMIRS** **2000020445**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 115 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I149 **HMIRS** **95050188**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 116 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I150 **HMIRS** **9998080370**
NNE **46-05 56TH RD.** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 117 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I151 **HMIRS** **94110998**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 118 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I152 **HMIRS** **96071434**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 119 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I153 **HMIRS** **9999090489**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 120 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I154 **HMIRS** **95031115**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 121 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I155 **HMIRS** **20015177**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 122 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I156 **HMIRS** **94071411**
NNE **4605 56TH RD** **N/A**
< 1/8 **NEW YORK, NY**
0.003 mi.
16 ft. **Site 123 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I157 **HMIRS** **95030892**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 124 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I158 **HMIRS** **9998050158**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 125 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I159 **HMIRS** **95111216**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 126 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I160 **HMIRS** **9900011713**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 127 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I161 **HMIRS** **90090605**
NNE **46-05 56 ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 128 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I162 **HMIRS** **9900014970**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 129 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I163 **HMIRS** **96040652**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 130 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I164 **HMIRS** **9998050171**
NNE **46-05 56TH ROAD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 131 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I165 **HMIRS** **9999030526**
NNE **46-05 56TH ROAD MASPETH** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 132 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I166 **HMIRS** **9999090487**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 133 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I167 **HMIRS** **90080866**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 134 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I168 **46-05 56TH RD** **HMIRS** **2007443091**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 135 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I169 **HMIRS** **95080482**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 136 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I170 **HMIRS** **20013032**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 137 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I171 **HMIRS** **95091492**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 138 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I172 **HMIRS** **94100587**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 139 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I173 **HMIRS** **97070333**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 140 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I174 **HMIRS** **9503036760**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 141 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I175 **HMIRS** **9998051144**
NNE **46-05 56TH ROAD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 142 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I176 **HMIRS** **96030503**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 143 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I177 **HMIRS** **95070209**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 144 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I178 **HMIRS** **9998051146**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 145 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I179 **HMIRS** **91020438**
NNE **46-05 56 RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 146 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I180 **HMIRS** **95110396**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 147 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I181 **HMIRS** **90020606**
NNE **46-05 56RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 148 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I182 **HMIRS** **97010442**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 149 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I183 **HMIRS** **9998051149**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 150 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I184 **HMIRS** **9999090498**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 151 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I185 **HMIRS** **95101374**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 152 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I186 **HMIRS** **9999090495**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 153 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I187 **HMIRS** **9999030539**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 154 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I188 **HMIRS** **96071448**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 155 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I189 **HMIRS** **90090026**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 156 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I190 **HMIRS** **91060597**
NNE **46-05 56 ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 157 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I191 **HMIRS** **96071445**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 158 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I192 **HMIRS** **95091493**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 159 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I193 **46-05 56TH RD** **HMIRS** **2005703253**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 160 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I194 **HMIRS** **9900011715**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 161 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I195 **46-05 56TH RD** **HMIRS** **2008438250**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 162 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I196 **HMIRS** **96071453**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 163 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I197 **HMIRS** **9900011726**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 164 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I198 **HMIRS** **96020412**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 165 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I199 **HMIRS** **96100209**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 166 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I200 **HMIRS** **95030193**
NNE **46-05 56TH RD** **N/A**
< 1/8 **NEW YORK, NY**
0.003 mi.
16 ft. **Site 167 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I201 **HMIRS** **96100800**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 168 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I202 **HMIRS** **9900014972**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 169 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I203 **HMIRS** **97070332**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 170 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I204 **HMIRS** **96050418**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 171 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I205 **HMIRS** **96050416**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 172 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I206 **HMIRS** **96100799**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 173 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I207 **HMIRS** **9998050192**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 174 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I208 **HMIRS** **9999030532**
NNE **46-05 56TH ROAD MASPETH** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 175 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I209 **HMIRS** **9998100139**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 176 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I210 **HMIRS** **97040341**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 177 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I211 **HMIRS** **95050186**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 178 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I212 **HMIRS** **95030416**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 179 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I213 **HMIRS** **96100192**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 180 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I214 **HMIRS** **9900011714**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 181 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I215 **HMIRS** **9998051466**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 182 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I216 **HMIRS** **9900014967**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 183 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I217 **HMIRS** **95030194**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 184 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I218 **HMIRS** **96020414**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 185 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I219 **HMIRS** **9998100138**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 186 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I220 **HMIRS** **96090290**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 187 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I221 **HMIRS** **9999090488**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 188 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I222 **HMIRS** **96110410**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 189 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I223 **UNITED PARCEL SERVICE** **UST** **U004064868**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY 11378**
0.003 mi.
16 ft. **Site 190 of 251 in cluster I**

Relative:
Higher

Actual:
25 ft.

UST:

Facility Id:	2-356735
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2013/06/28
UTM X:	590902.68631999998
UTM Y:	4509011.8051000005

Affiliation Records:

Site Id:	17831
Affiliation Type:	Owner
Company Name:	UNITED PARCEL SERVICE
Contact Type:	DISTRICT ENV. COORDINATOR
Contact Name:	MARK MERCHANT

UNITED PARCEL SERVICE (Continued) **U004064868**

Address1:	46-05 56TH ROAD
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 706-3121
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	dxliving
Date Last Modified:	4/4/2008

Site Id:	17831
Affiliation Type:	Emergency Contact
Company Name:	UNITED PARCEL SERVICE
Contact Type:	Not reported
Contact Name:	PAUL VETRANO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 706-3121
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	4/1/2008

Site Id:	17831
Affiliation Type:	On-Site Operator
Company Name:	UNITED PARCEL SERVICE
Contact Type:	Not reported
Contact Name:	HUMBERTO TORRES
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 706-3186
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	4/1/2008

Site Id:	17831
Affiliation Type:	Mail Contact
Company Name:	UNITED PARCEL SERVICE
Contact Type:	Not reported
Contact Name:	PLANT ENGR.
Address1:	46-05 56TH ROAD
Address2:	Not reported
City:	MASPETH

UNITED PARCEL SERVICE (Continued) **U004064868**

State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 706-3105
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
J02 - Dispenser - Suction
I02 - Overfill - High Level Alarm
D02 - Pipe Type - Galvanized Steel
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
G01 - Tank Secondary Containment - Diking (Aboveground)
I02 - Overfill - High Level Alarm
I02 - Overfill - High Level Alarm
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
D02 - Pipe Type - Galvanized Steel
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
D02 - Pipe Type - Galvanized Steel
B01 - Tank External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
I04 - Overfill - Product Level Gauge (A/G)
J01 - Dispenser - Submersible

UNITED PARCEL SERVICE (Continued) **U004064868**

G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
B00 - Tank External Protection - None
I00 - Overfill - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
D02 - Pipe Type - Galvanized Steel
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
F00 - Pipe External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
C01 - Pipe Location - Aboveground
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
F04 - Pipe External Protection - Fiberglass
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
L08 - Piping Leak Detection - Tank Top Sump
A01 - Tank Internal Protection - Epoxy Liner
D02 - Pipe Type - Galvanized Steel
J00 - Dispenser - None
E00 - Piping Secondary Containment - None
C01 - Pipe Location - Aboveground
B04 - Tank External Protection - Fiberglass
J01 - Dispenser - Submersible
H00 - Tank Leak Detection - None
D02 - Pipe Type - Galvanized Steel
A01 - Tank Internal Protection - Epoxy Liner
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
J02 - Dispenser - Suction
B00 - Tank External Protection - None

UNITED PARCEL SERVICE (Continued) **U004064868**

C00 - Pipe Location - No Piping
A01 - Tank Internal Protection - Epoxy Liner
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
I00 - Overfill - None
B04 - Tank External Protection - Fiberglass
E00 - Piping Secondary Containment - None
B04 - Tank External Protection - Fiberglass
L08 - Piping Leak Detection - Tank Top Sump
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
J00 - Dispenser - None
I00 - Overfill - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
J02 - Dispenser - Suction
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
I04 - Overfill - Product Level Gauge (A/G)
C01 - Pipe Location - Aboveground
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
I04 - Overfill - Product Level Gauge (A/G)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
B04 - Tank External Protection - Fiberglass
H00 - Tank Leak Detection - None
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
H00 - Tank Leak Detection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)

UNITED PARCEL SERVICE (Continued) **U004064868**

D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
C00 - Pipe Location - No Piping
F04 - Pipe External Protection - Fiberglass
C00 - Pipe Location - No Piping
C02 - Pipe Location - Underground/On-ground
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
J00 - Dispenser - None
A01 - Tank Internal Protection - Epoxy Liner
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
L08 - Piping Leak Detection - Tank Top Sump
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
J01 - Dispenser - Submersible
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
F04 - Pipe External Protection - Fiberglass
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
C01 - Pipe Location - Aboveground
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
D02 - Pipe Type - Galvanized Steel
F04 - Pipe External Protection - Fiberglass
C00 - Pipe Location - No Piping

UNITED PARCEL SERVICE (Continued) **U004064868**

C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
A01 - Tank Internal Protection - Epoxy Liner
J00 - Dispenser - None
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
L08 - Piping Leak Detection - Tank Top Sump
G00 - Tank Secondary Containment - None
I00 - Overfill - None
J02 - Dispenser - Suction
J01 - Dispenser - Submersible
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
K00 - Spill Prevention - None
A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
I00 - Overfill - None
I00 - Overfill - None
L08 - Piping Leak Detection - Tank Top Sump
K00 - Spill Prevention - None
B00 - Tank External Protection - None
I00 - Overfill - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
J00 - Dispenser - None
I00 - Overfill - None

UNITED PARCEL SERVICE (Continued) **U004064868**

A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F04 - Pipe External Protection - Fiberglass
G00 - Tank Secondary Containment - None
L08 - Piping Leak Detection - Tank Top Sump
J02 - Dispenser - Suction
J01 - Dispenser - Submersible
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
I02 - Overfill - High Level Alarm
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
D02 - Pipe Type - Galvanized Steel
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
I02 - Overfill - High Level Alarm
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
F04 - Pipe External Protection - Fiberglass
F00 - Pipe External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
I00 - Overfill - None
G00 - Tank Secondary Containment - None
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
I02 - Overfill - High Level Alarm
B00 - Tank External Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
I02 - Overfill - High Level Alarm
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel

UNITED PARCEL SERVICE (Continued) **U004064868**

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
B00 - Tank External Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
I00 - Overfill - None
F04 - Pipe External Protection - Fiberglass
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
B00 - Tank External Protection - None
C01 - Pipe Location - Aboveground
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
B00 - Tank External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I02 - Overfill - High Level Alarm
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
J02 - Dispenser - Suction
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
D00 - Pipe Type - No Piping
I02 - Overfill - High Level Alarm
B00 - Tank External Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
G04 - Tank Secondary Containment - Double-Walled (Underground)
A01 - Tank Internal Protection - Epoxy Liner
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None

UNITED PARCEL SERVICE (Continued) **U004064868**

C00 - Pipe Location - No Piping
I00 - Overfill - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
L08 - Piping Leak Detection - Tank Top Sump
D01 - Pipe Type - Steel/Carbon Steel/Iron
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
B04 - Tank External Protection - Fiberglass
B00 - Tank External Protection - None
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
A01 - Tank Internal Protection - Epoxy Liner
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction
J02 - Dispenser - Suction
J02 - Dispenser - Suction
B00 - Tank External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
A01 - Tank Internal Protection - Epoxy Liner
C00 - Pipe Location - No Piping
I00 - Overfill - None
I04 - Overfill - Product Level Gauge (A/G)
A01 - Tank Internal Protection - Epoxy Liner
A01 - Tank Internal Protection - Epoxy Liner
L08 - Piping Leak Detection - Tank Top Sump
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
D02 - Pipe Type - Galvanized Steel

UNITED PARCEL SERVICE (Continued) **U004064868**

G04 - Tank Secondary Containment - Double-Walled (Underground)
K00 - Spill Prevention - None
I00 - Overfill - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G04 - Tank Secondary Containment - Double-Walled (Underground)
D02 - Pipe Type - Galvanized Steel
J01 - Dispenser - Submersible
D02 - Pipe Type - Galvanized Steel
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
G01 - Tank Secondary Containment - Diking (Aboveground)
J01 - Dispenser - Submersible
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
H00 - Tank Leak Detection - None
J00 - Dispenser - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
A01 - Tank Internal Protection - Epoxy Liner
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
I03 - Overfill - Automatic Shut-Off
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B00 - Tank External Protection - None
B00 - Tank External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
L08 - Piping Leak Detection - Tank Top Sump
B00 - Tank External Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass

UNITED PARCEL SERVICE (Continued) **U004064868**

Tank Info:

Site ID:	17831
Tank Number:	001
Tank ID:	34893
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	002
Tank ID:	34894
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	003
Tank ID:	34895
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	004
Tank ID:	34896
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	005
Tank ID:	34897
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	006
Tank ID:	34898
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	007
Tank ID:	34899
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	008
Tank ID:	34900
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	009
Tank ID:	34901
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	010
Tank ID:	34902
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	011
Tank ID:	34903
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	012
Tank ID:	34904
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	013
Tank ID:	34905
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	014
Tank ID:	34906
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	015
Tank ID:	34907
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	016
Tank ID:	34908
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	017
Tank ID:	34909
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	018
Tank ID:	34910
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	019
Tank ID:	34911
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	020
Tank ID:	34912
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	021
Tank ID:	34913
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	022
Tank ID:	34914
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	023
Tank ID:	34915
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	024
Tank ID:	34916
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	025
Tank ID:	34917
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	026
Tank ID:	34918
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	027
Tank ID:	34919
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	028
Tank ID:	34920
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	029
Tank ID:	34921
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	030
Tank ID:	34922
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	031
Tank ID:	34923
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1969
Capacity Gallons:	3000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	032
Tank ID:	34924
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	15000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	033
Tank ID:	34925
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	15000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	034
Tank ID:	34926
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1966
Capacity Gallons:	15000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	17831
Tank Number:	035
Tank ID:	41296
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	036
Tank ID:	41297
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	037
Tank ID:	41298
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	038
Tank ID:	41299
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	039
Tank ID:	41300
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	040
Tank ID:	41301
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	041
Tank ID:	41302
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	042
Tank ID:	41303
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID:	17831
Tank Number:	043
Tank ID:	41304
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	044
Tank ID:	41305
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	2/1/1991
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008
Site ID:	17831
Tank Number:	045
Tank ID:	41420
Tank Status:	In Service
Tank Model:	104
Pipe Model:	D
Install Date:	6/1/1991
Capacity Gallons:	12000
Tightness Test Method:	01
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	7/1/1991
Register:	True
Modified By:	dxliving
Last Modified:	4/4/2008

UNITED PARCEL SERVICE (Continued) **U004064868**

Site ID: 17831

Tank Number: 046
Tank ID: 41421
Tank Status: In Service
Tank Model: 104
Pipe Model: D
Install Date: 6/1/1991
Capacity Gallons: 12000
Tightness Test Method: 01
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Equivalent technology
Date Test: 7/1/1991
Register: True
Modified By: dxliving
Last Modified: 4/4/2008

I224 **HMIRS** **96090145**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 191 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I225 **HMIRS** **94051277**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 192 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I226 **HMIRS** **9998100144**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 193 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I227 **HMIRS** **9999090499**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 194 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I228 **HMIRS** **95071525**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 195 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I229 **46-05 56TH RD** **HMIRS** **2008426847**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 196 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I230 **HMIRS** **20013922**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 197 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I231 **HMIRS** **9900011710**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 198 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I232 **HMIRS** **94060588**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **ASTORIA, NY**
0.003 mi.
16 ft. **Site 199 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I233 **HMIRS** **96020416**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 200 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I234 **HMIRS** **96100194**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 201 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I235 **HMIRS** **96090285**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 202 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I236 **HMIRS** **95090029**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 203 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I237 **HMIRS** **9900011712**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 204 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I238 **HMIRS** **9998050159**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 205 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I239 **HMIRS** **9900011716**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 206 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I240 **HMIRS** **9998051151**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 207 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I241 **HMIRS** **9999090506**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 208 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I242 **HMIRS** **95080481**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 209 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I243 **HMIRS** **9998050193**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 210 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I244 **46-05 56TH RD** **HMIRS** **2008434043**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 211 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I245 **HMIRS** **9998090166**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 212 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I246 **HMIRS** **95101375**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 213 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I247 **HMIRS** **9998051142**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 214 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I248 **HMIRS** **94051068**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 215 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I249 **HMIRS** **9999030497**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 216 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I250 **HMIRS** **94100590**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 217 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I251 **HMIRS** **9998050157**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 218 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I252 **HMIRS** **96020415**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 219 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I253 **HMIRS** **9503036761**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 220 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I254 **HMIRS** **95030230**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 221 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I255 **HMIRS** **2000020444**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 222 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I256 **HMIRS** **97040174**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 223 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I257 **HMIRS** **97040175**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 224 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I258 **HMIRS** **97040172**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 225 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I259 **HMIRS** **9999090502**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 226 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I260 **HMIRS** **97010443**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 227 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I261 **HMIRS** **9998050183**
NNE **46-05 56TH RD 11378** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 228 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I262 **HMIRS** **95110391**
NNE **46-05 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 229 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I263 **HMIRS** **96110412**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 230 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I264 **HMIRS** **95101376**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 231 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I265 **HMIRS** **95110747**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 232 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

I266 **HMIRS** **97090397**
NNE **46-05 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.003 mi.
16 ft. **Site 233 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
25 ft.

J267 **56TH ROAD & 48TH ST** **NY Spills** **S102150408**
North **56TH ROAD & 48TH ST** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.004 mi.
20 ft. **Site 1 of 7 in cluster J**

Relative:
Higher

Actual:
31 ft.

NY Spills:

Site ID:	253394
Facility Addr2:	Not reported
Facility ID:	9504015
Spill Number:	9504015
Facility Type:	ER
SWIS:	4101
Investigator:	MMMULQUE
Referred To:	Not reported
Spill Date:	7/3/1995
Reported to Dept:	7/3/1995
CID:	Not reported
Spill Cause:	Traffic Accident
Water Affected:	Not reported
Spill Source:	Tank Truck

56TH ROAD & 48TH ST (Continued) **S102150408**

Spill Notifier:	Local Agency
Cleanup Ceased:	7/3/1995
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	7/3/1995
Remediation Phase:	0
Date Entered In Computer:	8/1/1995
Spill Record Last Update:	9/30/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	207577
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MULQUEEN"
Remarks:	2 VEHICLE ACCIDENT - NO CLEAN UP - FD ON SCENE - DEP TO OVERSEE CLEANUP.

Material:

Site ID:	253394
Operable Unit ID:	1015210
Operable Unit:	01
Material ID:	365524
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9504015

56TH ROAD & 48TH ST (Continued) **S102150408**

Investigator:	MULQUEEN
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	07/03/1995 12:00
Reported to Dept Date/Time:	07/03/95 12:20
SWIS:	63
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Traffic Accident
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	08
Spill Notifier:	Local Agency
PBS Number:	Not reported
Cleanup Ceased:	07/03/95
Cleanup Meets Std:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	07/03/95
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	08/01/95
Date Spill Entered In Computer Data File:	Not reported
Update Date:	/ /
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	50
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	DIESEL
Class Type:	DIESEL
Times Material Entry In File:	10625
CAS Number:	Not reported

56TH ROAD & 48TH ST (Continued) **S102150408**

Last Date: 19940728
DEC Remarks: Not reported
Remark: 2 VEHICLE ACCIDENT - NO CLEAN UP - FD ON SCENE - DEP TO OVERSEE CLEANUP.

I268 **HMIRS** **9999030528**
NNE **46-25 56TH ROAD MASPETH** **N/A**
< 1/8 **MASPETH, NY**
0.004 mi.
23 ft. **Site 234 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
28 ft.

J269 **S.B. THOMAS, INC** **UST** **U000411291**
North **56-07 48TH STREET** **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11377**
0.005 mi.
24 ft. **Site 2 of 7 in cluster J**

Relative:
Higher

Actual:
31 ft.

UST:
Facility Id: 2-480894
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2015/07/09
UTM X: 591143.88789999997
UTM Y: 4508786.9448699998

Affiliation Records:
Site Id: 21477
Affiliation Type: Owner
Company Name: WERWAISS & CO. INC
Contact Type: MANAGING AGENT
Contact Name: JOHN WERWAISS
Address1: 230 PARK AVE.
Address2: Not reported
City: NEW YORK
State: NY
Zip Code: 10169
Country Code: 001
Phone: (212) 983-0044
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 12/10/2008

Site Id: 21477
Affiliation Type: On-Site Operator
Company Name: S.B. THOMAS, INC
Contact Type: Not reported
Contact Name: S.B. THOMAS, INC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY

S.B. THOMAS, INC (Continued) **U000411291**

Zip Code:	Not reported
Country Code:	001
Phone:	(718) 729-1653
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/10/2008

Site Id:	21477
Affiliation Type:	Emergency Contact
Company Name:	WERWAISS & CO. INC
Contact Type:	Not reported
Contact Name:	MR. RICHARD ANDELLA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(201) 595-7796
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/10/2008

Site Id:	21477
Affiliation Type:	Mail Contact
Company Name:	WERWAISS & CO. INC
Contact Type:	Not reported
Contact Name:	JOHN WERWAISS
Address1:	230 PARK AVENUE, SUITE 945
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10169
Country Code:	001
Phone:	(212) 983-0044
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	dxliving
Date Last Modified:	12/11/2007

Equipment Records:

L02 - Piping Leak Detection - Interstitial - Manual Monitoring
L02 - Piping Leak Detection - Interstitial - Manual Monitoring
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I02 - Overfill - High Level Alarm
H00 - Tank Leak Detection - None
F07 - Pipe External Protection - Retrofitted Sacrificial Anode
J01 - Dispenser - Submersible
E00 - Piping Secondary Containment - None
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None

S.B. THOMAS, INC (Continued) **U000411291**

B07 - Tank External Protection - Retrofitted Sacrificial Anode
D02 - Pipe Type - Galvanized Steel
G00 - Tank Secondary Containment - None
I00 - Overfill - None
K01 - Spill Prevention - Catch Basin
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
I02 - Overfill - High Level Alarm
G00 - Tank Secondary Containment - None
F07 - Pipe External Protection - Retrofitted Sacrificial Anode
G00 - Tank Secondary Containment - None
J01 - Dispenser - Submersible
I00 - Overfill - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
B07 - Tank External Protection - Retrofitted Sacrificial Anode
C00 - Pipe Location - No Piping

Tank Info:

Site ID:	21477
Tank Number:	001
Tank ID:	39095
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	7/1/1982
Capacity Gallons:	4000
Tightness Test Method:	21
Next Test Date:	6/6/2016
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	6/6/2011
Register:	True
Modified By:	BKFALVEY
Last Modified:	6/28/2011
Site ID:	21477
Tank Number:	002
Tank ID:	39096
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported

S.B. THOMAS, INC (Continued) **U000411291**

Install Date: 7/1/1982
Capacity Gallons: 4000
Tightness Test Method: 21
Next Test Date: 6/6/2016
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 6/6/2011
Register: True
Modified By: BKFALVEY
Last Modified: 6/28/2011

Site ID: 21477

Tank Number: 003
Tank ID: 39097
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 7/1/1982
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 3/1/1990
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Site ID: 21477

Tank Number: 004
Tank ID: 39098
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 7/1/1982
Capacity Gallons: 2000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 3/1/1990
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:
PBS Number: 2-480894
SPDES Number: Not reported
Emergency Contact: MR. RICHARD ANDELLA
Emergency Telephone: (201) 595-7796
Operator: S.B. THOMAS, INC
Operator Telephone: (718) 729-1653

S.B. THOMAS, INC (Continued) **U000411291**

Owner Name:	WERWAISS & CO. INC
Owner Address:	230 PARK AVE.
Owner City,St,Zip:	NEW YORK, NY 10169
Owner Telephone:	(212) 983-0044
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	WERWAISS & CO. INC
Mailing Address:	230 PARK AVENUE, SUITE 945
Mailing Address 2:	Not reported
Mailing City,St,Zip:	NEW YORK, NY 10169
Mailing Contact:	Not reported
Mailing Telephone:	(212) 983-0044
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	56007 48TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	07/07/2000
Expiration Date:	07/09/2005
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	8000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19820701
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Sacrificial Anode
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Sacrificial Anode
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Catch Basin

S.B. THOMAS, INC (Continued) **U000411291**

Dispenser:	Submersible
Date Tested:	01/01/1998
Next Test Date:	01/01/2003
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	USTest 2000
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19820701
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Sacrificial Anode
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Sacrificial Anode
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Catch Basin
Dispenser:	Submersible
Date Tested:	01/01/1998
Next Test Date:	01/01/2003
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	USTest 2000
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19820701
Capacity (gals):	4000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported

S.B. THOMAS, INC (Continued) **U000411291**

Missing Data for Tank:	Minor Data Missing
Date Closed:	03/01/1990
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19820701
Capacity (gals):	2000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	03/01/1990
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

J270 **BEST FOODS BAKING GROUP** **RCRA-NonGen** **1000392038**
North **56-07 48TH ST** **FINDS** **NYD986884419**
< 1/8 **MASPETH, NY 11378**
0.005 mi.
24 ft. **Site 3 of 7 in cluster J**

Relative:
Higher

Actual:
31 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	BEST FOODS BAKING GROUP
Facility address:	56-07 48TH ST MASPETH, NY 11378
EPA ID:	NYD986884419
Mailing address:	N RIVERVIEW DR TOTOWA, NY 07512
Contact:	Not reported
Contact address:	N RIVERVIEW DR TOTOWA, NY 07512
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

BEST FOODS BAKING GROUP (Continued) **1000392038**

Owner/Operator Summary:
Owner/operator name: STEVLO C O WERWAISS & CO
Owner/operator address: 230 PARK AVE SUITE 945
NEW YORK, NY 10169
Owner/operator country: US
Owner/operator telephone: (212) 983-0044
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: STEVLO C O WERWAISS & CO
Owner/operator address: 230 PARK AVE SUITE 945
NEW YORK, NY 10169
Owner/operator country: US
Owner/operator telephone: (212) 983-0044
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: BEST FOODS BAKING GROUP
Classification: Not a generator, verified

Date form received by agency: 04/14/1995
Facility name: BEST FOODS BAKING GROUP
Classification: Unverified

Date form received by agency: 01/24/1994
Facility name: BEST FOODS BAKING GROUP
Classification: Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 03/23/1993

BEST FOODS BAKING GROUP (Continued) **1000392038**

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004439518

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

J271 **HUB TRUCK RENTAL** **NY Spills** **S109206043**
North **56-07 48TH ST** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
24 ft. **Site 4 of 7 in cluster J**

Relative:
Higher

Actual:
31 ft.

NY Spills:
Site ID: 400899
Facility Addr2: Not reported
Facility ID: 0804059
Spill Number: 0804059
Facility Type: ER
SWIS: 4101
Investigator: hrpatel
Referred To: Not reported
Spill Date: 7/9/2008
Reported to Dept: 7/9/2008
CID: 77
Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/9/2008
Remediation Phase: 0
Date Entered In Computer: 7/9/2008
Spill Record Last Update: 12/9/2008
Spiller Name: Not reported
Spiller Company: DRIVER OF VEHICLE
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: JJ HALBERT
Contact Phone: (201) 489-5100

HUB TRUCK RENTAL (Continued) **S109206043**

DEC Region: 2
DER Facility ID: 350170
DEC Memo: DECPiper- I spoke with Nick at hess. Spill was onto parking lot and some got onto soil. Hess crew on scene spreading speedy dry. PTC will respond to remove it and affected soil. 07/09/08-Hiralkumar Patel. spoke with Eric at Hess oil. they removed about 10 durms of contaminated soil and will remove more tomorrow. will take endpoint samples. Eric Sutphen Hess Corp. Ph. (732) 750-6637 (O) (908) 392-0136 (C) Fax (732) 750-6082 email: esutphen@hess.com 07/10/08-Hiralkumar Patel. visited site. commercial properties in area. met Eric from Hess. about 150 gal diesel oil spilled from vent pipe during delivery. oil spilled on asphalt and ran about 300 ft on asphalt parking lot to dirt area in southeastern corner (intersection of 50th street & 56th road). about 20 ft * 20 ft area impacted. Hess is removing soil and will collect endpoint samples. 08/19/08-Hiralkumar Patel. left message for Eric to submit report. 08/20/08-Hiralkumar Patel. received email from Eric. he was notified by Joe from PTC stating that PTC has already showed sample analyticals to DEC and got approval for backfilling, which is not true. the department never received any sample analyticals. sent email to Eric. mentioned him that no sample analyticals ever received by the department and the department hasn't approved backfilling of excavation. asked him to submit sample analyticals, scaled site plan with sampling location and depth, final excavation dimensions and color photographs. received fax from PTC with sample analyticals only. no site plan or other information included. 08/22/08-Hiralkumar Patel. left message for Eric to submit remaining documents. left message for Joe at PTC. 08/27/08-Hiralkumar Patel. received call from Eric from Hess. he mentioned that PTC removed about 9 drums of contaminate material and contaminated water generated after powerwashing asphalt parking area. but they noticed more contamination on following day and then they hired another company who removed one full dumster. PTC collected endpoint samples, but they don't have site map with sampling location, excavation location etc. asked Eric to submit scaled site map with excavation area and depth deatails and sampling location with depth. told him that if no such document available, then requires soil sampling via boring to depth of six inches below excavation bottom. told him to collect samples from sidewall areas and also through bottom of excavation. Eric mentioned that they removed about 12 inches of soil from entire excavation. 12/02/08-Hiralkumar Patel. spoke with Eric. asked him to submit report. received call from Mark from PTC. asked him to submit complete report. 12/04/08-Hiralkumar Patel. received fax from Mr. Sojka from Hess corp with closure request. abstract: - approx. 35 gal diesel spilled due to tank overfill - fuel spilled onto parking lot blacktop and ran to soil area covering an area of approx. 30 ft by 30 ft - PTC removed contaminated soil - two endpoint samples collected chain of custody shows sample temp. as 25 degree centigrade. as per lab manager, if sample receives on same day, thats fine. but if samples delivered next day then has to be below 6 degree centrigrade. 12/09/08-Hiralkumar Patel. sent email to DEC Tim LeBarron regarding sampling temp. received email from Tim. he mentioned that if sample was delivered same day, then it is not really realistic or scientifically necessary to bring the sample temperature down to 4 +/- degrees celsius by the time the lab gets it. based on submitted document, case closed.
Remarks: spill onto asphalt in parking lot. overfill of tank, human error.

HUB TRUCK RENTAL (Continued) **S109206043**

spill contained

Material:

Site ID:	400899
Operable Unit ID:	1157710
Operable Unit:	01
Material ID:	2148744
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	35
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

J272 **AERIAL CABLE LEAK AT POLE # 10102** **NY Spills** **S108294234**
North **56 ROAD & 48 STREET** **N/A**
< 1/8 **QUEENS, NY**
0.005 mi.
24 ft. **Site 5 of 7 in cluster J**

Relative:
Higher

Actual:
31 ft.

NY Spills:

Site ID:	370466
Facility Addr2:	Not reported
Facility ID:	0607018
Spill Number:	0607018
Facility Type:	ER
SWIS:	4101
Investigator:	GDBREEN
Referred To:	Not reported
Spill Date:	9/19/2006
Reported to Dept:	9/19/2006
CID:	410
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.

AERIAL CABLE LEAK AT POLE # 10102 (Continued) **S108294234**

	Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/21/2006
Remediation Phase:	0
Date Entered In Computer:	9/19/2006
Spill Record Last Update:	12/21/2006
Spiller Name:	ERTS
Spiller Company:	CON EDISON POLE # 10102
Spiller Address:	NORTH SIDE OF 56 ROAD
Spiller City,St,Zip:	QUEENS, NY
Spiller Company:	999
Contact Name:	ERTS
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	320288
DEC Memo:	12/21/06 - See e-docs for Con Ed report detailing cleanup and closure. 202529. see eDocs
Remarks:	SPILL IS ROUGHLY 2 OUNCES OF DIL. FLUID: LOCATED 700 FEET EAST OF 44TH STREET: CONED # 202529 CLEANUP PENDING CREW AVAILABILITY:

Material:

Site ID:	370466
Operable Unit ID:	1128275
Operable Unit:	01
Material ID:	2117884
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

H273 **MARLBORO ELEMENTARY SCHOOL** **UST** **U001843166**
NNE **RTE 9W** **HIST UST** **N/A**
< 1/8 **MARLBORO, NY 12542**
0.005 mi.
26 ft. **Site 3 of 3 in cluster H**

Relative:
Higher

Actual:
21 ft.

UST:

Facility Id:	3-179604
Region:	STATE
DEC Region:	3
Site Status:	Unregulated

MARLBORO ELEMENTARY SCHOOL (Continued) **U001843166**

Program Type: PBS
Expiration Date: N/A
UTM X: 585618.03472999996
UTM Y: 4605942.7357599996

Affiliation Records:

Site Id: 32818
Affiliation Type: Mail Contact
Company Name: MCSD
Contact Type: Not reported
Contact Name: Not reported
Address1: PLATTEKILL RD
Address2: Not reported
City: MARLBORO
State: NY
Zip Code: 12542
Country Code: 001
Phone: (914) 236-4251
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 32818
Affiliation Type: Owner
Company Name: MCSD
Contact Type: Not reported
Contact Name: Not reported
Address1: PLATTEKILL RD
Address2: Not reported
City: MARLBORO
State: NY
Zip Code: 12542
Country Code: 001
Phone: (914) 236-4251
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 32818
Affiliation Type: On-Site Operator
Company Name: MARLBORO ELEMENTARY SCHOOL
Contact Type: Not reported
Contact Name: PHIL MARTIN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (914) 236-4441
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT

MARLBORO ELEMENTARY SCHOOL (Continued) **U001843166**

Date Last Modified: 3/4/2004

Site Id: 32818
Affiliation Type: Emergency Contact
Company Name: MCSD
Contact Type: Not reported
Contact Name: PHIL MARTIN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (914) 795-5203
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
H04 - Tank Leak Detection - Groundwater Well

Tank Info:

Site ID: 32818

Tank Number: 1
Tank ID: 71586
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 6/1/1960
Capacity Gallons: 4000
Tightness Test Method: 01
Next Test Date: Not reported
Date Tank Closed: 5/1/1992
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 8/1/1987
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:

PBS Number: 3-179604
SPDES Number: Not reported
Emergency Contact: PHIL MARTIN
Emergency Telephone: (914) 795-5203
Operator: PHIL MARTIN

MARLBORO ELEMENTARY SCHOOL (Continued) **U001843166**

Operator Telephone:	(914) 236-4441
Owner Name:	MCSD
Owner Address:	PLATTEKILL RD
Owner City,St,Zip:	MARLBORO, NY 12542
Owner Telephone:	(914) 236-4251
Owner Type:	Not reported
Owner Subtype:	Not reported
Mailing Name:	MCSD
Mailing Address:	PLATTEKILL RD
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MARLBORO, NY 12542
Mailing Contact:	Not reported
Mailing Telephone:	(914) 236-4251
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	Not reported
SWIS ID:	5136
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	06/30/1987
Expiration Date:	06/30/1992
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	MARLBOROUGH
County Code:	51
Town or City:	36
Region:	3

Tank Id:	1
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19600601
Capacity (gals):	4000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	Groundwater Well
Overfill Prot:	Product Level Gauge

MARLBORO ELEMENTARY SCHOOL (Continued) **U001843166**

Dispenser:	Suction
Date Tested:	08/01/1987
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	05/01/1992
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

I274 **HMIRS** **95050764**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 235 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I275 **4605 56TH ROAD** **NY Spills** **S104495818**
NNE **4605 56TH ROAD** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 236 of 251 in cluster I**

Relative:
Higher

Actual:
26 ft.

NY Spills:

Site ID:	319665
Facility Addr2:	Not reported
Facility ID:	9411230
Spill Number:	9411230
Facility Type:	ER
SWIS:	4101
Investigator:	SMMARTIN
Referred To:	Not reported
Spill Date:	11/22/1994
Reported to Dept:	11/22/1994
CID:	Not reported
Spill Cause:	Other
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	11/22/1994
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	11/22/1994
Remediation Phase:	0
Date Entered In Computer:	12/13/1994
Spill Record Last Update:	6/20/2008
Spiller Name:	Not reported
Spiller Company:	UPS
Spiller Address:	Not reported
Spiller City,St,Zip:	MONTICELLO, ZZ
Spiller Company:	001

4605 56TH ROAD (Continued) **S104495818**

Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	162080
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MARTINKAT"
Remarks:	COMPUTOR WENT DOWN/WHEN THEY CAME BACK ON, DRIVER GOT WRONG READING. CLEANED UP UPS

Material:

Site ID:	319665
Operable Unit ID:	1009106
Operable Unit:	01
Material ID:	377092
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9411230
Investigator:	MARTINKAT
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	11/22/1994 11:05
Reported to Dept Date/Time:	11/22/94 11:05
SWIS:	63
Spiller Name:	UPS
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Other
Reported to Dept:	On Land

4605 56TH ROAD (Continued) **S104495818**

Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 11/22/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/22/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/13/94
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/13/94
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: COMPUTOR WENT DOWN/WHEN THEY CAME BACK ON, DRIVER GOT WRONG READING. CLEANED UP UPS

I276 **HMIRS** **95100377**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 237 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I277 **HMIRS** **9900014969**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 238 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I278 **HMIRS** **9508037054**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 239 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I279 **HMIRS** **9900014968**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 240 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I280 **HMIRS** **95081485**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 241 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I281 **HMIRS** **95090030**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 242 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I282 **HMIRS** **95080479**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 243 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I283 **HMIRS** **95081559**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 244 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I284 **HMIRS** **95080480**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 245 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I285 **HMIRS** **96090135**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 246 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I286 **HMIRS** **95090031**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 247 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I287 **HMIRS** **95100380**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 248 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I288 **HMIRS** **95100379**
NNE **4605 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 249 of 251 in cluster I**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
26 ft.

I289 **HMIRS** **9508037055**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 250 of 251 in cluster I**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 26 ft.

I290 **HMIRS** **95081560**
NNE **4605 56TH RD** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
27 ft. **Site 251 of 251 in cluster I**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 26 ft.

E291 **DIAMANDIS BROS INC** **RCRA-NonGen** **1004755560**
ESE **1 GALASSO PL** **FINDS** **NY0000083683**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.005 mi.
28 ft. **Site 4 of 8 in cluster E**

Relative: Lower

Actual: 9 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	DIAMANDIS BROS INC
Facility address:	1 GALASSO PL MASPETH, NY 11378
EPA ID:	NY0000083683
Mailing address:	GALASSO PL MASPETH, NY 11378
Contact:	MARIO DIAMANDIS
Contact address:	GALASSO PL MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 456-3550
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	MARIO & GABRIEL DIAMANDIS
Owner/operator address:	1 GALASSO PL MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 456-3550
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	MARIO & GABRIEL DIAMANDIS
Owner/operator address:	1 GALASSO PL MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 456-3550
Legal status:	Private

DIAMANDIS BROS INC (Continued) **1004755560**

Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: DIAMANDIS BROS INC
Classification: Not a generator, verified

Date form received by agency: 12/22/1993
Facility name: DIAMANDIS BROS INC
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004310674

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYO000083683
Country: USA
Mailing Name: DIAMANDIS BROTHERS
Mailing Contact: GABRIEL DIAMANDIS
Mailing Address: 1 GALASSO PLACE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported

DIAMANDIS BROS INC (Continued) **1004755560**

Mailing Country: USA
Mailing Phone: 718-456-3550

Document ID: NJA2892294
Manifest Status: Not reported
Trans1 State ID: NJD986608941
Trans2 State ID: Not reported
Generator Ship Date: 01/18/1999
Trans1 Recv Date: 01/18/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/21/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NY0000083683
Trans1 EPA ID: NJD002454544
Trans2 EPA ID: Not reported
TSDF ID: 10339
Waste Code: F005 - UNKNOWN
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 99

Document ID: NJA2024510
Manifest Status: Completed copy
Trans1 State ID: 10339
Trans2 State ID: Not reported
Generator Ship Date: 950222
Trans1 Recv Date: 950222
Trans2 Recv Date: Not reported
TSD Site Recv Date: 950223
Part A Recv Date: 950308
Part B Recv Date: 950306
Generator EPA ID: NY0000083683
Trans1 EPA ID: NJD986608941
Trans2 EPA ID: Not reported
TSDF ID: NJD002454544
Waste Code: F003 - UNKNOWN
Quantity: 00070
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95

Document ID: NJA2291278
Manifest Status: Completed copy
Trans1 State ID: 10339
Trans2 State ID: Not reported
Generator Ship Date: 960320

DIAMANDIS BROS INC (Continued) **1004755560**

Trans1 Recv Date:	960320
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	960321
Part A Recv Date:	960402
Part B Recv Date:	960328
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	96

Document ID:	NJA2744987
Manifest Status:	Completed copy
Trans1 State ID:	10339
Trans2 State ID:	Not reported
Generator Ship Date:	970319
Trans1 Recv Date:	970319
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970320
Part A Recv Date:	970404
Part B Recv Date:	970409
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	97

Document ID:	NJA2833185
Manifest Status:	Not reported
Trans1 State ID:	NJD986608941
Trans2 State ID:	Not reported
Generator Ship Date:	02/18/1998
Trans1 Recv Date:	02/18/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/20/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD002454544
Trans2 EPA ID:	Not reported
TSDF ID:	10339

DIAMANDIS BROS INC (Continued) **1004755560**

Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	98

Document ID:	NJA1608671
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	940117
Trans1 Recv Date:	940117
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940119
Part A Recv Date:	Not reported
Part B Recv Date:	940128
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	94

EPA ID:	NY0000083683
Country:	USA
Mailing Name:	DIAMANDIS BROTHERS
Mailing Contact:	MARIO DIAMANDIS
Mailing Address:	1 GALASSOPLACE
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-456-3550

Document ID:	NJA2892294
Manifest Status:	Not reported
Trans1 State ID:	NJD986608941
Trans2 State ID:	Not reported
Generator Ship Date:	01/18/1999
Trans1 Recv Date:	01/18/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/21/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported

DIAMANDIS BROS INC (Continued) **1004755560**

Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD002454544
Trans2 EPA ID:	Not reported
TSDF ID:	10339
Waste Code:	F005 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	99

Document ID:	NJA2024510
Manifest Status:	Completed copy
Trans1 State ID:	10339
Trans2 State ID:	Not reported
Generator Ship Date:	950222
Trans1 Recv Date:	950222
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950223
Part A Recv Date:	950308
Part B Recv Date:	950306
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00070
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	95

Document ID:	NJA2291278
Manifest Status:	Completed copy
Trans1 State ID:	10339
Trans2 State ID:	Not reported
Generator Ship Date:	960320
Trans1 Recv Date:	960320
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	960321
Part A Recv Date:	960402
Part B Recv Date:	960328
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks

DIAMANDIS BROS INC (Continued) **1004755560**

Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	96

Document ID:	NJA2744987
Manifest Status:	Completed copy
Trans1 State ID:	10339
Trans2 State ID:	Not reported
Generator Ship Date:	970319
Trans1 Recv Date:	970319
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970320
Part A Recv Date:	970404
Part B Recv Date:	970409
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	97

Document ID:	NJA2833185
Manifest Status:	Not reported
Trans1 State ID:	NJD986608941
Trans2 State ID:	Not reported
Generator Ship Date:	02/18/1998
Trans1 Recv Date:	02/18/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/20/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD002454544
Trans2 EPA ID:	Not reported
TSDF ID:	10339
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	98

Document ID:	NJA1608671
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported

DIAMANDIS BROS INC (Continued) **1004755560**

Generator Ship Date:	940117
Trans1 Recv Date:	940117
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940119
Part A Recv Date:	Not reported
Part B Recv Date:	940128
Generator EPA ID:	NY0000083683
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	94

E292 **1 RAILROAD PL AKA** **LTANKS** **S103037929**
ESE **2 GALASSO PLACE** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
28 ft. **Site 5 of 8 in cluster E**

Relative:
Lower

Actual:
9 ft.

LTANKS:

Site ID:	297935
Spill No:	9713776
Spill Date:	12/1/1996
Spill Cause:	Tank Failure
Spill Source:	Non Major Facility > 1,100 gal
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	4/8/2004
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	3/12/1998
CID:	270
Water Affected:	Not reported
Spill Notifier:	Affected Persons
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	3/12/1998
Spill Record Last Update:	4/26/2004
Spiller Name:	FRANK GALASSO
Spiller Company:	GALISSO TRUCKING
Spiller Address:	2 GALASSO PL
Spiller City,St,Zip:	MASPETH, NY
Spiller County:	001
Spiller Contact:	FRANK GALISSO
Spiller Phone:	(718) 456-1800
Spiller Extention:	Not reported

1 RAILROAD PL AKA (Continued) **S103037929**

DEC Region: 2
DER Facility ID: 241041
Remarks: Potential of several thousands of gallons leaked/contaminates found in ground water

Material:
Site ID: 297935
Operable Unit ID: 1059725
Operable Unit: 01
Material ID: 566555
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:
Region of Spill: 2
Spill Number: 9713776
Spill Date: 12/01/1996
Spill Time: Not reported
Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported

1 RAILROAD PL AKA (Continued) **S103037929**

Reported to Department Date: 03/12/98
Reported to Department Time: 14:08
SWIS: 63
Spiller Contact: FRANK GALISSO
Spiller Phone: (718) 456-1800
Spiller Extention: Not reported
Spiller Name: GALISSO TRUCKING
Spiller Address: 2 GALASSO PL
Spiller City,St,Zip: MASPETH, NY
Spiller Cleanup Date: / /
Facility Contact: FRANK GALASSO
Facility Phone: (718) 456-1800
Facility Extention: Not reported
Spill Notifier: Affected Persons
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/12/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/15/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: DEC Sigona) investigated complaint. Developed a memo for the file concerning this spill report dated May 7, 1998. Met with Phil Gallasso on March 20, 1998 received report by EEA, Inc. dated December 1996 concerning discovery of free product 2 feetthick layer in a monitoring well on property adjacent to 21st Century Bus Depot possible source). Report does not indicate source from Galasso Trucking 1 Railroad Place or 2 Gallasso Place) as reported by Phil Galasso. DEC met with Chris Carpentieri, Esq for Frank Galasso Galasso Trucking, Inc.) on April 27, 1998 with Phil Galassso to discuss complaint by Phil Galasso that product was surfacing from groundwater onto street. Investigation revealed that it was not oil rather organic materialproducing

1 RAILROAD PL AKA (Continued) **S103037929**

sheen. Chris Carpentieri hired Ted Sailor to perform audit of Galasso Trucking property. DEC Sigona) and Udo Drescher, Esq. met with Miriam E. Villani on June 19, 1998 of Farrel Frit Attorneys to dicuss the possible violations at 21st Century Bus Service 3 Galasso Place?) source of spill? They will investigate requirements for facility PBS, Site Assessment, Tank Closure, etc. DEC sigona) inspected installation of groundwater monitoring wells on 3 Railroad Place 57-15 49th Street) side adjacent to Galasso Trucking discovered free product in MW 1 See Spill No. 9804647).

Spill Cause: potential of several thousands of gallons leaked/contaminates found in ground water

---

E293 **GALASSO TRUCKING INC** **RCRA-NonGen** **1001233296**
ESE **2 GALASSO PL** **FINDS** **NYR000064774**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.005 mi.
28 ft. **Site 6 of 8 in cluster E**

Relative: Lower

Actual: 9 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	GALASSO TRUCKING INC
Facility address:	2 GALASSO PL MASPETH, NY 11378
EPA ID:	NYR000064774
Mailing address:	GALASSO PL MASPETH, NY 11378
Contact:	FRANK GALASSO
Contact address:	GALASSO PL MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 456-1800
Contact email:	Not reported
EPA Region:	02
Land type:	Private
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	GALASSO TRUCKING INC
Owner/operator address:	2 GALASSO PL MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 456-1800
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	GALASSO TRUCKING INC
Owner/operator address:	2 GALASSO PL MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 456-1800
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

GALASSO TRUCKING INC (Continued) **1001233296**

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: GALASSO TRUCKING INC
Classification: Not a generator, verified

Date form received by agency: 12/16/1998
Facility name: GALASSO TRUCKING INC
Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 10/05/2001
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA Contractor/Grantee

FINDS:

Registry ID: 110004549686

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYR000064774
Country: USA
Mailing Name: GALASSO TRUCKING
Mailing Contact: FRANK GALASSO
Mailing Address: 2 GALASSO WAY
Mailing Address 2: Not reported
Mailing City: MASPETH

GALASSO TRUCKING INC (Continued) **1001233296**

Mailing State: NY
Mailing Zip: 10456
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-456-1800

Document ID: NYG0688293
Manifest Status: Not reported
Trans1 State ID: AZD983473539
Trans2 State ID: Not reported
Generator Ship Date: 02/03/1999
Trans1 Recv Date: 02/03/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 02/21/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000064774
Trans1 EPA ID: AZ0000337360
Trans2 EPA ID: Not reported
TSDF ID: AZ002
Waste Code: D009 - MERCURY 0.2 MG/L TCLP
Quantity: 00294
Units: K - Kilograms (2.2 pounds)
Number of Containers: 012
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Waste Code: D009 - MERCURY 0.2 MG/L TCLP
Quantity: 00044
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 99

Document ID: MIA7096724
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 12/28/1998
Trans1 Recv Date: 12/28/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000064774
Trans1 EPA ID: MID980991566
Trans2 EPA ID: Not reported
TSDF ID: 66786TWPA
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00018
Units: Y - Cubic yards* (.85 tons)
Number of Containers: 001
Container Type: DT - Dump trucks

GALASSO TRUCKING INC (Continued) **1001233296**

Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 98

E294 **GALASSO TRUCKING; INC.** **SWF/LF S104075745**
ESE **2 GALASSO PLACE** **SWRCY N/A**
< 1/8 **MASPETH, NY 11378**
0.005 mi.
28 ft. **Site 7 of 8 in cluster E**

Relative:
Lower

Actual:
9 ft.

SWF/LF:

Flag:	INACTIVE
Region Code:	2
Phone Number:	7184561800
Owner Name:	Frank Galasso
Owner Type:	Not reported
Owner Address:	2 Galasso Place
Owner Addr2:	Not reported
Owner City,St,Zip:	Maspeth, NY 11378
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	Not reported
Contact Address:	Not reported
Contact Addr2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Other
Activity Number:	[41Z24]
Active:	No
East Coordinate:	591200
North Coordinate:	4508663
Accuracy Code:	4.3 - Utilization of Digital Orthophoto Quads
Regulatory Status:	Registration
Waste Type:	Not reported
Authorization #:	None
Authorization Date:	Not reported
Expiration Date:	Not reported

SWRCY:

Region:	2
Facility Address 2:	Not reported
Phone Number:	7184561800
Owner Type:	Not reported
Owner Name:	Frank Galasso
Owner Address:	2 Galasso Place
Owner Address 2:	Not reported
Owner City,St,Zip:	Maspeth, NY 11378
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	Not reported
Contact Address:	Not reported
Contact Address 2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Recylables handling and recovery facilities

GALASSO TRUCKING; INC. (Continued) **S104075745**

Activity Number:	[41M24]
Active:	No
East Coordinate:	591200
North Coordinate:	4508663
Accuracy Code:	4.3 - Utilization of Digital Orthophoto Quads
Regulatory Status:	Registration
Permit #:	None
Auth. Date:	Not reported
Expiration Date:	Not reported
Waste Types:	Not reported

E295 **2 GALASSO PLACE** **NY Spills** **S104284834**
ESE **2 GALLASO PLACE** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.005 mi.
28 ft. **Site 8 of 8 in cluster E**

Relative:
Lower

Actual:
9 ft.

NY Spills:

Site ID:	297936
Facility Addr2:	Not reported
Facility ID:	9911008
Spill Number:	9911008
Facility Type:	ER
SWIS:	4101
Investigator:	SIGONA
Referred To:	Not reported
Spill Date:	12/16/1999
Reported to Dept:	12/16/1999
CID:	371
Spill Cause:	Deliberate
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/17/1999
Remediation Phase:	0
Date Entered In Computer:	12/16/1999
Spill Record Last Update:	3/19/2003
Spiller Name:	Not reported
Spiller Company:	NEW STYLE CARTING
Spiller Address:	3 RAILROAD PL (49TH LN)
Spiller City,St,Zip:	MASPETH, NY
Spiller Company:	001
Contact Name:	PHILLIP
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	241041
DEC Memo:	Not reported
Remarks:	CALLER'S PROPERTY ABUTTS SPILLER'S PROPERTY. THEY ARE BURYING DRUMS OF UNKNOWN MATERIAL AND ALSO CONTAMINATED SOIL BEHIND THEIR BLDG AND PARTLY ON CALLER'S PROPERTY(WITHOUT HIS PERMISSION) -- POSS GROUNDWATER CONTAMINATION AND WATER FLOWING INTO NEW TOWN CREEK.

2 GALASSO PLACE (Continued) **S104284834**

PLEASE CONTACT CALLER ASAP.

Material:

Site ID:	297936
Operable Unit ID:	1089694
Operable Unit:	01
Material ID:	296482
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	110
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9911008
Investigator:	SIGONA
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	12/16/1999 11:00
Reported to Dept Date/Time:	12/16/99 12:52
SWIS:	63
Spiller Name:	NEW STYLE CARTING
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Contact:	PHILLIP
Spiller Phone:	( ) -
Spiller Address:	3 RAILROAD PL (49TH LN)
Spiller City,St,Zip:	MASPETH, NY
Spill Cause:	Deliberate
Reported to Dept:	Groundwater
Water Affected:	Not reported
Spill Source:	01
Spill Notifier:	Affected Persons
PBS Number:	Not reported
Cleanup Ceased:	/ /

2 GALASSO PLACE (Continued) **S104284834**

Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/17/99
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/16/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/28/99
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Raw Sewage
Quantity Spilled: 110
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: On 12/16/99, Kerri O Dowd called Phillip Gallaso and left him a message that DEC Sigona was assigned to the spill, and left phone number. On December 16, 1999, DEC Sigona responded to complaint and arrived at 3:00 P.M. DEC Sigona met facility managers for New Style Carting. DEC Sigona inspected the facility and attempted to locate evidence of drums burried behind premises. DEC Sigona determined that complaint was incorrect. The facility had actually removed and properly disposed of 141 tons of petroleum contaminated soil associated with excavation of USTs during October 1999, as previously requested by DEC Sigona). In fact, the facility notified DEC will Spill No. 9906743 in September 1999. DEC found that facility owners were installing a concrete pad in the location of the former USTs. The pad will support a trash compactor being installed. The other UST area was being backfilled with broken concrete pieces and fill material. DEC Sigona did not detect any visualor odors of petroleum in fill material. There were no signs of drums being disposed on site or off-site. According to facility owner, the next dorr neighbor Frank Gallaso) no relationship to phil Gallaso erected a fence last week on easementblocking entrance to business and DEP facility. The Police were called and confrontatioon with Phip Gallaso started. The New Style compmany has filed an order to prevent the fence form being erected and for court trial. They belive the report ofthe drum diosposal was for retailiation purposes. On December 22, 1999, DEC Sigona received follow-up complaint from Phil Gallaso.

2 GALASSO PLACE (Continued) **S104284834**

He complained that New Style Waste had abandonded drums in front of Railroad/Galasso Place. On December 23, 1999,DEC Sigona and Breen performed follow-up inspection and did not find any signs of abandoned drums.

Remark: CALLER S PROPERTY ABUTTS SPILLER S PROPERTY. THEY ARE BURYING DRUMS OF UNKNOWN MATERIAL AND ALSO CONTAMINATED SOIL BEHIND THEIR BLDG AND PARTLY ON CALLER S PROPERTY WITHOUT HIS PERMISSION) -- POSS GROUNDWATER CONTAMINATION AND WATER FLOWING INTO NEWTOWN CREEK. PLEASE CONTACT CALLER ASAP.

K296 **NY Spills** **S104650588**
North **50TH ST & 56TH RD** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.006 mi.
30 ft. **Site 1 of 3 in cluster K**

Relative:
Higher

Actual:
25 ft.

NY Spills:

Site ID:	252001
Facility Addr2:	Not reported
Facility ID:	0000635
Spill Number:	0000635
Facility Type:	ER
SWIS:	4101
Investigator:	JHOCONNE
Referred To:	Not reported
Spill Date:	4/16/2000
Reported to Dept:	4/16/2000
CID:	365
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	5/29/2003
Remediation Phase:	0
Date Entered In Computer:	4/16/2000
Spill Record Last Update:	5/30/2003
Spiller Name:	CALLER
Spiller Company:	CON ED
Spiller Address:	4 IRVING PL
Spiller City,St,Zip:	NEW YORK, NY
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	206493
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL" e2mis 130917 D.Mcloughlin #15811 os emergency investigating trouble feeder 6q35 found approx 30 drops of dielectric fluid leaked onto sidewalk affecting a 3'x6'area. no sewers or waterways affected . cleanup as 50-499 ppm to begin with flush crew . Update 4/16/00 20:50 hrs -- R. Cosentino reports he reviewed job with #9 mechanic and George Jacobi of Env. Ops., found existing aerial joint is a 3W1W lead wipe joint, insulatum filled. Approx. 30 drops

(Continued) **S104650588**

of insulatum found on ground below trouble joint. Since PILC cable is connected to joint, as a precaution the cleanup will be done as 50-499 ppm. #9 to bag joint and G. Jacobi on location to start cleanup. update @ 2200hrs 4/16 j.jacobi os flush reports cleanup completed, sidewalk double washed all liquids solidified & placed in 1 drum. drum returned to yard under 1 trip rule. #12255 vdc. Update - 4/25/00 - Incident is closed - H Bertorelli # 54348 UPDATE 2/3/03 AERIAL JOINT WAS REPAIRED 3/8/02 EV

Remarks: FAULTY AIREAL JOINT - 30 DROPS - CLEAN UP PENDING CREW - REF #130917

Material:
Site ID: 252001
Operable Unit ID: 822380
Operable Unit: 01
Material ID: 288873
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0000635
Investigator: O'CONNELL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/16/2000 18:45
Reported to Dept Date/Time: 04/16/00 19:30
SWIS: 63
Spiller Name: CON ED
Spiller Contact: CALLER
Spiller Phone: (212) 580-6763
Spiller Address: 4 IRVING PL
Spiller City,St,Zip: NEW YORK, NY
Spill Cause: Equipment Failure

(Continued) **S104650588**

Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/16/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 04/17/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: FAULTY AIREAL JOINT - 30 DROPS - CLEAN UP PENDING CREW - REF 130917

D297 **WAREHOUSE** **NY Spills** **S109060133**
ENE **56-45 58TH STREET/58-11 56TH DRIVE** **N/A**
< 1/8 **MASPETH, NY**
0.006 mi.
31 ft. **Site 3 of 9 in cluster D**

Relative:
Higher

Actual:
17 ft.

NY Spills:
Site ID: 394307
Facility Addr2: Not reported
Facility ID: 0712659
Spill Number: 0712659
Facility Type: ER
SWIS: 4101

WAREHOUSE (Continued) **S109060133**

Investigator:	RVKETANI
Referred To:	Not reported
Spill Date:	3/3/2008
Reported to Dept:	3/3/2008
CID:	444
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/22/2011
Remediation Phase:	0
Date Entered In Computer:	3/3/2008
Spill Record Last Update:	2/22/2011
Spiller Name:	TYRON SHAH
Spiller Company:	WAREHOUSE
Spiller Address:	56-45 58TH STREET
Spiller City,St,Zip:	LONG ISLAND, NY
Spiller Company:	001
Contact Name:	TYRON SHAH
Contact Phone:	(917) 271-9914
DEC Region:	2
DER Facility ID:	343874
DEC Memo:	Sangesland spoke to Mr. Shah. He just rented this building and had Petro on site to set up a new account with them. Petro inspected the "Drains" and found oil contamination from the last occupant of the building. Sangesland could not verify if these "Drains" lead out to the city sewers or into on site drywells. Property manager/owner is: Ciampa North LLC, 136-26 37th Ave Flushing, NY 11354 Fax: 718-358-9268 Contact:Jackie 718-939-4888 Landlord's maintenance guy is Joseph 917-681-4252 Mr. Shah left a voice message with Joseph explaining the problem, no response. 03/07/08-Vought-Researched property shark and property address is also listed at 5811 56th Drive that is owned by Ciampa North LLC. PBS registration 2-609990 shows operator as Joe Ciampa (718-939-4888) and listed one 4000-gallon gasoline UST as closed removed in 10/26/06 and one 1080-gallon #2 fuel oil UST also closed/removed in 10/26/06. Vought called Ciampa North and Jackie not in. Vought obtained fax number and faxed and sent out copy of CSL with below requirements. DEC requires: 1)cleaning out of drains 2)delineation of soil and groundwater contamination 3)subission of site plan 4)Submission of inventory records (6NYCRR613.4a and c) 4)Submission of tank closure report as per 40CFR280 5)investigation of drain effluent location. 6/11/10-Vought-Spill transferred from DEC Vought to DEC Ketani as per DEC Austin and Vought transfer to Section A. 9/30/10 - Raphael Ketani. The spill took place on 3/3/08. The tenant had moved in and Petro found oil in the drains. It was not known where the oil had come from. A CSL was sent out, but there has been no response from Joe Ciampa, the landlord. The block and lot are 2664 and 1. According to a picture in Property Shark, the site is a one story commercial building at the corner of 58th Street and 56th Drive in Maspeth. The

WAREHOUSE (Continued) **S109060133**

PBS is #2-609990. This registration is actually for the adjoining property next door, Rosenthol Wine Warehouse, at 56-43 58th Street. A 1,080 UST and a 4,000 UST were closed and removed on 10/26/06. There is only a CSL for the case and the E-docs. There is one other spill case (0712672), but it is for the same site. I sent Mr. Ciampa a standard followup letter to the CSL. 10/21/10 - Raphael Ketani. Lisa from "the Ciampa Organization" called today. She requested a copy of the 2008 CSL. I sent it to her and stated that she needed to have Mr. Ciampa follow the instructions in the letter. I added that the Ciampa Organization has until November 21, 2010 in order to start the investigation. I told her to keep me updated regarding progress with the investigation. She said that she will. 10/27/10 - Raphael Ketani. Lisa Schaefer of the Ciampa Organization sent me an e-mail requesting more information regarding how this spill was discovered. I sent her an explanation with the DEC documentation/investigation requirements from the notes above. 12/2/10 - Raphael Ketani. I tried to call Ms. Schaefer (718) 939-4888, but I could only leave a message. 12/9/10 - Raphael Ketani. I tried to contact Ms. Schaefer and Mr. Ciampa. However, the receptionist told me that both of them were not in. As the deadline has past for starting the investigation, and as there has been no response from either person, I sent a STIP package to Mr. Ciampa. 1/7/11 - Raphael Ketani. I received a letter from Anastasia Stacey Gogos, President of Environmental Planning & Management, Inc., 1983 Marcus Avenue, Ste 109, Lake Success, NY, 11042 (516) 328-1194. The letter stated that EPM will look for documentation regarding the spill and the site. Once the information is found, then EPM will submit a summary and a course of action. The report will be submitted to the DEC on February 6, 2011. Richard Hart is the contact person at EPM. 1/10/11 - Raphael Ketani. I spoke to Mr. Hart. He said that they found the tank removal report for the 4,000 gal. UST. He said that the report has soil end point results. They are still looking for the report regarding the 1,080 gal. tank. I asked Mr. Hart whether the Ciampa Organization intended to sign the STIP. He asked whether they had to. I told him that the STIP was sent because the spill had happened about 3 years ago and the Ciampa Organization hadn't sent the DEC any documentation regarding the remediation of the spill. He said that he will call them and let them know that they still have to sign it. I told Mr. Hart that if we don't receive the signed STIP very soon, then the case will be sent to our legal division. Mr. Hart said that he will call them as soon as we get off the phone. Later, Mr. Hart called me. He said that he spoke to Mr. Ciampa. According to Mr. Hart, Mr. Ciampa is very willing to sign the STIP. He will sign it and get it to the DEC this week. 1/11/11 - Raphael Ketani. Lisa Schaefer of the Ciampa Organization called and stated that the signed STIP will be sent by overnight mail. The DEC will get the STIP by tomorrow. 1/12/11 - Raphael Ketani. I received the STIP that was signed by Mr. Ciampa. I forwarded it to our Office of General Counsel for the director's signature. 1/14/11 - Raphael Ketani. The STIP was signed by the Regional Director today and became executed. 2/15/11 - Raphael Ketani. Today I received a 2/11/11 letter from Mr. Hart of EPM with a UST Closure Report from Impact Environmental. I reviewed the package. It mentions that the 4,000 gal. fuel oil UST (the PBS registration states that the tank contained gasoline) was closed and removed, but not the 1,080 gal. #2 UST. In fact, the entire report does not deal with the 1,080 gal. UST. The end point results for the 4,000 gal. UST grave showed that none of the VOCs exceeded TAGM RSCOs. However, there were exceedences for the benzo series of

WAREHOUSE (Continued) **S109060133**

analytes and their associated combustion products, some of which were in the thousands of parts per billion. However, these analytes concentrations are considered in the report to be due to historical fill. One groundwater sample was taken, but only 6 ppb of MTBE was detected. The report and the contained results indicated that there was little or no soil or groundwater contamination from the oil that was in the 4,000 gal. UST. However, there was no information regarding the 1,080 gal. UST, not even its location. As a result of this, I drafted a letter for the review of Randall Austin, Chief of the Spills Unit, requesting an investigation of the area where the 1,080 gal. UST used to be. 2/22/11 - Raphael Ketani. I met with Mr. Austin to discuss my draft letter. He stated that the State could not demand that Ciampa North investigate the 1,080 gal. tank area as it had contained just oil, not motor fuels. If it had contained motor fuels, then there's a federal requirement that an investigation take place. As there is no requirement to investigate the 1,080 gal. tank area, and as the investigation of the 4,000 gal. tank area showed that there was no oil contamination of the soil and very slight VOC contamination of the groundwater below TAGM standards, I have determined that there is no threat to the public or the environment. Therefore, I am closing the spill case.

Remarks: JUST HAD PETRO CHECK OUT TANK AT A WAREHOUSE HE JUST RENTED AND IT WAS FOUND THAT THERE HAD BEEN A LEAK FROM PREVIOUSE OCCUPANT: PETRO ON SITE

Material:

Site ID:	394307
Operable Unit ID:	1151256
Operable Unit:	01
Material ID:	2141956
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

298
NNE
< 1/8
0.006 mi.
32 ft.

MANHOLE #284
56 DRIVE & 43RD ST
QUEENS, NY

NY Spills **S104284676**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
11 ft.

NY Spills:

Site ID:	110009
Facility Addr2:	Not reported
Facility ID:	9910801
Spill Number:	9910801
Facility Type:	ER
SWIS:	4101
Investigator:	CAENGELH
Referred To:	Not reported
Spill Date:	12/10/1999
Reported to Dept:	12/10/1999
CID:	322
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/28/2002
Remediation Phase:	0
Date Entered In Computer:	12/10/1999
Spill Record Last Update:	3/28/2002
Spiller Name:	UNKNOWN
Spiller Company:	UNKNOWN
Spiller Address:	UNKNOWN
Spiller City,St,Zip:	UNKNOWN, NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	96452
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"
Remarks:	1 GAL UNK OIL ON 200 GAL OF WATER - SAMPLE HAS BEEN TAKEN AND CLEAN UP PENDING - CON ED #129262

Material:

Site ID:	110009
Operable Unit ID:	1089497
Operable Unit:	01
Material ID:	296281
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported

MANHOLE #284 (Continued) **S104284676**

Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9910801
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/10/1999 13:35
Reported to Dept Date/Time: 12/10/99 14:31
SWIS: 63
Spiller Name: UNK
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Address: UNK
Spiller City,St,Zip: NY
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/10/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 02/17/00
Is Updated: False

MANHOLE #284 (Continued) **S104284676**

Tank:
- PBS Number: Not reported
- Tank Number: Not reported
- Tank Size: Not reported
- Test Method: Not reported
- Leak Rate Failed Tank: Not reported
- Gross Leak Rate: Not reported

Material:
- Material Class Type: Petroleum
- Quantity Spilled: 1
- Unkonwn Quantity Spilled: False
- Units: Gallons
- Quantity Recovered: 0
- Unkonwn Quantity Recovered: False
- Material: UNKNOWN PETROLEUM
- Class Type: UNKNOWN PETROLEUM
- Times Material Entry In File: 16414
- CAS Number: Not reported
- Last Date: 19940929
- DEC Remarks: Not reported
- Remark: 1 GAL UNK OIL ON 200 GAL OF WATER - SAMPLE HAS BEEN TAKEN AND CLEAN UP PENDING - CON ED 129262

K299 **CONSOLIDATED EDISON MH288** **MANIFEST** **S110046886**
North **56 RD & 50 ST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.007 mi.
37 ft. **Site 2 of 3 in cluster K**

Relative:
Higher

Actual:
26 ft.

NY MANIFEST:
- EPA ID: NYP004195673
- Country: USA
- Mailing Name: CONSOLIDATED EDISON MH288
- Mailing Contact: FRANKLYN MURRAY
- Mailing Address: 4 IRVING PL RM 828
- Mailing Address 2: Not reported
- Mailing City: NEW YORK
- Mailing State: NY
- Mailing Zip: 10003
- Mailing Zip4: Not reported
- Mailing Country: USA
- Mailing Phone: 212-460-2808

- Document ID: Not reported
- Manifest Status: Not reported
- Trans1 State ID: NJD003812047
- Trans2 State ID: NJD003812047
- Generator Ship Date: 2009-10-12
- Trans1 Recv Date: 2009-10-12
- Trans2 Recv Date: 2009-10-13
- TSD Site Recv Date: 2009-10-13
- Part A Recv Date: Not reported
- Part B Recv Date: Not reported
- Generator EPA ID: NYP004195673
- Trans1 EPA ID: Not reported
- Trans2 EPA ID: Not reported

CONSOLIDATED EDISON MH288 (Continued) **S110046886**

TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	31340.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000893903GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H111

K300 **CON EDISON - MANHOLE 288** **RCRA-LQG** **1014397249**
North **56 RD & 50 ST** **NYP004195673**
< 1/8 **MASPETH, NY 11378**
0.007 mi.
37 ft. **Site 3 of 3 in cluster K**

Relative:
Higher

Actual:
26 ft.

RCRA-LQG:

Date form received by agency:	03/23/2010
Facility name:	CON EDISON - MANHOLE 288
Facility address:	56 RD & 50 ST MASPETH, NY 11378
EPA ID:	NYP004195673
Mailing address:	4 IRVING PLACE NEW YORK, NY 10003
Contact:	FRANKLYN MURRAY
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	(212) 460-2808
Contact email:	MURRAYFR@CONED.COM
EPA Region:	02
Classification:	Large Quantity Generator
Description:	Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

CON EDISON - MANHOLE 288 (Continued) **1014397249**

Owner/Operator Summary:
- Owner/operator name: CONSOLIDATED EDISON COMPANY OF NY, INC.
- Owner/operator address: 4 IRVING PLACE
  NEW YORK, NY 10003
- Owner/operator country: US
- Owner/operator telephone: Not reported
- Legal status: Private
- Owner/Operator Type: Owner
- Owner/Op start date: 09/18/2009
- Owner/Op end date: Not reported

- Owner/operator name: CONSOLIDATED EDISON COMPANY OF NY, INC.
- Owner/operator address: 4 IRVING PLACE
  NEW YORK, NY 10003
- Owner/operator country: US
- Owner/operator telephone: Not reported
- Legal status: Private
- Owner/Operator Type: Operator
- Owner/Op start date: 09/18/2009
- Owner/Op end date: Not reported

Handler Activities Summary:
- U.S. importer of hazardous waste: No
- Mixed waste (haz. and radioactive): No
- Recycler of hazardous waste: No
- Transporter of hazardous waste: No
- Treater, storer or disposer of HW: No
- Underground injection activity: No
- On-site burner exemption: No
- Furnace exemption: No
- Used oil fuel burner: No
- Used oil processor: No
- User oil refiner: No
- Used oil fuel marketer to burner: No
- Used oil Specification marketer: No
- Used oil transfer facility: No
- Used oil transporter: No

Historical Generators:
- Date form received by agency: 09/18/2009
- Facility name: CON EDISON - MANHOLE 288
- Site name: CON EDISON
- Classification: Conditionally Exempt Small Quantity Generator

Hazardous Waste Summary:
- Waste code: D008
- Waste name: LEAD

- Violation Status: No violations found

L301 **NY Spills** **S106017613**
North **49 AND 56 ROAD** **N/A**
< 1/8 **QUEENS, NY**
0.008 mi.
41 ft. **Site 1 of 2 in cluster L**

Relative:
Higher

Actual:
30 ft.

NY Spills:

Site ID:	221002
Facility Addr2:	Not reported
Facility ID:	0305701
Spill Number:	0305701
Facility Type:	ER
SWIS:	4101
Investigator:	SMSANGES
Referred To:	Not reported
Spill Date:	8/28/2003
Reported to Dept:	8/28/2003
CID:	199
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/29/2003
Remediation Phase:	0
Date Entered In Computer:	8/28/2003
Spill Record Last Update:	8/29/2003
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	FERRA BROTHERS
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	182797
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND" EPA contact had no information on this event. notifier contact number was wrong
Remarks:	materal was released from a storage tank - unk reason

Material:

Site ID:	221002
Operable Unit ID:	874160
Operable Unit:	01
Material ID:	502943
Material Code:	0617A
Material Name:	LIME
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported

(Continued) **S106017613**

Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

L302 **POLE #10113** **NY Spills** **S106968318**
North **56TH RD AND 49TH ST** **N/A**
< 1/8 **QUEENS, NY**
0.008 mi.
41 ft. **Site 2 of 2 in cluster L**

Relative:
Higher

Actual:
30 ft.

NY Spills:
Site ID: 346827
Facility Addr2: Not reported
Facility ID: 0502463
Spill Number: 0502463
Facility Type: ER
SWIS: 4101
Investigator: GDBREEN
Referred To: Not reported
Spill Date: 5/31/2005
Reported to Dept: 5/31/2005
CID: 41
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 7/25/2005
Remediation Phase: 0
Date Entered In Computer: 6/1/2005
Spill Record Last Update: 7/25/2005
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Company: Not reported
Contact Name: ERT DESK
Contact Phone: (212) 580-8383
DEC Region: 2
DER Facility ID: 293081

POLE #10113 (Continued) **S106968318**

DEC Memo: 158884. 5/31/05 2135 HRS J. ROSALIE #01547 FOD REPORTS FOUND JOINT LEAKED FROM P#10113 FEEDER 6Q35 THAT OPEN AUTO. APPROX 1-QUART OF INSULATUM ONTO ASPHALT IN STREET ALSO 1/2 PINT ON SIDEWALK. IT IS CONTAINED. NO SEWERS OR WATERAYS AFFECTED. NO FIRE OR SMOKE NO PRIVATE PROPERTY INVOLVED AT THIS TIME. UNABLE TO TAKE SAMPLE FROM JOINT DUE TO FEEDER NEEDS TO BE GROUNDED & TAKEN OFF SYSTEM. ENVIR OPPS CREW WAS DISPACTHED FOR 50-499 CLEANUP. AREA IS CORDONED OFF AT THIS TIME. 1-SAMPLE WILL BE TAKEN FROM STREET. CHAIN CUSTODY #DD-10509 ACCOUNT #45768. G DONATONE 6/1/05 Update 0500hrs : Environmental Operations Crew Stubbs, Walker and Stanford responded to Overhead spill on Pole #10113 and treated as 50-499PPM PCB. Source of spill is a blown joint on feeder 6Q35. Crew double washed an area of 25' wide by 30' long. Fence divide 10' area into private property and 15' into sidewalk and street. The fence was also double washed. Crew used safe wash and Biogen to wash area. Overhead diaper leaking joint and two drums of solid and PPE generated. Drums will be brought to CPB yard under the one trip rule. Crew will manned area pending lab results. G DONATONE UDPATE 01-JUNE-2005 3658. Results of Analysis. DESCRIPTION: GREASE FROM JOINT. Aroclor 1242 < 1.0 ppm EPA 608/8082 Aroclor 1254 12.0 ppm EPA 608/8082 Aroclor 1248 < 1.0 ppm EPA 608/8082 Aroclor 1260 < 1.0 ppm EPA 608/8082

---------- TOTAL PCB 12 ppm borcherdingc UPDATE 01-JUNE-2005 1350. ENVIRONMENTAL OPS MECHANIC J. BREAKENRIDGE, EMP NO. 85657 REPORTS, OVERHEAD DEPARTMENT MADE REPAIRS TO THE ARIAL JOINT. SIDEWALK WAS RE-CLEANED, UTILIZING ABSORBALL, ALL DEBRIS WAS REMOVED & SIDEWALK WASHED W/ SAFEWASH. CLEANUP IS REPORTED TO BE 100% COMPLETE. BORCHERDINGC Closed. 7-25-05. George Breen

Remarks: spill is contained - feeder #6Q35 - no to five questions - 1 1/2 quarts of fluid. 158884.

Material:

Site ID:	346827
Operable Unit ID:	1104585
Operable Unit:	01
Material ID:	584806
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

F303
WSW
< 1/8
0.009 mi.
49 ft.

55-04 MASPETH AVE
QUEENS, NY

Site 8 of 12 in cluster F

Relative:
Higher

Actual:
19 ft.

NY Spills **S104649012**
NY Hist Spills **N/A**

NY Spills:

Site ID:	185869
Facility Addr2:	Not reported
Facility ID:	9901700
Spill Number:	9901700
Facility Type:	ER
SWIS:	4101
Investigator:	TOMASELLO
Referred To:	Not reported
Spill Date:	5/13/1999
Reported to Dept:	5/13/1999
CID:	270
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/3/2003
Remediation Phase:	0
Date Entered In Computer:	5/13/1999
Spill Record Last Update:	3/3/2003
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ALDO LORENZINI
Contact Phone:	(718) 628-2071
DEC Region:	2
DER Facility ID:	155454
DEC Memo:	Not reported
Remarks:	HOSE ON VEHICLE BROKE DURING DELIVERY CAUSING SPILL

Material:

Site ID:	185869
Operable Unit ID:	1080470
Operable Unit:	01
Material ID:	305234
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20
Units:	Gallons
Recovered:	20
Resource Affected:	Not reported
Oxygenate:	False

(Continued) **S104649012**

Tank Test:
- Site ID: Not reported
- Spill Tank Test: Not reported
- Tank Number: Not reported
- Tank Size: Not reported
- Test Method: Not reported
- Leak Rate: Not reported
- Gross Fail: Not reported
- Modified By: Not reported
- Last Modified: Not reported
- Test Method: Not reported

NY Hist Spills:
- Region of Spill: 2
- Spill Number: 9901700
- Investigator: TOMASELLO
- Caller Name: Not reported
- Caller Agency: Not reported
- Caller Phone: Not reported
- Notifier Name: Not reported
- Notifier Agency: Not reported
- Notifier Phone: Not reported
- Spill Date/Time: 05/13/1999 13:00
- Reported to Dept Date/Time: 05/13/99 14:44
- SWIS: 63
- Spiller Name: UNKNOWN
- Spiller Contact: Not reported
- Spiller Phone: ( ) -
- Spiller Contact: ALDO LORENZINI
- Spiller Phone: (718) 628-2071
- Spiller Address: Not reported
- Spiller City,St,Zip: Not reported
- Spill Cause: Equipment Failure
- Reported to Dept: On Land
- Water Affected: Not reported
- Spill Source: 07
- Spill Notifier: Affected Persons
- PBS Number: Not reported
- Cleanup Ceased: / /
- Cleanup Meets Std: False
- Last Inspection: / /
- Recommended Penalty: Penalty Not Recommended
- Spiller Cleanup Dt: / /
- Enforcement Date: / /
- Invstgn Complete: / /
- UST Involvement: False
- Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
- Spill Closed Dt: / /
- Corrective Action Plan Submitted: / /
- Date Region Sent Summary to Central Office: / /
- Date Spill Entered In Computer Data File: 05/13/99
- Date Spill Entered In Computer Data File: Not reported
- Update Date: 05/14/99
- Is Updated: False

(Continued) **S104649012**

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 20
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: HOSE ON VEHICLE BROKE DURING DELIVERY CAUSING SPILL

F304 **55-05 MASPETH AVE.** **NY Spills** **S102102828**
WSW **55-05 MASPETH AVE.** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.009 mi.
49 ft. **Site 9 of 12 in cluster F**

Relative:
Higher

Actual:
19 ft.

NY Spills:
Site ID: 196167
Facility Addr2: Not reported
Facility ID: 9214173
Spill Number: 9214173
Facility Type: ER
SWIS: 4101
Investigator: JMKRIMGO
Referred To: Not reported
Spill Date: 3/25/1993
Reported to Dept: 3/25/1993
CID: Not reported
Spill Cause: Housekeeping
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/24/1997
Remediation Phase: 0
Date Entered In Computer: 3/29/1993
Spill Record Last Update: 10/24/1997
Spiller Name: Not reported

55-05 MASPETH AVE. (Continued) **S102102828**

Spiller Company:	NORDIC WOODWORKING CO.
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	163426
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "KRIMGOLD" 10/10/95: This is additional information about material spilled from the translation of the old spill file: PARKING LOT COVERED. REF TO AIR DIV.
Remarks:	DUST CONTROL EXHAUST SYSTEM AT NORDIC WOODWORKING CO. HAS NO RECOVERY FEATURE. WOOD SAWDUST & FORMICA SAWDUST IS EJECTED FROM THE BLDG INTO THE AIR DISTRIBUTING A LAYER OF THE MATERIALS ALL OVER THE

Material:

Site ID:	Not reported
Operable Unit ID:	Not reported
Operable Unit:	Not reported
Material ID:	Not reported
Material Code:	Not reported
Material Name:	Not reported
Case No.:	Not reported
Material FA:	Not reported
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9214173
Investigator:	KRIMGOLD
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	03/25/1993 12:00
Reported to Dept Date/Time:	03/25/93 13:54
SWIS:	63

55-05 MASPETH AVE. (Continued) **S102102828**

Spiller Name: NORDIC WOODWORKING CO.
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Housekeeping
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/24/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/29/93
Date Spill Entered In Computer Data File: Not reported
Update Date: 10/24/97
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Not reported
Quantity Spilled: Not reported
Unkonwn Quantity Spilled: Not reported
Units: Not reported
Quantity Recovered: Not reported
Unkonwn Quantity Recovered: Not reported
Material: Not reported
Class Type: Not reported
Times Material Entry In File: Not reported
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: PARKING LOT COVERED. REF TO AIR DIV.
Remark: DUST CONTROL EXHAUST SYSTEM AT NORDIC WOODWORKING CO. HAS NO RECOVERY FEATURE. WOOD SAWDUST FORMICA SAWDUST IS EJECTED FROM THE BLDG INTO THE AIR DISTRIBUTING A LAYER OF THE MATERIALS ALL OVER THE

F305 **55-04 MASPETH AVE** **LTANKS** **S102102757**
WSW **55-04 MASPETH AVE** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY** **NY Spills**
0.009 mi. **NY Hist Spills**
49 ft. **Site 10 of 12 in cluster F**

Relative:
Higher

Actual:
19 ft.

LTANKS:

Site ID:	185868
Spill No:	0008225
Spill Date:	10/12/2000
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	5/11/2004
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	MCTIBBE
Referred To:	Not reported
Reported to Dept:	10/13/2000
CID:	389
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	10/13/2000
Spill Record Last Update:	5/11/2004
Spiller Name:	Not reported
Spiller Company:	NYC TRANSIT
Spiller Address:	370 JAY ST
Spiller City,St,Zip:	BROOKLYN, NY -
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	278314
Remarks:	CALLER REPORTING A TANK TEST FAILURE TANK AND PIPES ARE DOUBLE WALLED NO RELEASE. NO CALLBACK NECESSARY

Material:

Site ID:	185868
Operable Unit ID:	830596
Operable Unit:	01
Material ID:	545741
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

55-04 MASPETH AVE (Continued) **S102102757**

Tank Test:

Site ID:	185868
Spill Tank Test:	1525934
Tank Number:	Not reported
Tank Size:	2500
Test Method:	03
Leak Rate:	0
Gross Fail:	F
Modified By:	Spills
Last Modified:	10/1/2004
Test Method:	Horner EZ Check I or II

HIST LTANKS:

Region of Spill:	2
Spill Number:	0008225
Spill Date:	10/12/2000
Spill Time:	17:00
Spill Cause:	Tank Test Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Investigator:	TIBBE
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	10/13/00
Reported to Department Time:	11:54
SWIS:	63
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	NYC TRANSIT
Spiller Address:	370 JAY ST
Spiller City,St,Zip:	BROOKLYN, NY -
Spiller Cleanup Date:	/ /
Facility Contact:	Not reported
Facility Phone:	( ) -
Facility Extention:	Not reported
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	True

55-04 MASPETH AVE (Continued) **S102102757**

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/13/00
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 10/13/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 2500
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Talk Test Failures only pass or fail

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: CALLER REPORTING A TANK TEST FAILURE TANK AND PIPES ARE DOUBLE WALLED NO RELEASE. NO CALLBACK NECESSARY

NY Spills:
Site ID: 136876
Facility Addr2: Not reported
Facility ID: 9208440
Spill Number: 9208440
Facility Type: ER
SWIS: 4101
Investigator: KSTANG
Referred To: Not reported
Spill Date: 10/22/1992
Reported to Dept: 10/22/1992
CID: Not reported
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: 10/23/1992
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/23/1992
Remediation Phase: 0
Date Entered In Computer: 10/23/1992

55-04 MASPETH AVE (Continued) **S102102757**

Spill Record Last Update:	9/30/2004
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	117111
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TANG"
Remarks:	CONNECTION ON DELIVERY HOSE FITTING BROKE-OIL SPRAYED ONTO A CAR AND CONCRETE STREET-DRIVER APPLIED SPEEDI-DRI,SPILL TEAM ENROUTE TO P/U AND DISPOSE

Material:

Site ID:	136876
Operable Unit ID:	975231
Operable Unit:	01
Material ID:	405537
Material Code:	0012
Material Name:	Kerosene (#1 Fuel Oil)
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9208440
Investigator:	TANG
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	10/22/1992 08:40
Reported to Dept Date/Time:	10/22/92 08:55
SWIS:	63

55-04 MASPETH AVE (Continued) **S102102757**

Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 08
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 10/23/92
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/23/92
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/23/92
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: KEROSENE
Class Type: KEROSENE
Times Material Entry In File: 2052
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: CONNECTION ON DELIVERY HOSE FITTING BROKE-OIL SPRAYED ONTO A CAR AND CONCRETE STREET-DRIVER APPLIED SPEEDI-DRI,SPILL TEAM ENROUTE TO P/U AND DISPOSE

C306 **BORO-WIDE RECYCLING CORP.** **AST** **A100354060**
SSW **3 RAILROAD PLACE** **N/A**
< 1/8 **MASPETH, NY 11378**
0.009 mi.
50 ft. **Site 3 of 10 in cluster C**

Relative:
Higher

Actual:
13 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-603855
Program Type:	PBS
UTM X:	591480.48987000005
UTM Y:	4508594.57711
Expiration Date:	2015/12/08

Affiliation Records:

Site Id:	25754
Affiliation Type:	Emergency Contact
Company Name:	BORO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	ROBERT CRISTINA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(917) 416-3960
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BKFALVEY
Date Last Modified:	12/10/2010

Site Id:	25754
Affiliation Type:	Owner
Company Name:	BORO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	3 RAILROAD PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 326-7149
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BKFALVEY
Date Last Modified:	12/10/2010

Site Id:	25754
Affiliation Type:	On-Site Operator
Company Name:	BORO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	ROMEO FERRANTE
Address1:	Not reported
Address2:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **A100354060**

City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 326-7149
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BKFALVEY
Date Last Modified:	12/10/2010

Site Id:	25754
Affiliation Type:	Mail Contact
Company Name:	BOBO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	ROBERT CRISTINA
Address1:	3 RAILROAD PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 326-7149
Phone Ext:	Not reported
Email:	BOB@BOROWIDERECYCLING.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/8/2010

Equipment Records:

L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
I05 - Overfill - Vent Whistle
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None

BORO-WIDE RECYCLING CORP. (Continued) **A100354060**

H00 - Tank Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
I05 - Overfill - Vent Whistle
B00 - Tank External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
E00 - Piping Secondary Containment - None
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
I05 - Overfill - Vent Whistle
K00 - Spill Prevention - None
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
K00 - Spill Prevention - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I05 - Overfill - Vent Whistle
K00 - Spill Prevention - None
K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None

BORO-WIDE RECYCLING CORP. (Continued) **A100354060**

D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
I05 - Overfill - Vent Whistle
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None

BORO-WIDE RECYCLING CORP. (Continued) **A100354060**

J02 - Dispenser - Suction
D00 - Pipe Type - No Piping
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
C00 - Pipe Location - No Piping

Tank Info:

Tank Number:	1
Tank Id:	237255
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1999
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	12/8/2010

Tank Number:	2
Tank Id:	237256
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1999
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	12/8/2010

Tank Number:	3
Tank Id:	237257
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1999
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **A100354060**

Register:	True
Modified By:	NRLOMBAR
Last Modified:	12/8/2010
Tank Number:	4
Tank Id:	237258
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1999
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	12/8/2010

C307 **BORO-WIDE RECYCLING CORP.** **UST** **U003418629**
SSW **3 RAILROAD PLACE** **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.009 mi.
50 ft. **Site 4 of 10 in cluster C**

Relative:
Higher

Actual:
13 ft.

UST:

Facility Id:	2-603855
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2015/12/08
UTM X:	591480.48987000005
UTM Y:	4508594.57711

Affiliation Records:

Site Id:	25754
Affiliation Type:	Emergency Contact
Company Name:	BORO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	ROBERT CRISTINA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(917) 416-3960
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BKFALVEY
Date Last Modified:	12/10/2010
Site Id:	25754

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Affiliation Type:	Owner
Company Name:	BORO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	3 RAILROAD PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 326-7149
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BKFALVEY
Date Last Modified:	12/10/2010

Site Id:	25754
Affiliation Type:	On-Site Operator
Company Name:	BORO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	ROMEO FERRANTE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 326-7149
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BKFALVEY
Date Last Modified:	12/10/2010

Site Id:	25754
Affiliation Type:	Mail Contact
Company Name:	BOBO-WIDE RECYCLING CORP.
Contact Type:	Not reported
Contact Name:	ROBERT CRISTINA
Address1:	3 RAILROAD PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 326-7149
Phone Ext:	Not reported
Email:	BOB@BOROWIDERECYCLING.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/8/2010

Equipment Records:

L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

L00 - Piping Leak Detection - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
I05 - Overfill - Vent Whistle
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
I05 - Overfill - Vent Whistle
B00 - Tank External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
E00 - Piping Secondary Containment - None
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
I05 - Overfill - Vent Whistle
K00 - Spill Prevention - None
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
K00 - Spill Prevention - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I05 - Overfill - Vent Whistle
K00 - Spill Prevention - None
K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
I05 - Overfill - Vent Whistle
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D00 - Pipe Type - No Piping
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
C00 - Pipe Location - No Piping

Tank Info:

Site ID:	25754
Tank Number:	001
Tank ID:	55764
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	002
Tank ID:	55765
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	003
Tank ID:	55766
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	004
Tank ID:	55767
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	005
Tank ID:	55768
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	006
Tank ID:	55769
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	007
Tank ID:	55770
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	008
Tank ID:	55771
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	009
Tank ID:	55772
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	010
Tank ID:	55773
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25754
Tank Number:	011
Tank ID:	55774
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Install Date:	Not reported
Capacity Gallons:	3000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	7/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-603855
SPDES Number:	Not reported
Emergency Contact:	ROBERT CRISTINA
Emergency Telephone:	(718) 326-7128
Operator:	ROBERT CRISTINA
Operator Telephone:	(718) 326-7128
Owner Name:	MIRO REALTY CORP.
Owner Address:	3 RAILROAD PLACE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 326-7128
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	NEW STYLE WASTE REMOVAL CORP.
Mailing Address:	3 RAILROAD PLACE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	ROBERT CRISTINA
Mailing Telephone:	(718) 326-7128
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	01/05/1999
Expiration Date:	12/28/2003
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Vent Whistle
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 07/01/1999
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Vent Whistle, None
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 07/01/1999
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	007
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	008
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	009
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	010
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	011
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	3000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None

BORO-WIDE RECYCLING CORP. (Continued) **U003418629**

Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

C308 **NEW STYLE WASTE** **SWRCY** **S102559261**
SSW **3 RAILROAD PL** **HIST LTANKS** **N/A**
< 1/8 **MASPBETH, NY** **NY Spills**
0.009 mi. **NY Hist Spills**
50 ft. **Site 5 of 10 in cluster C**

Relative:
Higher

Actual:
13 ft.

SWRCY:

Region:	2
Facility Address 2:	Not reported
Phone Number:	7183265419
Owner Type:	Not reported
Owner Name:	Robert Cristina
Owner Address:	3 Railroad Place
Owner Address 2:	Not reported
Owner City,St,Zip:	Maspeth, NY 11378
Owner Email:	myrnarecycling@hotmail.com
Owner Phone:	Not reported
Contact Name:	Not reported
Contact Address:	Not reported
Contact Address 2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Recylables handling and recovery facilities
Activity Number:	[41MA2]
Active:	Yes
East Coordinate:	591523
North Coordinate:	4508663
Accuracy Code:	4.3 - Utilization of Digital Orthophoto Quads
Regulatory Status:	Registration
Permit #:	None
Auth. Date:	Not reported
Expiration Date:	Not reported
Waste Types:	Metals (Ferrous);Metals (Non-Ferrous);Paper/Cardboard;Paper (All Types);Plastics;Waste Tires

HIST LTANKS:

Region of Spill:	2
Spill Number:	9906743
Spill Date:	09/07/1999
Spill Time:	09:00
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported

NEW STYLE WASTE (Continued) **S102559261**

Spill Source:	Other Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Investigator:	SIGONA
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	09/07/99
Reported to Department Time:	10:12
SWIS:	63
Spiller Contact:	BILL RYAN
Spiller Phone:	(516) 454-6100
Spiller Extention:	Not reported
Spiller Name:	NEW STYLE WASTE
Spiller Address:	3 RAILROAD PL
Spiller City,St,Zip:	MASPBETH, NY
Spiller Cleanup Date:	/ /
Facility Contact:	BILL RYAN
Facility Phone:	(516) 454-6100
Facility Extention:	Not reported
Spill Notifier:	Other
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	True
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	09/07/99
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	11/15/99
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	True
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	True

NEW STYLE WASTE (Continued) **S102559261**

Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: DEC SIGONA REASSIGNED FROM TOMASELLO ON 10/15/99. DEC Sigona conducted previous investigation at site.
Spill Cause: DURING TANK REMOVAL CALLER FOUND CONTAMINED SOIL AROUND 3 TANKS CELL PHONE 516-551-9047 FOR CALLER AT SITE

NY Spills:
Site ID: 157259
Facility Addr2: Not reported
Facility ID: 9906743
Spill Number: 9906743
Facility Type: ER
SWIS: 4101
Investigator: skcarlso
Referred To: MNA
Spill Date: 9/7/1999
Reported to Dept: 9/7/1999
CID: 257
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not Closed
Remediation Phase: 4

NEW STYLE WASTE (Continued) **S102559261**

Date Entered In Computer: 9/7/1999
Spill Record Last Update: 5/27/2009
Spiller Name: BILL RYAN
Spiller Company: NEW STYLE WASTE
Spiller Address: 3 RAILROAD PL
Spiller City,St,Zip: MASPETH, NY
Spiller Company: 001
Contact Name: BILL RYAN
Contact Phone: (516) 454-6100
DEC Region: 2
DER Facility ID: 133005
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL" This spill case was reassigned from DEC (Sigona) to Rommel on 02/02/2004 (diesel) This gasoline spill case has been reassigned from DEC (Sigona) to Rommel on January 7, 2004. DEC SIGONA REASSIGNED FROM TOMASELLO ON 10/15/99. DEC Sigona conducted previous investigation at site. 02/24/05 Reassigned from Rommel to Sun. 03/04/05 File Update by Sun: On 03/03/05, Sun sent a letter to Michael Weinberger, the property owner informing him that the the Department has reviewed the Underground Storage Tank Closure Report prepared by his consultant, American Environmental Assessment Corp., dated September 1999 for the above referenced site. The report indicated that 24 soil endpoint samples secured from the sidewalls and bottom of each of three tank fields had high VOC and SVOC concentrations in excess of NYSDEC guidance values as outlined in the Technical and Administrative Guidance Memorandum (TAGM) #4046 for Recommended Soil Cleanup Objectives for Gasoline and fuel oil Contaminated Soils. In order to evaluate the impact on the soil and groundwater contamination on and off site from the above spill, the Department requires the following by May 31, 2005 as per DER-10 Technical Guidance for Site Investigation and Remediation (document available at http://www.dec.state.ny.us/website/der/index.html): 1. Delineation of Soil and Groundwater Contamination: A subsurface investigation to adequately characterize site hydrogeology and to completely delineate the full extent of petroleum contamination to soil and groundwater both on-site and off-site must be performed. The investigation at a minimum must include installation of borings/wells: 1) one at center of former 6-550 gallon USTs of Gas/Diesel tank field (Tank Field #1), 2) one at former 3000-gallon fuel oil UST (Tank Field #2), 3) one at center of former 4-550 gallon USTs of Gas/Diesel tank field (Tank Field #3)n and 4)one at each former pump island. A report summarizing the findings of the subsurface investigation including boring logs, well installation logs, sample analyticals, site plan, conclusions and recommendations must be submitted to the Department. Additional borings/monitoring wells may be required by the Department upon review of the investigation report. 2. Surrounding Property Sketch: A surrounding property sketch including property layout and usage must be submitted to the Department. North arrow and scale must also be included on the Site Plan. 3. Locations of Remote Fills and Dispenser Islands: The locations of former remote fills and dispenser islands must be included on the site plan. The Department will evaluate the submitted information and determine if additional investigation is warranted. (Joe Sun) 06/09/05-File Update by Sun: On 06/08/05 Sun sent a letter to the consultant, Sander Sternig of VTEQRE, Ltd., informing him that the Department has reviewed the the Soil and Groundwater Delineation Report prepared by VTEQE, Ltd., dated May 10, 2005, and required that

NEW STYLE WASTE (Continued) **S102559261**

the investigation report must be resubmitted to include the following items: 1)Analytical results for VOCs for soil and groundwater samples for boring location #3 from former six (6) 550-gallon gasoline USTs, 2)Correct the North Arrow, and also correct the description of former UST locations on Site Map. The Revised Investigation Report must be submitted to the Department by July 15, 2005.(Sun) 12/1/05: Reassigned from Sun to Andersen. 12/2/05: Reviewed revised soil and groundwater report submitted by VTEQE,LTD. The department requires additional delineation around soil core #3. 12/12/05: Received letter from Sander Sternig with locations of two additional MW locations. Approved locations on 12/12/05. 3/17/06: Called Sander Sternig of VTEQE LTD. The property owner is being uncooperative with respect to continued investigation and action at this site. Sent RAP required letter. 5/17/06: Spoke to Michael Christina (718-326-7149, borowiderecy@aol.com). He requested the department recommend other companies for him to use because he wants to solicit estimates for an RAP. An extension was granted until June 16, 2006. 6/21/06: Spoke to Michael Christina (fax 718-416-1913). Chris Tomasello of ASR is the new consultant for the site. 6/29/06: Received a call from Chris Tomasello that is he the new consultant for the site. 8/9/06: Sent Chris Tomasello an email to followup on status. (ctomasello@askasr.com) 8/18/06: Received email from Christ Tomasello: "My client has been on vacation. I am setting up a meeting with him and I was assured that he is ready, willing, and able to go forward. I will keep you in the loop." 9/8/06: Sent Chris Tomasello an email to followup on status. 9/19/06: Received email from Chris Tomasello. An RAP will be prepared once they are officially retained. 10/6/06: Received email from Chris Tomasello. He was been retained. RAP required. 10/30/06: Sent email to Chris Tomasello to followup on status of RAP submission. 11/6/06: Approved RAP. Four monitoring wells and three injection wells. Biorem injection. Monthly monitoring, quarterly sampling, and semi-annual reporting will occur. 1/22/07: Emailed Chris Tomasello to followup on RAP implementation. Received email from Tomasello:"ASR is actively working at 3 Railroad place. The client has a very active business and we are working directly in the middle of his work area. To not close him down, ASR has been performing all of our work on Saturdays. To date, we have installed 3 groundwater observation wells, and 3 bio application points. Boring have been logged and soil samples have been taken. The site has been surveyed. GW flow has been determined. Two additional wells were scheduled to go in last Saturday, but were canceled due to the weather. Borowide had equipment failures due to the cold and could not clean the site for work to be performed. We are attempting to reschedule the installation of the wells for 1/27/07 or possibly 2/3/07. After the installation of the wells, the site wells will be developed and sampled." 3/7/07: Received email from Chris Tomasello:"We are finalizing the status report on Rail Road Place and the report ison it's way out to you. It includes groundwater and soil samples. The Bio will start just as soon as the weather breaks. There is no where enclosed to mix the product on the site." 3/13/07: Received update report. Wells installed and sampled. Impacted soil and groundwater in MW 1, 2, 3. Max BTEX 2751 ppb (MW3) (2/12/07). High benzene concentrations (1400 ppb benzene in MW3). Bioremediation has not been applied yet. 5/2/07: Received email from Chris Tomasello: "Yes we have started the installation of the bio solution. To date we have installed 150 gallons of the bio solution out of 2,500 gallons. There will be 17 applications of 150 gallons each over

NEW STYLE WASTE (Continued) **S102559261**

an 8 week period. We are scheduled to go out to the site on Friday May 4th for an additional treatment. Please let me know if you would like to go out and see the work so that I can narrow down a time that my guys will be on the site. We don't work regular hours there-sometimes we start early or late." 7/30/07: Emailed Chris Tomasello to followup on the status of bioremedation application and quarterly report submission. Received email from Chris Tomasello:"We are still making bio applications at the site. We have one or two more applications to make. It has taken a little longer than we anticipated because the site groundwater is higher than anticipated, therefore it cannot take the product as fast as we had proposed. Also, the client is on a payment plan and we don't want to get too far ahead of him. The site is due to be sampled the end of next month (August) with a report to follow. " 10/12/07: Left voice message with Chris Tomasello's receptionist to followup on update report. 10/23/07: Emailed Chris Tomasello to followup on quarterly report submittal. 10/24/07: Reviewed status report. Bioaugmentation solution applied to three injection wells in February - March 2007 (location not shown on site plan). Four monitoring wells sampled in September 2007. Low dissolved concentrations remain. Sent letter requesting quarterly sampling. Review for closure in one or two additional quarters. 4/28/08 - Carlson: Emailed Chris Tomasello. A quarterly report is overdue. 5/1/08 - Carlson: Received email from Chris Tomasello. Report is on the way. 5/14/08 - Carlson: Reviewed reports dated March 2008 and April 2008. Wells sampled on 2/28/08. General increase in contamination. Bioremediation unsuccessful. Maximum BTEX 8150 ppb (MW3). Maximum MTBE 5 ppb (MW1). 10/17/08 - Carlson: Reviewed update report. Wells sampled on 5/31/08. Maximum BTEX concentration 8,520 ppb (MW3). MTBE ND. 4/10/09 - Carlson: Emailed Chris Tomasello - quarterly update report overdue. 5/27/09 - Carlson: Spoke to Chris Tomasello. Update report will be submitted next week.

Remarks: DURING TANK REMOVAL CALLER FOUND CONTAMINED SOIL AROUND 3 TANKS CELL PHONE 516-551-9047 FOR CALLER AT SITE

Material:

Site ID:	157259
Operable Unit ID:	1085177
Operable Unit:	01
Material ID:	299468
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	157259
Operable Unit ID:	1085177
Operable Unit:	01
Material ID:	299469
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons

NEW STYLE WASTE (Continued) **S102559261**

Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	157259
Operable Unit ID:	1085177
Operable Unit:	01
Material ID:	299467
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	157259
Operable Unit ID:	1085177
Operable Unit:	01
Material ID:	299466
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Site ID:	150684
Facility Addr2:	Not reported
Facility ID:	9613076
Spill Number:	9613076
Facility Type:	ER
SWIS:	4101
Investigator:	SMMARTIN
Referred To:	Not reported
Spill Date:	2/4/1997
Reported to Dept:	2/4/1997
CID:	351
Spill Cause:	Housekeeping
Water Affected:	Not reported
Spill Source:	Commercial/Industrial

NEW STYLE WASTE (Continued) **S102559261**

Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/5/1997
Remediation Phase:	0
Date Entered In Computer:	2/4/1997
Spill Record Last Update:	2/6/1997
Spiller Name:	Not reported
Spiller Company:	NEW STYLE WASTE, INC
Spiller Address:	SAME
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	128105
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MARTINKAT" 2/5/97 SPOKE WITH BRIAN FALVEY, SOLID WASTE 3RRPR IS OFFICE, FACILITY ON GRAND AVENUE. 2/5 VISITED SITE WITH ECO'S WILLIAMS & FRITZ AREA AROUND TANK CLEAN. HAD BEEN RAINING STEADILY OVERNIGHT... REGISTRATION REQUIRED FOR WASTE OIL TANK.
Remarks:	WORKERS IN THE FACILTY WERE TRANSFERRING WASTE OIL + ANTI-FREEZE INTO A WASTE OIL TANK + WAS SPILLING OIL + ANTI-FREEZE ONTO THE GROUND + FLOWING INTO A CATCH BASIN - SPILL FAXED FROM REGION 2 ON 02/04/97

Material:

Site ID:	150684
Operable Unit ID:	1044617
Operable Unit:	01
Material ID:	341725
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	150684
Operable Unit ID:	1044617
Operable Unit:	01
Material ID:	341726
Material Code:	0043A
Material Name:	ANTIFREEZE
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

NEW STYLE WASTE (Continued) **S102559261**

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Click this hyperlink while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill:	2
Spill Number:	9613076
Investigator:	MARTINKAT
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	02/04/1997 12:40
Reported to Dept Date/Time:	02/04/97 15:15
SWIS:	63
Spiller Name:	NEW STYLE WASTE, INC
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	SAME
Spiller City,St,Zip:	Not reported
Spill Cause:	Housekeeping
Reported to Dept:	In Sewer
Water Affected:	Not reported
Spill Source:	01
Spill Notifier:	DEC
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	02/05/97
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	02/04/97
Date Spill Entered In Computer Data File:	Not reported
Update Date:	02/06/97

NEW STYLE WASTE (Continued) **S102559261**

Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported
Last Date: 19940927
Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: ANTIFREEZE
Class Type: ANTIFREEZE
Times Material Entry In File: 0
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: 2/5/97 SPOKE WITH BRIAN FALVEY, SOLID WASTE 3RRPR IS OFFICE, FACILITY ON GRAND AVENUE. 2/5 VISITED SITE WITH ECO S WILLIAMS FRITZ AREA AROUND TANK CLEAN. HAD BEEN RAINING STEADILY OVERNIGHT... REGISTRATION REQUIRED FOR WASTE OIL TANK.
Remark: WORKERS IN THE FACILTY WERE TRANSFERRING WASTE OIL + ANTI-FREEZE INTO A WASTE OIL TANK + WAS SPILLING OIL + ANTI-FREEZE ONTO THE GROUND + FLOWING INTO A CATCH BASIN - SPILL FAXED FROM REGION 2 ON 02/04/97

M309 **BROOKLYN QUEENS EXPRESSWA** **NY Spills** **S102144578**
North **B.Q.X-WAY/ KOSCIOSKO BRGE** **NY Hist Spills** **N/A**
< 1/8 **NEW YORK, NY**
0.011 mi.
60 ft. **Site 1 of 3 in cluster M**

Relative:
Higher

Actual:
11 ft.

NY Spills:
Site ID: 102790
Facility Addr2: Not reported
Facility ID: 8702066
Spill Number: 8702066
Facility Type: ER
SWIS: 4101
Investigator: UNASSIGNED
Referred To: Not reported
Spill Date: 6/12/1987
Reported to Dept: 6/12/1987
CID: Not reported

BROOKLYN QUEENS EXPRESSWA (Continued) **S102144578**

Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	DEC
Cleanup Ceased:	6/12/1987
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Not reported
Spill Closed Dt:	6/12/1987
Remediation Phase:	0
Date Entered In Computer:	6/12/1987
Spill Record Last Update:	9/30/2004
Spiller Name:	Not reported
Spiller Company:	LOMG ISLAND TRUCKING CO.
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	91015
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was " " Not reported
Remarks:	SEVERAL PRODUCT LINES ON TRUCK LEAKING ON ROADWAY.

Material:

Site ID:	102790
Operable Unit ID:	908671
Operable Unit:	01
Material ID:	471946
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2

BROOKLYN QUEENS EXPRESSWA (Continued) **S102144578**

Spill Number:	8702066
Investigator:	Not reported
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	06/12/1987 08:00
Reported to Dept Date/Time:	06/12/87 08:30
SWIS:	63
Spiller Name:	LOMG ISLAND TRUCKING CO.
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Equipment Failure
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	08
Spill Notifier:	DEC
PBS Number:	Not reported
Cleanup Ceased:	06/12/87
Cleanup Meets Std:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	06/12/87
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	06/12/87
Date Spill Entered In Computer Data File:	Not reported
Update Date:	/ /
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	2
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	GASOLINE
Class Type:	GASOLINE
Times Material Entry In File:	21329
CAS Number:	Not reported

BROOKLYN QUEENS EXPRESSWA (Continued) **S102144578**

Last Date: 19940929
DEC Remarks: Not reported
Remark: SEVERAL PRODUCT LINES ON TRUCK LEAKING ON ROADWAY.

C310 **AIRACTOR CORP.** **SSTS** **1005424112**
SSW **5 RAILROAD PLACE** **N/A**
< 1/8 **MASPETH-, NY 11378**
0.012 mi.
62 ft. **Site 6 of 10 in cluster C**

Relative:
Higher

Actual:
13 ft.

SSTS:
Product: D. D. G.
Contact: Not reported
Status: Inactive
Registration Number: 006095NY 001
Report Year: 1990
Permit: Registered
Product Number: 00609500003
Product Type: End-use blend, formulation, or concentrate
Product Class: Disinfectant, germicide, sanitizer
Product Use: All other products
UOM: Not reported
Market: Marketed in the United States and exported out of the United States
Region: Not reported
Zero product: Not reported
Pesticide RUP report: Not reported

F311 **CERRO WIRE & CABLE CO** **RCRA-NonGen** **1000366435**
WSW **5500 MASPETH AVE** **FINDS** **NYD041552811**
< 1/8 **MASPETH, NY 11378** **UST**
0.013 mi. **HIST UST**
67 ft. **Site 11 of 12 in cluster F** **MANIFEST**

Relative:
Higher

Actual:
18 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: CERRO WIRE & CABLE CO
Facility address: 5500 MASPETH AVE
MASPETH, NY 113782221
EPA ID: NYD041552811
Mailing address: MASPETH AVE
MASPETH, NY 11378
Contact: Not reported
Contact address: MASPETH AVE
MASPETH, NY 11378
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: CERRO WIRE & CABLE DIV-MARMON GROUP INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US

CERRO WIRE & CABLE CO (Continued) **1000366435**

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: CERRO WIRE & CABLE DIV-MARMON GROUP INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: CERRO WIRE & CABLE CO
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: CERRO WIRE & CABLE CO
Classification: Not a generator, verified

Date form received by agency: 08/18/1980
Facility name: CERRO WIRE & CABLE CO
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110001579952

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

CERRO WIRE & CABLE CO (Continued) **1000366435**

program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

UST:

Facility Id:	2-190357
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2012/06/05
UTM X:	591506.12179999996
UTM Y:	4508475.0984199997

Affiliation Records:

Site Id:	5870
Affiliation Type:	Owner
Company Name:	NYC TRANSIT AUTHORITY
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	2 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10004
Country Code:	001
Phone:	(646) 252-5777
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	10/21/2010

Site Id:	5870
Affiliation Type:	Mail Contact
Company Name:	NYC TRANSIT AUTHORITY
Contact Type:	Not reported
Contact Name:	JENNIFER WUOUTINEN, OSS
Address1:	2 BROADWAY
Address2:	27TH FLOOR
City:	NEW YORK
State:	NY
Zip Code:	10004
Country Code:	001
Phone:	(646) 252-5777
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	9/5/2008

Site Id:	5870
Affiliation Type:	Emergency Contact
Company Name:	NYC TRANSIT AUTHORITY
Contact Type:	Not reported
Contact Name:	JENNIFER WUOUTINEN
Address1:	Not reported

CERRO WIRE & CABLE CO (Continued) **1000366435**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 252-5777
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	9/5/2008

Site Id:	5870
Affiliation Type:	On-Site Operator
Company Name:	MASPETH WAREHOUSE STOREROOM SS
Contact Type:	Not reported
Contact Name:	NYC TRANSIT AUTHORITY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(347) 643-7525
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	3/16/2007

Equipment Records:

E04 - Piping Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double-Walled (Underground)
B00 - Tank External Protection - None
K01 - Spill Prevention - Catch Basin
I04 - Overfill - Product Level Gauge (A/G)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
C00 - Pipe Location - No Piping
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
J00 - Dispenser - None
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B00 - Tank External Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
L09 - Piping Leak Detection - Exempt Suction Piping
H99 - Tank Leak Detection - Other
G04 - Tank Secondary Containment - Double-Walled (Underground)
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground

CERRO WIRE & CABLE CO (Continued) **1000366435**

G07 - Tank Secondary Containment - Excavation/Trench Liner System
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction
L08 - Piping Leak Detection - Tank Top Sump
I02 - Overfill - High Level Alarm
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
B04 - Tank External Protection - Fiberglass
B00 - Tank External Protection - None
B04 - Tank External Protection - Fiberglass
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
K01 - Spill Prevention - Catch Basin
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
I02 - Overfill - High Level Alarm
I03 - Overfill - Automatic Shut-Off
A00 - Tank Internal Protection - None
I00 - Overfill - None
I02 - Overfill - High Level Alarm
I03 - Overfill - Automatic Shut-Off
G04 - Tank Secondary Containment - Double-Walled (Underground)
H00 - Tank Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
B00 - Tank External Protection - None
J02 - Dispenser - Suction
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
L08 - Piping Leak Detection - Tank Top Sump
B04 - Tank External Protection - Fiberglass
B00 - Tank External Protection - None
J02 - Dispenser - Suction

CERRO WIRE & CABLE CO (Continued) **1000366435**

I00 - Overfill - None
F00 - Pipe External Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
I03 - Overfill - Automatic Shut-Off
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground

Tank Info:

Site ID:	5870
Tank Number:	001
Tank ID:	6805
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1937
Capacity Gallons:	15000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	5870
Tank Number:	002
Tank ID:	6806
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1937
Capacity Gallons:	20000
Tightness Test Method:	01
Next Test Date:	Not reported
Date Tank Closed:	7/1/1997
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	4/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

CERRO WIRE & CABLE CO (Continued) **1000366435**

Site ID:	5870
Tank Number:	003
Tank ID:	45246
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	ZZ
Next Test Date:	Not reported
Date Tank Closed:	10/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	10/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	5870
Tank Number:	004
Tank ID:	45247
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	ZZ
Next Test Date:	Not reported
Date Tank Closed:	10/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	10/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	5870
Tank Number:	005
Tank ID:	45248
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	ZZ
Next Test Date:	Not reported
Date Tank Closed:	10/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	10/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

CERRO WIRE & CABLE CO (Continued) **1000366435**

Site ID:	5870
Tank Number:	006
Tank ID:	45249
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	ZZ
Next Test Date:	Not reported
Date Tank Closed:	10/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	10/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	5870
Tank Number:	007
Tank ID:	45250
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	ZZ
Next Test Date:	Not reported
Date Tank Closed:	10/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	10/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	5870
Tank Number:	MAS-1
Tank ID:	47344
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1993
Capacity Gallons:	4000
Tightness Test Method:	00
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	7/23/2010

CERRO WIRE & CABLE CO (Continued) **1000366435**

Site ID: 5870

Tank Number: MAS-2
Tank ID: 47345
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/1/1993
Capacity Gallons: 2500
Tightness Test Method: 00
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Equivalent technology
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 7/23/2010

Site ID: 5870

Tank Number: MAS-3
Tank ID: 47346
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/1/1993
Capacity Gallons: 20000
Tightness Test Method: 00
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Equivalent technology
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 7/23/2010

HIST UST:
PBS Number: 2-190357
SPDES Number: Not reported
Emergency Contact: HOWARD MATZA
Emergency Telephone: (718) 243-4581
Operator: NYC TRANSIT AUTHORITY
Operator Telephone: (718) 628-2122
Owner Name: NYC TRANSIT AUTHORITY
Owner Address: 370 JAY ST ROOM 819
Owner City,St,Zip: BROOKLYN, NY 11201
Owner Telephone: (718) 243-4581
Owner Type: Local Government
Owner Subtype: The City of New York
Mailing Name: NYC TRANSIT AUTHORITY
Mailing Address: 370 JAY ST ROOM 819
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11201
Mailing Contact: HOWARD MATZA
Mailing Telephone: (718) 243-4581

CERRO WIRE & CABLE CO (Continued) **1000366435**

Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	55004 MASPETH AVE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	06/25/1997
Expiration Date:	06/05/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	26500
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19371201
Capacity (gals):	15000
Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Vault (w/o access)
Leak Detection:	Other
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002

CERRO WIRE & CABLE CO (Continued) **1000366435**

Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19371201
Capacity (gals):	20000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	04/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/1997
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	10/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	10/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported

CERRO WIRE & CABLE CO (Continued) **1000366435**

Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	10/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	10/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	10/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	10/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel

CERRO WIRE & CABLE CO (Continued) **1000366435**

Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	10/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	10/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	007
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	10/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	10/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	MAS-1
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19931001
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground

CERRO WIRE & CABLE CO (Continued) **1000366435**

Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm, Product Level Gauge
Dispenser:	Suction
Date Tested:	03/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	MAS-2
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19931001
Capacity (gals):	2500
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm, Product Level Gauge
Dispenser:	Suction
Date Tested:	03/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	MAS-3
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19931001
Capacity (gals):	20000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	Fiberglass Liner (FRP)
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass

CERRO WIRE & CABLE CO (Continued) **1000366435**

Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm, Product Level Gauge
Dispenser: Suction
Date Tested: 03/01/1991
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Petro-Tite
Deleted: False
Updated: True
Lat/long: Not reported

NY MANIFEST:
EPA ID: NYD041552811
Country: USA
Mailing Name: CERRO WIRE AND CABLE COMPANY
Mailing Contact: TOWNS KEN CHIEF PLANT ENG
Mailing Address: 5500 MASPETH AVENUE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-386-5500

Document ID: NYO2372301
Manifest Status: Completed copy
Trans1 State ID: NYJA045
Trans2 State ID: Not reported
Generator Ship Date: 830504
Trans1 Recv Date: 830504
Trans2 Recv Date: Not reported
TSD Site Recv Date: 830504
Part A Recv Date: 030517
Part B Recv Date: 030517
Generator EPA ID: NYD041552811
Trans1 EPA ID: NJD096865837
Trans2 EPA ID: Not reported
TSDF ID: NJD096865837
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 07400
Units: P - Pounds
Number of Containers: 024
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 83

Document ID: NYO2894706
Manifest Status: Completed copy
Trans1 State ID: JA045
Trans2 State ID: Not reported
Generator Ship Date: 840221

CERRO WIRE & CABLE CO (Continued) **1000366435**

Trans1 Recv Date:	840221
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	840221
Part A Recv Date:	840307
Part B Recv Date:	840228
Generator EPA ID:	NYD041552811
Trans1 EPA ID:	NJD096865837
Trans2 EPA ID:	Not reported
TSDF ID:	NJD096865837
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	30000
Units:	P - Pounds
Number of Containers:	010
Container Type:	DT - Dump trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	84

Document ID:	NYO2894715
Manifest Status:	Completed copy
Trans1 State ID:	NYJA045
Trans2 State ID:	Not reported
Generator Ship Date:	840221
Trans1 Recv Date:	840221
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	840221
Part A Recv Date:	840307
Part B Recv Date:	840228
Generator EPA ID:	NYD041552811
Trans1 EPA ID:	NJD096865837
Trans2 EPA ID:	Not reported
TSDF ID:	NJD096865837
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	15000
Units:	P - Pounds
Number of Containers:	014
Container Type:	DT - Dump trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	84

D312 **DIAMANDIS BROTHERS INC** **RCRA-NonGen** **1000457946**
ENE **56-17 56TH DR** **MANIFEST** **NYD986932291**
< 1/8 **MASPETH, NY 11378**
0.014 mi.
73 ft. **Site 4 of 9 in cluster D**

Relative:
Higher

Actual:
18 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	DIAMANDIS BROTHERS INC
Facility address:	56-17 56TH DR MASPETH, NY 113781123
EPA ID:	NYD986932291
Mailing address:	56TH DR MASPETH, NY 11378
Contact:	Not reported
Contact address:	56TH DR

DIAMANDIS BROTHERS INC (Continued) **1000457946**

MASPETH, NY 11378
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: MARIO & GABRIEL DIAMANDIS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: MARIO & GABRIEL DIAMANDIS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: DIAMANDIS BROTHERS INC
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: DIAMANDIS BROTHERS INC
Classification: Not a generator, verified

Date form received by agency: 11/30/1990

DIAMANDIS BROTHERS INC (Continued) **1000457946**

Facility name: DIAMANDIS BROTHERS INC
Classification: Small Quantity Generator

Violation Status: No violations found

NY MANIFEST:
EPA ID: NYD986932291
Country: USA
Mailing Name: DIAMANDIS BROTHERS INCORPORATED
Mailing Contact: GABRIEL
Mailing Address: 56-17 56TH DRIVE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-894-7245

Document ID: NJA0977219
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 910115
Trans1 Recv Date: 910115
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910115
Part A Recv Date: 910129
Part B Recv Date: 910212
Generator EPA ID: NYD986932291
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSDF ID: NJD002454544
Waste Code: F003 - UNKNOWN
Quantity: 00060
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 91

Document ID: NJA1317324
Manifest Status: Completed copy
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 920120
Trans1 Recv Date: 920120
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920121
Part A Recv Date: 920130
Part B Recv Date: 920204
Generator EPA ID: NYD986932291
Trans1 EPA ID: NJD986608941
Trans2 EPA ID: Not reported
TSDF ID: NJD002454544

DIAMANDIS BROTHERS INC (Continued) **1000457946**

Waste Code:	F003 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	92

Document ID:	NJA1556974
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	930201
Trans1 Recv Date:	930201
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	930202
Part A Recv Date:	930211
Part B Recv Date:	930217
Generator EPA ID:	NYD986932291
Trans1 EPA ID:	NJD986608941
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00090
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	93

C313 **BRADCO SUPPLY CORP** **RCRA-NonGen** **1001223743**
SSW **7 RAILROAD PL** **FINDS** **NYR000049585**
< 1/8 **MASPETH, NY 11378** **NY Spills**
0.014 mi. **NY Hist Spills**
74 ft. **Site 7 of 10 in cluster C**

Relative: Higher

Actual: 13 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	BRADCO SUPPLY CORP
Facility address:	7 RAILROAD PL MASPETH, NY 113782111
EPA ID:	NYR000049585
Mailing address:	PRODUCTION WAY AVENEL, NY 07001
Contact:	Not reported
Contact address:	PRODUCTION WAY AVENEL, NY 07001
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

BRADCO SUPPLY CORP (Continued) **1001223743**

Owner/Operator Summary:
Owner/operator name: MICHAEL L WEINBERGER - BRADCO SUPPLY CO
Owner/operator address: 13 PRODUCTION WAY
AVENEL, NJ 07001
Owner/operator country: US
Owner/operator telephone: (732) 382-3400
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: MICHAEL L WEINBERGER - BRADCO SUPPLY CO
Owner/operator address: 13 PRODUCTION WAY
AVENEL, NJ 07001
Owner/operator country: US
Owner/operator telephone: (732) 382-3400
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: BRADCO SUPPLY CORP
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: BRADCO SUPPLY CORP
Classification: Not a generator, verified

Date form received by agency: 01/27/1998
Facility name: BRADCO SUPPLY CORP
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004539955

BRADCO SUPPLY CORP (Continued) **1001223743**

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY Spills:

Site ID:	100097
Facility Addr2:	Not reported
Facility ID:	9714039
Spill Number:	9714039
Facility Type:	ER
SWIS:	4101
Investigator:	AIIslam
Referred To:	Not reported
Spill Date:	3/18/1998
Reported to Dept:	3/18/1998
CID:	281
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	6/13/2005
Remediation Phase:	0
Date Entered In Computer:	3/18/1998
Spill Record Last Update:	6/13/2005
Spiller Name:	MIKE WEINBERGER
Spiller Company:	BRADCO SUPPLY
Spiller Address:	7 RAILROAD PLACE
Spiller City,St,Zip:	MASPETH, NY
Spiller Company:	001
Contact Name:	BEN CANCEMI
Contact Phone:	(516) 753-1260
DEC Region:	2
DER Facility ID:	88917
DEC Memo:	This gasoline spill case has been reassigned from DEC (Sigona) to Rommel on January 7, 2004. On July 2, 1998, DEC Sigona received investigation report by GES for Tank closure at this site. >>> "Michael L. Weinberger Esq." <mweinberger@bradcosupply.com> 01/14/05 03:43PM >>> We filed a tank closure report with your office affecting our facility at 7 Railroad Place, Maspeth, NY back in July, 1998. We have never received an NFA letter or other response from your office. I spoke to Jacob Krumgold of your Spill Management Department this morning concerning the issuance of the NFA letter. We are trying to close on the sale of the property and the buyer's lender has requested a copy of the NFA letter. Anything your office can do to expedite the issuance of a response at this point would be

BRADCO SUPPLY CORP (Continued) **1001223743**

appreciated. I assume our submission fell through the cracks. Michael L. Weinberger, Esq. mweinberger@bradcosupply.com Bradco Supply Corporation 13 Production Way Avenel, NJ 07001 Phone: 732-382-3400 Fax: 732-382-6577 02/11/05 Reassigned from Rommel to Sun. 1/21/05 Received above email from Randy Austin. Reviewed UST Closure Report received 7/2/98. 1 4K gallon gas UST removed. Portions of vault left in place. Sidewall samples collected from broken locations of vault. East wall excavation limited to 4.5 ft bg due to potential for undermining foundation of warehouse. Endpoint sample at east wall T - 7500 ppb E - 7900 X - 50000 ppb Total VOA - 218,900 ppb Letter faxed requiring soil and groundwater investigation. Note, PBS Registration: Michael Wensberg at Bradco Email Michael Weinberger, Esq. at Bradco. Rommel >>> "Dawn Ruffini" <DRuffini@gesonline.com> 01/24/05 09:48AM >>> GES has been contracted by Bradco Supply Corp. to consult on this project. We will be putting together a proposal by the end of this week, and will be proceeding with the required work pending approval by our client. We will keep you apprised of our progress and schedule. If you have any questions, please feel free to contact me at 631-582-4187, ext. 23 or on my cell at 914-494-4808. Thanks. Dawn 5/3/05 - received RI report, re-assigned to Imdadul Isalm to review and follow up. - KST 6/1/05- Talked to Mr. Sander Sternig of VTEQUE Ltd. after reviewing the RI report prepared by them. There apears to be little deviation from the proposed boring locations as per Jennifer's letter, dt. Jan 25/05. Three soil samplings and three GW samplings result came out clean and as such, spill closure and NFA were requested for the site. However, advised him to submit a site map in a bigger scale showing the exact boring locations, fill port and dispenser island area in detail and a discussion on the problems encountered in fulfilling the required site investigation as per Jennifer's letter.- II 6/13/05- Reviewed the subsequent two clarifying notes (dt. 6/1/05 and 6/8/05)from Sander Sternig of VTEQE Ltd. and found satisfactory. As such, the spill is closed.- II

Remarks: ABOVE LOCATION IS A LUMBER YARD. CALLER HIRED TO REMOVE FUEL STORAGE TANK ON SITE AND DISCOVER SOME SOIL CONTAMINATION. FURTHER TEST AND SOIL REMOVAL WILL BE DONE TOMORROW. NO CALL BACK REQUESTED.

Material:

Site ID:	100097
Operable Unit ID:	1056906
Operable Unit:	01
Material ID:	325017
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported

BRADCO SUPPLY CORP (Continued) **1001223743**

Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9714039
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/18/1998 13:30
Reported to Dept Date/Time: 03/18/98 15:47
SWIS: 63
Spiller Name: BRADCO SUPPLY
Spiller Contact: MIKE WEINBERGER
Spiller Phone: (732) 382-3400
Spiller Contact: BEN CANCEMI
Spiller Phone: (516) 753-1260
Spiller Address: 7 RAILROAD PLACE
Spiller City,St,Zip: MASPETH, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/18/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 07/15/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported

BRADCO SUPPLY CORP (Continued) **1001223743**

Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: On July 2, 1998, DEC Sigona received investigation report by GES for Tank closure at this site.
Remark: ABOVE LOCATION IS A LUMBER YARD. CALLER HIRED TO REMOVE FUEL STORAGE TANK ON SITE AND DISCOVER SOME SOIL CONTAMINATION. FURTHER TEST AND SOIL REMOVAL WILL BE DONE TOMORROW. NO CALL BACK REQUESTED.

C314 **BRADCO SUPPLY CORPORATION** **UST** **U003127589**
SSW **7 RAILROAD PLACE** **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.014 mi.
74 ft. **Site 8 of 10 in cluster C**

Relative:
Higher

Actual:
13 ft.

UST:
Facility Id: 2-130648
Region: STATE
DEC Region: 2
Site Status: Unregulated
Program Type: PBS
Expiration Date: N/A
UTM X: 591480.48987000005
UTM Y: 4508594.57711

Affiliation Records:
Site Id: 4113
Affiliation Type: Emergency Contact
Company Name: BAS PROPERTIES, LLC
Contact Type: Not reported
Contact Name: ERIC GOLDMAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 326-7900
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 4113
Affiliation Type: Mail Contact
Company Name: BRADCO SUPPLY CORPORATION
Contact Type: Not reported

BRADCO SUPPLY CORPORATION (Continued) **U003127589**

Contact Name:	MICHAEL L. WEINSBERG
Address1:	13 PRODUCTION WAY
Address2:	AVENEL
City:	NEW JERSEY
State:	NJ
Zip Code:	07001
Country Code:	001
Phone:	(732) 382-3400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	4113
Affiliation Type:	Owner
Company Name:	BAS PROPERTIES, LLC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	7 RAILROAD PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 326-7900
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	4113
Affiliation Type:	On-Site Operator
Company Name:	BRADCO SUPPLY CORPORATION
Contact Type:	Not reported
Contact Name:	BRADCO SUPPLY CORP.
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 326-7900
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None

BRADCO SUPPLY CORPORATION (Continued) **U003127589**

J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
I00 - Overfill - None

Tank Info:

Site ID:	4113
Tank Number:	001
Tank ID:	5315
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/1/1998
Capacity Gallons:	4000
Tightness Test Method:	02
Next Test Date:	Not reported
Date Tank Closed:	1/1/1998
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	5/1/1997
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-130648
SPDES Number:	Not reported
Emergency Contact:	ERIC GOLDMAN
Emergency Telephone:	(718) 326-7900
Operator:	BRADCO SUPPLY CORP.
Operator Telephone:	(718) 326-7900
Owner Name:	BAS PROPERTIES, LLC
Owner Address:	7 RAILROAD PLACE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 326-7900
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	BRADCO SUPPLY CORPORATION
Mailing Address:	13 PRODUCTION WAY
Mailing Address 2:	AVENEL
Mailing City,St,Zip:	NEW JERSEY, NJ 07001
Mailing Contact:	MICHAEL L. WEINSBERG
Mailing Telephone:	(732) 382-3400
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	7 RAILROAD PLACE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	10/06/1997
Expiration Date:	05/07/2002

BRADCO SUPPLY CORPORATION (Continued) **U003127589**

Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19980101
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	05/01/1997
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	01/01/1998
Test Method:	Tank Auditor
Deleted:	False
Updated:	True
Lat/long:	Not reported

D315 **DIAMANDIS BROS INC** **RCRA-NonGen** **1004756897**
ENE **56-27 56TH DR** **MANIFEST** **NYD982536948**
< 1/8 **MASPETH, NY 11378**
0.019 mi.
101 ft. **Site 5 of 9 in cluster D**

Relative:
Higher

Actual:
18 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	DIAMANDIS BROS INC
Facility address:	56-27 56TH DR MASPETH, NY 11378
EPA ID:	NYD982536948
Mailing address:	56TH DR MASPETH, NY 11378
Contact:	Not reported
Contact address:	56TH DR MASPETH, NY 11378
Contact country:	US

DIAMANDIS BROS INC (Continued) **1004756897**

Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: MARIO DIAMANDIS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: MARIO DIAMANDIS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: DIAMANDIS BROS INC
Classification: Not a generator, verified

Date form received by agency: 10/29/1993
Facility name: DIAMANDIS BROS INC
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 04/12/1988
Facility name: DIAMANDIS BROS INC
Classification: Small Quantity Generator

DIAMANDIS BROS INC (Continued) **1004756897**

Violation Status: No violations found

NY MANIFEST:

EPA ID:	NYD982536948
Country:	USA
Mailing Name:	DIAMANDIS BROTHERS INCORPORATED
Mailing Contact:	DIAMANDIS BROTHERS INCORPORATED
Mailing Address:	56-27 56TH DRIVE
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-894-7245

Document ID:	NJA0566119
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	890109
Trans1 Recv Date:	890109
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	890110
Part A Recv Date:	890228
Part B Recv Date:	890119
Generator EPA ID:	NYD982536948
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00030
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	89

Document ID:	NJA0840952
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	900109
Trans1 Recv Date:	900109
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900110
Part A Recv Date:	900118
Part B Recv Date:	900123
Generator EPA ID:	NYD982536948
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00050
Units:	G - Gallons (liquids only)* (8.3 pounds)

DIAMANDIS BROS INC (Continued) **1004756897**

Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 90

J316 **HMIRS** **95040853**
North **55-90 48TH STREET** **N/A**
< 1/8 **MASPETH, NY**
0.021 mi.
109 ft. **Site 6 of 7 in cluster J**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 37 ft.

J317 **FEDEX GROUND - QUEENS** **FINDS** **1007798626**
North **55-90 48TH ST** **N/A**
< 1/8 **FLUSHING, NY 11378**
0.021 mi.
109 ft. **Site 7 of 7 in cluster J**

Relative: Higher

FINDS:

Registry ID: 110019611384

Actual: 37 ft.

Environmental Interest/Information System

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

D318 **WHIRLPOOL FACTORY SERVICE** **RCRA-NonGen** **1004758632**
NE **56-34 56TH ST** **FINDS** **NYD987013299**
< 1/8 **MASPETH, NY 11378**
0.025 mi.
132 ft. **Site 6 of 9 in cluster D**

Relative:
Higher

Actual:
19 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	WHIRLPOOL FACTORY SERVICE
Facility address:	56-34 56TH ST MASPETH, NY 11378
EPA ID:	NYD987013299
Mailing address:	56TH ST MASPETH, NY 11378
Contact:	GARY BARTILUCCI
Contact address:	56TH ST MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 361-9312
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	WHIRLPOOL CORP
Owner/operator address:	AD CENTER 2000 M63 NORTH BENTON HARBOR, MI 49022
Owner/operator country:	US
Owner/operator telephone:	(800) 446-2475
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	WHIRLPOOL CORP
Owner/operator address:	AD CENTER 2000 M63 NORTH BENTON HARBOR, MI 49022
Owner/operator country:	US
Owner/operator telephone:	(800) 446-2475
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No

WHIRLPOOL FACTORY SERVICE (Continued) **1004758632**

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: WHIRLPOOL FACTORY SERVICE
Classification: Not a generator, verified

Date form received by agency: 09/03/1992
Facility name: WHIRLPOOL FACTORY SERVICE
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004494510

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

C319 **15 RAIL ROAD PL** **ERNS** **2005607995**
SSW **15 RAIL ROAD PL** **N/A**
< 1/8 **QUEENS, NY**
0.026 mi.
135 ft. **Site 9 of 10 in cluster C**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual:
13 ft.

C320 **OVERHEAD TRANSFORMER** **NY Spills** **S106867710**
SSW **15 RAILROAD PL** **N/A**
< 1/8 **QUEENS, NY**
0.026 mi.
135 ft. **Site 10 of 10 in cluster C**

Relative:
Higher

NY Spills:
Site ID: 342951
Facility Addr2: Not reported
Actual:
13 ft.
Facility ID: 0500076
Spill Number: 0500076
Facility Type: ER
SWIS: 4101
Investigator: JHOCONNE
Referred To: Not reported
Spill Date: 4/2/2005
Reported to Dept: 4/2/2005
CID: 73
Spill Cause: Other
Water Affected: Not reported

OVERHEAD TRANSFORMER (Continued) **S106867710**

Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	4/5/2005
Remediation Phase:	0
Date Entered In Computer:	4/3/2005
Spill Record Last Update:	4/5/2005
Spiller Name:	ERT
Spiller Company:	CON ED
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ERT DESK
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	289336
DEC Memo:	e2mis no. 157908: 4/2/05 2215HRS O.S. D.MCLOUGHLIN #15811 #9 REPORTS POLE#20550 SPILT IN 1/2 AND 3-PHASE TRANSFOMER SER- #KU4110769701 75 KV KUHLMAN LANDED ON STREET AT 15 RAILROAD PL. (AKA 49 LANE) LEAKING APPROX 74 GALLONS OF OIL ONTO STREET AND 1-SEWER N/O POLE. UNDETERMIN AMOUNT AT THIS TIME.APPROX 100 ' BY 50' AREA WAS AFFECTED. ENVIR CREW AND OVER 50-TANKER DISPACTHED. AREA CORDON OFF. EPA#NYP-004130159 4/2/05 2315HRS O.S. C.LABARBARRA ENVIR OPPS REPORTS HE FOUND A TM NUMBER UNKNOWN AT THIS TIME 25' S/O POLE#20550. FOUND APPROX 5-GALLONS OF OIL ON 500 GALLONS WATER IN STRUCTURE. STRUCTURE IS EMPTY NO UNIT IN STRUCTURE. 1-SAMPLE WILL BE TAKEN OF STRUCTURE AND 1-SAMPLE WILL BE TAKEN FROM PUDDLE ON STREET. 4/3/05 0128HRS O.S.C.LABARBARRA REPORTS 1-SAMPLE TAKEN FROM TRANSFORMER IN STREET AND 1-SAMPLE FROM TM S/O POLE 20550. CHAIN CUSTODY #DD17710. CLEAN HARBORS ARRIVED AND WILL CLEAN CATCH BASIN IN SEWER. CLEANUP OF AREA CONTINUES. NOTE TM S/O OF POLE HAS BEEN IDENTIFY AS VS-9508 IT IS ABANDED. UPDATE: 04-03-05 0750HRS LAB RESULTS RETURNED 05-03005-001 <1.0PPM Lab Sequence Number: 05-03005-002 Date Approved: 4/03/2005 MATRIX: OIL GRAB LOCATION: 50' S/O 15 RAILROAD PLACE STRUCTURE: VAULT VS 9508 FEEDER ID: TOTAL PCB <1.0 PPM UPDATE: 03-APR-2005 1000HRS Operating supervisor J.Dekanchuk reports clean harbors was contracted to provide equipment and man power to clean up a overhead transformer spill at 15 railroad pl. The vendor applied absorbents to oil spill in street,an area of about 50' x 150' and removed same with their vactor truck. The oil stained areas were double washed with degreaser, liquid picked up by their vactor. A con Edison tanker was used to remove oil and water from a abanded vs9508, by clean harbors personal. In addition two catch basins were pumped out and double washed. ERT David Duke, inspected the area at the completion of the clean up and determined it was satisfactory. UPDATE 04/04/05 04:55 EMAIL FROM DAVID DUKE Please insert some of these details as you see fit, into e2MIS 157908. The NYC DEP issued a Commissioner's Order for the clean-up and the US Coast Guard issued instructions that need to be documented. April 2, 2005 21:30 start time; pole-mounted transformer falls to street and releases 74 gallons non-PCB oil onto street and into sewer. Andrew Kelly of the NYC DEP cannot determine

OVERHEAD TRANSFORMER (Continued) **S106867710**

if the oil-impacted sewer leads to a treatment plant or to a storm sewer outfall. The US Coast Guard instructs ConEdison to inspect the Maspeth Creek outfall during daylight hours tomorrow, April 3rd. April 3, 2005 08:00 D.Duke-ERT (88158) arrives at Railroad Place. Clean Harbor?s Vactor and crew are present and have completed power washing the street and are brooming up the last remains of dry absorbent that was bermed around the transformer. No sheen or oil product is visible on the street or sidewalk within a 100-foot radius around the fallen transformer. 08:20 D.Duke- ERT (88158) arrives at Maspeth Creek storm sewer outfall, located at 49th Street and Maspeth Avenue. Maspeth Creek is bounded on 3 sides by commercial properties and is well fenced with no access points from the road; the only access is via Newtown Creek. The sewer outfall is 20 feet below the road level of 49th Street and is shaped as a slot, approximately 40 feet wide and several feet high (depending on the tide). Maspeth Creek itself is 200 foot wide and extends from the outfall under 49th Street for 250 yards West to where it meets Newtown Creek. Permanent Hard Boom is in already in place (by an unknown party; possibly the DEP) across the mouth of Maspeth Creek where it meets Newtown Creek. 09:00 D.Duke calls the ERT Desk to report that a sheen is present at the mouth of the sewer outfall under 49th Street on the North side of Maspeth Creek. The sheen covers an area approximately 20 feet by 40 feet and is being blown by the wind to the North shore at the sewer outfall. D.Duke drives the perimeter of the Maspeth Creek looking for an access point for a small boat. No access points are found, all perimeter area is fenced and is private property. Discussions with ERT Desk noted that the Hard Boom should prevent the sheen from entering Newtown Creek. Management decides that it is best to clean the sheen now. 09:45 ERT Desk calls Ken’s Marine for response to Maspeth Creek. 11:10 Ken’s Marine arrives; (first time). Ken’s crew finds that Maspeth Creek is very shallow (as little as 1 foot) and their boat (1.5 foot draft) grounds onto the muddy bottom. Discussions conclude that a shallow draft row boat should be able to access the sewer outfall. 11:30 Ken’s Marine leaves the site. 14:10 Ken’s Marine arrives (second time) with a John boat. Two man crew rows from Newtown Creek to the sewer outfall at 49th Street. The tide is now rising and the sheen is being forced back into the 40 foot wide outfall slot. Ken’s Marine deploys two 100 foot, soft, oil-absorbent booms in front of the sewer outfall. The logic is that when the tide again goes out, the sheen will exit the outfall slot and be captured by the soft boom. Ken’s crew will return tomorrow morning (April 4th) to pick up the soft boom. The crew is instructed to call the ERT Desk prior to leaving their docks to give the Field ERT time to rendezvous to ensure a proper cleanup is accomplished. 15:30 Ken’s crew leaves Maspeth Creek site.
UPDATE********** 4-4-05 10:30HRS DAN PONTECORVO (ERT) REPORTS, HE WAS REQUESTED TO GO BACK TO LOCATION TO TAKE TWO SAMPLES. ONE LIQUID SAMPLE AND ONE SOLID PAD FOR OIL ID ONLY. KENS MARINE ARRIVED ON LOCATION AT 09:45 WITH BOATS AND PICKED UP 200’ OF PADS THAT WERE PLACED SUNDAY MORNING. KENS MARINE LEFT LOCATION AT AT 10:15 AND AREA THAT WAS AFFECTED WAS CLEANED. Lab Sequence Number: 05-03030-001 Date Approved: 4/04/2005 MATRIX: LIQUID GRAB DESCRIPTION: MASPETH CREEK LOCATION: MASPETH AVE & 49 ST Oil Identification - The presence of oil was not detected in the sample. Lab Sequence Number: 05-03030-002 Date Approved: 4/04/2005 MATRIX: SOLID GRAB DESCRIPTION: MASPETH CREEK LOCATION: MASPETH AVE & 49 ST Oil Identification - The presence of oil was not detected in the

OVERHEAD TRANSFORMER (Continued) **S106867710**

sample.
Remarks: UTILITY POLE SPLIT CAUSING TRANSFORMER TO FALL TO THE GROUND. 50 GALLONS SPILLED ONTO THE PAVEMENT AND 25 GALLONS INTO A SEWER DRAIN. CON ED CREWS ON SCENE.

Material:
Site ID: 342951
Operable Unit ID: 1101638
Operable Unit: 01
Material ID: 581851
Material Code: 0020A
Material Name: TRANSFORMER OIL
Case No.: Not reported
Material FA: Petroleum
Quantity: 75
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

D321 **EURO MOTORS** **RCRA-NonGen** **1000334888**
NE **56-24 56TH ST** **FINDS** **NYD982535726**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.032 mi.
169 ft. **Site 7 of 9 in cluster D**

Relative:
Higher

Actual:
21 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: EUROMOTORS
Facility address: 56-24 56TH ST
MASPETH, NY 113781132
EPA ID: NYD982535726
Mailing address: 56TH ST
MASPETH, NY 11378
Contact: Not reported
Contact address: 56TH ST
MASPETH, NY 11378
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

EURO MOTORS (Continued) **1000334888**

Owner/Operator Summary:
Owner/operator name: VINCENT LIBRIZZO
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: VINCENT LIBRIZZO
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: EUROMOTORS
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: EUROMOTORS
Classification: Not a generator, verified

Date form received by agency: 04/18/1988
Facility name: EUROMOTORS
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004422811

EURO MOTORS (Continued) **1000334888**

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID:	NYD982535726
Country:	USA
Mailing Name:	EURO MOTORS
Mailing Contact:	EURO MOTORS
Mailing Address:	56-24 56TH STREET
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-392-8896

Document ID:	NJA0841027
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	900130
Trans1 Recv Date:	900130
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900130
Part A Recv Date:	900326
Part B Recv Date:	900214
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00140
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	90

Document ID:	NJA1009736
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	000000000
Trans2 State ID:	000000000
Generator Ship Date:	900619
Trans1 Recv Date:	900619
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900619
Part A Recv Date:	900914

EURO MOTORS (Continued) **1000334888**

Part B Recv Date:	900627
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	90

Document ID:	NJA0950602
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	901002
Trans1 Recv Date:	901002
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	901002
Part A Recv Date:	901211
Part B Recv Date:	901108
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00220
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	90

Document ID:	NJA1106756
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	910415
Trans1 Recv Date:	910415
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	910416
Part A Recv Date:	910618
Part B Recv Date:	910426
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F003 - UNKNOWN
Quantity:	00370
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001

EURO MOTORS (Continued) **1000334888**

Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	91

Document ID:	NYA6457014
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	PLATE#
Trans2 State ID:	57745GB
Generator Ship Date:	880420
Trans1 Recv Date:	880420
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	880420
Part A Recv Date:	880609
Part B Recv Date:	880506
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NYD000824334
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000824334
Waste Code:	F005 - UNKNOWN
Quantity:	00165
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	88

Document ID:	NJA0627845
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	890424
Trans1 Recv Date:	890424
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	890425
Part A Recv Date:	890510
Part B Recv Date:	890504
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00300
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	89

Document ID:	NJA0628350
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS103

EURO MOTORS (Continued) **1000334888**

Trans2 State ID:	Not reported
Generator Ship Date:	890710
Trans1 Recv Date:	890710
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	890711
Part A Recv Date:	890721
Part B Recv Date:	890719
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00105
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	89

Document ID:	NJA0629033
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	891011
Trans1 Recv Date:	891011
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	891011
Part A Recv Date:	891108
Part B Recv Date:	891018
Generator EPA ID:	NYD982535726
Trans1 EPA ID:	NJD980787147
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	F005 - UNKNOWN
Quantity:	00120
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	89

D322 **56-25 56TH ST** **NY Spills** **S102143179**
NE **56-25 56TH ST** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.033 mi.
172 ft. **Site 8 of 9 in cluster D**

Relative:
Higher

Actual:
21 ft.

NY Spills:

Site ID:	249665
Facility Addr2:	Not reported
Facility ID:	9205578
Spill Number:	9205578
Facility Type:	ER
SWIS:	4101
Investigator:	RWAUSTIN

56-25 56TH ST (Continued) **S102143179**

Referred To:	Not reported
Spill Date:	8/12/1992
Reported to Dept:	8/12/1992
CID:	Not reported
Spill Cause:	Human Error
Water Affected:	Not reported
Spill Source:	Vessel
Spill Notifier:	Local Agency
Cleanup Ceased:	8/12/1992
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/12/1992
Remediation Phase:	0
Date Entered In Computer:	8/21/1992
Spill Record Last Update:	9/30/2004
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	204667
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "AUSTIN"
Remarks:	Not reported

Material:

Site ID:	249665
Operable Unit ID:	969185
Operable Unit:	01
Material ID:	409779
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported

56-25 56TH ST (Continued) **S102143179**

Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9205578
Investigator: AUSTIN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/12/1992 12:30
Reported to Dept Date/Time: 08/12/92 16:25
SWIS: 63
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 10
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: 08/12/92
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/12/92
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/21/92
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons

56-25 56TH ST (Continued) **S102143179**

Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: Not reported

N323 **APKON INC** **FINDS** **1007812907**
ESE **57-15 57TH PLACE** **N/A**
< 1/8 **MASPETH, NY 11378**
0.035 mi.
183 ft. **Site 1 of 4 in cluster N**

Relative: Higher

Actual: 27 ft.

FINDS:

Registry ID: 110019754504

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

D324 **CIAMPA ORGANIZATION** **RCRA-NonGen** **1000872815**
NE **136-26 37TH AVE** **FINDS** **NYD987040334**
< 1/8 **FLUSHING, NY 11354** **MANIFEST**
0.038 mi.
199 ft. **Site 9 of 9 in cluster D**

Relative: Higher

Actual: 22 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: CIAMPA ORGANIZATION
Facility address: 136-26 37TH AVE
FLUSHING, NY 113544143
EPA ID: NYD987040334
Mailing address: 56TH DR
MASPETH, NY 11378
Contact: Not reported
Contact address: 56TH DR
MASPETH, NY 11378
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: CIAMPA NORTH CO
Owner/operator address: 136-26 37TH AVE
FLUSHING, NY 11354
Owner/operator country: US
Owner/operator telephone: (718) 939-4888

CIAMPA ORGANIZATION (Continued) **1000872815**

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: CIAMPA NORTH CO
Owner/operator address: 136-26 37TH AVE
FLUSHING, NY 11354
Owner/operator country: US
Owner/operator telephone: (718) 939-4888
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: CIAMPA ORGANIZATION
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: CIAMPA ORGANIZATION
Classification: Not a generator, verified

Date form received by agency: 09/01/1993
Facility name: CIAMPA ORGANIZATION
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004508505

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

CIAMPA ORGANIZATION (Continued) **1000872815**

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID:	NYD987040334
Country:	USA
Mailing Name:	CIAMPA ORG
Mailing Contact:	ORLAN HURTT
Mailing Address:	56-17 56TH ST
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-939-4888
Document ID:	NYB5213385
Manifest Status:	Completed copy
Trans1 State ID:	PD9938
Trans2 State ID:	Not reported
Generator Ship Date:	930917
Trans1 Recv Date:	930917
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	930917
Part A Recv Date:	Not reported
Part B Recv Date:	931006
Generator EPA ID:	NYD987040334
Trans1 EPA ID:	NYD082785429
Trans2 EPA ID:	Not reported
TSDF ID:	NYD082785429
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	00045
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	095
Year:	93

N325 **58-50 57TH RD/NYC DOT** **LTANKS** **S100153422**
SE **58-50 57TH RD/NYC DOT** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY**
0.039 mi.
205 ft. **Site 2 of 4 in cluster N**

Relative:
Higher

Actual:
27 ft.

LTANKS:

Site ID:	140029
Spill No:	9108991
Spill Date:	11/22/1991
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	6/14/1995
Facility Addr2:	Not reported

58-50 57TH RD/NYC DOT (Continued) **S100153422**

Cleanup Ceased:	6/14/1995
Cleanup Meets Standard:	True
SWIS:	4101
Investigator:	GUTIERREZ
Referred To:	Not reported
Reported to Dept:	11/22/1991
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	11/27/1991
Spill Record Last Update:	1/26/2005
Spiller Name:	Not reported
Spiller Company:	NYC DOT
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	70458
Remarks:	4K / 10LB AIR TEST / SYSTEM TEST

Material:

Site ID:	140029
Operable Unit ID:	959164
Operable Unit:	01
Material ID:	417654
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	140029
Spill Tank Test:	1539336
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/1/2004
Test Method:	Unknown

58-50 57TH RD/NYC DOT (Continued) **S100153422**

HIST LTANKS:

Region of Spill:	2
Spill Number:	9108991
Spill Date:	11/22/1991
Spill Time:	13:30
Spill Cause:	Tank Test Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Non Commercial/Industrial
Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	06/14/95
Cleanup Ceased:	06/14/95
Cleanup Meets Standard:	True
Investigator:	GUTIERREZ
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	11/22/91
Reported to Department Time:	13:33
SWIS:	62
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	NYC DOT
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spiller Cleanup Date:	/ /
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	True
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	11/27/91
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	01/17/96
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	0
Test Method:	Not reported
Leak Rate Failed Tank:	0.00

58-50 57TH RD/NYC DOT (Continued) **S100153422**

Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: 4K / 10LB AIR TEST / SYSTEM TEST

N326 **NYCDOT MASPETH SIGN SHOP** **LTANKS** **S100491002**
SE **58-50 57TH RD/DOT GARAGE** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY**
0.039 mi.
205 ft. **Site 3 of 4 in cluster N**

Relative:
Higher

Actual:
27 ft.

LTANKS:
Site ID: 75249
Spill No: 9200928
Spill Date: 4/23/1992
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 6/14/1995
Facility Addr2: Not reported
Cleanup Ceased: 6/14/1995
Cleanup Meets Standard: True
SWIS: 4101
Investigator: GUTIERREZ
Referred To: Not reported
Reported to Dept: 4/23/1992
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 4/24/1992
Spill Record Last Update: 12/23/2004
Spiller Name: Not reported
Spiller Company: MASPETH SIGN SHOP
Spiller Address: 58-50 57TH ROAD
Spiller City,St,Zip: MASPETH, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 70458

NYCDOT MASPETH SIGN SHOP (Continued) **S100491002**

Remarks: 4K

Material:
Site ID: 75249
Operable Unit ID: 968323
Operable Unit: 01
Material ID: 415689
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 75249
Spill Tank Test: 1539905
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:
Region of Spill: 2
Spill Number: 9200928
Spill Date: 04/23/1992
Spill Time: 16:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/14/95
Cleanup Ceased: 06/14/95
Cleanup Meets Standard: True
Investigator: GUTIERREZ
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 04/23/92
Reported to Department Time: 18:20
SWIS: 63

NYCDOT MASPETH SIGN SHOP (Continued) **S100491002**

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: MASPETH SIGN SHOP
Spiller Address: 58-50 57TH ROAD
Spiller City,St,Zip: MASPETH
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/24/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 01/17/96
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 05/05/95: GROSS FAILURE - NO VISIBLE MATERIAL SPILLED, TANK LEVEL BEING MAINTAINED, STILL UNDER INVESTIGATION; TANK TEST FAILURE ALL THESE INFORMATION FROM SPILL 95-01536).
Spill Cause: 4K

O327 **DEP DRUMS** **NY Spills** **S102143891**
SSW **48TH ST.&MASPETH AVE.** **NY Hist Spills** **N/A**
< 1/8 **NEW YORK CITY, NY**
0.041 mi.
215 ft. **Site 1 of 11 in cluster O**

Relative:
Lower

Actual:
4 ft.

NY Spills:

Site ID:	71405
Facility Addr2:	Not reported
Facility ID:	8600292
Spill Number:	8600292
Facility Type:	ER
SWIS:	4101
Investigator:	RWAUSTIN
Referred To:	Not reported
Spill Date:	4/11/1986
Reported to Dept:	4/11/1986
CID:	Not reported
Spill Cause:	Abandoned Drums
Water Affected:	NONE
Spill Source:	Unknown
Spill Notifier:	Police Department
Cleanup Ceased:	4/11/1986
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Not reported
Spill Closed Dt:	4/11/1986
Remediation Phase:	0
Date Entered In Computer:	5/2/1986
Spill Record Last Update:	10/15/1997
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	67567
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "AUSTIN" 4/11/86: CDC CO. CALLED OUT TO REMOVE DRUMS.
Remarks:	ACT.QUAN.SPIL-15-20 "GAL" DRUMS-NYC DEP WILL INVESTIGATE&REMOVE THE DRUMS

Material:

Site ID:	71405
Operable Unit ID:	896555
Operable Unit:	01
Material ID:	480466
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

DEP DRUMS (Continued) **S102143891**

Site ID:	71405
Operable Unit ID:	896555
Operable Unit:	01
Material ID:	480467
Material Code:	0630A
Material Name:	NONENE
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	8600292
Investigator:	AUSTIN
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	04/11/1986 15:45
Reported to Dept Date/Time:	04/11/86 17:25
SWIS:	63
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Abandoned Drums
Reported to Dept:	On Land
Water Affected:	NONE
Spill Source:	12
Spill Notifier:	Police Department
PBS Number:	Not reported
Cleanup Ceased:	04/11/86
Cleanup Meets Std:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /

DEP DRUMS (Continued) **S102143891**

Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 04/11/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/02/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 10/15/97
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NONENE
Class Type: NONENE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: 4/11/86: CDC CO. CALLED OUT TO REMOVE DRUMS.
Remark: ACT.QUAN.SPIL-15-20 GAL DRUMS-NYC DEP WILL INVESTIGATE REMOVE THE DRUMS

F328 **DICKARD WIDDER INDUSTRIES** **RCRA-NonGen** **1001224589**
SSE **56-02 MASPETH AVE** **FINDS** **NY0002312379**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.042 mi.
222 ft. **Site 12 of 12 in cluster F**

Relative:
Higher

Actual:
24 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: DICKARD WIDDER INDUSTRIES
Facility address: 56-02 MASPETH AVE
MASPETH, NY 11378
EPA ID: NY0002312379
Mailing address: MASPETH AVE

DICKARD WIDDER INDUSTRIES (Continued) **1001224589**

MASPETH, NY 11378
Contact: JOHN F PARRINO
Contact address: MASPETH AVE
MASPETH, NY 11378
Contact country: US
Contact telephone: (718) 416-7524
Contact email: JP@DICKARDWIDDER.COM
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: STEVEN SLAVEN
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/01/1984
Owner/Op end date: Not reported

Owner/operator name: STEVE SLAVEN
Owner/operator address: MASPETH AVE
MASPETH, NY 11378
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1984
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 07/12/2006
Facility name: DICKARD WIDDER INDUSTRIES
Classification: Small Quantity Generator

Date form received by agency: 07/11/2006
Facility name: DICKARD WIDDER INDUSTRIES

DICKARD WIDDER INDUSTRIES (Continued) **1001224589**

Classification: Small Quantity Generator

Date form received by agency: 02/09/1998
Facility name: DICKARD WIDDER INDUSTRIES
Site name: PRIMARY PACKAGING
Classification: Small Quantity Generator

Hazardous Waste Summary:
Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D018
Waste name: BENZENE

Waste code: D039
Waste name: TETRACHLOROETHYLENE

Waste code: D040
Waste name: TRICHLOROETHYLENE

Violation Status: No violations found

FINDS:

Registry ID: 110007990594

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NY0002312379
Country: USA
Mailing Name: PRIMARY PACKAGING
Mailing Contact: TONY SHAW
Mailing Address: 56-12 MASPETH AVENUE
Mailing Address 2: Not reported
Mailing City: QUEENS
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-894-8424

Document ID: NJA2819708

DICKARD WIDDER INDUSTRIES (Continued) **1001224589**

Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	Not reported
Generator Ship Date:	02/11/1998
Trans1 Recv Date:	02/11/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/19/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0002312379
Trans1 EPA ID:	NJD002182897
Trans2 EPA ID:	Not reported
TSDF ID:	08690
Waste Code:	F005 - UNKNOWN
Quantity:	02418
Units:	P - Pounds
Number of Containers:	006
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	98

Document ID:	NYC4516446
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	MOD095038998
Generator Ship Date:	02/19/1998
Trans1 Recv Date:	02/19/1998
Trans2 Recv Date:	02/27/1998
TSD Site Recv Date:	03/01/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0002312379
Trans1 EPA ID:	KYD053348108
Trans2 EPA ID:	Not reported
TSDF ID:	IL246399
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	05390
Units:	P - Pounds
Number of Containers:	011
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	98

P329 **POLE 84561** **NY Spills** **S105236224**
ENE **56-16 56TH DR** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.045 mi.
240 ft. **Site 1 of 2 in cluster P**

Relative:
Higher

Actual:
22 ft.

NY Spills:

Site ID:	306667
Facility Addr2:	Not reported
Facility ID:	0108490
Spill Number:	0108490
Facility Type:	ER

POLE 84561 (Continued) **S105236224**

SWIS:	4101
Investigator:	KMFOLEY
Referred To:	Not reported
Spill Date:	11/21/2001
Reported to Dept:	11/21/2001
CID:	312
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/12/2002
Remediation Phase:	0
Date Entered In Computer:	11/21/2001
Spill Record Last Update:	2/12/2002
Spiller Name:	Not reported
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	247676
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY/SANGESLAND" Con Ed e2mis #140362 Notes: 11-21-01 Found overhead transformer had hole in it and leaked 5gal on sidewalk. Labelled non-PCB. It splashed onto building that is an auto shop factory-type building. The secondary hit the fin on the transformer causing a hole and the oil spilled out. Env Ops Ron James will respond. #9 troubleshooter will take transformer offline.
Remarks:	spilled on bldg and concrete - not cleaned up yet - poss failure of secondary bushing - steve sangesland advised

Material:

Site ID:	306667
Operable Unit ID:	845884
Operable Unit:	01
Material ID:	529738
Material Code:	0016A
Material Name:	NON PCB OIL
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported

POLE 84561 (Continued) **S105236224**

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0108490
Investigator: FOLEY/SANGESLAND
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/21/2001 22:55
Reported to Dept Date/Time: 11/21/01 23:14
SWIS: 63
Spiller Name: CON EDISON
Spiller Contact: Not reported
Spiller Phone: (212) 580-6763
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/21/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/26/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported

POLE 84561 (Continued) **S105236224**

Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NON PCB OIL
Class Type: NON PCB OIL
Times Material Entry In File: 2798
CAS Number: Not reported
Last Date: 19940928
DEC Remarks: Con Ed e2mis 140362 Notes: 11-21-01 Found overhead transformer had hole in it and leaked 5gal on sidewalk. Labelled non-PCB. It splashed onto building that is an auto shop factory-type building. The secondary hit the fin on the transformer causing a hole and the oil spilled out. Env Ops Ron James will respond. 9 troubleshooter will take transformer offline.
Remark: spilled on bldg and concrete - not cleaned up yet - poss failure of secondary bushing - steve sangesland advised

---

O330 **49-40 MASPETH AVE/PRESTON** **LTANKS** **S100153863**
South **49-40 MASPETH AVE/PRESTON** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY**
0.048 mi.
253 ft. **Site 2 of 11 in cluster O**

Relative:
Lower

Actual:
9 ft.

LTANKS:
Site ID: 239473
Spill No: 9104393
Spill Date: 7/23/1991
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 8/2/1991
Facility Addr2: Not reported
Cleanup Ceased: 8/2/1991
Cleanup Meets Standard: True
SWIS: 4101
Investigator: RWAUSTIN
Referred To: Not reported
Reported to Dept: 7/24/1991
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 7/26/1991
Spill Record Last Update: 11/19/1992
Spiller Name: Not reported
Spiller Company: 51 S CORTLAND REALTY
Spiller Address: 11 WEST ST

49-40 MASPETH AVE/PRESTON (Continued) **S100153863**

Spiller City,St,Zip:	BROOKLYN, NY 11222
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	196957
Remarks:	PULLED 8 550'S; FOUND 20 CUBIC YDS OF CONTAMINATED SOIL. HIRED CA RICHCONTRACTORS-CONTACT: 516-674-3889. WILL HIRE ANOTHER CONTRACTOR FOR CLEANUP. AUSTIN WITNESSED SOIL/ASPHALT BATCHING 8/2/91

Material:

Site ID:	239473
Operable Unit ID:	955173
Operable Unit:	01
Material ID:	423463
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Not reported
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

HIST LTANKS:

Region of Spill:	2
Spill Number:	9104393
Spill Date:	07/23/1991
Spill Time:	17:00
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	08/02/91
Cleanup Ceased:	08/02/91
Cleanup Meets Standard:	True
Investigator:	AUSTIN
Caller Name:	Not reported
Caller Agency:	Not reported

49-40 MASPETH AVE/PRESTON (Continued) **S100153863**

Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	07/24/91
Reported to Department Time:	13:50
SWIS:	63
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	51 S CORTLAND REALTY
Spiller Address:	11 WEST ST
Spiller City,St,Zip:	BKLYN, NY 11222
Spiller Cleanup Date:	08/02/91
Facility Contact:	Not reported
Facility Phone:	(718) 389-1235
Facility Extention:	Not reported
Spill Notifier:	Other
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	08/02/91
UST Involvement:	True
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	07/26/91
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	11/19/92
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	-1
Unkonwn Quantity Spilled:	False
Units:	Not reported
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	DIESEL
Class Type:	DIESEL
Times Material Entry In File:	10625
CAS Number:	Not reported
Last Date:	19940728
DEC Remarks:	08/02/91: SOIL PROCESSED WITH RECYCLING TECHNOLOGY S ASPHALT BATCHING PROCESS GRAVE SAMPLES TAKEN AND ANALYSED FOR TPH W/BTEX HNU MONITORING BY CARICH CONSULTANTS.
Spill Cause:	PULLED 8 550 S; FOUND 20 CUBIC YDS OF CONTAMINATED SOIL. HIRED CA

49-40 MASPETH AVE/PRESTON (Continued) **S100153863**

RICHCONTRACTORS-CONTACT: 516-674-3889. WILL HIRE ANOTHER CONTRACTOR FOR CLEANUP. AUSTIN WITNESSED SOIL/ASPHALT BATCHING 8/2/91

P331 **BROADWAY BODY WORK** **FINDS** **1007789283**
ENE **56-26 56TH DR** **N/A**
< 1/8 **QUEENS, NY 11378**
0.048 mi.
254 ft. **Site 2 of 2 in cluster P**

Relative:
Higher

Actual:
23 ft.

FINDS:

Registry ID: 110019517744

Environmental Interest/Information System

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Q332 **NEWTOWN CREEK** **NY Spills** **1001749946**
SSW **NEWTOWN CREEK** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.053 mi.
278 ft. **Site 1 of 3 in cluster Q**

Relative:
Lower

Actual:
0 ft.

NY Spills:

Site ID:	236835
Facility Addr2:	Not reported
Facility ID:	9504303
Spill Number:	9504303
Facility Type:	ER
SWIS:	4101
Investigator:	ADZHITOM
Referred To:	Not reported
Spill Date:	7/10/1995
Reported to Dept:	7/10/1995
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	NEWTOWN CREEK
Spill Source:	Unknown
Spill Notifier:	Federal Government
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	4/29/2004
Remediation Phase:	0
Date Entered In Computer:	8/3/1995
Spill Record Last Update:	2/7/2005
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY

NEWTOWN CREEK (Continued) **1001749946**

Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
DER Facility ID: 272519
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ZHITOMIRSKY" 04/29/2004: Closed by Rashid Ahmed.
Remarks: SHEEN IS ON THE SURFACE. CG SENDING A TEAM OUT - UPDATE - SPILL WAS INVESTIGATED BY USCG - SHEEN WAS COMING FROM GREENPOINT PLUME

Material:
Site ID: 236835
Operable Unit ID: 1015351
Operable Unit: 01
Material ID: 365812
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9504303
Investigator: ZHITOMIRSKY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/10/1995 17:18
Reported to Dept Date/Time: 07/10/95 18:28
SWIS: 63
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown

NEWTOWN CREEK (Continued) **1001749946**

Reported to Dept: Surface Water
Water Affected: NEWTOWN CREEK
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/03/95
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/07/95
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: SHEEN IS ON THE SURFACE. CG SENDING A TEAM OUT - UPDATE - SPILL WAS INVESTIGATED BY USCG - SHEEN WAS COMING FROM GREENPOINT PLUME

Q333 **NEWTOWN CREEK** **NY Spills** **S102147634**
SSW **NEWTOWN CREEK** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.053 mi.
278 ft. **Site 2 of 3 in cluster Q**

Relative:
Lower

Actual:
0 ft.

NY Spills:
Site ID: 236834
Facility Addr2: Not reported
Facility ID: 9312527
Spill Number: 9312527
Facility Type: ER

NEWTOWN CREEK (Continued) **S102147634**

SWIS:	4101
Investigator:	JMKRIMGO
Referred To:	Not reported
Spill Date:	1/25/1994
Reported to Dept:	1/25/1994
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Federal Government
Cleanup Ceased:	9/5/1995
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/5/1995
Remediation Phase:	0
Date Entered In Computer:	1/26/1994
Spill Record Last Update:	5/15/2003
Spiller Name:	Not reported
Spiller Company:	UNK
Spiller Address:	Not reported
Spiller City,St,Zip:	***UPDATE***, ZZ
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	195106
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "KRIMGOLD" 10/10/95: This is additional information about material spilled from the translation of the old spill file: SHEEN.
Remarks:	USCG WILL LOOK AT IT, IN 2 YRS.

Material:

Site ID:	236834
Operable Unit ID:	994522
Operable Unit:	01
Material ID:	387953
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported

NEWTOWN CREEK (Continued) **S102147634**

Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9312527
Investigator: KRIMGOLD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/25/1994 09:15
Reported to Dept Date/Time: 01/25/94 09:51
SWIS: 63
Spiller Name: UNK
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: 09/05/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/05/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/26/94
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/05/95
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum

NEWTOWN CREEK (Continued) **S102147634**

Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: SHEEN.
Remark: USCG WILL LOOK AT IT, IN 2 YRS.

Q334 **NEWTOWN CREEK** **NY Spills** **S102147798**
SSW **NEWTON CREEK** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.053 mi.
278 ft. **Site 3 of 3 in cluster Q**

Relative:
Lower

Actual:
0 ft.

NY Spills:
Site ID: 91410
Facility Addr2: Not reported
Facility ID: 9313688
Spill Number: 9313688
Facility Type: ER
SWIS: 4101
Investigator: SIGONA
Referred To: Not reported
Spill Date: 2/21/1994
Reported to Dept: 2/21/1994
CID: Not reported
Spill Cause: Unknown
Water Affected: NEWTON CREEK
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: 1/13/1995
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 1/13/1995
Remediation Phase: 0
Date Entered In Computer: 2/24/1994
Spill Record Last Update: 1/13/1995
Spiller Name: Not reported
Spiller Company: UNK
Spiller Address: Not reported
Spiller City,St,Zip: ***UPDATE***, ZZ
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
DER Facility ID: 82258
DEC Memo: Not reported
Remarks: SHEEN ON THE WATER NO OTHERS ON SCENE - CLEAN UP FROM USCG ENROUTE.

NEWTOWN CREEK (Continued) **S102147798**

Material:

Site ID:	91410
Operable Unit ID:	995735
Operable Unit:	01
Material ID:	564437
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Not reported
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9313688
Investigator:	SIGONA
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	02/21/1994 15:31
Reported to Dept Date/Time:	02/21/94 16:12
SWIS:	63
Spiller Name:	UNK
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	Surface Water
Water Affected:	NEWTON CREEK
Spill Source:	12
Spill Notifier:	Local Agency
PBS Number:	Not reported
Cleanup Ceased:	01/13/95
Cleanup Meets Std:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended

NEWTOWN CREEK (Continued) **S102147798**

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/13/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/24/94
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/13/95
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported
Last Date: 19940927
DEC Remarks: Not reported
Remark: SHEEN ON THE WATER NO OTHERS ON SCENE - CLEAN UP FROM USCG ENROUTE.

O335 **SPREADING MACHINE INC-48-85 MASPETH AVE** **FINDS** **1007757338**
SSW **48-85 MASPETH AVE** **N/A**
< 1/8 **QUEENS, NY 11378**
0.053 mi.
281 ft. **Site 3 of 11 in cluster O**

Relative:
Lower

Actual:
9 ft.

FINDS:

Registry ID: 110019197475

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

O336 **LARSTAN PROCESSING CO INC** **RCRA-NonGen** **1000387914**
SSW **48-85 MASPETH AVE** **FINDS** **NYD001512847**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.053 mi.
281 ft. **Site 4 of 11 in cluster O**

Relative:
Lower

Actual:
9 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	LARSTAN PROCESSING CO INC
Facility address:	48-85 MASPETH AVE MASPETH, NY 113782109
EPA ID:	NYD001512847
Mailing address:	MASPETH AVE MASPETH, NY 11378
Contact:	Not reported
Contact address:	MASPETH AVE MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	CHARLES CATAN
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	CHARLES CATAN
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No

LARSTAN PROCESSING CO INC (Continued) **1000387914**

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: LARSTAN PROCESSING CO INC
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: LARSTAN PROCESSING CO INC
Classification: Not a generator, verified

Date form received by agency: 09/02/1988
Facility name: LARSTAN PROCESSING CO INC
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004335103

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYD001512847
Country: USA
Mailing Name: LARSTAN PROCESSING COMPANY
Mailing Contact: LARSTAN PROCESSING COMPANY
Mailing Address: 48-85 MASPETH AVENUE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 717-417-0909

Document ID: NYA7797654
Manifest Status: Completed copy
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 880902
Trans1 Recv Date: 880902
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880902
Part A Recv Date: 880919
Part B Recv Date: 880922

LARSTAN PROCESSING CO INC (Continued) **1000387914**

Generator EPA ID:	NYD001512847
Trans1 EPA ID:	NYD000824334
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000824334
Waste Code:	F005 - UNKNOWN
Quantity:	00220
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	004
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	88

M337 **PHELPS DODGE REFINING CORP** **MANIFEST** **1009231755**
NNE **42-04 56TH RD** **N/A**
< 1/8 **MASPETH, NY 11378**
0.054 mi.
283 ft. **Site 2 of 3 in cluster M**

Relative:
Higher

Actual:
15 ft.

NY MANIFEST:

EPA ID:	NYP000785923
Country:	USA
Mailing Name:	PHELPS DODGE REFINING CORP
Mailing Contact:	ROBERT L BAUGHANER
Mailing Address:	1501 W FOUNTAINHEAD PKWY
Mailing Address 2:	Not reported
Mailing City:	FLUSHING
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-729-8043

Document ID:	NJO0111564
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	3560CV
Trans2 State ID:	Not reported
Generator Ship Date:	840719
Trans1 Recv Date:	840719
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	840720
Part A Recv Date:	840727
Part B Recv Date:	840817
Generator EPA ID:	NYP000785923
Trans1 EPA ID:	NJD053124939
Trans2 EPA ID:	Not reported
TSDF ID:	NJD049851892
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	26510
Units:	P - Pounds
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	84

PHELPS DODGE REFINING CORP (Continued) **1009231755**

Document ID:	NJO0111559
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	Not reported
Trans2 State ID:	Not reported
Generator Ship Date:	840712
Trans1 Recv Date:	840712
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	840713
Part A Recv Date:	840727
Part B Recv Date:	840822
Generator EPA ID:	NYP000785923
Trans1 EPA ID:	NJD053124939
Trans2 EPA ID:	Not reported
TSDF ID:	NJD049851892
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	49680
Units:	P - Pounds
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	84

Document ID:	NJO0111562
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	3560DC
Trans2 State ID:	Not reported
Generator Ship Date:	840712
Trans1 Recv Date:	840712
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	840713
Part A Recv Date:	840727
Part B Recv Date:	840820
Generator EPA ID:	NYP000785923
Trans1 EPA ID:	NJD053124939
Trans2 EPA ID:	Not reported
TSDF ID:	NJD049851892
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	50180
Units:	P - Pounds
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	84

Document ID:	NJO0111565
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	3560CV
Trans2 State ID:	Not reported
Generator Ship Date:	840717
Trans1 Recv Date:	840717
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	840718
Part A Recv Date:	840727

PHELPS DODGE REFINING CORP (Continued) **1009231755**

Part B Recv Date:	840817
Generator EPA ID:	NYP000785923
Trans1 EPA ID:	NJD053124939
Trans2 EPA ID:	Not reported
TSDF ID:	NJD049851892
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	47250
Units:	P - Pounds
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	84

M338 **PHELPS DODGE LAUREL HILL SITE** **UST** **U004047962**
NNE **40-02 56TH ROAD** **N/A**
< 1/8 **MASPETH, NY 11378**
0.054 mi.
283 ft. **Site 3 of 3 in cluster M**

Relative:
Higher

Actual:
15 ft.

UST:

Facility Id:	2-609332
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	592172.36114000005
UTM Y:	4511148.7150900001

Affiliation Records:

Site Id:	31176
Affiliation Type:	Owner
Company Name:	PHELPS DODGE REFINING CORPORATION
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	ONE NORTH CENTRAL AVENUE
Address2:	Not reported
City:	PHOENIX
State:	AZ
Zip Code:	85004
Country Code:	001
Phone:	(602) 366-7826
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	31176
Affiliation Type:	Mail Contact
Company Name:	PHELPS DODGE REFINING CORP.
Contact Type:	Not reported
Contact Name:	RICK MOHR
Address1:	ONE NORTH CENTRAL AVENUE
Address2:	Not reported
City:	PHOENIX
State:	AZ

PHELPS DODGE LAUREL HILL SITE (Continued) **U004047962**

Zip Code:	85004
Country Code:	001
Phone:	(602) 366-7826
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	31176
Affiliation Type:	Emergency Contact
Company Name:	PHELPS DODGE REFINING CORPORATION
Contact Type:	Not reported
Contact Name:	RICK MOHR
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(602) 366-7826
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	31176
Affiliation Type:	On-Site Operator
Company Name:	PHELPS DODGE LAUREL HILL SITE
Contact Type:	Not reported
Contact Name:	SOREN SUVER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 374-8121
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground

Tank Info:

PHELPS DODGE LAUREL HILL SITE (Continued) **U004047962**

Site ID: 31176

Tank Number: 001
Tank ID: 67158
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 3000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/29/2003
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

339
North
< 1/8
0.055 mi.
289 ft.

UNITED PARCEL SERVICE INC **FINDS** **1011447529**
55-55 48TH ST **N/A**
MASPETH, NY 11378

Relative:
Higher

Actual:
44 ft.

FINDS:

Registry ID: 110035859504

Environmental Interest/Information System
US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

O340
SSW
< 1/8
0.056 mi.
298 ft.

CANOVER INDUSTRIES **FINDS** **1007796841**
48TH ST & MASPETH AVE **N/A**
QUEENS, NY 11378

Site 5 of 11 in cluster O

Relative:
Lower

Actual:
10 ft.

FINDS:

Registry ID: 110019593509

Environmental Interest/Information System
AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is

CANOVER INDUSTRIES (Continued) **1007796841**

used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

O341 **CANOVER INDUSTRIES INC** **RCRA-NonGen** **1000343678**
SSW **48TH ST & MASPETH AVE** **FINDS** **NYD001903475**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.056 mi.
298 ft. **Site 6 of 11 in cluster O**

Relative:
Lower

Actual:
10 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	CANOVER INDUSTRIES INC
Facility address:	48TH ST & MASPETH AVE MASPETH, NY 11378
EPA ID:	NYD001903475
Mailing address:	PO BOX 77 MASPETH, NY 11378
Contact:	Not reported
Contact address:	PO BOX 77 MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	UNKNOWN
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	UNKNOWN
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

CANOVER INDUSTRIES INC (Continued) **1000343678**

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: CANOVER INDUSTRIES INC
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: CANOVER INDUSTRIES INC
Classification: Not a generator, verified

Date form received by agency: 09/02/1987
Facility name: CANOVER INDUSTRIES INC
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/03/1989
Date achieved compliance: 08/03/1989
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: 0
Final penalty amount: 0
Paid penalty amount: 0

Evaluation Action Summary:
Evaluation date: 08/03/1989
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - General
Date achieved compliance: 08/03/1989
Evaluation lead agency: State

FINDS:

Registry ID: 110007997098

CANOVER INDUSTRIES INC (Continued) **1000343678**

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID:	NYD001903475
Country:	USA
Mailing Name:	CANOVER INDUSTRIES
Mailing Contact:	CANOVER INDUSTRIES
Mailing Address:	48TH STREET & MASPETH AVENUE
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-456-8900

Document ID:	NJA0727654
Manifest Status:	Completed copy
Trans1 State ID:	000000000
Trans2 State ID:	000000000
Generator Ship Date:	900117
Trans1 Recv Date:	900117
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900118
Part A Recv Date:	900129
Part B Recv Date:	900125
Generator EPA ID:	NYD001903475
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002182897
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	03708
Units:	P - Pounds
Number of Containers:	009
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	90

Document ID:	NJA9628390
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	NJDEPS086
Generator Ship Date:	891018
Trans1 Recv Date:	891018
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	891019
Part A Recv Date:	891024

CANOVER INDUSTRIES INC (Continued) **1000343678**

Part B Recv Date:	891030
Generator EPA ID:	NYD001903475
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002182897
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	05177
Units:	P - Pounds
Number of Containers:	010
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	89

Document ID:	NJA0802680
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	NJDEPS869
Generator Ship Date:	901128
Trans1 Recv Date:	901128
Trans2 Recv Date:	901129
TSD Site Recv Date:	901129
Part A Recv Date:	901231
Part B Recv Date:	910102
Generator EPA ID:	NYD001903475
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	ILD051060408
TSDF ID:	NJD002182897
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	01756
Units:	P - Pounds
Number of Containers:	007
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	90

Document ID:	NJA0904076
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	NJDEPS869
Generator Ship Date:	900913
Trans1 Recv Date:	900913
Trans2 Recv Date:	900913
TSD Site Recv Date:	900913
Part A Recv Date:	900920
Part B Recv Date:	901001
Generator EPA ID:	NYD001903475
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	ILD051060408
TSDF ID:	NJD002182897
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	01551
Units:	P - Pounds
Number of Containers:	003

CANOVER INDUSTRIES INC (Continued) **1000343678**

Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NJA0904790
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900613
Trans1 Recv Date: 900613
Trans2 Recv Date: 900614
TSD Site Recv Date: 900614
Part A Recv Date: 910204
Part B Recv Date: 900625
Generator EPA ID: NYD001903475
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: ILD051060408
TSDF ID: NJD002182897
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 03108
Units: P - Pounds
Number of Containers: 006
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 90

Document ID: NJA1070099
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NJDEPS869
Trans2 State ID: NJDEPS869
Generator Ship Date: 901127
Trans1 Recv Date: 901127
Trans2 Recv Date: 901129
TSD Site Recv Date: 901129
Part A Recv Date: 901221
Part B Recv Date: 910102
Generator EPA ID: NYD001903475
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: ILD051060408
TSDF ID: NJD002182897
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 02060
Units: P - Pounds
Number of Containers: 005
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYA8076717
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 706938NY

CANOVER INDUSTRIES INC (Continued) **1000343678**

Trans2 State ID:	Not reported
Generator Ship Date:	881024
Trans1 Recv Date:	881024
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	881025
Part A Recv Date:	881123
Part B Recv Date:	881103
Generator EPA ID:	NYD001903475
Trans1 EPA ID:	NYD088658646
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980700942
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00600
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	020
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	88

Document ID:	NYA8076726
Manifest Status:	Completed copy
Trans1 State ID:	000000000
Trans2 State ID:	000000000
Generator Ship Date:	881028
Trans1 Recv Date:	881028
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	881029
Part A Recv Date:	881109
Part B Recv Date:	881116
Generator EPA ID:	NYD001903475
Trans1 EPA ID:	PAD085690592
Trans2 EPA ID:	Not reported
TSDF ID:	OHD980700942
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	01050
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	035
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00440
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	008
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	88

O342
SSW
< 1/8
0.058 mi.
306 ft.

5703 48TH ST
QUEENS, NY

Site 7 of 11 in cluster O

LTANKS **S104789528**
NY Hist Spills **N/A**

Relative:
Lower

Actual:
10 ft.

LTANKS:

Site ID:	64677
Spill No:	0007012
Spill Date:	9/14/2000
Spill Cause:	Tank Overfill
Spill Source:	Commercial Vehicle
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/24/2003
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	SACCACIO
Referred To:	Not reported
Reported to Dept:	9/14/2000
CID:	396
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	9/14/2000
Spill Record Last Update:	2/24/2003
Spiller Name:	Not reported
Spiller Company:	PARRY TRANSPORTATION
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	JOHN GLIDDEN
Spiller Phone:	(917) 769-0362
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	62279
Remarks:	fd on scene speedy dry has been put down.

Material:

Site ID:	64677
Operable Unit ID:	829839
Operable Unit:	01
Material ID:	548115
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

(Continued) **S104789528**

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0007012
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/14/2000 07:35
Reported to Dept Date/Time: 09/14/00 08:26
SWIS: 63
Spiller Name: PARRY TRANSPORTATION
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: JOHN GLIDDEN
Spiller Phone: (917) 769-0362
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 07
Spill Notifier: Fire Department
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/14/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/19/00
Is Updated: False

(Continued) **S104789528**

Tank:
- PBS Number: Not reported
- Tank Number: Not reported
- Tank Size: Not reported
- Test Method: Not reported
- Leak Rate Failed Tank: Not reported
- Gross Leak Rate: Not reported

Material:
- Material Class Type: Petroleum
- Quantity Spilled: 15
- Unkonwn Quantity Spilled: False
- Units: Gallons
- Quantity Recovered: 0
- Unkonwn Quantity Recovered: True
- Material: DIESEL
- Class Type: DIESEL
- Times Material Entry In File: 10625
- CAS Number: Not reported
- Last Date: 19940728
- DEC Remarks: Not reported
- Remark: fd on scene speedy dry has been put down.

O343 **NY Spills** **S104879582**
SSW **57-02 48TH ST** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.058 mi.
306 ft. **Site 8 of 11 in cluster O**

Relative:
Lower

Actual:
10 ft.

NY Spills:
- Site ID: 297031
- Facility Addr2: Not reported
- Facility ID: 0009357
- Spill Number: 0009357
- Facility Type: ER
- SWIS: 4101
- Investigator: MXTIPPLE
- Referred To: Not reported
- Spill Date: 10/5/2000
- Reported to Dept: 11/14/2000
- CID: 257
- Spill Cause: Unknown
- Water Affected: Not reported
- Spill Source: Unknown
- Spill Notifier: Affected Persons
- Cleanup Ceased: Not reported
- Cleanup Meets Std: False
- Last Inspection: Not reported
- Recommended Penalty: Penalty Not Recommended
- UST Trust: False
- Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
- Spill Closed Dt: 11/14/2000
- Remediation Phase: 0
- Date Entered In Computer: 11/14/2000
- Spill Record Last Update: 11/15/2000
- Spiller Name: Not reported
- Spiller Company: UNKNOWN

(Continued) **S104879582**

Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: ALEX AVRASEN
Contact Phone: (516) 374-7890
DEC Region: 2
DER Facility ID: 240357
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE" 11/14/2000 SPOKE WITH ALEX AVRASEN FROM COSMOS ENVIR. HE DESCRIBED THE UNKNOWN MATERIAL AS A CHEMICAL PRODUCT ONCE USED IN DYE STAMPING. A CHEMICAL THAT WAS USED 30-40 YEARS AGO TO CLEAN METAL. SOMETHING THAT LOOKED LIKE A CHEMICAL PRODUCT, NOT A PETROLEUM. UPON FINDING CONTAMINANTS, HIS CLIENT WALKED AWAY FROM PURCHASING THE PROPERTY. NO LAB ANALYSIS WAS PERFORMED. REFERRED TO BOTH DEP HAZMAT AND SOLID WASTE.
Remarks: caller found contamination in soil when he had a client trying to purchase property

Material:
Site ID: 297031
Operable Unit ID: 831646
Operable Unit: 01
Material ID: 543307
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0009357
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 10/05/2000 12:00

(Continued) **S104879582**

Reported to Dept Date/Time: 11/14/00 14:09
SWIS: 63
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: ( ) -
Spiller Contact: ALEX AVRASEN
Spiller Phone: (516) 374-7890
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/14/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/14/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/15/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: 11/14/2000 SPOKE WITH ALEX AVRASEN FROM COSMOS ENVIR. HE DESCRIBED THE UNKNOWN MATERIAL AS A CHEMICAL PRODUCT ONCE USED IN DYE STAMPING. A CHEMICAL THAT WAS USED 30-40 YEARS AGO TO CLEAN METAL. SOMETHING THAT LOOKED LIKE A CHEMICAL PRODUCT, NOT APETROLEUM. UPON FINDING CONTAMINANTS, HIS CLIENT WALKED AWAY FROM PURCHASING THE PROPERTY. NO LAB ANALYSIS WAS PERFORMED. REFERRED TO

(Continued) **S104879582**

BOTH DEP HAZMAT AND SOLID WASTE.
Remark: caller found contamination in soil when he had a client trying to purchase property

---

O344 **POLE 92057** **NY Spills** **S104953273**
SSW **57-03 48TH ST** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.058 mi.
306 ft. **Site 9 of 11 in cluster O**

Relative:
Lower

Actual:
10 ft.

NY Spills:

Site ID:	214581
Facility Addr2:	Not reported
Facility ID:	0012910
Spill Number:	0012910
Facility Type:	ER
SWIS:	4101
Investigator:	JHOCONNE
Referred To:	Not reported
Spill Date:	3/8/2001
Reported to Dept:	3/8/2001
CID:	382
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	6/24/2003
Remediation Phase:	0
Date Entered In Computer:	3/8/2001
Spill Record Last Update:	6/24/2003
Spiller Name:	CALLER
Spiller Company:	CON ED
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	MANHATTAN, NY
Spiller Company:	001
Contact Name:	SEAN MCKEEVER
Contact Phone:	(212) 580-6763
DEC Region:	2
DER Facility ID:	279657
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL" E2MIS 135841 08-MAR-2001 11:35 HRS. OVERHEAD TECH DEPT. M.NEVILLE EMP# 27356 CH.LINEMEN REPORTS: WHILE ON LOCATION FOR MAINTENANCE WORK FOUND: APPROX. 1 pt OF DIELECTRIC TRANSFORMER FLUID LEAKING FROM AN "A" PHASE BUSHING ON A 3 PHASE 75 KVA TRANSFORMER ON POLE# 92057. SPILL IS CONTAINED TO POLE & RISER. #9 DISPATCHED TO DENERGIZE TRANSFORMER, BAG & REMOVE. UPDATE 3/8/01 23:40 HRS O. ADRIAN, #9 O.G.S., REPORTS THAT AS PER OVERHEAD SUPERVISOR T. BARNHILL THE CLEANUP IS COMPLETE AT THIS TIME AND TRANSFORMER HAS BEEN REMOVED. UPDATE 4/07/03 CLEAN UP WAS PERFORMED BY DOUBLE WASHING AREA WITH BIO-GEN AND USING ABSORBANT AND DIAPERS.
Remarks:	1 pt oil leaking from transformer onto riser. clean up pending

POLE 92057 (Continued) **S104953273**

deenrgizing of transformer. con ed 135-841

Material:

Site ID:	214581
Operable Unit ID:	834840
Operable Unit:	01
Material ID:	539632
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	0012910
Investigator:	O'CONNELL
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	03/08/2001 11:00
Reported to Dept Date/Time:	03/08/01 12:53
SWIS:	63
Spiller Name:	CON ED
Spiller Contact:	CALLER
Spiller Phone:	(212) 580-6763
Spiller Contact:	SEAN MCKEEVER
Spiller Phone:	(212) 580-6763
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	MANHATTAN, NY
Spill Cause:	Equipment Failure
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	01
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	/ /

POLE 92057 (Continued) **S104953273**

Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/08/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/08/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: 1 pt oil leaking from transformer onto riser. clean up pending deenrgi ing of transformer. con ed 135-841

O345 **HMIRS** **91050641**
SSW **56-13 48TH ST** **N/A**
< 1/8 **MASPETH, NY**
0.059 mi.
309 ft. **Site 10 of 11 in cluster O**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
11 ft.

O346
SSW
< 1/8
0.059 mi.
309 ft.

56-13 48TH ST
MASPETH, NY

Site 11 of 11 in cluster O

HMIRS **90020602**
N/A

Relative:
Higher

Actual:
11 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

R347
NNE
< 1/8
0.059 mi.
314 ft.

MTA RAIL STATION
56TH ST 43RD ST
QUEENS, NY

Site 1 of 4 in cluster R

NY Spills **S106719691**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
17 ft.

NY Spills:

Site ID:	158651
Facility Addr2:	Not reported
Facility ID:	9801489
Spill Number:	9801489
Facility Type:	ER
SWIS:	4101
Investigator:	CAENGELH
Referred To:	Not reported
Spill Date:	5/4/1998
Reported to Dept:	5/4/1998
CID:	233
Spill Cause:	Unknown
Water Affected:	EAST RIVER
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
Spill Closed Dt:	6/1/1998
Remediation Phase:	0
Date Entered In Computer:	5/4/1998
Spill Record Last Update:	1/24/2003
Spiller Name:	Not reported
Spiller Company:	UNK
Spiller Address:	Not reported
Spiller City,St,Zip:	***UPDATE***, ZZ
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	134053
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT" Engelhardt arrived at 12:45. NYPD, NYFD, NYDEP, USCG and NYOEM on scene. PD reported that oil was coming out of outfall earlier but stopped. Now white foamy substance coming out. Traced to Compudye at 445-22 54th Ave in Maspeth, a fabric dyeing factory. They discharge to sanitary sewer but regulator was jammed open. Referred to SPDES, Burns.
Remarks:	OIL SLICK ON WATER SURFACE STARTS AT MASEPTH CREEK AND FLOWS INTO EAST RIVER NYC FD CALLED ALSO REQ CALL # 917-769-0483

MTA RAIL STATION (Continued) **S106719691**

Material:

Site ID:	158651
Operable Unit ID:	1059405
Operable Unit:	01
Material ID:	323426
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Site ID:	443434
Facility Addr2:	Not reported
Facility ID:	1009857
Spill Number:	1009857
Facility Type:	ER
SWIS:	4101
Investigator:	RMPIPER
Referred To:	Not reported
Spill Date:	12/15/2010
Reported to Dept:	12/15/2010
CID:	Not reported
Spill Cause:	Traffic Accident
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/22/2010
Remediation Phase:	0
Date Entered In Computer:	12/15/2010
Spill Record Last Update:	12/22/2010
Spiller Name:	MARLEY
Spiller Company:	NAPA TRANSPORT- COLLISION W/ TRAIN

MTA RAIL STATION (Continued) **S106719691**

Spiller Address:	56TH ST & 43RD ST
Spiller City,St,Zip:	QUEENS, NY
Spiller Company:	999
Contact Name:	MARLEY
Contact Phone:	(347) 203-6886
DEC Region:	2
DER Facility ID:	398371
DEC Memo:	truck train accident - Piper did a site visit Sangesland got a call from Metro Environmental saying they did the cleanup. Metro 718-567-7599
Remarks:	MTA collision w/ a tractor trailer. Mostly contained to the soil on side of tracks.

Material:

Site ID:	443434
Operable Unit ID:	1193892
Operable Unit:	01
Material ID:	2189486
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Click this hyperlink while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill:	2
Spill Number:	9801489
Investigator:	ENGELHARDT
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	05/04/1998 22:40
Reported to Dept Date/Time:	05/04/98 23:16
SWIS:	63

MTA RAIL STATION (Continued) **S106719691**

Spiller Name: UNK
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: EAST RIVER
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
Spill Closed Dt: 06/01/98
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/04/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/01/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Engelhardt arrived at 12:45. NYPD, NYFD, NYDEP, USCG and NYOEM on scene. PD reported that oil was coming out of outfall earlier but stopped. Now white foamy substance coming out. Traced to Compudye at 445-22 54th Ave in Maspeth, a fabric dyeingfactory. They discharge to sanitary sewer but regulator was jammed open. Referred to SPDES, Burns.
Remark: OIL SLICK ON WATER SURFACE STARTS AT MASEPTH CREEK AND FLOWS INTO EAST RIVER NYC FD CALLED ALSO REQ CALL 917-769-0483

R348 **POLE 77383** **NY Spills** **S104510322**
NNE **43RD ST/56TH RD** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.059 mi.
314 ft. **Site 2 of 4 in cluster R**

Relative:
Higher

Actual:
17 ft.

NY Spills:

Site ID:	268689
Facility Addr2:	Not reported
Facility ID:	9913489
Spill Number:	9913489
Facility Type:	ER
SWIS:	4101
Investigator:	JHOCONNE
Referred To:	Not reported
Spill Date:	2/29/2000
Reported to Dept:	2/29/2000
CID:	246
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/28/2002
Remediation Phase:	0
Date Entered In Computer:	2/29/2000
Spill Record Last Update:	1/24/2003
Spiller Name:	CALLER
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	218881
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL"
Remarks:	transformer on the pole failed depositing material onto concrete and plywood wall. tarps in place and cleanup crew enroute. #130173

Material:

Site ID:	268689
Operable Unit ID:	1088015
Operable Unit:	01
Material ID:	295332
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported

POLE 77383 (Continued) **S104510322**

Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9913489
Investigator: O'CONNELL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/29/2000 01:25
Reported to Dept Date/Time: 02/29/00 02:49
SWIS: 63
Spiller Name: CON EDISON
Spiller Contact: CALLER
Spiller Phone: ( ) -
Spiller Contact: CALLER
Spiller Phone: ( ) -
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/29/00
Date Spill Entered In Computer Data File: Not reported

POLE 77383 (Continued) **S104510322**

Update Date: 03/01/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: transformer on the pole failed depositing material onto concrete and plywood wall. tarps in place and cleanup crew enroute. 130173

R349 **43RD STREET & 56 ROAD / LONG ISLAND CITY** **ERNS** **94414474**
NNE **43RD STREET & 56 ROAD / LONG ISLAND CITY** **N/A**
< 1/8 **NEW YORK, NY**
0.060 mi.
316 ft. **Site 3 of 4 in cluster R**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual:
17 ft.

S350 **LAURELHILL SITE** **NY Spills** **S106970436**
NNE **4202 56 ROAD** **N/A**
< 1/8 **MASPETH, NY**
0.061 mi.
322 ft. **Site 1 of 2 in cluster S**

Relative:
Higher

Actual:
15 ft.

NY Spills:
Site ID: 350713
Facility Addr2: Not reported
Facility ID: 0505661
Spill Number: 0505661
Facility Type: ER
SWIS: 4101
Investigator: SMSANGES
Referred To: Not reported
Spill Date: 8/8/2005
Reported to Dept: 8/8/2005
CID: 409
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Responsible Party

LAURELHILL SITE (Continued) **S106970436**

Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/9/2005
Remediation Phase:	0
Date Entered In Computer:	8/8/2005
Spill Record Last Update:	8/9/2005
Spiller Name:	SOREN SUVER
Spiller Company:	LAURELHILL SITE
Spiller Address:	4202 56 ROAD
Spiller City,St,Zip:	MASPETH, NY
Spiller Company:	001
Contact Name:	SOREN SUVER
Contact Phone:	(718) 349-0683
DEC Region:	2
DER Facility ID:	297188
DEC Memo:	This "spill" event is part of a Brown Fields remediation case managed by Shaminder Chawla.
Remarks:	soren suver on site roject manager site # 7183490683. INACTIVE UNDERGROUND STORAGE TANK. THE TANK IS GOING TO BER REMOVED THERE IS WATER IN IT BUT NOTHING ELSE. DEC SHAMINDER CHAWLA IS ON SITE.

Material:

Site ID:	350713
Operable Unit ID:	1108268
Operable Unit:	01
Material ID:	2098204
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

S351 **PHELPS DODGE REFINERY** **HWAR** **S110943041**
NNE **4202 56TH RD** **N/A**
< 1/8 **MASPETH, NY 11378**
0.061 mi.
322 ft. **Site 2 of 2 in cluster S**

Relative: **Higher**

Actual: **15 ft.**

HWAR:

Location Telephone Number:	2127298043
Location Contact Name:	BOB BAUGHMAN
Latitude Decimal Degrees (Assumed Nn.Nnnnnn):	Not reported
Longitude In Decimal Degrees (Assumed Decimal):	Not reported
Owner Or Alternate Company Name:	Not reported
Owner Or Alternate Street Address:	Not reported
Owner Or Alternate Post Office Box:	Not reported
Owner Or Alternate City:	Not reported
Owner Or Alternate State:	Not reported
Owner Or Alternate Zip Code:	Not reported
Owner Or Alternate Telephone Number:	Not reported
Owner Or Alternate Contact Name:	Not reported
Operator Or Alternate Company Name:	Not reported
Operator Or Alternate Street Address:	Not reported
Operator Or Alternate Post Office Box:	Not reported
Operator Or Alternate City:	Not reported
Operator Or Alternate State:	Not reported
Operator Or Alternate Zip Code:	Not reported
Operator Or Alternate Telephone Number:	Not reported
Operator Or Alternate Contact Name:	Not reported
Secondary Or Alternate Usepa Identification Number:	Not reported
Standard Industrial Classification Code:	Not reported
Primary NAIC System Code:	Not reported
Secondary NAIC System Code:	Not reported
Haz Waste Large Quantity Generator Ind (H/Historic, 0-9 Year Latest Report, E Last Report > 10 Yrs):	Not reported
Haz Waste Small Quantity Generator(or Smaller) Ind (as above):	Not reported
Nonhazardous Waste Generator Ind (as above):	H
Compost Annual Reort Ind (as above):	Not reported
Landfill Annual Report Ind (as above):	Not reported
Potentially Infectious Medical Waste Annual Report Ind (as above):	Not reported
Haz Waste Permit Ind (S Indicates Activity):	Not reported
Solid Waste Permit Ind (S Indicates Activity):	Not reported
Used Tire Program Activity Ind (S Indicates Activity):	Not reported
Compliance Order Tracking Activity Ind (S Indicates Activity):	Not reported
Facility Compliance Tracking System Activity Ind (S Indicates Activity):	Not reported
Ind Of Groundwater Data In Mainframe Groundwater System (S Indicates Activity):	Not reported
Lust Program Activity Ind (S Indicates Activity):	Not reported
Lust Reimbursement Program Activity Ind (S Indicates Activity):	Not reported
Site Remediation Program Activity Ind (S Indicates Activity):	Not reported
FSRS Activity Ind (S Indicates Activity):	Not reported
State Response Action Activity Ind (S Indicates Activity):	Not reported
Name And Address Change Date:	11/12/02
Hazardous Annual Report Company Name:	Not reported
Hazardous Annual Report Street Address:	Not reported
Hazardous Annual Report Post Office Box:	Not reported
Hazardous Annual Report City:	Not reported
Hazardous Annual Report State:	Not reported
Hazardous Annual Report Zip Code:	Not reported
Hazardous Annual Report Telephone Number:	Not reported
Hazardous Annual Report Contact First Name:	Not reported
Hazardous Annual Report Contact Last Name:	Not reported
Hazardous Annual Report Contact Person Title Code:	Not reported

PHELPS DODGE REFINERY (Continued) **S110943041**

Hazardous Annual Report New Notifier Code:	Not reported
FIPS Country Code:	001
FIPS State Code:	36
FIPS County Code:	081
FIPS City Or Township Code:	000
IEPA Region Identifier:	Not reported
Original Entry Date:	07/20/84
Change Date:	11/12/02
Primary USEPA Identification Number:	Not reported
Status:	Not reported
Code:	BP
Total Tanks:	Not reported

N352 **DIAMOND AUTO BODY INC** **RCRA-NonGen** **1000301217**
ENE **57-50 MASPETH AVE** **FINDS** **NYD981139868**
< 1/8 **MASPETH, NY 11378**
0.066 mi.
347 ft. **Site 4 of 4 in cluster N**

Relative:
Higher

Actual:
27 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	DIAMOND AUTO BODY INC
Facility address:	57-50 MASPETH AVE MASPETH, NY 113782212
EPA ID:	NYD981139868
Mailing address:	MASPETH AVE MASPETH, NY 11378
Contact:	Not reported
Contact address:	MASPETH AVE MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	Not reported
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	Not reported
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported

DIAMOND AUTO BODY INC (Continued) **1000301217**

Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: DIAMOND AUTO BODY INC
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: DIAMOND AUTO BODY INC
Classification: Not a generator, verified

Date form received by agency: 10/28/1985
Facility name: DIAMOND AUTO BODY INC
Classification: Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 01/28/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004400835

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

R353 **SWING STAGING INC** **FINDS** **1011990623**
NNE **55-51 43RD ST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.069 mi.
362 ft. **Site 4 of 4 in cluster R**

Relative:
Higher

Actual:
17 ft.

FINDS:

Registry ID: 110037940128

Environmental Interest/Information System

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

T354 **THE CATALANO CO** **UST** **U000394269**
NNW **34-02 LAUREL HILL BOULEVARD** **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.070 mi.
371 ft. **Site 1 of 5 in cluster T**

Relative:
Higher

Actual:
16 ft.

UST:

Facility Id:	2-069116
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2012/01/14
UTM X:	590478.66304999997
UTM Y:	4509255.8671899997

Affiliation Records:

Site Id:	1449
Affiliation Type:	On-Site Operator
Company Name:	THE CATALANO CO
Contact Type:	Not reported
Contact Name:	THE CATALANO CO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 937-5402
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	1449
Affiliation Type:	Emergency Contact
Company Name:	SALVATORE CATALANO
Contact Type:	Not reported

THE CATALANO CO (Continued) **U000394269**

Contact Name:	ELEANOR CATALANO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 937-1168
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	1449
Affiliation Type:	Owner
Company Name:	SALVATORE CATALANO
Contact Type:	PARTNER
Contact Name:	SALVATORE CATALANO
Address1:	25-61 36TH ST
Address2:	Not reported
City:	ASTORIA
State:	NY
Zip Code:	11103
Country Code:	001
Phone:	(718) 721-4314
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	msbaptis
Date Last Modified:	6/11/2007

Site Id:	1449
Affiliation Type:	Mail Contact
Company Name:	SALVATORE CATALANO
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	25-61 36TH ST
Address2:	Not reported
City:	ASTORIA
State:	NY
Zip Code:	11103
Country Code:	001
Phone:	(718) 721-4314
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
D00 - Pipe Type - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)

THE CATALANO CO (Continued) **U000394269**

J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
B00 - Tank External Protection - None

Tank Info:

Site ID:	1449
Tank Number:	001
Tank ID:	2517
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/1/1964
Capacity Gallons:	5000
Tightness Test Method:	21
Next Test Date:	5/10/2012
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	5/10/2007
Register:	True
Modified By:	BKFALVEY
Last Modified:	6/8/2007

HIST UST:

PBS Number:	2-069116
SPDES Number:	Not reported
Emergency Contact:	ELEANOR CATALANO
Emergency Telephone:	(718) 937-1168
Operator:	THE CATALANO CO
Operator Telephone:	(718) 937-5402
Owner Name:	SALVATORE CATALANO
Owner Address:	25-61 36TH ST
Owner City,St,Zip:	ASTORIA, NY 11103
Owner Telephone:	(718) 721-4314
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	SALVATORE CATALANO
Mailing Address:	25-61 36TH ST
Mailing Address 2:	Not reported
Mailing City,St,Zip:	ASTORIA, NY 11103
Mailing Contact:	Not reported
Mailing Telephone:	(718) 721-4314
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	34002 LAUREL HILL BLVD
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False

THE CATALANO CO (Continued) **U000394269**

Certification Date:	11/23/2001
Expiration Date:	01/14/2007
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	5000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19640101
Capacity (gals):	5000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	10/01/1999
Next Test Date:	10/01/2004
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Horner EZ Check
Deleted:	False
Updated:	True
Lat/long:	Not reported

T355 **34-02 LAUREL HILL BLVD** **NY Spills** **S102238489**
NNW **34-02 LAURAL HILL BLVD** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.070 mi.
371 ft. **Site 2 of 5 in cluster T**

Relative:
Higher

Actual:
16 ft.

NY Spills:

Site ID:	149975
Facility Addr2:	Not reported
Facility ID:	9511676
Spill Number:	9511676
Facility Type:	ER
SWIS:	4101
Investigator:	SMMARTIN
Referred To:	Not reported
Spill Date:	12/15/1995

34-02 LAUREL HILL BLVD (Continued) **S102238489**

Reported to Dept:	12/15/1995
CID:	204
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/15/1995
Remediation Phase:	0
Date Entered In Computer:	12/15/1995
Spill Record Last Update:	1/18/1996
Spiller Name:	MICK CHRONOPOULOS
Spiller Company:	34-02 LAUREL HILL BLVD
Spiller Address:	34-02 LAURAL HILL BLVD
Spiller City,St,Zip:	MASPETH, ZZ
Spiller Company:	001
Contact Name:	MICK CHRONOPOULOS
Contact Phone:	(718) 545-3662
DEC Region:	2
DER Facility ID:	127544
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MARTINKAT"
Remarks:	while rewinding hose trigger on gun opened

Material:

Site ID:	149975
Operable Unit ID:	1025892
Operable Unit:	01
Material ID:	359006
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	Yes
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

34-02 LAUREL HILL BLVD (Continued) **S102238489**

NY Hist Spills:

Region of Spill:	2
Spill Number:	9511676
Investigator:	MARTINKAT
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	12/15/1995 09:30
Reported to Dept Date/Time:	12/15/95 11:37
SWIS:	63
Spiller Name:	34-02 LAUREL HILL BLVD
Spiller Contact:	MICK CHRONOPOULOS
Spiller Phone:	(718) 545-3662
Spiller Contact:	MICK CHRONOPOULOS
Spiller Phone:	(718) 545-3662
Spiller Address:	34-02 LAURAL HILL BLVD
Spiller City,St,Zip:	MASPETH
Spill Cause:	Equipment Failure
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	07
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/15/95
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	12/15/95
Date Spill Entered In Computer Data File:	Not reported
Update Date:	01/18/96
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	1
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	1

34-02 LAUREL HILL BLVD (Continued) **S102238489**

Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: while rewinding hose trigger on gun opened

T356 **34-02 LAUREL HILL ROAD** **NY Spills** **S102149451**
NNW **34-02 LAUREL HILL ROAD** **NY Hist Spills** **N/A**
< 1/8 **QUEENS NORTH, NY**
0.070 mi.
371 ft. **Site 3 of 5 in cluster T**

Relative:
Higher

Actual:
16 ft.

NY Spills:
Site ID: 78012
Facility Addr2: Not reported
Facility ID: 9414231
Spill Number: 9414231
Facility Type: ER
SWIS: 4101
Investigator: MCTIBBE
Referred To: Not reported
Spill Date: 1/26/1995
Reported to Dept: 1/26/1995
CID: Not reported
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: 1/26/1995
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 1/26/1995
Remediation Phase: 0
Date Entered In Computer: 1/27/1995
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
DER Facility ID: 72664
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIBBE"
Remarks: LEAK ON COMPRESSOR FITTING

Material:
Site ID: 78012
Operable Unit ID: 1007804

34-02 LAUREL HILL ROAD (Continued) **S102149451**

Operable Unit: 01
Material ID: 372975
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: Yes
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9414231
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/26/1995 17:00
Reported to Dept Date/Time: 01/26/95 12:41
SWIS: 63
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: 01/26/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /

34-02 LAUREL HILL ROAD (Continued) **S102149451**

UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/26/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/27/95
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 1
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: LEAK ON COMPRESSOR FITTING

T357 **CONSOLIDATED EDISON** **MANIFEST** **S110046430**
NNW **56 RD & LAUREL HILL BLVD** **N/A**
< 1/8 **LONG ISLAND CITY, NY 11101**
0.073 mi.
385 ft. **Site 4 of 5 in cluster T**

Relative:
Higher

Actual:
17 ft.

NY MANIFEST:
EPA ID: NYP004195699
Country: USA
Mailing Name: CONSOLIDATED EDISON
Mailing Contact: FRANKLYN MURRAY
Mailing Address: 4 IRVING PLACE RM 828
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10003
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-460-2808

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD003812047
Trans2 State ID: Not reported

CONSOLIDATED EDISON (Continued) **S110046430**

Generator Ship Date:	2009-10-07
Trans1 Recv Date:	2009-10-07
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-10-07
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004195699
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	1300.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000893779GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

T358 **NY Spills** **S106003545**
NNW **56TH RD & LAUREL HILL BLV** **N/A**
< 1/8 **QUEENS, NY**
0.073 mi.
386 ft. **Site 5 of 5 in cluster T**

Relative:
Higher

Actual:
17 ft.

NY Spills:

Site ID:	328996
Facility Addr2:	Not reported
Facility ID:	0201575
Spill Number:	0201575
Facility Type:	ER
SWIS:	4101
Investigator:	MXTIPPLE
Referred To:	Not reported
Spill Date:	5/13/2002
Reported to Dept:	5/13/2002
CID:	205
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False

(Continued) **S106003545**

Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	5/15/2002
Remediation Phase:	0
Date Entered In Computer:	5/13/2002
Spill Record Last Update:	3/29/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	264753
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE" spilled from BQE overpass drain into NYPD parking lot into storm sewer during a downpour. DEP notified, sanitation requested to sand and sweep.
Remarks:	SPILL FROM BRIDGE TO GROUND BELOW. CLEANUP IN PROGRESS.

Material:

Site ID:	328996
Operable Unit ID:	852550
Operable Unit:	01
Material ID:	522990
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

U359 **GAS STATION** **LTANKS** **S108131349**
ENE **57-59 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.074 mi.
392 ft. **Site 1 of 2 in cluster U**

Relative:
Higher

Actual:
28 ft.

LTANKS:

Site ID:	369526
Spill No:	0606215
Spill Date:	8/30/2006
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/8/2007
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	rmpiper
Referred To:	Not reported
Reported to Dept:	8/30/2006
CID:	444
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	8/30/2006
Spill Record Last Update:	3/8/2007
Spiller Name:	JOHN OKANE
Spiller Company:	GAS STATION
Spiller Address:	27-29 MASPETCH AVE
Spiller City,St,Zip:	MASPETCH, NY
Spiller County:	001
Spiller Contact:	JOHN OKANE
Spiller Phone:	(718) 779-1111
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	319406
Remarks:	550 GALLON TANK HAD HOLES AND CONTAMINATED SOIL;

Material:

Site ID:	369526
Operable Unit ID:	1127359
Operable Unit:	01
Material ID:	2116952
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

GAS STATION (Continued) **S108131349**

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

V360 **WASTE MANAGEMENT OF NY;LLC (75 THOMAS ST** **SWF/LF** **S105841763**
WSW **75 THOMAS ST.;(485 SCOTT AVE.)** **SWRCY** **N/A**
< 1/8 **BROOKLYN, NY 11222**
0.086 mi.
456 ft. **Site 1 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

SWF/LF:

Flag:	INACTIVE
Region Code:	2
Phone Number:	7185335308
Owner Name:	Not reported
Owner Type:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	Tara Hemmer
Contact Address:	Not reported
Contact Addr2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	C&D processing - registered
Activity Number:	[24W04]
Active:	No
East Coordinate:	590315
North Coordinate:	4508992
Accuracy Code:	Not reported
Regulatory Status:	Permit
Waste Type:	Not reported
Authorization #:	None
Authorization Date:	Not reported
Expiration Date:	Not reported

Flag:	INACTIVE
Region Code:	2
Phone Number:	7185335308
Owner Name:	Not reported
Owner Type:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported

WASTE MANAGEMENT OF NY;LLC (75 THOMAS ST (Continued) **S105841763**

Owner Phone:	Not reported
Contact Name:	Tara Hemmer
Contact Address:	Not reported
Contact Addr2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Transfer station - regulated
Activity Number:	[24T04]
Active:	No
East Coordinate:	590315
North Coordinate:	4508992
Accuracy Code:	Not reported
Regulatory Status:	Permit
Waste Type:	Not reported
Authorization #:	None
Authorization Date:	Not reported
Expiration Date:	Not reported

SWRCY:

Region:	2
Facility Address 2:	Not reported
Phone Number:	7185335308
Owner Type:	Not reported
Owner Name:	Not reported
Owner Address:	Not reported
Owner Address 2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	Tara Hemmer
Contact Address:	Not reported
Contact Address 2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Recylables handling and recovery facilities
Activity Number:	[24M04]
Active:	No
East Coordinate:	590315
North Coordinate:	4508992
Accuracy Code:	Not reported
Regulatory Status:	Permit
Permit #:	None
Auth. Date:	Not reported
Expiration Date:	Not reported
Waste Types:	Not reported

V361 **LEHIGH CARTING CO INC** **UST** **U001836404**
WSW **485 SCOTT AVE** **HIST UST** **N/A**
< 1/8 **BROOKLYN, NY 11222**
0.086 mi.
456 ft. **Site 2 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

UST:

Facility Id:	2-310778
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	590365.79734000005
UTM Y:	4508960.3225100003

Affiliation Records:

Site Id:	14215
Affiliation Type:	Emergency Contact
Company Name:	LEHIGH CARTING CO INC
Contact Type:	Not reported
Contact Name:	MICHAEL VECCHIO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 387-2794
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	14215
Affiliation Type:	Owner
Company Name:	LEHIGH CARTING CO INC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	485 SCOTT AVE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11222
Country Code:	001
Phone:	(718) 387-8400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	CGFREEDM
Date Last Modified:	12/15/2004

Site Id:	14215
Affiliation Type:	Mail Contact
Company Name:	LEHIGH CARTING CO INC
Contact Type:	Not reported
Contact Name:	SUPER./FACILITY MANAGER
Address1:	485 SCOTT AVE
Address2:	Not reported

LEHIGH CARTING CO INC (Continued) **U001836404**

City:	BROOKLYN
State:	NY
Zip Code:	11222
Country Code:	001
Phone:	(718) 387-8400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	CGFREEDM
Date Last Modified:	12/15/2004

Site Id:	14215
Affiliation Type:	On-Site Operator
Company Name:	LEHIGH CARTING CO INC
Contact Type:	Not reported
Contact Name:	LEHIGH CARTING CO INC
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 387-8400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
G03 - Tank Secondary Containment - Vault (w/o access)
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
I00 - Overfill - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
I00 - Overfill - None
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
I00 - Overfill - None

LEHIGH CARTING CO INC (Continued) **U001836404**

I00 - Overfill - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None

Tank Info:

Site ID:	14215
Tank Number:	001
Tank ID:	18369
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	15000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14215
Tank Number:	002
Tank ID:	18370
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14215
Tank Number:	003
Tank ID:	18371
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550

LEHIGH CARTING CO INC (Continued) **U001836404**

Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14215
Tank Number:	004
Tank ID:	18372
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-310778
SPDES Number:	Not reported
Emergency Contact:	MICHAEL VECCHIO
Emergency Telephone:	(718) 387-2794
Operator:	LEHIGH CARTING CO INC
Operator Telephone:	(718) 387-8400
Owner Name:	LEHIGH CARTING CO INC
Owner Address:	485 SCOTT AVE
Owner City,St,Zip:	BKLYN, NY 11222
Owner Telephone:	(718) 387-8400
Owner Type:	Not reported
Owner Subtype:	Not reported
Mailing Name:	LEHIGH CARTING CO INC
Mailing Address:	485 SCOTT AVE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BKLYN, NY 11222
Mailing Contact:	SUPER./FACILITY MANAGER
Mailing Telephone:	(718) 387-8400
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	485 SCOTT AVE
SWIS ID:	6101
Old PBS Number:	Not reported
Facility Type:	OTHER
Inspected Date:	Not reported
Inspector:	Not reported

LEHIGH CARTING CO INC (Continued) **U001836404**

Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	11/30/1992
Expiration Date:	08/17/1997
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	61
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	15000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL

LEHIGH CARTING CO INC (Continued) **U001836404**

Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking

LEHIGH CARTING CO INC (Continued) **U001836404**

Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

V362 **WASTE MGMT-485 SCOTT AVE** **FINDS** **1006040687**
WSW **485 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11201**
0.086 mi.
456 ft. **Site 3 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

FINDS:

Registry ID: 110001570960

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

V363 **BQE TANSFER STATION** **FINDS** **1012304349**
WSW **485 SCOTT AVE** **N/A**
< 1/8 **BROOKLYN, NY 11201**
0.086 mi.
456 ft. **Site 4 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

FINDS:

Registry ID: 110040086527

Environmental Interest/Information System
US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

V364 **WASTE MANAGEMENT NY (BQE** **SWF/LF** **S102632765**
WSW **485 SCOTT AVENUE** **SWRCY** **N/A**
< 1/8 **BROOKYN, NY 11222** **FINANCIAL ASSURANCE**
0.086 mi.
456 ft. **Site 5 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

SWF/LF:

Flag:	INACTIVE
Region Code:	2
Phone Number:	7185335308
Owner Name:	Waste Management of NY
Owner Type:	Private
Owner Address:	123 Varrick Avenue
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11237
Owner Email:	Not reported
Owner Phone:	7183867900
Contact Name:	Tara Hemmer
Contact Address:	123 Varick Avenue
Contact Addr2:	Not reported
Contact City,St,Zip:	Brooklyn, NY 11237
Contact Email:	Not reported
Contact Phone:	7185335308
Activity Desc:	C&D processing - regulated
Activity Number:	[24W04]
Active:	No
East Coordinate:	Not reported
North Coordinate:	Not reported
Accuracy Code:	Not reported
Regulatory Status:	Permit
Waste Type:	Wood (Clean);Wood (Pallets & Crates);Wood (Trees/Stumps)
Authorization #:	None
Authorization Date:	Not reported
Expiration Date:	Not reported

Flag:	ACTIVE
Region Code:	2
Phone Number:	7185335308
Owner Name:	Waste Management of NY

WASTE MANAGEMENT NY (BQE (Continued) **S102632765**

Owner Type:	Private
Owner Address:	123 Varrick Avenue
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11237
Owner Email:	Not reported
Owner Phone:	7183867900
Contact Name:	Tara Hemmer
Contact Address:	123 Varick Avenue
Contact Addr2:	Not reported
Contact City,St,Zip:	Brooklyn, NY 11237
Contact Email:	Not reported
Contact Phone:	7185335308
Activity Desc:	Transfer station - regulated
Activity Number:	[24T04]
Active:	Yes
East Coordinate:	590298
North Coordinate:	4508891
Accuracy Code:	4.2 - Utilization of GIS and existing spatial data
Regulatory Status:	None
Waste Type:	MSW (Residential/Institutional & Commercial)
Authorization #:	2-6101-00026/00001
Authorization Date:	7/5/2001
Expiration Date:	6/27/2006

SWRCY:

Region:	2
Facility Address 2:	Not reported
Phone Number:	7185335308
Owner Type:	Private
Owner Name:	Waste Management of NY
Owner Address:	123 Varrick Avenue
Owner Address 2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11237
Owner Email:	Not reported
Owner Phone:	7183867900
Contact Name:	Tara Hemmer
Contact Address:	123 Varick Avenue
Contact Address 2:	Not reported
Contact City,St,Zip:	Brooklyn, NY 11237
Contact Email:	Not reported
Contact Phone:	7185335308
Activity Desc:	Recylables handling and recovery facilities
Activity Number:	[24M04]
Active:	No
East Coordinate:	Not reported
North Coordinate:	Not reported
Accuracy Code:	Not reported
Regulatory Status:	Permit
Permit #:	None
Auth. Date:	Not reported
Expiration Date:	Not reported
Waste Types:	Glass

FINANCIAL ASSURANCE 1:

Owner Name:	Waste Management of NY
Region:	2

WASTE MANAGEMENT NY (BQE (Continued) **S102632765**

Planning Unit:	New York City
Estimate Type:	Closure
Estimate Amount:	695000
Estimate Date:	3/1/2001
Mechanism:	Surety bond - Performance
Mechanism Amount:	695000
Financial Institution:	Amwest Surety Insurance Company
Issue Date:	Not reported
Expiration Date:	Not reported
Activity Number:	24T04
Activity Description:	Transfer station - regulated

V365 **WASTE MGMT-485 SCOTT AVE** **ICIS 1011562639**
WSW **485 SCOTT AVENUE BROOKLYN NY 11201** **N/A**
< 1/8 **BROOKLYN, NY 11201**
0.086 mi.
456 ft. **Site 6 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

ICIS:

Enforcement Action ID:	02-1982-0044
FRS ID:	110001570960
Program ID:	AIRS/AFS 3604700158
Action Name:	LEHIGH CARTING CO
Facility Name:	WASTE MGMT-485 SCOTT AVE
Facility Address:	485 SCOTT AVENUE BROOKLYN NY 11201 BROOKLYN, New York 11201
Enforcement Action Type:	Civil Judicial Action
Facility County:	Kings
EPA Region #:	3

Enforcement Action ID:	02-1982-0044
FRS ID:	110001570960
Program ID:	FIS 2-6101-00026
Action Name:	LEHIGH CARTING CO
Facility Name:	WASTE MGMT-485 SCOTT AVE
Facility Address:	485 SCOTT AVENUE BROOKLYN NY 11201 BROOKLYN, New York 11201
Enforcement Action Type:	Civil Judicial Action
Facility County:	Kings
EPA Region #:	3

Enforcement Action ID:	02-1982-0044
FRS ID:	110001570960
Program ID:	FRS 110001570960
Action Name:	LEHIGH CARTING CO
Facility Name:	WASTE MGMT-485 SCOTT AVE
Facility Address:	485 SCOTT AVENUE BROOKLYN NY 11201 BROOKLYN, New York 11201
Enforcement Action Type:	Civil Judicial Action
Facility County:	Kings
EPA Region #:	3

Program ID:	AIRS/AFS 3604700158
Facility Name:	WASTE MGMT-485 SCOTT AVE
Address:	485 SCOTT AVENUE
Tribal Indicator:	N
Fed Facility:	No

WASTE MGMT-485 SCOTT AVE (Continued) **1011562639**

NAIC Code: Not reported
SIC Code: 4212

Program ID: FIS 2-6101-00026
Facility Name: WASTE MGMT-485 SCOTT AVE
Address: 485 SCOTT AVENUE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 4212

Program ID: FRS 110001570960
Facility Name: WASTE MGMT-485 SCOTT AVE
Address: 485 SCOTT AVENUE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 4212

V366 **WASTE MANAGEMENT OF NEW YORK, LLC** **AST** **A100353019**
WSW **485 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11237**
0.086 mi.
456 ft. **Site 7 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-600179
Program Type: PBS
UTM X: 590397.39234999998
UTM Y: 4508888.2286200002
Expiration Date: 2016/06/11

Affiliation Records:
Site Id: 22162
Affiliation Type: Mail Contact
Company Name: WASTE MANAGEMENT OF NY, LLC
Contact Type: ENVIRONMENTAL MANAGER
Contact Name: JAY KAPLAN
Address1: 123 VARICK AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11237
Country Code: 001
Phone: (718) 533-5310
Phone Ext: Not reported
Email: JKAPLAN2@WM.COM
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/21/2010

Site Id: 22162
Affiliation Type: Owner
Company Name: WASTE MANAGEMENT OF NEW YORK, LLC
Contact Type: ENVIRONMENTAL MANAGER

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **A100353019**

Contact Name:	JAY KAPLAN
Address1:	123 VARICK AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11237
Country Code:	001
Phone:	(718) 533-5310
Phone Ext:	Not reported
Email:	JKAPLAN2@WM.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	11/12/2009

Site Id:	22162
Affiliation Type:	On-Site Operator
Company Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Contact Type:	Not reported
Contact Name:	PETE DELUCA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 533-5300
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	6/21/2010

Site Id:	22162
Affiliation Type:	Emergency Contact
Company Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Contact Type:	Not reported
Contact Name:	JAY KAPLAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 773-1814
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	6/21/2010

Equipment Records:

H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
K01 - Spill Prevention - Catch Basin

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **A100353019**

I05 - Overfill - Vent Whistle
K01 - Spill Prevention - Catch Basin
D11 - Pipe Type - Flexible Piping
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
G10 - Tank Secondary Containment - Impervious Underlayment
E00 - Piping Secondary Containment - None
J02 - Dispenser - Suction
D11 - Pipe Type - Flexible Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B01 - Tank External Protection - Painted/Asphalt Coating
C01 - Pipe Location - Aboveground
A00 - Tank Internal Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
B01 - Tank External Protection - Painted/Asphalt Coating
L09 - Piping Leak Detection - Exempt Suction Piping
B01 - Tank External Protection - Painted/Asphalt Coating
D99 - Pipe Type - Other
K01 - Spill Prevention - Catch Basin
I04 - Overfill - Product Level Gauge (A/G)
G01 - Tank Secondary Containment - Diking (Aboveground)
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
G99 - Tank Secondary Containment - Other
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
I04 - Overfill - Product Level Gauge (A/G)
B01 - Tank External Protection - Painted/Asphalt Coating
G04 - Tank Secondary Containment - Double-Walled (Underground)
J00 - Dispenser - None
A00 - Tank Internal Protection - None
H05 - Tank Leak Detection - In-Tank System (ATG)
D99 - Pipe Type - Other
C00 - Pipe Location - No Piping
I05 - Overfill - Vent Whistle
J02 - Dispenser - Suction
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
D11 - Pipe Type - Flexible Piping
F02 - Pipe External Protection - Original Sacrificial Anode
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C01 - Pipe Location - Aboveground

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **A100353019**

G01 - Tank Secondary Containment - Diking (Aboveground)
G04 - Tank Secondary Containment - Double-Walled (Underground)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
D00 - Pipe Type - No Piping
E00 - Piping Secondary Containment - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
F06 - Pipe External Protection - Wrapped
B04 - Tank External Protection - Fiberglass
H05 - Tank Leak Detection - In-Tank System (ATG)
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction

Tank Info:

Tank Number:	004
Tank Id:	59866
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1999
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	3/15/2011

Tank Number:	005
Tank Id:	59867
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1998
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	3/15/2011

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **A100353019**

Tank Number:	006
Tank Id:	231437
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/15/1997
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	3/15/2011

Tank Number:	007
Tank Id:	231438
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Tank Converted to Non-Regulated Use
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/15/1997
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	3/23/2010
Register:	True
Modified By:	NRLOMBAR
Last Modified:	7/1/2010

V367 **WASTE MANAGEMENT OF NEW YORK, LLC** **UST** **U004078874**
WSW **485 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11237**
0.086 mi.
456 ft. **Site 8 of 30 in cluster V**

Relative:
Higher

Actual:
11 ft.

UST:

Facility Id:	2-600179
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2016/06/11
UTM X:	590397.39234999998
UTM Y:	4508888.2286200002

Affiliation Records:

Site Id:	22162
Affiliation Type:	Mail Contact
Company Name:	WASTE MANAGEMENT OF NY, LLC
Contact Type:	ENVIRONMENTAL MANAGER
Contact Name:	JAY KAPLAN
Address1:	123 VARICK AVENUE

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U004078874**

Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11237
Country Code:	001
Phone:	(718) 533-5310
Phone Ext:	Not reported
Email:	JKAPLAN2@WM.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	6/21/2010

Site Id:	22162
Affiliation Type:	Owner
Company Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Contact Type:	ENVIRONMENTAL MANAGER
Contact Name:	JAY KAPLAN
Address1:	123 VARICK AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11237
Country Code:	001
Phone:	(718) 533-5310
Phone Ext:	Not reported
Email:	JKAPLAN2@WM.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	11/12/2009

Site Id:	22162
Affiliation Type:	On-Site Operator
Company Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Contact Type:	Not reported
Contact Name:	PETE DELUCA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 533-5300
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	6/21/2010

Site Id:	22162
Affiliation Type:	Emergency Contact
Company Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Contact Type:	Not reported
Contact Name:	JAY KAPLAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U004078874**

Zip Code:	Not reported
Country Code:	999
Phone:	(646) 773-1814
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	6/21/2010

Equipment Records:

H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
K01 - Spill Prevention - Catch Basin
I05 - Overfill - Vent Whistle
K01 - Spill Prevention - Catch Basin
D11 - Pipe Type - Flexible Piping
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
G10 - Tank Secondary Containment - Impervious Underlayment
E00 - Piping Secondary Containment - None
J02 - Dispenser - Suction
D11 - Pipe Type - Flexible Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B01 - Tank External Protection - Painted/Asphalt Coating
C01 - Pipe Location - Aboveground
A00 - Tank Internal Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
B01 - Tank External Protection - Painted/Asphalt Coating
L09 - Piping Leak Detection - Exempt Suction Piping
B01 - Tank External Protection - Painted/Asphalt Coating
D99 - Pipe Type - Other
K01 - Spill Prevention - Catch Basin
I04 - Overfill - Product Level Gauge (A/G)
G01 - Tank Secondary Containment - Diking (Aboveground)
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
G99 - Tank Secondary Containment - Other
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
I04 - Overfill - Product Level Gauge (A/G)
B01 - Tank External Protection - Painted/Asphalt Coating

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U004078874**

G04 - Tank Secondary Containment - Double-Walled (Underground)
J00 - Dispenser - None
A00 - Tank Internal Protection - None
H05 - Tank Leak Detection - In-Tank System (ATG)
D99 - Pipe Type - Other
C00 - Pipe Location - No Piping
I05 - Overfill - Vent Whistle
J02 - Dispenser - Suction
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
D11 - Pipe Type - Flexible Piping
F02 - Pipe External Protection - Original Sacrificial Anode
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C01 - Pipe Location - Aboveground
G01 - Tank Secondary Containment - Diking (Aboveground)
G04 - Tank Secondary Containment - Double-Walled (Underground)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
D00 - Pipe Type - No Piping
E00 - Piping Secondary Containment - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
F06 - Pipe External Protection - Wrapped
B04 - Tank External Protection - Fiberglass
H05 - Tank Leak Detection - In-Tank System (ATG)
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction

Tank Info:

Site ID:	22162
Tank Number:	001
Tank ID:	41431
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1990
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1999
Tank Location:	5
Tank Type:	Other
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U004078874**

Site ID:	22162
Tank Number:	002
Tank ID:	41432
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1990
Capacity Gallons:	2000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/1999
Tank Location:	5
Tank Type:	Other
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	22162
Tank Number:	003
Tank ID:	41433
Tank Status:	Closed - Removed
Tank Model:	106
Pipe Model:	Not reported
Install Date:	6/1/1999
Capacity Gallons:	2000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	4/1/2005
Tank Location:	5
Tank Type:	Fiberglass coated steel
Date Test:	Not reported
Register:	True
Modified By:	MABARTLE
Last Modified:	3/17/2005

U368 **HMIRS** **2004000911**
ENE **56-73 58 ST** **N/A**
< 1/8 **MASPETH, NY**
0.087 mi.
462 ft. **Site 2 of 2 in cluster U**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
30 ft.

W369 **POLE #87904** **NY Spills** **S104284842**
SSE **48-80 MASPETH AVE** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.088 mi.
463 ft. **Site 1 of 9 in cluster W**

Relative:
Higher

Actual:
11 ft.

NY Spills:

Site ID:	128109
Facility Addr2:	Not reported
Facility ID:	9911021
Spill Number:	9911021
Facility Type:	ER
SWIS:	4101
Investigator:	COMENALE
Referred To:	Not reported
Spill Date:	12/16/1999
Reported to Dept:	12/16/1999
CID:	252
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/28/2002
Remediation Phase:	0
Date Entered In Computer:	12/16/1999
Spill Record Last Update:	11/17/2004
Spiller Name:	FARNK MASSERIA
Spiller Company:	POLE #87904
Spiller Address:	48-80 MASPETH AVE
Spiller City,St,Zip:	QUEENS, ZZ
Spiller Company:	001
Contact Name:	FARNK MASSERIA
Contact Phone:	(212) 580-6763
DEC Region:	2
DER Facility ID:	110538
DEC Memo:	e2mis no. 129318: 12-16-99 14:20hrs c. rodriquez reports, found 1 qt of dielectric fluid leaked from oh transformer onto ground a three cars. area is contained and no sewers or waterways were affected. could not check for historical records because this is a new transformer. mr rodriquez will call back up when he gets back up to transformer in a oh bucket to see what manufactures name, number date and pcb count is. at this time r. cosenttino was notified and is on his way to location. also a bklyn fluh crew was dispatched to location. three cars were affected, but two of them left the location. the other car affected remains on location its plate number is vqx-248. it has oil spots on rear of vehicle. will follow up with more details of this spill as soon as posible. 15:25hrs c. rodriquez reports, manufacture name is westinghouse and there is two dates one reads 6/1998 and the other is 7/1999 and the pcb count on it reads 10.ppm. id# is cst 84a472350. update********** 16:50hrs r. cosentino reports, the two other cars that left location refused to stay, but the other car stayed and was double washed and the owner

POLE #87904 (Continued) **S104284842**

anne salvati was very satisfied. also r. cosentino notified ert of
cleanup & no outside agency responded. update********** 17:00hrs b.
saladino reports, one liquid sample was taken and delivered to chem
lab. Update: 12/16/99 19:25Hrs. Lab Seq#: 99-12892 Results: <1.00 PPM
Update: 12/16/99 20:30Hrs. As of this time cleanup is completed.
Earlier, #9 stopped leak and bagged unit.

Remarks: MATERIAL HAD LANDED ON THREE VEHS IN AREA- TWO VEHS LEFT SCENE-THE OTHER VEH HAS NY REG VQX248. CLEANUP AS 50-499 PPM PCB.

Material:

Site ID:	128109
Operable Unit ID:	1089710
Operable Unit:	01
Material ID:	296494
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9911021
Investigator:	COMENALE
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	12/16/1999 14:00
Reported to Dept Date/Time:	12/16/99 15:37
SWIS:	63
Spiller Name:	POLE #87904
Spiller Contact:	FARNK MASSERIA
Spiller Phone:	(212) 580-6763
Spiller Contact:	FARNK MASSERIA
Spiller Phone:	(212) 580-6763
Spiller Address:	48-80 MASPETH AVE
Spiller City,St,Zip:	QUEENS

POLE #87904 (Continued) **S104284842**

Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/16/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/21/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: MATERIAL HAD LANDED ON THREE VEHS IN AREA- TWO VEHS LEFT SCENE-THE OTHER VEH HAS NY REG VQX248. CLEANUP AS 50-499 PPM PCB.

X370 **ACME SKILLMAN CONCRETE CO. INC.** **UST** **U003312842**
ENE **56-22 58TH STREET** **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378**
0.099 mi.
525 ft. **Site 1 of 12 in cluster X**

Relative:
Higher

Actual:
29 ft.

UST:
Facility Id: 2-600199
Region: STATE
DEC Region: 2
Site Status: Active

ACME SKILLMAN CONCRETE CO. INC. (Continued) **U003312842**

Program Type: PBS
Expiration Date: 2016/07/03
UTM X: 591839.13422000001
UTM Y: 4508772.3186499998

Affiliation Records:

Site Id: 22182
Affiliation Type: Emergency Contact
Company Name: 56-22 58TH STREET CORPORATION
Contact Type: Not reported
Contact Name: FERNANDO MINCHELLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 326-2002
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: BVCAMPBE
Date Last Modified: 4/26/2011

Site Id: 22182
Affiliation Type: Mail Contact
Company Name: 56-22 58TH STREET CORPORATION
Contact Type: Not reported
Contact Name: ATONIO MINCHELLA
Address1: 56-22 58TH STRREET
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 326-1225
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: DXLIVING
Date Last Modified: 5/9/2006

Site Id: 22182
Affiliation Type: On-Site Operator
Company Name: ACME SKILLMAN CONCRETE CO. INC.
Contact Type: Not reported
Contact Name: FERNANDO MINCHELLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 326-2002
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: BVCAMPBE

ACME SKILLMAN CONCRETE CO. INC. (Continued) **U003312842**

Date Last Modified: 4/26/2011

Site Id: 22182
Affiliation Type: Owner
Company Name: 56-22 58TH STREET CORPORATION
Contact Type: PRESIDENT
Contact Name: ANTONIO MINCHELLA
Address1: 56-22 58TH STREET
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 326-1225
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2/1/2008

Equipment Records:

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D02 - Pipe Type - Galvanized Steel
L09 - Piping Leak Detection - Exempt Suction Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
I03 - Overfill - Automatic Shut-Off
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
E00 - Piping Secondary Containment - None
I01 - Overfill - Float Vent Valve
B00 - Tank External Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
F02 - Pipe External Protection - Original Sacrificial Anode
F02 - Pipe External Protection - Original Sacrificial Anode
K01 - Spill Prevention - Catch Basin
E00 - Piping Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
I03 - Overfill - Automatic Shut-Off
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping

Tank Info:
Site ID: 22182

Tank Number: 001
Tank ID: 41521
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 4/1/1988
Capacity Gallons: 1000
Tightness Test Method: 20

ACME SKILLMAN CONCRETE CO. INC. (Continued) **U003312842**

Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	10/1/1998
Register:	True
Modified By:	BVCAMPBE
Last Modified:	4/26/2011
Site ID:	22182
Tank Number:	002
Tank ID:	41522
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1988
Capacity Gallons:	1000
Tightness Test Method:	20
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	10/1/1998
Register:	True
Modified By:	BVCAMPBE
Last Modified:	4/26/2011

HIST UST:

PBS Number:	2-600199
SPDES Number:	Not reported
Emergency Contact:	MARK MCBREAIRTY
Emergency Telephone:	(718) 326-2002
Operator:	MARK MCBREAIRTY
Operator Telephone:	(718) 326-2002
Owner Name:	56-22 58TH STREET CORPORATION
Owner Address:	56-22 58TH STREET
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 326-1225
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	56-22 58TH STREET CORPORATION
Mailing Address:	56-22 58TH STRREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	ATONIO MINCHELLA
Mailing Telephone:	(718) 326-1225
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	56022 58TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported

ACME SKILLMAN CONCRETE CO. INC. (Continued) **U003312842**

Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	06/08/2001
Expiration Date:	07/03/2006
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	2000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19880401
Capacity (gals):	1000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Sacrificial Anode
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	Float Vent Valve, Automatic Shut-Off
Dispenser:	Suction
Date Tested:	10/01/1998
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	USTest 2000
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19880401
Capacity (gals):	1000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL

ACME SKILLMAN CONCRETE CO. INC. (Continued) **U003312842**

Pipe Internal:	None
Pipe External:	Sacrificial Anode
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	Automatic Shut-Off, Catch Basin
Dispenser:	Suction
Date Tested:	10/01/1998
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	USTest 2000
Deleted:	False
Updated:	True
Lat/long:	Not reported

Y371 **CONSOLIDATED EDISON** **MANIFEST** **S110046632**
SSE **RUST ST AND 57 PL** **N/A**
< 1/8 **QUEENS VILLAGE, NY 11427**
0.101 mi.
535 ft. **Site 1 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

NY MANIFEST:

EPA ID:	NYP004194122
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLYN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2009-09-12
Trans1 Recv Date:	2009-09-12
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-09-14
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004194122
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	1600.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	4.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09

CONSOLIDATED EDISON (Continued) **S110046632**

Manifest Tracking Num:	001440735FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	2009-09-12
Trans1 Recv Date:	2009-09-12
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-09-14
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004194122
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593636
Waste Code:	Not reported
Quantity:	1600.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	4.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001440735FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

V372 **HMIRS** **9900000808**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 9 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V373 **HMIRS** **94030601**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 10 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V374 **HMIRS** **9998081336**
WSW **500 SCOTT AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 11 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V375 **HMIRS** **94101056**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 12 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V376 **HMIRS** **9998051284**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 13 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V377 **HMIRS** **96091126**
WSW **500 SCOTT AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 14 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V378
WSW
< 1/8
0.104 mi.
550 ft.

500 SCOTT AVE
BROOKLYN, NY

Site 15 of 30 in cluster V

HMIRS **92100588**
N/A

Relative:
Higher

Actual:
13 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

V379
WSW
< 1/8
0.104 mi.
550 ft.

500 SCOTT AVENUE
BROOKLYN, NY

Site 16 of 30 in cluster V

HMIRS **92060291**
N/A

Relative:
Higher

Actual:
13 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

V380
WSW
< 1/8
0.104 mi.
550 ft.

PRESTON TRUCKING CO
500 SCOTT AVE
MASPETH, NY 11222

Site 17 of 30 in cluster V

RCRA-NonGen **1000994310**
FINDS **NYD980787501**
MANIFEST

Relative:
Higher

Actual:
13 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	PRESTON TRUCKING CO
Facility address:	500 SCOTT AVE MASPETH, NY 11222
EPA ID:	NYD980787501
Mailing address:	MASPETH AVE MASPETH, NY 11378
Contact:	Not reported
Contact address:	MASPETH AVE MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	PRESTON CORP
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	PRESTON CORP
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private

PRESTON TRUCKING CO (Continued) **1000994310**

Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: PRESTON TRUCKING CO
Classification: Not a generator, verified

Date form received by agency: 04/05/1995
Facility name: PRESTON TRUCKING CO
Classification: Not a generator, verified

Date form received by agency: 02/20/1985
Facility name: PRESTON TRUCKING CO
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110009471179

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYD980787501
Country: USA
Mailing Name: PRESTON TRUCKING
Mailing Contact: PRESTON TRUCKING
Mailing Address: 49-40 MASPETH AVENUE
Mailing Address 2: Not reported

PRESTON TRUCKING CO (Continued) **1000994310**

Mailing City:	QUEENS
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-456-9690

Document ID:	PAB0630770
Manifest Status:	Completed copy
Trans1 State ID:	PA-AH0139
Trans2 State ID:	PA-AH
Generator Ship Date:	850411
Trans1 Recv Date:	850411
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	850411
Part A Recv Date:	850425
Part B Recv Date:	850424
Generator EPA ID:	NYD980787501
Trans1 EPA ID:	PAD085690592
Trans2 EPA ID:	Not reported
TSDF ID:	PAD085690592
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00050
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	85

V381 **HMIRS** **95031057**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 18 of 30 in cluster V**

Relative:
Higher

Actual:
13 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

V382
WSW
< 1/8
0.104 mi.
550 ft.

500 SCOTT AVE
BROOKLYN, NY

Site 19 of 30 in cluster V

HMIRS **9998011002**
N/A

Relative:
Higher

Actual:
13 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

V383
WSW
< 1/8
0.104 mi.
550 ft.

500 SCOTT AVENUE
BROOKLYN, NY

Site 20 of 30 in cluster V

HMIRS **97120665**
N/A

Relative:
Higher

Actual:
13 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

V384
WSW
< 1/8
0.104 mi.
550 ft.

JOHN KNICK REALTY CORP
500 SCOTT AVE
BROOKLYN, NY 11222

Site 21 of 30 in cluster V

RCRA-NonGen **1000554878**
FINDS **NYD986973675**
MANIFEST

Relative:
Higher

Actual:
13 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	JOHN KNICK REALTY CORP
Facility address:	500 SCOTT AVE BROOKLYN, NY 11222
EPA ID:	NYD986973675
Mailing address:	S SERVICE RD JERICHO, NY 11753
Contact:	Not reported
Contact address:	S SERVICE RD JERICHO, NY 11753
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	JOHN KNICK REALTY CORP
Owner/operator address:	UNKNOWN UNKNOWN, NY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	JOHN KNICK REALTY CORP
Owner/operator address:	UNKNOWN UNKNOWN, NY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212

JOHN KNICK REALTY CORP (Continued) **1000554878**

Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: JOHN KNICK REALTY CORP
Classification: Not a generator, verified

Date form received by agency: 12/29/1993
Facility name: JOHN KNICK REALTY CORP
Classification: Not a generator, verified

Date form received by agency: 10/10/1991
Facility name: JOHN KNICK REALTY CORP
Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 12/29/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA Contractor/Grantee

FINDS:

Registry ID: 110004477423

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

JOHN KNICK REALTY CORP (Continued) **1000554878**

NY MANIFEST:

EPA ID:	NYD986973675
Country:	USA
Mailing Name:	JOHN KNICK REALTY CORP
Mailing Contact:	FRED J. CARILLO
Mailing Address:	25 SOUTH SERVICE ROAD
Mailing Address 2:	Not reported
Mailing City:	JERICHO
Mailing State:	NY
Mailing Zip:	11753
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	516-997-4100

Document ID:	NYB2134584
Manifest Status:	Completed copy
Trans1 State ID:	VU4150
Trans2 State ID:	VU4150
Generator Ship Date:	911017
Trans1 Recv Date:	911017
Trans2 Recv Date:	911018
TSD Site Recv Date:	911018
Part A Recv Date:	Not reported
Part B Recv Date:	911105
Generator EPA ID:	NYD986973675
Trans1 EPA ID:	NYD986893261
Trans2 EPA ID:	NYD986893261
TSDF ID:	NYD082785429
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	91

V385 **SCOTT AVENUE FACILITY** **FINDS** **1009324624**
WSW **500 SCOTT AVE** **N/A**
< 1/8 **BROOKLYN, NY 11222**
0.104 mi.
550 ft. **Site 22 of 30 in cluster V**

Relative:
Higher

Actual:
13 ft.

FINDS:

Registry ID: 110024410216

Environmental Interest/Information System

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

SCOTT AVENUE FACILITY (Continued) **1009324624**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

V386 **HMIRS** **95110786**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 23 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V387 **HMIRS** **9999020352**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 24 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

V388 **P-I-E NATIONWIDE INC VACANT TRUCK TERM** **UST** **U000393636**
WSW **500 SCOTT AVE** **HIST UST** **N/A**
< 1/8 **BROOKLYN, NY 11222**
0.104 mi.
550 ft. **Site 25 of 30 in cluster V**

Relative:
Higher

Actual:
13 ft.

UST:

Facility Id:	2-034738
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	590341.38303000003
UTM Y:	4509045.7725200001

Affiliation Records:

Site Id:	296
Affiliation Type:	Owner
Company Name:	JOHN KNICK REALTY CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	25 SOUTH SERVICE RD
Address2:	Not reported
City:	JERICHO
State:	NY
Zip Code:	11756
Country Code:	001
Phone:	(516) 997-4100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported

P-I-E NATIONWIDE INC VACANT TRUCK TERM (Continued) **U000393636**

Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	296
Affiliation Type:	Mail Contact
Company Name:	JOHN KNICK REALTY CORP
Contact Type:	Not reported
Contact Name:	FRED J. CIRILLO
Address1:	25 SOUTH SERVICE RD
Address2:	Not reported
City:	JERICHO
State:	NY
Zip Code:	11756
Country Code:	001
Phone:	(516) 997-4100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	296
Affiliation Type:	On-Site Operator
Company Name:	P-I-E NATIONWIDE INC VACANT TRUCK TERM
Contact Type:	Not reported
Contact Name:	P-I-E NATIONWIDE INC
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 782-4266
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	296
Affiliation Type:	Emergency Contact
Company Name:	JOHN KNICK REALTY CORP
Contact Type:	Not reported
Contact Name:	MARTIN FABIAN/TERMINAL MANAGER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 782-4266
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

P-I-E NATIONWIDE INC VACANT TRUCK TERM (Continued) **U000393636**

Equipment Records:

C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
I00 - Overfill - None
J02 - Dispenser - Suction
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
I00 - Overfill - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
C00 - Pipe Location - No Piping
D00 - Pipe Type - No Piping
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D00 - Pipe Type - No Piping
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
I00 - Overfill - None

Tank Info:

Site ID:	296
Tank Number:	001
Tank ID:	924
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

P-I-E NATIONWIDE INC VACANT TRUCK TERM (Continued) **U000393636**

Site ID:	296
Tank Number:	002
Tank ID:	925
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	296
Tank Number:	003
Tank ID:	926
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	296
Tank Number:	004
Tank ID:	927
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

P-I-E NATIONWIDE INC VACANT TRUCK TERM (Continued) **U000393636**

HIST UST:

PBS Number:	2-034738
SPDES Number:	Not reported
Emergency Contact:	MARTIN FABIAN/TERMINAL MANAGER
Emergency Telephone:	(718) 782-4266
Operator:	P-I-E NATIONWIDE INC
Operator Telephone:	(718) 782-4266
Owner Name:	JOHN KNICK REALTY CORP
Owner Address:	25 SOUTH SERVICE RD
Owner City,St,Zip:	JERICHO, NY 11756
Owner Telephone:	(516) 997-4100
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	JOHN KNICK REALTY CORP
Mailing Address:	25 SOUTH SERVICE RD
Mailing Address 2:	Not reported
Mailing City,St,Zip:	JERICHO, NY 11756
Mailing Contact:	FRED J. CIRILLO
Mailing Telephone:	(516) 997-4100
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	500 SCOTT AVE
SWIS ID:	6101
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	12/02/1986
Expiration Date:	12/02/1991
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	61
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported

P-I-E NATIONWIDE INC VACANT TRUCK TERM (Continued) **U000393636**

Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported

P-I-E NATIONWIDE INC VACANT TRUCK TERM (Continued) **U000393636**

Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

V389 **HMIRS** **92110099**
WSW **500 SCOTT AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.104 mi.
550 ft. **Site 26 of 30 in cluster V**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

W390
SE
< 1/8
0.105 mi.
554 ft.

SAMJIN AMERRICA INC.
49-01 MASPETH AVE.
MASPETH, NY 11378

Site 2 of 9 in cluster W

FINDS **1004566006**
N/A

Relative:
Higher

Actual:
12 ft.

FINDS:

Registry ID: 110011485419

Environmental Interest/Information System

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

W391
SE
< 1/8
0.105 mi.
554 ft.

WALLACE PACKAGING CORP
57-01 49TH ST
MASPETH, NY 11378

Site 3 of 9 in cluster W

HIST UST **U003074368**
AST **N/A**
HIST AST

Relative:
Higher

Actual:
12 ft.

HIST UST:

PBS Number:	2-189758
SPDES Number:	Not reported
Emergency Contact:	JONATHAN ALLEN
Emergency Telephone:	(516) 365-3458
Operator:	JEAN W ALLEN
Operator Telephone:	(718) 386-1881
Owner Name:	JEAN W ALLEN
Owner Address:	28 WILTON RD
Owner City,St,Zip:	HUNTINGTON, NY 11743
Owner Telephone:	(516) 692-6043
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	WALLACE PACKAKING CORPORATION
Mailing Address:	59-01 49TH STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	SUPER FACILITY MANAGER
Mailing Telephone:	(718) 386-1881
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	57001 49TH ST
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	09/02/1998
Expiration Date:	06/05/2002
Renew Flag:	False
Renewal Date:	Not reported

WALLACE PACKAGING CORP (Continued) **U003074368**

Total Capacity: 3080
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 63
Town or City: 01
Region: 2

Tank Id: 00A
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 06/01/1989
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 00B
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported

WALLACE PACKAGING CORP (Continued) **U003074368**

Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-189758
Program Type: PBS
UTM X: 591225.14289000002
UTM Y: 4508759.5218900004
Expiration Date: 2008/01/27

Affiliation Records:
Site Id: 5816
Affiliation Type: Mail Contact
Company Name: MARYLU, LLC
Contact Type: Not reported
Contact Name: MR. LOUIS TODARO
Address1: 57-01 49TH PLACE
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (212) 532-0633
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 5816
Affiliation Type: On-Site Operator
Company Name: MARYLU, LLC
Contact Type: Not reported
Contact Name: MR. LOUIS TODARO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 532-0633
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 5816
Affiliation Type: Emergency Contact

WALLACE PACKAGING CORP (Continued) **U003074368**

Company Name:	MARYLU, LLC
Contact Type:	Not reported
Contact Name:	MR. LOUIS TODARO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(212) 532-0633
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	5816
Affiliation Type:	Owner
Company Name:	MARYLU, LLC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	57-01 49TH PLACE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(212) 532-0633
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

H99 - Tank Leak Detection - Other
L09 - Piping Leak Detection - Exempt Suction Piping
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)
C01 - Pipe Location - Aboveground
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction

Tank Info:

WALLACE PACKAGING CORP (Continued) **U003074368**

Tank Number:	10A
Tank Id:	6447
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	11/1/1989
Capacity Gallons:	2000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST AST:

PBS Number:	2-189758
SWIS Code:	6301
Operator:	JEAN W ALLEN
Facility Phone:	(718) 386-1881
Facility Addr2:	57001 49TH ST
Facility Type:	MANUFACTURING
Emergency:	JONATHAN ALLEN
Emergency Tel:	(516) 365-3458
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	JEAN W ALLEN
Owner Address:	28 WILTON RD
Owner City,St,Zip:	HUNTINGTON, NY 11743
Federal ID:	Not reported
Owner Tel:	(516) 692-6043
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	SUPER FACILITY MANAGER
Mailing Name:	WALLACE PACKAKING CORPORATION
Mailing Address:	59-01 49TH STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Telephone:	(718) 386-1881
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	False
Certification Date:	09/02/1998
Expiration:	06/05/2002
Renew Flag:	False
Renew Date:	Not reported
Total Capacity:	3080
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing

WALLACE PACKAGING CORP (Continued) **U003074368**

Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 63
Town or City Code: 01
Region: 2

Tank ID: 10A
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: 19891101
Capacity (Gal): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 9
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

Tank ID: 10B
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: 19891101
Capacity (Gal): 1080
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 9
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1996
Test Method: Not reported

WALLACE PACKAGING CORP (Continued) **U003074368**

Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

W392 **WALLACE PACKAGING CORP** **LTANKS** **S100346425**
SE **57-01 49TH ST** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY**
0.105 mi.
554 ft. **Site 4 of 9 in cluster W**

Relative:
Higher

Actual:
12 ft.

LTANKS:

Site ID:	255186
Spill No:	8904556
Spill Date:	8/7/1989
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Spill Closed Dt:	3/25/1991
Facility Addr2:	Not reported
Cleanup Ceased:	3/25/1991
Cleanup Meets Standard:	True
SWIS:	4101
Investigator:	O'DOWD
Referred To:	Not reported
Reported to Dept:	8/8/1989
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	9/1/1989
Spill Record Last Update:	3/29/2004
Spiller Name:	Not reported
Spiller Company:	MID-COUNTY MECHANICAL
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	209012
Remarks:	5K TK FAILED HORNER-EZY. L R = -0.088 GPH. WILL DISCUSS OPTIONS. NO ACTION AT THIS TIME.

Material:

Site ID:	255186
Operable Unit ID:	929812
Operable Unit:	01
Material ID:	448601
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum

WALLACE PACKAGING CORP (Continued) **S100346425**

Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 255186
Spill Tank Test: 1535808
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:
Region of Spill: 2
Spill Number: 8904556
Spill Date: 08/07/1989
Spill Time: 15:30
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Not reported
Spill Closed Dt: 03/25/91
Cleanup Ceased: 03/25/91
Cleanup Meets Standard: True
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 08/08/89
Reported to Department Time: 08:15
SWIS: 63
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: MID-COUNTY MECHANICAL
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 847-1800
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-189758

WALLACE PACKAGING CORP (Continued) **S100346425**

Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 09/01/89
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/25/91
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: 03/25/91: SUBMITTED TWO SAMPLES OF GROUNDWATER, BOTH CAME UP CLEAN.
Spill Cause: 5K TK FAILED HORNER-EZY. L R = -0.088 GPH. WILL DISCUSS OPTIONS. NO ACTION AT THIS TIME.

X393 **MANHOLE # 10106** **NY Spills** **S106469978**
ENE **58TH ST / 56 ROAD** **N/A**
< 1/8 **QUEENS, NY**
0.105 mi.
557 ft. **Site 2 of 12 in cluster X**

Relative:
Higher

Actual:
27 ft.

NY Spills:
Site ID: 260718
Facility Addr2: Not reported
Facility ID: 0402748
Spill Number: 0402748
Facility Type: ER
SWIS: 4101
Investigator: JHOCONNE
Referred To: Not reported
Spill Date: 6/12/2004
Reported to Dept: 6/12/2004
CID: 27
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Local Agency

MANHOLE # 10106 (Continued) **S106469978**

Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/21/2004
Remediation Phase:	0
Date Entered In Computer:	6/12/2004
Spill Record Last Update:	9/21/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	212931
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL" e2mis no. 153813: APPROX. 1/2 PINT UNKNOWN OIL ON FLOOR OF MH-10106. CLEANUP TO BE DONE AS 50-499 PPM DUE TO FAULT ON FEEDER LOCATED IN THIS MANHOLE. FOD TO REMAIN ON LOCATION PENDING ARRIVAL OF ENV. OPS. CREWS. LAB SEQ # 04-04582 PCB 109 PPM. ENVIR OPPS REPORTS FOUND EARTHEN SUMP IN STRUCTURE. Update 6/12/04 14:00hrs. Structure was washed with 20 gallons of bio-gen 760, 5 gallons of 715 sludge softener and 10 gallons of safe wash (bulldog detergent). An earthen sump was found. Two sump samples were taken; one from the bottom of sump and one from the wall of the sump. LSN 04-04590: Wall - 3 ppm; bottom - 4 ppm SUMP WERE CLEANED & CEMENTED ON 6/12.
Remarks:	Callers reports 1/2 pint unk spill in a clay bottom manhole. No clean up as of yet. Con ED employees will be doing the cleanup.

Material:

Site ID:	260718
Operable Unit ID:	886360
Operable Unit:	01
Material ID:	490364
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported

MANHOLE # 10106 (Continued) **S106469978**

Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

V394 **SPIRAL METAL CO INC** **RCRA-NonGen** **1000353320**
WSW **497 SCOTT AVE** **FINDS** **NYD080447469**
< 1/8 **BROOKLYN, NY 11222**
0.106 mi.
560 ft. **Site 27 of 30 in cluster V**

Relative:
Higher

Actual:
13 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: SPIRAL METAL CO INC
Facility address: 497 SCOTT AVE
BROOKLYN, NY 11222
EPA ID: NYD080447469
Mailing address: SCOTT AVE
BROOKLYN, NY 11222
Contact: Not reported
Contact address: SCOTT AVE
BROOKLYN, NY 11222
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: Not reported
Owner/operator address: OWNERSTREET
OWNERCITY, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: OPERNAME
Owner/operator address: OPERSTREET
OPERCITY, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No

SPIRAL METAL CO INC (Continued) **1000353320**

Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: SPIRAL METAL CO INC
Classification: Not a generator, verified

Date form received by agency: 09/25/1999
Facility name: SPIRAL METAL CO INC
Classification: Not a generator, verified

Date form received by agency: 11/19/1980
Facility name: SPIRAL METAL CO INC
Classification: Not a generator, verified

Date form received by agency: 07/24/1980
Facility name: SPIRAL METAL CO INC
Classification: Not a generator, verified

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/05/1985
Date achieved compliance: 04/24/1987
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 11/18/1985
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 0
Final penalty amount: 0
Paid penalty amount: 0

Evaluation Action Summary:
Evaluation date: 09/23/1999
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 08/05/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 04/24/1987
Evaluation lead agency: State

SPIRAL METAL CO INC (Continued) **1000353320**

FINDS:

Registry ID: 110004371135

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Z395 **1 RAILROAD PL/QUEENS** **LTANKS** **S100145819**
SSW **1 RAILROAD PLACE** **HIST LTANKS** **N/A**
< 1/8 **NEW YORK CITY, NY**
0.106 mi.
560 ft. **Site 1 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

LTANKS:

Site ID:	228223
Spill No:	8910221
Spill Date:	1/24/1990
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/4/2003
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	ADMIN. CLOSED
Referred To:	Not reported
Reported to Dept:	1/24/1990
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1/26/1990
Spill Record Last Update:	3/4/2003
Spiller Name:	Not reported
Spiller Company:	INTERSTATE EXPRESS
Spiller Address:	1 RAILROAD PLACE
Spiller City,St,Zip:	QUEENS, NY
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	188261
Remarks:	15K TANK FAILED PETRO TITE, UNABLE TO HOLD PRODUCT , WILL EXCAVATE, ISOLATE & RETEST, PRODUCT BELOW FILL LINE. CLOSED DUE TO LACK OF ANY RECENT INFO - DOES NOT MEET ANY CLEANUP REQUIREMENTS.

1 RAILROAD PL/QUEENS (Continued) **S100145819**

Material:

Site ID:	228223
Operable Unit ID:	935302
Operable Unit:	01
Material ID:	443337
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	228223
Spill Tank Test:	1536721
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/1/2004
Test Method:	Unknown

HIST LTANKS:

Region of Spill:	2
Spill Number:	8910221
Spill Date:	01/24/1990
Spill Time:	16:05
Spill Cause:	Tank Test Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Investigator:	SULLIVAN
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	01/24/90
Reported to Department Time:	17:05
SWIS:	63
Spiller Contact:	Not reported
Spiller Phone:	Not reported

1 RAILROAD PL/QUEENS (Continued) **S100145819**

Spiller Extention: Not reported
Spiller Name: INTERSTATE EXPRESS
Spiller Address: 1 RAILROAD PLACE
Spiller City,St,Zip: QUEENS, NY
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 456-8788
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-602925
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/26/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/18/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: 15K TANK FAILED PETRO TITE, UNABLE TO HOLD PRODUCT , WILL EXCAVATE, ISOLATE RETEST, PRODUCT BELOW FILL LINE.

X396 **WONDER INTERNATIONAL TRAI** **NY Spills** **S109060144**
ENE **56-45 58TH STREET** **N/A**
< 1/8 **MASPETH, NY**
0.108 mi.
568 ft. **Site 3 of 12 in cluster X**

Relative:
Higher

Actual:
27 ft.

NY Spills:
Site ID: 394325
Facility Addr2: Not reported
Facility ID: 0712672
Spill Number: 0712672
Facility Type: ER

WONDER INTERNATIONAL TRAI (Continued) **S109060144**

SWIS:	4101
Investigator:	smsanges
Referred To:	Not reported
Spill Date:	3/3/2008
Reported to Dept:	3/3/2008
CID:	408
Spill Cause:	Other
Water Affected:	DRAIN
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/6/2008
Remediation Phase:	0
Date Entered In Computer:	3/3/2008
Spill Record Last Update:	3/6/2008
Spiller Name:	Not reported
Spiller Company:	WONDER INTERNATIONAL TRAI
Spiller Address:	56-45 58TH STREET
Spiller City,St,Zip:	MASPETH, NY 11378
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	(917) 371-9914
DEC Region:	2
DER Facility ID:	343890
DEC Memo:	This spill is closed - it is a duplicate to spill #0712659
Remarks:	PETRO WENT TO BUSINESS TO OPEN NEW ACCOUNT AND FOUND THAT SOMEONE HAD POURED OIL DOWN THE DRAIN ; WHERE THE DRAIN GOES AND HOW MUCH WAS POURED DOWN IT ARE UNKOWN; NO CLEAN UP WAS REALLY POSSIBLE;

Material:

Site ID:	394325
Operable Unit ID:	1151275
Operable Unit:	01
Material ID:	2141973
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported

WONDER INTERNATIONAL TRAI (Continued) **S109060144**

Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

397
North
< 1/8
0.111 mi.
584 ft.

57-65 48TH ST/CANOVER IND **NY Spills** **S102145389**
57-65 48TH STREET **NY Hist Spills** **N/A**
NEW YORK CITY, NY

Relative:
Higher

Actual:
50 ft.

NY Spills:

Site ID:	162012
Facility Addr2:	Not reported
Facility ID:	8902940
Spill Number:	8902940
Facility Type:	ER
SWIS:	4101
Investigator:	FINGER
Referred To:	Not reported
Spill Date:	6/21/1989
Reported to Dept:	6/21/1989
CID:	Not reported
Spill Cause:	Human Error
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	6/21/1989
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Not reported
Spill Closed Dt:	6/21/1989
Remediation Phase:	0
Date Entered In Computer:	6/23/1989
Spill Record Last Update:	9/30/2004
Spiller Name:	Not reported
Spiller Company:	CANOVER INDUSTRIES
Spiller Address:	57-65 48TH STREET
Spiller City,St,Zip:	MASPETH, NY 11378
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	136754
DEC Memo:	Not reported
Remarks:	STRUCK LINE TO OVERHEAD HEATER, NYCFD #28 ON SCENE, SORBENT MATERIAL USED & STORED IN DRUM FOR PROPER DISPOSAL, CLEAN UP COMPLETED.

Material:

Site ID:	162012
Operable Unit ID:	928495
Operable Unit:	01
Material ID:	565072
Material Code:	0001
Material Name:	#2 Fuel Oil

57-65 48TH ST/CANOVER IND (Continued) **S102145389**

Case No.: Not reported
Material FA: Petroleum
Quantity: 10
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 8902940
Investigator: FINGER
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/21/1989 10:30
Reported to Dept Date/Time: 06/21/89 11:57
SWIS: 63
Spiller Name: CANOVER INDUSTRIES
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: 57-65 48TH STREET
Spiller City,St,Zip: MASPETH, NY 11378
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 06/21/89
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 06/21/89
Corrective Action Plan Submitted: / /

57-65 48TH ST/CANOVER IND (Continued) **S102145389**

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/23/89
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 10
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: STRUCK LINE TO OVERHEAD HEATER, NYCFD 28 ON SCENE, SORBENT MATERIAL USED STORED IN DRUM FOR PROPER DISPOSAL, CLEAN UP COMPLETED.

X398 **ROSENTHOL WINE** **UST** **U004048176**
ENE **56-43 58TH STREET** **N/A**
< 1/8 **MASPETH, NY 11378**
0.111 mi.
588 ft. **Site 4 of 12 in cluster X**

Relative:
Higher

Actual:
27 ft.

UST:
Facility Id: 2-609990
Region: STATE
DEC Region: 2
Site Status: Unregulated
Program Type: PBS
Expiration Date: N/A
UTM X: 591831.41391
UTM Y: 4508672.7453800002

Affiliation Records:
Site Id: 350017
Affiliation Type: On-Site Operator
Company Name: ROSENTHOL WINE
Contact Type: Not reported
Contact Name: JOE CIAMPA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 939-4888

ROSENTHOL WINE (Continued) **U004048176**

Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	KXTANG
Date Last Modified:	7/27/2005

Site Id:	350017
Affiliation Type:	Owner
Company Name:	JOE CIAMPA
Contact Type:	ACCOUTING SUPERVISOR
Contact Name:	CAROLYN VENTI
Address1:	136-28 37TH AVE
Address2:	Not reported
City:	FLUSHING
State:	NY
Zip Code:	11354
Country Code:	001
Phone:	(718) 939-48888
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	KXTANG
Date Last Modified:	7/27/2005

Site Id:	350017
Affiliation Type:	Mail Contact
Company Name:	IMPACT ENVIRONMENTAL
Contact Type:	Not reported
Contact Name:	CAROLYN VENTI
Address1:	170 KEYLAND COURT
Address2:	Not reported
City:	BOHEMIA
State:	NY
Zip Code:	11716
Country Code:	001
Phone:	(631) 269-1599
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	KXTANG
Date Last Modified:	7/27/2005

Site Id:	350017
Affiliation Type:	Emergency Contact
Company Name:	JOE CIAMPA
Contact Type:	Not reported
Contact Name:	JOE CIAMPA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 939-4888
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported

ROSENTHOL WINE (Continued) **U004048176**

Modified By: KXTANG
Date Last Modified: 7/27/2005

Equipment Records:

L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
B03 - Tank External Protection - Original Impressed Current
H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
E00 - Piping Secondary Containment - None
F03 - Pipe External Protection - Original Impressed Current
F00 - Pipe External Protection - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
I02 - Overfill - High Level Alarm
J00 - Dispenser - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
H05 - Tank Leak Detection - In-Tank System (ATG)
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
E00 - Piping Secondary Containment - None
I00 - Overfill - None
K00 - Spill Prevention - None

Tank Info:

Site ID: 350017

Tank Number: 1
Tank ID: 207373
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 11/1/1981
Capacity Gallons: 4000
Tightness Test Method: 00
Next Test Date: Not reported
Date Tank Closed: 10/26/2006
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 3/29/2007

Site ID: 350017

Tank Number: 2
Tank ID: 216576
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/11/1973

ROSENTHOL WINE (Continued) **U004048176**

Capacity Gallons:	1080
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/26/2006
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	3/29/2007

X399 **SCHEDULED TRUCKING** **HIST UST** **U001841414**
ENE **58-75 MAURICE AVENUE** **N/A**
< 1/8 **QUEENS, NY 11378**
0.112 mi.
593 ft. **Site 5 of 12 in cluster X**

Relative:
Higher

Actual:
30 ft.

HIST UST:

PBS Number:	2-600360
SPDES Number:	Not reported
Emergency Contact:	JIM MENNECKE
Emergency Telephone:	(212) 270-9006
Operator:	PAT MORTORANA
Operator Telephone:	(212) 270-9006
Owner Name:	MANUFACTURERS HANOVER TRUST CO AS TRUSTEE U/W/F
Owner Address:	GEORGE HEBENSTREIT- 270 PARK AVE-20 FL
Owner City,St,Zip:	NEW YORK, NY 10017
Owner Telephone:	(212) 270-9006
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	MANUFACTURERS HANOVER TRUST CO
Mailing Address:	270 PARK AVENUE-20TH FLOOR
Mailing Address 2:	Not reported
Mailing City,St,Zip:	NEW YORK, NY 10017
Mailing Contact:	MR. JIM MENNECKE
Mailing Telephone:	(212) 270-9006
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	58075 MAURICE AVENUE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	10/09/1991
Expiration Date:	10/03/1996
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False

SCHEDULED TRUCKING (Continued) **U001841414**

CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 63
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19770901
Capacity (gals): 550
Product Stored: EMPTY
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 09/01/1977
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19560501
Capacity (gals): 550
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 09/01/1977
Test Method: Not reported
Deleted: False
Updated: True

SCHEDULED TRUCKING (Continued) **U001841414**

Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19560501
Capacity (gals): 550
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 09/01/1977
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19560501
Capacity (gals): 550
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 09/01/1977
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

SCHEDULED TRUCKING (Continued) **U001841414**

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19560501
Capacity (gals):	550
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	None
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	09/01/1977
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19560501
Capacity (gals):	550
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	None
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	09/01/1977
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

X400 **58-75 MAURICE AVE** **AST** **A100293121**
ENE **58-75 MAURICE AVENUE** **N/A**
< 1/8 **MASPETH, NY 11378**
0.112 mi.
593 ft. **Site 6 of 12 in cluster X**

Relative:
Higher

Actual:
30 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-600360
Program Type:	PBS
UTM X:	592040.05558000004
UTM Y:	4508821.7729900004
Expiration Date:	2012/06/07

Affiliation Records:

Site Id:	22343
Affiliation Type:	Owner
Company Name:	ATLANTIC PARATRANS OF NYC INC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	7 NORTH STREET
Address2:	Not reported
City:	STATEN ISLAND
State:	NY
Zip Code:	10302
Country Code:	001
Phone:	(718) 442-9100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	3/10/2011

Site Id:	22343
Affiliation Type:	Emergency Contact
Company Name:	ATLANTIC PARATRANS OF NYC INC
Contact Type:	Not reported
Contact Name:	JOHN DOZIS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(917) 440-6215
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/16/2004

Site Id:	22343
Affiliation Type:	Mail Contact
Company Name:	ATLANTIC EXPRESS
Contact Type:	Not reported
Contact Name:	WILLIAM B. MC VEIGH
Address1:	46-81 METROPOLITAN AVENUE
Address2:	Not reported

58-75 MAURICE AVE (Continued) **A100293121**

City:	RIDGEWOOD
State:	NY
Zip Code:	11385
Country Code:	001
Phone:	(718) 416-7620
Phone Ext:	Not reported
Email:	BMCVEIGH@ABTG.NET
Fax Number:	Not reported
Modified By:	DXLIVING
Date Last Modified:	4/30/2007

Site Id:	22343
Affiliation Type:	On-Site Operator
Company Name:	ATLANTIC PARATRANS OF NYC, INC.
Contact Type:	Not reported
Contact Name:	JOHN DOZIS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 326-8402
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/16/2004

Equipment Records:

G09 - Tank Secondary Containment - Modified Double-Walled (Aboveground)
G09 - Tank Secondary Containment - Modified Double-Walled (Aboveground)
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
B05 - Tank External Protection - Jacketed
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)
B01 - Tank External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
G03 - Tank Secondary Containment - Vault (w/o access)
D02 - Pipe Type - Galvanized Steel
J00 - Dispenser - None
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
G03 - Tank Secondary Containment - Vault (w/o access)
J00 - Dispenser - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
J00 - Dispenser - None

58-75 MAURICE AVE (Continued) **A100293121**

A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
I00 - Overfill - None
I00 - Overfill - None
D10 - Pipe Type - Copper
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J00 - Dispenser - None
E09 - Piping Secondary Containment - Modified Double-Walled (Aboveground)
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
I00 - Overfill - None
J00 - Dispenser - None
I04 - Overfill - Product Level Gauge (A/G)
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
D10 - Pipe Type - Copper
F00 - Pipe External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
G03 - Tank Secondary Containment - Vault (w/o access)
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
C01 - Pipe Location - Aboveground
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
J00 - Dispenser - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
B99 - Tank External Protection - Other
I00 - Overfill - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
I02 - Overfill - High Level Alarm
K00 - Spill Prevention - None
E09 - Piping Secondary Containment - Modified Double-Walled (Aboveground)
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
C02 - Pipe Location - Underground/On-ground
B01 - Tank External Protection - Painted/Asphalt Coating

58-75 MAURICE AVE (Continued) **A100293121**

F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None

Tank Info:

Tank Number:	001
Tank Id:	170461
Tank Location:	3
Tank Type:	Equivalent Technology
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/2002
Capacity Gallons:	8000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DXLIVING
Last Modified:	4/30/2007

Tank Number:	OO2
Tank Id:	181149
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/2003
Capacity Gallons:	500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	12/16/2004

Tank Number:	OO3
Tank Id:	181150
Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/2003
Capacity Gallons:	275
Tightness Test Method:	NN

58-75 MAURICE AVE (Continued) **A100293121**

Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DXLIVING
Last Modified:	4/30/2007

X401 **58-75 MAURICE AVE** **UST** **U004078030**
ENE **58-75 MAURICE AVENUE** **N/A**
< 1/8 **MASPETH, NY 11378**
0.112 mi.
593 ft. **Site 7 of 12 in cluster X**

Relative:
Higher

Actual:
30 ft.

UST:

Facility Id:	2-600360
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2012/06/07
UTM X:	592040.05558000004
UTM Y:	4508821.7729900004

Affiliation Records:

Site Id:	22343
Affiliation Type:	Owner
Company Name:	ATLANTIC PARATRANS OF NYC INC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	7 NORTH STREET
Address2:	Not reported
City:	STATEN ISLAND
State:	NY
Zip Code:	10302
Country Code:	001
Phone:	(718) 442-9100
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	3/10/2011

Site Id:	22343
Affiliation Type:	Emergency Contact
Company Name:	ATLANTIC PARATRANS OF NYC INC
Contact Type:	Not reported
Contact Name:	JOHN DOZIS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(917) 440-6215
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR

58-75 MAURICE AVE (Continued) **U004078030**

Date Last Modified: 12/16/2004

Site Id: 22343
Affiliation Type: Mail Contact
Company Name: ATLANTIC EXPRESS
Contact Type: Not reported
Contact Name: WILLIAM B. MC VEIGH
Address1: 46-81 METROPOLITAN AVENUE
Address2: Not reported
City: RIDGEWOOD
State: NY
Zip Code: 11385
Country Code: 001
Phone: (718) 416-7620
Phone Ext: Not reported
Email: BMCVEIGH@ABTG.NET
Fax Number: Not reported
Modified By: DXLIVING
Date Last Modified: 4/30/2007

Site Id: 22343
Affiliation Type: On-Site Operator
Company Name: ATLANTIC PARATRANS OF NYC, INC.
Contact Type: Not reported
Contact Name: JOHN DOZIS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 326-8402
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 12/16/2004

Equipment Records:

G09 - Tank Secondary Containment - Modified Double-Walled (Aboveground)
G09 - Tank Secondary Containment - Modified Double-Walled (Aboveground)
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
B05 - Tank External Protection - Jacketed
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)
B01 - Tank External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
G03 - Tank Secondary Containment - Vault (w/o access)
D02 - Pipe Type - Galvanized Steel
J00 - Dispenser - None
A00 - Tank Internal Protection - None

58-75 MAURICE AVE (Continued) **U004078030**

C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
G03 - Tank Secondary Containment - Vault (w/o access)
J00 - Dispenser - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
I00 - Overfill - None
I00 - Overfill - None
D10 - Pipe Type - Copper
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J00 - Dispenser - None
E09 - Piping Secondary Containment - Modified Double-Walled (Aboveground)
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
I00 - Overfill - None
J00 - Dispenser - None
I04 - Overfill - Product Level Gauge (A/G)
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
D10 - Pipe Type - Copper
F00 - Pipe External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
G03 - Tank Secondary Containment - Vault (w/o access)
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
C01 - Pipe Location - Aboveground
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
J00 - Dispenser - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
B99 - Tank External Protection - Other
I00 - Overfill - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

58-75 MAURICE AVE (Continued) **U004078030**

F00 - Pipe External Protection - None
I02 - Overfill - High Level Alarm
K00 - Spill Prevention - None
E09 - Piping Secondary Containment - Modified Double-Walled (Aboveground)
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
C02 - Pipe Location - Underground/On-ground
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None

Tank Info:

Site ID:	22343
Tank Number:	001-A
Tank ID:	170462
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	9/1/1977
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/1/1977
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	22343
Tank Number:	002
Tank ID:	42339
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1956
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/1/1977
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

58-75 MAURICE AVE (Continued) **U004078030**

Site ID:	22343
Tank Number:	003
Tank ID:	42340
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1956
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/1/1977
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	22343
Tank Number:	004
Tank ID:	42341
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1956
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/1/1977
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	22343
Tank Number:	005
Tank ID:	42342
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1956
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/1/1977
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

58-75 MAURICE AVE (Continued) **U004078030**

Site ID:	22343
Tank Number:	006
Tank ID:	42343
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1956
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	9/1/1977
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

AA402 **BROOKLYN UNION GAS** **RCRA-NonGen** **1000990354**
WSW **PAGE PL & MASPETH AVE** **FINDS** **NYR000003137**
< 1/8 **QUEENS, NY 11378** **MANIFEST**
0.113 mi.
598 ft. **Site 1 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	BROOKLYN UNION GAS
Facility address:	PAGE PL & MASPETH AVE QUEENS, NY 11378
EPA ID:	NYR000003137
Mailing address:	METROTECH CENTER - 18TH FL BROOKLYN, NY 112013850
Contact:	Not reported
Contact address:	METROTECH CENTER - 18TH FL BROOKLYN, NY 112013850
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	BROOKLYN UNION GAS
Owner/operator address:	ONE METROTECH CENTER - 18TH FL BROOKLYN, NY 11201
Owner/operator country:	US
Owner/operator telephone:	(718) 403-3088
Legal status:	Municipal
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported
Owner/operator name:	BROOKLYN UNION GAS
Owner/operator address:	ONE METROTECH CENTER - 18TH FL BROOKLYN, NY 11201

BROOKLYN UNION GAS (Continued) **1000990354**

Owner/operator country: US
Owner/operator telephone: (718) 403-3088
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: BROOKLYN UNION GAS
Classification: Not a generator, verified

Date form received by agency: 03/18/1996
Facility name: BROOKLYN UNION GAS
Site name: BROOKLYN UNION
Classification: Large Quantity Generator

Date form received by agency: 07/10/1995
Facility name: BROOKLYN UNION GAS
Classification: Not a generator, verified

Date form received by agency: 04/14/1995
Facility name: BROOKLYN UNION GAS
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110009242186

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

BROOKLYN UNION GAS (Continued) **1000990354**

NY MANIFEST:

EPA ID:	NYR000003137
Country:	USA
Mailing Name:	BROOKLYN UNION GAS
Mailing Contact:	AMY CORCORAN
Mailing Address:	ONE METROTECH CTR
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11201
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-403-3286

Document ID:	TXA0826585
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	TX40349
Trans2 State ID:	Not reported
Generator Ship Date:	950613
Trans1 Recv Date:	950613
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950619
Part A Recv Date:	950629
Part B Recv Date:	950725
Generator EPA ID:	NYR000003137
Trans1 EPA ID:	NJD071629976
Trans2 EPA ID:	Not reported
TSDF ID:	TXD055141378
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	00263
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	007
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	95

Document ID:	TXA0578564
Manifest Status:	Completed copy
Trans1 State ID:	TX40349
Trans2 State ID:	Not reported
Generator Ship Date:	950509
Trans1 Recv Date:	950509
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950512
Part A Recv Date:	Not reported
Part B Recv Date:	950530
Generator EPA ID:	NYR000003137
Trans1 EPA ID:	NJD071629976
Trans2 EPA ID:	Not reported
TSDF ID:	TXD055141378
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	00285
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	008

BROOKLYN UNION GAS (Continued) **1000990354**

Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	95

Document ID:	TXA0578565
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	TX40349
Trans2 State ID:	Not reported
Generator Ship Date:	950504
Trans1 Recv Date:	950504
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950512
Part A Recv Date:	Not reported
Part B Recv Date:	950530
Generator EPA ID:	NYR000003137
Trans1 EPA ID:	NJD071629976
Trans2 EPA ID:	Not reported
TSDF ID:	TXD055141378
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	00435
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	008
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00415
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	013
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	95

AA403 **CONSOLIDATED EDISON** **MANIFEST** **S108650784**
WSW **MASPETH AVE & PAGE PL** **N/A**
< 1/8 **QUEENS, NY**
0.114 mi.
601 ft. **Site 2 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

NY MANIFEST:

EPA ID:	NYP004152773
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLYN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	Not reported

CONSOLIDATED EDISON (Continued) **S108650784**

Manifest Status:	Not reported
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	8/9/2007
Trans1 Recv Date:	8/9/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	8/13/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004152773
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	114
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	001030842JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	2007-08-09
Trans1 Recv Date:	2007-08-09
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2007-08-13
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004152773
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	114.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	07

CONSOLIDATED EDISON (Continued) **S108650784**

Manifest Tracking Num:	001030842JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

AB404 **TEMO SALES** **NY Spills** **S104789547**
SSW **57-03 48TH ST** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.116 mi.
613 ft. **Site 1 of 5 in cluster AB**

Relative:
Higher

Actual:
13 ft.

NY Spills:

Site ID:	214580
Facility Addr2:	Not reported
Facility ID:	0007036
Spill Number:	0007036
Facility Type:	ER
SWIS:	4101
Investigator:	WBWELLIN
Referred To:	Not reported
Spill Date:	9/14/2000
Reported to Dept:	9/14/2000
CID:	390
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	11/28/2005
Remediation Phase:	0
Date Entered In Computer:	9/14/2000
Spill Record Last Update:	11/28/2005
Spiller Name:	MARIETTA TEITLER
Spiller Company:	TEMO SALES
Spiller Address:	57-03 48TH ST
Spiller City,St,Zip:	MASPETH, ZZ
Spiller Company:	001
Contact Name:	MARIETTA TEITLER
Contact Phone:	(718) 417-8366
DEC Region:	2
DER Facility ID:	177790
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL C" 03/26/04. Transferred from Sacaccio to Rommel. Followup phone call made on 11/23/05 by Will Welling to Edward Ramowski, Temo

TEMO SALES (Continued) **S104789547**

sales. Awaiting reply. 11/28/2005 Call made by Will Welling to Marietta Teitler. Ms. Tietler had made the initial call in to DEC. She said that a trucker backing up to their loading dock "missed" and ruptured a fuel tank. She called in the spill because otherwise "the trucker was just going to leave." The spill was "on the road." A response was made, the spill was cleaned up, she said. I told her I would close the file.

Remarks: caller reporting spill of fuel on her property

Material:

Site ID:	214580
Operable Unit ID:	827883
Operable Unit:	01
Material ID:	548138
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	0007036
Investigator:	SACCACIO
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	09/14/2000 08:00
Reported to Dept Date/Time:	09/14/00 12:07
SWIS:	63
Spiller Name:	TEMO SALES
Spiller Contact:	MARIETTA TEITLER
Spiller Phone:	(718) 417-8366
Spiller Contact:	MARIETTA TEITLER
Spiller Phone:	(718) 417-8366
Spiller Address:	57-03 48TH ST
Spiller City,St,Zip:	MASPETH

TEMO SALES (Continued) **S104789547**

Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/14/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/18/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: caller reporting spill of fuel on her property

Y405 **MASPETH SUBSTATION** **VCP** **S105464380**
SSE **57-77 RUST STREET** **N/A**
< 1/8 **MASPETH, NY 11378**
0.119 mi.
626 ft. **Site 2 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

VCP:
Program Type: VCP
Site Code: 56944
HW Code: V00326
Site Class: A
SWIS: 4101

MASPETH SUBSTATION (Continued) **S105464380**

Region: 2
Town: New York City
Acres: .500
Date Record Added: 11/30/2000 4:06:00 PM
Date Record Updated: 1/14/2011 1:30:00 PM
Updated By: JHOCONNE
Site Description: The former Maspeth Substation site is located at 57-77 Rust Street in the Maspeth section of the Borough and County of Queens, New York 11378 and denoted as Tax Lot 1 in Block 2676 on the Tax Map of the City of New York, Queens County. The Site is located in a mixed residential and industrial area. There is a one story structure on the site and an open yard. The Site is bordered by 2 story residential homes on the north, by 58th Street on the east, by Rust Street on the west, and by 58th Avenue on the south. The Site was formerly a Con Edison electrical substation which housed transformers and other PCB-containing equipment. Operations ceased in 1988 and the property was sold in 1996. The site is currently owned by M&A Linens and is used for textile storage.
Env Problem: Investigations conducted at the site revealed the presence of petroleum (transformer oil) contaminated with polychlorinated biphenyls (PCBs) in both soil and groundwater. Residual PCB-containing free-phase product was detected in groundwater (approximately 15 to 17 feet below grade). Laboratory analytical data reports the maximum concentration of PCBs (Aroclor 1260) at 328 ppm. An Interim Remedial Measure (IRM) consisting of excavation and removal of PCB-contaminated surface soil took place prior to the sale of the property in 1996. An additional IRM consisting of removal of PCB-contaminated oil from monitoring wells on site began in October 1999 and continued through 2003. Con Edison (the Volunteer) submitted and the Department approved a Remedial Action Work Plan (RAWP) which involves excavation and removal of contaminated soil and groundwater to a depth of up to 30 feet below grade. Implementation of the RAWP began in March 2005. As of this update the on-site soil removal has been completed. In addition, limited excavations have been completed on off-site properties along the north boundary of the site to remove small areas of soil contamination. The Volunteer is preparing FER to be submitted to the Department for review.
Health Problem: Contaminated soil has been excavated and disposed of off-site and remaining contaminated soil lies at depth. The site is completely fenced-off; therefore, human exposure to soil is unlikely. Exposure to groundwater is unlikely since the area is served by public water. Additional investigations are being performed to determine the potential for off-site impacts.

Y406 **CON EDISON - MASPETH FORMER SUBSTATION** **RCRA-LQG** **1004761692**
SSE **57-77 RUST STREET** **PADS** **NYR000089441**
< 1/8 **FLUSHING, NY 11378** **MANIFEST**
0.119 mi.
626 ft. **Site 3 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

RCRA-LQG:
Date form received by agency: 02/21/2008
Facility name: CON EDISON - MASPETH FORMER SUBSTATION
Facility address: 57-77 RUST STREET
FLUSHING, NY 11378
EPA ID: NYR000089441
Mailing address: 4 IRVING PLACE
NEW YORK, NY 10003

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Contact:	FRANKLIN MURRAY
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	(212) 460-2808
Contact email:	MURRAYFR@CONED.COM
EPA Region:	02
Classification:	Large Quantity Generator
Description:	Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	4 IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/2006
Owner/Op end date:	Not reported

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	4 IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	01/01/2006
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2007
Facility name: CON EDISON - MASPETH FORMER SUBSTATION
Classification: Large Quantity Generator

Date form received by agency: 02/21/2006
Facility name: CON EDISON - MASPETH FORMER SUBSTATION
Classification: Large Quantity Generator

Date form received by agency: 02/20/2006
Facility name: CON EDISON - MASPETH FORMER SUBSTATION
Classification: Small Quantity Generator

Date form received by agency: 02/25/2004
Facility name: CON EDISON - MASPETH FORMER SUBSTATION
Site name: CON EDISON - MASPETH FORMER SUBSTATION
Classification: Large Quantity Generator

Date form received by agency: 09/05/2000
Facility name: CON EDISON - MASPETH FORMER SUBSTATION
Site name: CON EDISON AT M & A LINENS
Classification: Small Quantity Generator

Hazardous Waste Summary:
Waste code: B007
Waste name: B007

Violation Status: No violations found

PADS:
EPAID: NYR000089441
Facility name: Con Edison at M & A Linens
Facility Address: 57-77 Rust Street
Maspeth, NY
Facility country: US
Generator: Yes
Storer: No
Transporter: No
Disposer: No
Research facility: No
Smelter: No
Facility owner name: M & A Linens
Contact title: Not reported
Contact name: Eddy Louie
Contact tel: (718)204-4262
Contact extension: Not reported
Mailing address: 31-01 20th Avenue Bldg. #138
Long Island City, NY 11105
Mailing country: US
Cert. title: Not reported
Cert. name: Not reported
Cert. date: 5/29/2001
Date received: 7/3/2001

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

NY MANIFEST:

EPA ID:	NYR000089441
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLIN MURRAY
Mailing Address:	4 IRVING PLACE
Mailing Address 2:	RM 828
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	NYE0617058
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	10/21/2003
Trans1 Recv Date:	10/21/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/21/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	NYD980593636
Trans2 EPA ID:	Not reported
TSDF ID:	46299JM
Waste Code:	B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity:	00136
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	03

Document ID:	NYE0641475
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	05/19/2003
Trans1 Recv Date:	05/19/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/19/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	NYD980593636
Trans2 EPA ID:	Not reported
TSDF ID:	46109JM
Waste Code:	B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity:	00418
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

Document ID: NYE0459279
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 06/20/2003
Trans1 Recv Date: 06/20/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 06/23/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: NYD980593636
Trans2 EPA ID: Not reported
TSDF ID: 46233JM
Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity: 00382
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

Document ID: NYE0459378
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 01/13/2003
Trans1 Recv Date: 01/13/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/13/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: NYD980593636
Trans2 EPA ID: Not reported
TSDF ID: 46299JM
Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity: 00173
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

Document ID: NYE0459414
Manifest Status: Not reported
Trans1 State ID: NYD006982359

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Trans2 State ID: Not reported
Generator Ship Date: 01/27/2003
Trans1 Recv Date: 01/27/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/27/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: NYD980593636
Trans2 EPA ID: Not reported
TSDF ID: 46299JM
Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity: 00245
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

Document ID: NYE1606077
Manifest Status: Not reported
Trans1 State ID: PAD146714878
Trans2 State ID: Not reported
Generator Ship Date: 11/21/2005
Trans1 Recv Date: 11/21/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/23/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: PT2568HPA
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 24685
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DT - Dump trucks
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: Not reported

Document ID: NYE1318509
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 12/19/2003
Trans1 Recv Date: 12/19/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/19/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: NYD980593636

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Trans2 EPA ID: Not reported
TSDF ID: 46110JM
Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity: 00027
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

Document ID: NYE1315053
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 11/21/2003
Trans1 Recv Date: 11/21/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/21/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: NYD980593636
Trans2 EPA ID: Not reported
TSDF ID: 46109JM
Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity: 00064
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

Document ID: NYE1316808
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 07/18/2003
Trans1 Recv Date: 07/18/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/18/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000089441
Trans1 EPA ID: NYD980593636
Trans2 EPA ID: Not reported
TSDF ID: 46233JM
Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity: 00736
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Year:	03
Document ID:	NYE1316979
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	04/18/2003
Trans1 Recv Date:	04/18/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/18/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	NYD980593636
Trans2 EPA ID:	Not reported
TSDF ID:	46299JM
Waste Code:	B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity:	00545
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	03

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/6/2007
Trans1 Recv Date:	3/6/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/7/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	26009
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160454GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/8/2007
Trans1 Recv Date:	3/8/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/9/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	21228
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160459GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/9/2007
Trans1 Recv Date:	3/9/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/12/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Quantity:	20094
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160460GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/9/2007
Trans1 Recv Date:	3/9/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/12/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	22208
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160461GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/13/2007
Trans1 Recv Date:	3/13/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/14/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	22117
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160462GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/13/2007
Trans1 Recv Date:	3/13/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/14/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	21981
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Year:	07
Manifest Tracking Num:	000160463GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/14/2007
Trans1 Recv Date:	3/14/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/15/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	21283
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160464GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/15/2007
Trans1 Recv Date:	3/15/2007

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/16/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	21628
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160465GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/15/2007
Trans1 Recv Date:	3/15/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/16/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	19840
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160466GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N

CON EDISON - MASPETH FORMER SUBSTATION (Continued) **1004761692**

Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD146714878
Trans2 State ID:	Not reported
Generator Ship Date:	3/16/2007
Trans1 Recv Date:	3/16/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	3/19/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000089441
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049836679
Waste Code:	Not reported
Quantity:	19632
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	000160467GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H132

Click this hyperlink while viewing on your computer to access
217 additional NY_MANIFEST: record(s) in the EDR Site Report.

Y407 **CON ED-RUST ST EMER GEN** **FINDS** **1007767059**
SSE **57-77 RUST ST** **N/A**
< 1/8 **QUEENS, NY 11378**
0.119 mi.
626 ft. **Site 4 of 10 in cluster Y**

Relative:
Higher

FINDS:

Registry ID: 110019294896

Actual:
28 ft.

Environmental Interest/Information System

CON ED-RUST ST EMER GEN (Continued) **1007767059**

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Y408 **SUBSTATION** **NY Spills** **S106016231**
SSE **57-77 RUST STREET** **N/A**
< 1/8 **MASPETH, NY 11378**
0.119 mi.
626 ft. **Site 5 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

NY Spills:

Site ID:	265646
Facility Addr2:	Not reported
Facility ID:	0304106
Spill Number:	0304106
Facility Type:	ER
SWIS:	4101
Investigator:	YYWONG
Referred To:	V00326
Spill Date:	7/18/2003
Reported to Dept:	7/18/2003
CID:	365
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	Not Closed
Remediation Phase:	1
Date Entered In Computer:	7/18/2003
Spill Record Last Update:	10/1/2009
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ -
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	57470
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "RODRIGUEZ" e2mis 149369 7/18/03 - Third Party Spill - 1257hrs Frank Casella # 01757 Mech A Transportation reports while at the old Maspeth SS neighbor complained of stain on bluestone which covers a 4' x 10' area of bluestone along the fence line. No fire/smoke involved. Per Barry Cohen, Mgr Remediation, property was sold to Linen Co. No sewers or waterways affected. No sampling necessary. As per D. Duke ERT was advised by Kerry Foley of DEC to input as Third Party Spill and to be followed up at a later date to determine responsible party. Notified CIG S. McKeever @ 1356hrs
Remarks:	stain on bluestone that covers 4' x 10' area - con ed will do the

SUBSTATION (Continued) **S106016231**

clean up - ref #149369

Material:

Site ID:	265646
Operable Unit ID:	871056
Operable Unit:	01
Material ID:	504972
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Y409 **FORMER SUBSTATION** **NY Spills** **S106969257**
SSE **57-77 RUST STREET** **N/A**
< 1/8 **MASPETH, NY 11378**
0.119 mi.
626 ft. **Site 6 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

NY Spills:

Site ID:	348490
Facility Addr2:	Not reported
Facility ID:	0503800
Spill Number:	0503800
Facility Type:	ER
SWIS:	4101
Investigator:	JMKRIMGO
Referred To:	Not reported
Spill Date:	6/29/2005
Reported to Dept:	6/29/2005
CID:	408
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.

FORMER SUBSTATION (Continued) **S106969257**

	Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/18/2009
Remediation Phase:	0
Date Entered In Computer:	6/29/2005
Spill Record Last Update:	9/18/2009
Spiller Name:	Not reported
Spiller Company:	THIRD PARTY SPILL
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ERT DESK MIKE DAUGHTERY
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	57470
DEC Memo:	159491. 29-JUN-2005 15:08 HRS. 3RD PARTY SPILL. CONSTRUCTION MGMT.DEPT. INSPECTOR G.BAEZ EMP# 01664 REPORTS: SUB-CONTRACTOR SKANSKA UNDERPINNING & FOUNDATION INC. (CONTACT PERSON: PROJECT MANAGER TOM TROCHALIDER P# 1- 917-807-6115) DRILLING RIG LEAKED 3oz OF HYDRAULIC FLUID ON TO SOIL OF SUB-STATION & THE CONCRETE OF PRIVATE PROPERTY BORDERING STATION. THE CLEANUP OF PRIVATE PROPERTY IS BEING CLEANED WITH ABSORBENT PADS & SIMPLE GREEN AT THIS TIME. THE SOIL HAS BEEN DUG & REMOVED BY CONTRACTOR WORKING ON SITE. NO WATER. NO SEWERS OR WATERWAYS APPEAR TO BE AFFECTED. THE SPILL IN NOT CONTAINED. THERE IS NO FIRE INVOLVEMENT. NO SMOKE INVOLVEMENT. THERE WERE NO INJURIES RELATED TO THIS INCIDENT. THERE ARE NO INCLEMENT WEATHER CONDITIONS OR HAZARD THAT CONTRIBUTED TO THIS SPILL. OWNER OF SUBSTANCES IS 3rd PARTY CONTRACTOR. C.HOGAN 07511 UPDATE 29-JUN-2005 16:07 HRS. CIG P.MCGUIRE NOTIFIED. C.HOGAN 07511 09/18/09. J.Krimgold reviewed the case and decided to close it.
Remarks:	3 OUNZES OF PRODUCT THAT HIT SOIL AND CONCRETE. SOME OF THE PRODUCT WENT OUTSIDE OF THE SUBSTATION, CONSIDERED PRIVATE PROPERTY. SOIL IN STATION IS CLEANED UP AND THE CONCRETE IS IN PROGRESS. CON ED # 159491

Material:

Site ID:	348490
Operable Unit ID:	1106140
Operable Unit:	01
Material ID:	1968634
Material Code:	0010
Material Name:	Hydraulic Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported

FORMER SUBSTATION (Continued) **S106969257**

Last Modified: Not reported
Test Method: Not reported

Y410 **GLENDALE SUB STATION** **NY Spills** **S106013298**
SSE **57-77 RUST ST** **N/A**
< 1/8 **MASPETH, NY**
0.119 mi.
626 ft. **Site 7 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

NY Spills:

Site ID:	265645
Facility Addr2:	Not reported
Facility ID:	0300684
Spill Number:	0300684
Facility Type:	ER
SWIS:	4101
Investigator:	AERODRIG
Referred To:	Not reported
Spill Date:	4/18/2003
Reported to Dept:	4/18/2003
CID:	322
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	6/13/2003
Remediation Phase:	0
Date Entered In Computer:	4/18/2003
Spill Record Last Update:	3/29/2004
Spiller Name:	Not reported
Spiller Company:	CON ED
Spiller Address:	128 WEST END AVE
Spiller City,St,Zip:	MANHATTAN, NY
Spiller Company:	001
Contact Name:	ANDREW MORRIS
Contact Phone:	(212) 580-6763
DEC Region:	2
DER Facility ID:	216453
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "RODRIGUEZ" 6/13/03 Arakhan and Foley inspected substation. Cap bank #2 appeared to have a stain on the concrete underneath the C phase cable. Con Ed explained that they have powerwashed and cannot remove stain. Leak was due to extreme heat conditions.(KMF) E2MIS 147986 4-18-03 1600 HRS F. MUELLER # 05426 SSO AT GLENDALE SUB. STA. 57-77 RUST ST AT CAT BANK # 2 (IN HOUSE) "C" PHASE POTHEAD (CABLE) LEAKED APPROX 1 PINT CABLE OIL ONTO CONCRETE PAD UNDER POTHEAD. THEY WILL START CLEANUP AS 50-499 PPM OF CONCRETE PAD AND PUT CLEANUP MATERIAL IN OVER 50 PPM DRUM. THEY WILL HAVE CHEM LAB COME TO LOCATION TO TAKE SAMPLE OF OIL FROM (SOURCE) "C" PHASE POTHEAD SO WHEN THEY MAKE (UG SPLICING CREW) PERM REPAIRS TO POTHEAD THEY WILL DO REST OF

GLENDALE SUB STATION (Continued) **S106013298**

CLEANUP AS PER SAMPLE RESULTS. THERE WAS NO FIRE OR SMOKE AT THIS LOCATION DUE TO THIS OIL. NO PRIVATE PROPERTY AFFECTED. NO INJURIES. NO SEWERS OR WATERWAYS AFFECTED. THEY PLACED PLASTIC TARP UNDER POTHEAD FOR PROTECTION OF ANY FURTHER SPILL. THEY PLACED E.S.TAG # 043-0016. THEY WILL LEAVE TAG IN PLACED UNTILL "C" PHASE POTHEAD IS REPAIRED. SAMPLE TO BE TAKEN AND CHAIN OF CUSTODY PAPER TO BE DONE BY CHEM LAB.

Remarks: spill from capacitor bank #2(c phase potheat) - spill being cleaned up at this time con ed #147986

Material:

Site ID:	265645
Operable Unit ID:	868879
Operable Unit:	01
Material ID:	508760
Material Code:	0020A
Material Name:	TRANSFORMER OIL
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Y411 **R.A.W. TIRES INC.** **SWF/LF** **S105912838**
SSE **57-77 RUST STREET** **N/A**
< 1/8 **MASPETH, NY 11378**
0.119 mi.
626 ft. **Site 8 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

SWF/LF:

Flag:	INACTIVE
Region Code:	2
Phone Number:	7184178111
Owner Name:	Not reported
Owner Type:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	EFRAIM STERN
Contact Address:	Not reported
Contact Addr2:	Not reported

R.A.W. TIRES INC. (Continued) **S105912838**

Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Waste tire storage - Regulated
Activity Number:	[41KA0]
Active:	No
East Coordinate:	Not reported
North Coordinate:	Not reported
Accuracy Code:	Not reported
Regulatory Status:	Not reported
Waste Type:	Not reported
Authorization #:	None
Authorization Date:	Not reported
Expiration Date:	Not reported

Y412 **MASPETH SUBSTATION** **NY Spills** **S104786935**
SSE **57-77 RUST AVE** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.119 mi.
630 ft. **Site 9 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

NY Spills:

Site ID:	265644
Facility Addr2:	Not reported
Facility ID:	0004153
Spill Number:	0004153
Facility Type:	ER
SWIS:	4101
Investigator:	JHOCONNE
Referred To:	Not reported
Spill Date:	6/28/2000
Reported to Dept:	7/6/2000
CID:	207
Spill Cause:	Abandoned Drums
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Citizen
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	7/7/2000
Remediation Phase:	0
Date Entered In Computer:	7/6/2000
Spill Record Last Update:	7/10/2000
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spiller Company:	Not reported
Contact Name:	MIKE VOLPE
Contact Phone:	(718) 366-1834
DEC Region:	2
DER Facility ID:	216453
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was

MASPETH SUBSTATION (Continued) **S104786935**

"O'CONNELL" 2 drums of investigation derived waste - properly labeled - left on-site for pick up by Con Ed corporate transportation. Neighbor noticed drums and called Community Board. Drums were picked up on Friday 7/7/00. Called Mike Volpe - told him that drums had been removed.

Remarks: 55 GAL DRUM OF UNK MATERIAL LEFT IN THE REAR OF THE ABOVE ADDRESS PCB'S - CAUTION ENGRAVED ON BARREL

Material:

Site ID:	265644
Operable Unit ID:	825377
Operable Unit:	01
Material ID:	548898
Material Code:	0063A
Material Name:	UNKNOWN HAZARDOUS MATERIAL
Case No.:	Not reported
Material FA:	Hazardous Material
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Site ID:	265647
Facility Addr2:	Not reported
Facility ID:	9614406
Spill Number:	9614406
Facility Type:	ER
SWIS:	4101
Investigator:	YYWONG
Referred To:	V00326
Spill Date:	3/12/1997
Reported to Dept:	3/12/1997
CID:	252
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response.

MASPETH SUBSTATION (Continued) **S104786935**

Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not Closed
Remediation Phase: 1
Date Entered In Computer: 3/12/1997
Spill Record Last Update: 10/1/2009
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Company: Not reported
Contact Name: STEVE ROMERO
Contact Phone: (212) 580-6763
DEC Region: 2
DER Facility ID: 57470
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT" 3/18/97 - Barry Cohen, Con Ed Remediation: Monitoring wells installed as part of excavation remediation project last spring prior to sale of former substation property to tire company. PCB (50 - 500 ppm in oil) contamination. Wells installed last month. Just sampled wells. Found 0.5 inches free product. Investigation work plan submitted to NYSDEC DER Hazardous Waste Remediation (S. Singh). He is project manager for cleanup of PCB contamination at the site.
Remarks: CON ED HAS TAKEN SAMPLES/EH&S WILL FOLLOW UP ON INCIDENT

Material:
Site ID: 265647
Operable Unit ID: 1045809
Operable Unit: 01
Material ID: 339515
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 2
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Click this hyperlink while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:
Region of Spill: 2

MASPETH SUBSTATION (Continued) **S104786935**

Spill Number:	0004153
Investigator:	O'CONNELL
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	06/28/2000 12:00
Reported to Dept Date/Time:	07/06/00 15:26
SWIS:	63
Spiller Name:	CON EDISON
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Contact:	MIKE VOLPE
Spiller Phone:	(718) 366-1834
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Abandoned Drums
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	12
Spill Notifier:	Citizen
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	07/07/00
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	07/06/00
Date Spill Entered In Computer Data File:	Not reported
Update Date:	07/10/00
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Nonpetroleum/Nonhazardous
Quantity Spilled:	0
Unkonwn Quantity Spilled:	True
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	UNKNOWN HAZARDOUS MATERIAL

MASPETH SUBSTATION (Continued) **S104786935**

Class Type: UNKNOWN HAZARDOUS MATERIAL
Times Material Entry In File: 2093
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: 2 drums of investigation derived waste - properly labeled - left on-site for pick up by Con Ed corporate transportation. Neighbor noticed drums and called Community Board. Drums were picked up on Friday 7/7/00. Called Mike Volpe - told him that drums had been removed.
Remark: 55 GAL DRUM OF UNK MATERIAL LEFT IN THE REAR OF THE ABOVE ADDRESS PCB S - CAUTION ENGRAVED ON BARREL

Region of Spill: 2
Spill Number: 9614406
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/12/1997 14:00
Reported to Dept Date/Time: 03/12/97 18:43
SWIS: 63
Spiller Name: CON EDISON
Spiller Contact: Not reported
Spiller Phone: ( ) -
Spiller Contact: STEVE ROMERO
Spiller Phone: (212) 580-6763
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/12/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/04/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported

MASPETH SUBSTATION (Continued) **S104786935**

Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 2
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 3/18/97 - Barry Cohen, Con Ed Remediation: Monitoring wells installed as part of excavation remediation project last spring prior to sale of former substation property to tire company. PCB 50 - 500 ppm in oil) contamination. Wells installed lastmonth. Just sampled wells. Found 0.5 inches free product. Investigation work plan submitted to NYSDEC DER Ha ardous Waste Remediation S. Singh). He is project manager for cleanup of PCB contamination at the site.
Remark: CON ED HAS TAKEN SAMPLES/EH S WILL FOLLOW UP ON INCIDENT

Y413 **FORMER MASPETH SUBSTATION** **NY Spills** **S104790063**
SSE **5777 RUST ST** **NY Hist Spills** **N/A**
< 1/8 **QUEENS, NY**
0.119 mi.
630 ft. **Site 10 of 10 in cluster Y**

Relative:
Higher

Actual:
28 ft.

NY Spills:
Site ID: 245490
Facility Addr2: Not reported
Facility ID: 0007625
Spill Number: 0007625
Facility Type: ER
SWIS: 4101
Investigator: JHOCONNE
Referred To: Not reported
Spill Date: 9/13/2000
Reported to Dept: 9/28/2000
CID: 207
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 1/29/2003
Remediation Phase: 0
Date Entered In Computer: 9/28/2000
Spill Record Last Update: 1/29/2003
Spiller Name: TOM THAYAVALLY

FORMER MASPETH SUBSTATION (Continued) **S104790063**

Spiller Company:	GO-FRONT SCAFFOLD CO
Spiller Address:	5777 RUST ST
Spiller City,St,Zip:	QUEENS, NY
Spiller Company:	001
Contact Name:	TOM THAYAVALLY
Contact Phone:	(718) 456-3218
DEC Region:	2
DER Facility ID:	201624
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL" 9/28/00: Former Maspeth Substation. Met at site with Bharat Mukhi (Con Ed EH&S Remediation). He showed me where he found hydraulic oil spill that apparenlt leaked from equipment stored on the site. He had called me in the office on 9/13 to tell me that a forklift owned/operated by Go-Front Scaffolding Co had leaked approxiamtely 5 gallons onto bluestone. Bharat informed the property owner (M&A Linens) to call in the spill to our Hotline and clean it up. As of today's visit, no spill report has been filed, and no clean up has been done. I met with Go-Front's rep (Tom Thayavally) and instructed him tocall a contractor and have contaminated soil/bluestone removed ASAP. I called spill in to Hotline. Tom Thayavally (718) 456-3218 Subsequent site visits confirmed that oily soil/bluestone was removed. (JHO)
Remarks:	LEAK OF HYDRAULIC OIL FROM FORKLIFT. CON ED NOTIFIED DEC REGIONAL OFFICE ON SEPT 13. SPILLER INSTRUCTED TODAY BY DEC TO HAVE CLEAN UP COMPLETED BY CONTRACTOR.

Material:

Site ID:	245490
Operable Unit ID:	830203
Operable Unit:	01
Material ID:	545159
Material Code:	0010
Material Name:	Hydraulic Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	0007625

FORMER MASPETH SUBSTATION (Continued) **S104790063**

Investigator:	O'CONNELL
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	09/13/2000 12:00
Reported to Dept Date/Time:	09/28/00 15:30
SWIS:	63
Spiller Name:	GO-FRONT SCAFFOLD CO
Spiller Contact:	TOM THAYAVALLY
Spiller Phone:	(718) 456-3218
Spiller Contact:	TOM THAYAVALLY
Spiller Phone:	(718) 456-3218
Spiller Address:	5777 RUST ST
Spiller City,St,Zip:	QUEENS, NY
Spill Cause:	Equipment Failure
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	07
Spill Notifier:	DEC
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	09/28/00
Date Spill Entered In Computer Data File:	Not reported
Update Date:	09/29/00
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Petroleum
Quantity Spilled:	5
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	HYDRAULIC OIL
Class Type:	HYDRAULIC OIL

FORMER MASPETH SUBSTATION (Continued) **S104790063**

Times Material Entry In File: 1846
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: LEAK OF HYDRAULIC OIL FROM FORKLIFT. CON ED NOTIFIED DEC REGIONAL OFFICE ON SEPT 13. SPILLER INSTRUCTED TODAY BY DEC TO HAVE CLEAN UP COMPLETED BY CONTRACTOR.

414
NW
< 1/8
0.120 mi.
632 ft.

DRY ICE CORP **UST** **U004046573**
34-52 LAUREL HILL BLVD **N/A**
MASPETH, NY 11378

Relative:
Higher

Actual:
16 ft.

UST:
Facility Id: 2-610126
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: Not reported
UTM X: 590365.40616999997
UTM Y: 4509255.5962300003

Affiliation Records:
Site Id: 359632
Affiliation Type: Owner
Company Name: DRY ICE CORP
Contact Type: VP.
Contact Name: ROGER HAWKES
Address1: 189 CENTRAL AVE
Address2: Not reported
City: OLD TAPPAN
State: NJ
Zip Code: 07675
Country Code: 001
Phone: (201) 767-3200
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 12/4/2008

Site Id: 359632
Affiliation Type: On-Site Operator
Company Name: DRY ICE CORP
Contact Type: Not reported
Contact Name: DRY ICE CORP
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 392-9300
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

DRY ICE CORP (Continued) **U004046573**

Modified By:	KXTANG
Date Last Modified:	2/16/2006
Site Id:	359632
Affiliation Type:	Emergency Contact
Company Name:	DRY ICE CORP
Contact Type:	Not reported
Contact Name:	MIKE NOLAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(516) 868-6460
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/4/2008
Site Id:	359632
Affiliation Type:	Mail Contact
Company Name:	DRY ICE CORP
Contact Type:	VP.
Contact Name:	ROGER HAWKES
Address1:	189 CENTRAL AVE
Address2:	Not reported
City:	OLD TAPPAN
State:	NJ
Zip Code:	07675
Country Code:	001
Phone:	(201) 767-3200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/4/2008

Equipment Records:

A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
I02 - Overfill - High Level Alarm
D01 - Pipe Type - Steel/Carbon Steel/Iron
F02 - Pipe External Protection - Original Sacrificial Anode
E00 - Piping Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
H05 - Tank Leak Detection - In-Tank System (ATG)
J02 - Dispenser - Suction
B02 - Tank External Protection - Original Sacrificial Anode
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
F02 - Pipe External Protection - Original Sacrificial Anode

DRY ICE CORP (Continued) **U004046573**

F06 - Pipe External Protection - Wrapped
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
H05 - Tank Leak Detection - In-Tank System (ATG)
G00 - Tank Secondary Containment - None
B02 - Tank External Protection - Original Sacrificial Anode
F06 - Pipe External Protection - Wrapped
B01 - Tank External Protection - Painted/Asphalt Coating
E00 - Piping Secondary Containment - None

Tank Info:

Site ID:	359632
Tank Number:	01
Tank ID:	210068
Tank Status:	In Service
Tank Model:	101
Pipe Model:	Not reported
Install Date:	6/13/1983
Capacity Gallons:	2000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	12/2/2005
Register:	True
Modified By:	msbaptis
Last Modified:	11/10/2006

Site ID:	359632
Tank Number:	02
Tank ID:	210069
Tank Status:	In Service
Tank Model:	101
Pipe Model:	Not reported
Install Date:	6/13/1983
Capacity Gallons:	2000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	12/2/2005
Register:	True
Modified By:	msbaptis
Last Modified:	11/10/2006

AC415 **POLE NUMBER P-65912** **NY Spills** **S110751580**
SW **473 SCOTT AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.121 mi.
640 ft. **Site 1 of 3 in cluster AC**

Relative:
Higher

Actual:
16 ft.

NY Spills:

Site ID:	444179
Facility Addr2:	Not reported
Facility ID:	1010567
Spill Number:	1010567
Facility Type:	ER
SWIS:	2401
Investigator:	RWAUSTIN
Referred To:	Not reported
Spill Date:	1/12/2011
Reported to Dept:	1/12/2011
CID:	Not reported
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/11/2011
Remediation Phase:	0
Date Entered In Computer:	1/12/2011
Spill Record Last Update:	2/11/2011
Spiller Name:	ERT
Spiller Company:	CONEDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	MANHATTAN, NY
Spiller Company:	999
Contact Name:	ERT
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	399085
DEC Memo:	2/11/11 - Austin - 1/2 gal. dielectric fluid from pole trans. leaked onto pavement, snow - Con Ed contained and cleaned up the spill - see additional info in the eDocs files - spill closed - end
Remarks:	2 qts. spilled on to concrete and snow. Clean up in progress.

Material:

Site ID:	444179
Operable Unit ID:	1194619
Operable Unit:	01
Material ID:	2190482
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.5
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported

POLE NUMBER P-65912 (Continued) **S110751580**

Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

W416 **CONTAM. ADJ. TO NYC ERP SITE** **NY Spills** **S109062609**
SSE **2 GALASSO PLACE / 1 RAILROAD PLACE** **N/A**
< 1/8 **MASPETH, NY**
0.122 mi.
643 ft. **Site 5 of 9 in cluster W**

Relative:
Higher

Actual:
12 ft.

NY Spills:
Site ID: 397413
Facility Addr2: Not reported
Facility ID: 0801483
Spill Number: 0801483
Facility Type: ER
SWIS: 4101
Investigator: RMPIPER
Referred To: Not reported
Spill Date: 5/7/2008
Reported to Dept: 5/7/2008
CID: 444
Spill Cause: Other
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not Closed
Remediation Phase: 1
Date Entered In Computer: 5/7/2008
Spill Record Last Update: 11/4/2008
Spiller Name: JONATHAN GRECO
Spiller Company: OPEN FIELD OWNED NYC
Spiller Address: 57-15 49TH STREET
Spiller City,St,Zip: MASPETH, NY
Spiller Company: 001
Contact Name: JONATHAN GRECO
Contact Phone: (518) 402-9694
DEC Region: 2
DER Facility ID: 355463

CONTAM. ADJ. TO NYC ERP SITE (Continued) **S109062609**

DEC Memo: 11/4/08 - Austin - Spoke with Jon Greco, DEC/DER project manager for an ERP project occurring at 57-15 49th St., Queens (#B00152, spill 3 0313650), adjoining this site. He indicated that he had called this spill report in as a result of findings during some tank removal/soil excavation activities along the boundary line of 2 Galasso Pl. He indicated that the soil contamination found along the boundary was upgradient of the contamination sources on his site, and appeared to be coming from the Gallasso Pl. site (may also be know as 1 Railroad Place). The property owner of 2 Galasso Pl. had a consultant representing him witnessing the excavation work. This spill was caled in but was assigned to Mr. Greco. It is being reassigned to Ryan Piper for conducting the investigation at 2 Galasso Pl, and coordinating with Mr. Greco on the impact from this spill onto the 49th St. property. - end

Remarks: DURING AN ERP INVESTIGATION AT 57-15 49TH ST. FOUND MORE CONTAMINATED SOIL IN A DIFFERENT LOCATION: DEC REP NOTED SIGNIFICANT PETROLUEM CONTAMINATED SOIL, UPGRADIANT OF KNOWN TANK ON SITE, AND CONTAMINATION IN GROUND ALONG SITE BOUNDARY WITH 2 GALASSO PLACE.

Material:

Site ID:	397413
Operable Unit ID:	1154381
Operable Unit:	01
Material ID:	2145176
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

W417 **NYC ERP SITE** **NY Spills** **S106383732**
SSE **57-15 49TH ST** **N/A**
< 1/8 **MASPETH, NY**
0.122 mi.
643 ft. **Site 6 of 9 in cluster W**

Relative: Higher

Actual: 12 ft.

NY Spills:

Site ID:	68821
Facility Addr2:	Not reported
Facility ID:	0313650
Spill Number:	0313650

NYC ERP SITE (Continued) **S106383732**

Facility Type:	ER
SWIS:	4101
Investigator:	jxgreco
Referred To:	Not reported
Spill Date:	3/12/2004
Reported to Dept:	3/12/2004
CID:	403
Spill Cause:	Other
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/28/2011
Remediation Phase:	0
Date Entered In Computer:	3/12/2004
Spill Record Last Update:	3/28/2011
Spiller Name:	GREG MENEGIO
Spiller Company:	ADDRESS A/K/A
Spiller Address:	3 RAILROAD PLACE
Spiller City,St,Zip:	MASPEPH, NY
Spiller Company:	001
Contact Name:	GREG MENEGIO
Contact Phone:	(631) 283-2470
DEC Region:	2
DER Facility ID:	65497
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL" Address also known as #3 Railroad Place 3/12/2004 - Former Trucking company PBS# 2-603855 10 550 gal gasoline tanks were pulled in 1999 Open spill numbers for this site: #9209704 Reassigned from Zhitomirski to Rommel #9804647 Reassigned from Sigona to Rommel 6/18/04 Investigation and remedation to be tracked under spill #9906743. (KMF) 4/7/05 - spill re-opened due to error in consolidating spill records. Staff made a mistake with the site address and thought to close this spill by consolidating to 9906743. It was rectified later by field visit. - KST 11/4/08 - Austin - Disregard the above info, except for the 4/7/05 note indicating why the spill and PBS references are erroneous. This site is assigned this active spill report number, and has the PBS# of 2-610335. This spill has been reassigned to Jon Greco in DEC/DER/Albany, as part of his work on an ERP project at this location with NYC, who owns this site. See B00152 for more info. - end 07/28/10 - Greco - Work on this spill was to be done in conjunction with an on-going ERP project, however, this is no longer believed to be the case due to an adjacent property owner's involvement (i.e., it is believed that one of the likely sources of contamination (a former 20,000 gallon UST) was plumbed to the neighboring property, Galasso Trucking). The Department is seeking to remove NYC from the ERP and will further pursue this petroleum cleanup with Galasso Trucking. 03/28/11 NYC ERP Contract was terminated in December, 2010. Greco closed this spill and cross referenced it to Spill # 08-01483, which is being handled as a regional lead.

NYC ERP SITE (Continued) **S106383732**

Remarks: they were trenching the property when they discovered the soil to be contaminated from a historical spill.

Material:

Site ID:	68821
Operable Unit ID:	878787
Operable Unit:	01
Material ID:	495248
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	68821
Operable Unit ID:	878787
Operable Unit:	01
Material ID:	495247
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

W418 **MASPETH PROJECT** **ERP** **S105589986**
SSE **57-15 49TH STREET** **N/A**
< 1/8 **NEW YORK CITY, NY 11378**
0.122 mi.
643 ft. **Site 7 of 9 in cluster W**

Relative:
Higher

Actual:
12 ft.

ERP:

Site Code:	57276
Program:	ERP
HW Code:	B00152
Site Class:	A
Class N:	A
SWIS:	4101
Region:	2

MASPETH PROJECT (Continued) **S105589986**

Town: New York City
Acres: 2.800
Record Added: 10/30/2003 2:32:00 PM
Record Updated: 11/15/2010 1:22:00 PM
Updated By: JAQUINN
Site Description: The Maspeth Railroad Place site is located in an industrialized area of Queens County, New York. The site is approximately 3-acres in size, and can be found at 57-15 49th Street. The main site features include a fenced lot which constitutes the majority of the site. There are no perminent structures on the lot. The headwaters of Maspeth Creek are located approximately 100 hundred feet from the site. The site is currently vacant, though there is evidence of some trespassing. The site is surrounded by industrial/commercial properties on all sides. The site has had several industrial/commercial uses over the years, but is reported to have been most recently the site of a bus maintenance facility. A former chemicals blending operation was located immediately adjacent to the site, and there was some concern that wastes from that operation could have contaminated the site. The Remedial Investigation is complete, and the alternatives analysis has been submitted in draft form. In the spring and summer of 2008, the City of New York performed an Interim Remedial Measure by removing a 20,000 gallon storage tank which was found during the site investigation. The NYSDEC is currently involved in negotiations with a neighboring land owner regarding the cleanup of petroleum believed to be emanating from their property onto the Maspeth property. Resolution of the negotiations is expected in the fall of 2010.
Env Problem: The primary contaminants of concern at the site are petroleum related compounds. Preliminary data indicated the possible presence of a common plasticizer (bis-2-ethylhexyl pthalate) at elevated levels in groundwater and soils, however, more recent data indicated much lower levels than previously reported. Localized soil and groundwater contamination has been identified. Groundwater is above standards for petroleum compounds. The site has not been determined to be a significant threat to the environment.
Health Problem: Soil and groundwater are contaminated with petroleum-related volatile and semi-volatile organic compounds. Exposure to contaminated groundwater is not expected because the area is served by public water. The area is heavily industrialized and the site is partially fenced, but tresspassers may be exposed to contaminated surface soil.

W419 **57-15 49TH ST** **LTANKS** **S100494356**
SSE **57-15 49TH ST** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY** **NY Spills**
0.122 mi. **NY Hist Spills**
643 ft. **Site 8 of 9 in cluster W**

Relative:
Higher

Actual:
12 ft.

LTANKS:
Site ID: 271677
Spill No: 9209704
Spill Date: 11/19/1992
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 6/18/2004
Facility Addr2: Not reported
Cleanup Ceased: Not reported

57-15 49TH ST (Continued) **S100494356**

Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	JMROMMEL
Referred To:	Not reported
Reported to Dept:	11/19/1992
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	11/23/1992
Spill Record Last Update:	4/7/2005
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	221104
Remarks:	NYCDEP IS MOVING THEIR REPAIR GARAGE TO THIS LOCATION-FOUND 20K UST ONSITE-DUG TRUCK

Material:

Site ID:	271677
Operable Unit ID:	973521
Operable Unit:	01
Material ID:	406750
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

57-15 49TH ST (Continued) **S100494356**

HIST LTANKS:

Region of Spill:	2
Spill Number:	9209704
Spill Date:	11/19/1992
Spill Time:	12:00
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Investigator:	ZHITOMIRSKY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Reported to Department Date:	11/19/92
Reported to Department Time:	16:40
SWIS:	62
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spiller Cleanup Date:	/ /
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Notifier:	Other
PBS Number:	Not reported
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	11/23/92
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	10/14/97
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported

57-15 49TH ST (Continued) **S100494356**

Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: NYCDEP IS MOVING THEIR REPAIR GARAGE TO THIS LOCATION-FOUND 20K UST ONSITE-DUG TRUCK

NY Spills:
Site ID: 121606
Facility Addr2: Not reported
Facility ID: 9804647
Spill Number: 9804647
Facility Type: ER
SWIS: 4101
Investigator: JMROMMEL
Referred To: Not reported
Spill Date: 7/6/1998
Reported to Dept: 7/14/1998
CID: 205
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 6/18/2004
Remediation Phase: 0
Date Entered In Computer: 7/14/1998
Spill Record Last Update: 4/7/2005
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: CALLER
Contact Phone: (718) 595-4518
DEC Region: 2
DER Facility ID: 65497
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL" DEC (Sigona) recieved proposed groundwater monitoring well installation plan on June 23, 1998. Wells were installed

57-15 49TH ST (Continued) **S100494356**

contamination was found. DEP & Port Authority to submit results. This spill site is adjacent and possibly part of 3 Railroad Place New Style Waste Transfer under Spill No. 9906743. It was found out later that it is a different site. KST 3/12/2004 Case reassigned from Sigona to Rommel Ref #0313650, #9209704,

Remarks: CALLER REPORTED PETRO IN MONITORING WELL. UNK ORIGIN. (ANTHONY SIGONA CASE) ALT ADDRESS 3 RAILROAD PLACE.

Material:

Site ID:	121606
Operable Unit ID:	1062560
Operable Unit:	01
Material ID:	319367
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9804647
Investigator:	SIGONA
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	07/06/1998 12:00
Reported to Dept Date/Time:	07/14/98 10:04
SWIS:	63
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Contact:	CALLER
Spiller Phone:	(718) 595-4518
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown

57-15 49TH ST (Continued) **S100494356**

Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/14/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 07/15/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: DEC Sigona) recieved proposed groundwater monitoring well installation plan on June 23, 1998. Wells were installed contamination was found. DEP Port Authority to submit results.
Remark: CALLER REPORTED PETRO IN MONITORING WELL. UNK ORIGIN. ANTHONY SIGONA CASE) ALT ADDRESS 3 RAILROAD PLACE.

W420 **MASPETH** **UST** **U004063507**
SSE **57-15 49TH STREET** **N/A**
< 1/8 **MASPETH, NY 11378**
0.122 mi.
643 ft. **Site 9 of 9 in cluster W**

Relative:
Higher

Actual:
12 ft.

UST:

Facility Id:	2-610335
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591284.40859999997
UTM Y:	4508466.81494

Affiliation Records:

Site Id:	370214
Affiliation Type:	Emergency Contact
Company Name:	NYC DEPT. OF ENVIRONMENTAL PROTECTION
Contact Type:	Not reported
Contact Name:	SCOTT JOHNSON
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 595-4376
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	KXTANG
Date Last Modified:	9/13/2006

Site Id:	370214
Affiliation Type:	Mail Contact
Company Name:	NYC DEPT. OF ENVIRONMENTAL PROTECTION
Contact Type:	Not reported
Contact Name:	MAURICE WINTER
Address1:	59-17 JUNCTION BOULEVARD
Address2:	11TH FLOOR
City:	FLUSHING
State:	NY
Zip Code:	11373
Country Code:	001
Phone:	(718) 595-4514
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	5/28/2009

Site Id:	370214
Affiliation Type:	On-Site Operator
Company Name:	MASPETH
Contact Type:	Not reported
Contact Name:	NYC DEP
Address1:	Not reported
Address2:	Not reported

MASPETH (Continued) **U004063507**

City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: VACANT LOT
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 9/13/2006

Site Id: 370214
Affiliation Type: Owner
Company Name: NYC DEPT. OF ENVIRONMENTAL PROTECTION
Contact Type: Not reported
Contact Name: Not reported
Address1: 59-17 JUNCTION BLVD
Address2: Not reported
City: FLUSHING
State: NY
Zip Code: 11373
Country Code: 001
Phone: (718) 595-4376
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 5/28/2009

Equipment Records:

H04 - Tank Leak Detection - Groundwater Well
L00 - Piping Leak Detection - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F02 - Pipe External Protection - Original Sacrificial Anode
D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None
C00 - Pipe Location - No Piping
B02 - Tank External Protection - Original Sacrificial Anode
I00 - Overfill - None
G00 - Tank Secondary Containment - None
E00 - Piping Secondary Containment - None
F06 - Pipe External Protection - Wrapped
J00 - Dispenser - None

Tank Info:
Site ID: 370214

Tank Number: 001
Tank ID: 213529
Tank Status: Closed - Removed
Tank Model: 101
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 20000
Tightness Test Method: NN
Next Test Date: Not reported

MASPETH (Continued) **U004063507**

Date Tank Closed: 3/10/2008
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 5/28/2009

Z421 **4915 MASPETH AVE** **HMIRS** **2008452761**
SSW **4915 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.123 mi.
648 ft. **Site 2 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z422 **HMIRS** **92060599**
SSW **4915 MASPETH AVENUE** **N/A**
< 1/8 **MASPETH, NY**
0.123 mi.
648 ft. **Site 3 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AA423 **VIACOM** **RCRA-CESQG** **1004762049**
SSW **49-29 MASPETH AVE** **FINDS** **NYR000093021**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.124 mi.
654 ft. **Site 3 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

RCRA-CESQG:
Date form received by agency: 01/01/2007
Facility name: VIACOM
Facility address: 49-29 MASPETH AVE
MASPETH, NY 11378
EPA ID: NYR000093021
Mailing address: MASPETH AVE
MASPETH, NY 11378
Contact: DAVID DORIAN
Contact address: MASPETH AVE
MASPETH, NY 11378
Contact country: US
Contact telephone: (718) 366-6510
Contact email: Not reported
EPA Region: 02
Land type: Private
Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less

VIACOM (Continued) **1004762049**

of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	UNKNOWN
Owner/operator address:	NOT REQUIRED NOT REQUIRED, NY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	12/31/1979
Owner/Op end date:	Not reported

Owner/operator name:	TRANSPORTATION DISPLAY INC
Owner/operator address:	4929 MASPETH AVE MASPETH, NY 11378
Owner/operator country:	Not reported
Owner/operator telephone:	(718) 366-6180
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/0001
Owner/Op end date:	Not reported

Owner/operator name:	VIACOM
Owner/operator address:	NOT REQUIRED NOT REQUIRED, NY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	12/31/1979
Owner/Op end date:	Not reported

Owner/operator name:	TRANSPORTATION DISPLAY INC
Owner/operator address:	4929 MASPETH AVE MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 366-6180
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/2001
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No

VIACOM (Continued) **1004762049**

On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: VIACOM
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 04/30/2003
Facility name: VIACOM
Classification: Small Quantity Generator

Date form received by agency: 08/29/2002
Facility name: VIACOM
Site name: TRANSPORTATION DISPLAYS INC
Classification: Large Quantity Generator

Date form received by agency: 01/02/2001
Facility name: VIACOM
Site name: TRANSPORTATION DISPLAY INC
Classification: Conditionally Exempt Small Quantity Generator

Hazardous Waste Summary:
Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 02/02/2004
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004566381

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

VIACOM (Continued) **1004762049**

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID:	NYR000093021
Country:	USA
Mailing Name:	TRANSPORTATION DISPLAY INC
Mailing Contact:	TRANSPORTATION DISPLAY INC
Mailing Address:	4929 MASPETH AVE
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-617-0771

Document ID:	MIA8812344
Manifest Status:	Not reported
Trans1 State ID:	PAR000501577
Trans2 State ID:	PAD146714878
Generator Ship Date:	05/02/2003
Trans1 Recv Date:	05/02/2003
Trans2 Recv Date:	05/02/2003
TSD Site Recv Date:	05/12/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000093021
Trans1 EPA ID:	MID060975844
Trans2 EPA ID:	Not reported
TSDF ID:	NYPA354
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00165
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	NYC7131622
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	05/02/2003
Trans1 Recv Date:	05/02/2003

VIACOM (Continued) **1004762049**

Trans2 Recv Date:	05/09/2003
TSD Site Recv Date:	05/12/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000093021
Trans1 EPA ID:	KYD053348108
Trans2 EPA ID:	Not reported
TSDF ID:	NY55817JC
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00400
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00400
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	NYC6966685
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	07/28/2003
Trans1 Recv Date:	07/28/2003
Trans2 Recv Date:	08/01/2003
TSD Site Recv Date:	08/04/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000093021
Trans1 EPA ID:	KYD053348108
Trans2 EPA ID:	Not reported
TSDF ID:	NY89930JE
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00800
Units:	P - Pounds
Number of Containers:	002
Container Type:	CW - Wooden boxes
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	NYB9514998
Manifest Status:	Not reported
Trans1 State ID:	NY0000291823
Trans2 State ID:	PAD146714878
Generator Ship Date:	05/09/2001
Trans1 Recv Date:	05/09/2001
Trans2 Recv Date:	05/10/2001
TSD Site Recv Date:	05/11/2001

VIACOM (Continued) **1004762049**

Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000093021
Trans1 EPA ID:	NYD049836679
Trans2 EPA ID:	Not reported
TSDF ID:	1A375
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	05000
Units:	P - Pounds
Number of Containers:	010
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	03500
Units:	P - Pounds
Number of Containers:	007
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	05000
Units:	P - Pounds
Number of Containers:	010
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	01

AA424 **4929 MASPETH AVE** **NY Spills** **S102446495**
SSW **4929 MASPETH AVE** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 4 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

NY Spills:

Site ID:	170972
Facility Addr2:	Not reported
Facility ID:	9609180
Spill Number:	9609180
Facility Type:	ER
SWIS:	4101
Investigator:	WXSUN
Referred To:	Not reported
Spill Date:	10/22/1996
Reported to Dept:	10/23/1996
CID:	311
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

4929 MASPETH AVE (Continued) **S102446495**

Spill Closed Dt:	2/22/2007
Remediation Phase:	0
Date Entered In Computer:	10/23/1996
Spill Record Last Update:	2/22/2007
Spiller Name:	STEVE
Spiller Company:	TDI
Spiller Address:	4929 MASPETH AVE
Spiller City,St,Zip:	MASPETH, NY
Spiller Company:	001
Contact Name:	STEVE
Contact Phone:	(718) 366-6180
DEC Region:	2
DER Facility ID:	143872
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL" 03/26/04 Transferred from Saccacio to Rommel. Letter to be sent 11/02/06 Reassigned to Sun. (MS) 1/4/07: Sun sent letter certified mail to Stephen Hillwig (TDI), 275 Madison Ave, NYC (for 4929 Maspeth Ave location) on 1/3/04 requiring that the following be submitted to the NYSDEC by 2/3/07: 1. Tank closure assessment report. 2. Locations of tank and/or line test failure. 3. Subsurface investigation report, including current and historical soil and groundwater analysis. 4. Surrounding property sketch: A surrounding property sketch including property layout and usage must be submitted to NYSDEC. North arrow and scale must also be included on the site plan. If no tank closure report was prepared or no subsurface investigation was conducted before, the Department requires the following be performed and submitted: 1. Submission of a Tank Closure & Site Assessment Including Soil and Groundwater Investigation Results. (JS/MS) 2/20/07: Received documentation from RP's consultants Walden Assoc. Reviewing. (JS/MS) 2/6/07: Letter re-sent on 2/6/07 (same as above) to 49-29 Maspeth Avenue as first letter was returned to the DEC. (JS/MS) 2/22/07: Contact was made with Robert Keane of Walden Associates, Inc. (WAI), the consultant who performed investigation and remediation activities at the site between 1996 and 2000. Mr. Keane informed the DEC that multiple investigations had taken place at the site, all documentation had previously been submitted to the DEC (attention to a former NYSDEC employee), and that the site had been cleaned. DEC staff requested that all documentation be resubmitted to the Department for review. Such documents, including multiple reports and correspondence letters, was delivered to the DEC on February 20, 2007. Reports included all previous site investigations as well as soil and groundwater analytical results. These results indicated that no volatile organic and semi-volatile organic compounds were present in the groundwater beneath the site. In addition, soil samples indicated only low level-background concentrations of semi-volatile organic compounds and no volatile organic compounds. Consequently, the Department determined that no further action was warranted and this spill case was closed on February 22, 2007. (JS/MS)
Remarks:	tank installer company called to notified while removing and in stalling a new tank discovered a large amt of waste product at site. this is the first installation for this company and would like immediate guidence.

Material:

Site ID:	170972
Operable Unit ID:	1037266
Operable Unit:	01

4929 MASPETH AVE (Continued) **S102446495**

Material ID:	573549
Material Code:	1213A
Material Name:	MTBE (METHYL-TERT-BUTYL ETHER)
Case No.:	01634044
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	True
Site ID:	170972
Operable Unit ID:	1037266
Operable Unit:	01
Material ID:	561150
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	True

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9609180
Investigator:	SACCACIO
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	10/22/1996 15:00
Reported to Dept Date/Time:	10/23/96 09:18
SWIS:	63
Spiller Name:	TDI
Spiller Contact:	STEVE
Spiller Phone:	(718) 355-6180
Spiller Contact:	STEVE
Spiller Phone:	(718) 366-6180
Spiller Address:	4929 MASPETH AVE

4929 MASPETH AVE (Continued) **S102446495**

Spiller City,St,Zip: MASPETH, NY
Spill Cause: Unknown
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/23/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 10/16/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: tank installer company called to notified while removing and in stalling a new tank discovered a large amt of waste product at site. this is the first installation for this company and would like immediate guidence.

Z425 **49-15 MASPETH AVE** **HMIRS** **2007428339**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 4 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z426 **49-15 MASPETH AVE** **HMIRS** **2007445974**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 5 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z427 **COMMERCIAL** **LTANKS** **S107417374**
SSW **49-15 MASPETH AV** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 6 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

LTANKS:

Site ID:	289220
Spill No:	9612083
Spill Date:	5/26/1995
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	7/28/2003
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	RWAUSTIN
Referred To:	Not reported
Reported to Dept:	1/7/1997
CID:	297
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1/7/1997
Spill Record Last Update:	7/28/2003
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	999
Spiller Contact:	MARC LEVINN
Spiller Phone:	(516) 826-4707
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	234198

COMMERCIAL (Continued) **S107417374**

Remarks: CALLER WORKS FOR THE PROPERTY OWNERS - THEY RECIEVED THE RESULTS OF A PHASE II TEST AND IT WAS POSITIVE FOR CONTAMINATION - POSSIBLE FROM OVERFILLING VEHICLE FUEL TANKS

Material:

Site ID:	289220
Operable Unit ID:	1039959
Operable Unit:	01
Material ID:	340735
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Z428 **CONWAY CENTRAL EXPRESS** **NY Spills** **S103483015**
SSW **49-15 MASPETH AVENUE** **NY Hist Spills** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 7 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

NY Spills:

Site ID:	218795
Facility Addr2:	Not reported
Facility ID:	9805268
Spill Number:	9805268
Facility Type:	ER
SWIS:	4101
Investigator:	JBMCCULL
Referred To:	Not reported
Spill Date:	7/28/1998
Reported to Dept:	7/28/1998
CID:	204
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **S103483015**

Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/6/2006
Remediation Phase:	0
Date Entered In Computer:	7/28/1998
Spill Record Last Update:	3/6/2006
Spiller Name:	MIKE KATZ
Spiller Company:	CONWAY CENTRAL EXPRESS
Spiller Address:	49-15 MASPETH AVENUE
Spiller City,St,Zip:	MASPETH, NY 11378-
Spiller Company:	001
Contact Name:	MIKE KATZ
Contact Phone:	(510) 521-3773
DEC Region:	2
DER Facility ID:	180980
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL" This Spill cleanup project has been reassigned from DEC (Sigona) to Rommel on 2/2/2004. Reference PBS facility information 2-032492. Tank tested on 3/8/05, passed. DEC Sigona investigated report on 7/28/98 at 3 P.M. Met on-site with Jim Bethel, Service center manager (718)-381-3700. Provided copies of Stars Memo #1, SPOTS Memo #14 & PBS regs. According to Jim Bethel, CCX was upgrading 4K UST diesel using help from Tank Technology, Inc. Approximately 1 year ago, Gasoline Installations installed 2" fill pipe and tested tank and found it to be tight. Tank Tech was installing a 4" fill while tank volume was lowered. They found contaminated soils around the fill pipe (vertical). They attribute the contamination to overfills (however, contractor said it was a leaking pipe fitting (2")? They have been performing tightness tests according to CCX. The lawyer will be briefed on the status of the spills. DEC Sigona) provided options 1) remove soil to clean endpoint. 2) perform soil borings or test wells to de-lineate contamination. Report finding to DEC Left site at 3:45 P.M. 7/28/98. Refer to Spill No. 9612083 (Mike Mulqueen, Investigator).
Remarks:	FLANGE WAS LOOSE CAUSING SPILL

Material:

Site ID:	218795
Operable Unit ID:	1066430
Operable Unit:	01
Material ID:	320015
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **S103483015**

Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9805268
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/28/1998 10:40
Reported to Dept Date/Time: 07/28/98 11:51
SWIS: 63
Spiller Name: CONWAY CENTRAL EXPRESS
Spiller Contact: MIKE KATZ
Spiller Phone: (510) 521-3773
Spiller Contact: MIKE KATZ
Spiller Phone: (510) 521-3773
Spiller Address: 49-15 MASPETH AVENUE
Spiller City,St,Zip: MASPETH, NY 11378-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/28/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 07/29/98
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported

CONWAY CENTRAL EXPRESS (Continued) **S103483015**

Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: DEC Sigona investigated report on 7/28/98 at 3 P.M. Met on-site with Jim Bethel, Service center manager 718)-381-3700. Provided copies of Stars Memo 1, SPOTS Memo 14 PBS regs. According to Jim Bethel, CCX was upgrading 4K UST diesel using help from Tank Technology, Inc. Approximately 1 year ago, Gasoline Installations installed 2 fill pipe and tested tank and found it to be tight. Tank Tech was installing a 4 fill while tank volume was lowered. They found contaminated soils around the fill pipe vertical). They attribute the contamination to overfills however, contractor said it was a leaking pipe fitting 2)? They have been performing tightness tests according to CCX. The lawyer will be briefed on the status of the spills. DEC Sigona) provided options 1) remove soil to clean endpoint. 2) perform soil borings or test wells to de-lineate contamination. Report finding to DEC Left site at 3:45 P.M. 7/28/98. Refer to Spill No. 9612083 Mike Mulqueen, Investigator).
Remark: FLANGE WAS LOOSE CAUSING SPILL

Z429 **CON-WAY FREIGHT-XBY** **FINDS** **1010346773**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY 11378**
0.124 mi.
654 ft. **Site 8 of 21 in cluster Z**

Relative: Higher

Actual: 13 ft.

FINDS:

Registry ID: 110030899188

Environmental Interest/Information System
US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

Z430
SSW
< 1/8
0.124 mi.
654 ft.

49-15 MASPETH AVE
MASPETH, NY

Site 9 of 21 in cluster Z

HMIRS **95080196**
N/A

Relative:
Higher

Actual:
13 ft.

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Z431
SSW
< 1/8
0.124 mi.
654 ft.

CON-WAY FREIGHT-XBY
49-15 MASPETH AVENUE
MASPETH, NY 11378

Site 10 of 21 in cluster Z

UST **U001839170**
HIST UST **N/A**

Relative:
Higher

Actual:
13 ft.

UST:

Facility Id:	2-032492
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	Not reported
UTM X:	591241.83644999994
UTM Y:	4508535.4589200001

Affiliation Records:

Site Id:	218
Affiliation Type:	Mail Contact
Company Name:	CON-WAY FREIGHT
Contact Type:	Not reported
Contact Name:	JEFF SETEN
Address1:	2211 OLD EARHART
Address2:	Not reported
City:	ANN ARBOR
State:	MI
Zip Code:	48105
Country Code:	001
Phone:	(734) 757-1657
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	6/21/2010

Site Id:	218
Affiliation Type:	On-Site Operator
Company Name:	CON-WAY FREIGHT-XBY
Contact Type:	Not reported
Contact Name:	CON-WAY CENTRAL EXPRESS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 381-3700
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	6/21/2010

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Site Id:	218
Affiliation Type:	Emergency Contact
Company Name:	MASPETH AVENUE ASSOC. LLC
Contact Type:	Not reported
Contact Name:	BOB CAMPBELL
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 381-3700
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	6/21/2010

Site Id:	218
Affiliation Type:	Owner
Company Name:	MASPETH AVENUE ASSOC. LLC
Contact Type:	MGR
Contact Name:	JEFF SETEN
Address1:	79 WHEATLEY RD
Address2:	Not reported
City:	OLD WESTBURY
State:	NY
Zip Code:	11568
Country Code:	001
Phone:	(516) 626-3487
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	6/21/2010

Equipment Records:

I03 - Overfill - Automatic Shut-Off
J02 - Dispenser - Suction
D00 - Pipe Type - No Piping
B08 - Tank External Protection - Retrofitted Impressed Current
I00 - Overfill - None
B00 - Tank External Protection - None
A01 - Tank Internal Protection - Epoxy Liner
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H05 - Tank Leak Detection - In-Tank System (ATG)
F08 - Pipe External Protection - Retrofitted Impressed Current
F00 - Pipe External Protection - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping

CON-WAY FREIGHT-XBY (Continued) **U001839170**

A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
I00 - Overfill - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
J02 - Dispenser - Suction
I00 - Overfill - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
I00 - Overfill - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
F00 - Pipe External Protection - None
D00 - Pipe Type - No Piping
I00 - Overfill - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
D00 - Pipe Type - No Piping
D00 - Pipe Type - No Piping
F00 - Pipe External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
I00 - Overfill - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None

Tank Info:
Site ID: 218

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Tank Number:	001
Tank ID:	30461
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1981
Capacity Gallons:	4000
Tightness Test Method:	14
Next Test Date:	6/29/2015
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	6/29/2010
Register:	True
Modified By:	BKFALVEY
Last Modified:	8/16/2010
Site ID:	218
Tank Number:	002
Tank ID:	30462
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1981
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	4/24/2003
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	KXTANG
Last Modified:	8/19/2005
Site ID:	218
Tank Number:	003
Tank ID:	30463
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	250
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	218

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Tank Number:	004
Tank ID:	30464
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	250
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	218
Tank Number:	005
Tank ID:	30465
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	250
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	218
Tank Number:	006
Tank ID:	30466
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	250
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	218

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Tank Number:	007
Tank ID:	30467
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	250
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	218
Tank Number:	008
Tank ID:	30468
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1963
Capacity Gallons:	250
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1992
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-032492
SPDES Number:	Not reported
Emergency Contact:	BOB CAMPBELL
Emergency Telephone:	(718) 381-3700
Operator:	CON-WAY CENTRAL EXPRESS
Operator Telephone:	(718) 381-3700
Owner Name:	JOHNSON AVENUE REALTY CO.
Owner Address:	P.O. BOX 292-79 WHEATLEY ROAD
Owner City,St,Zip:	OLD WESTBURY, NY 11568
Owner Telephone:	(516) 626-3487
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	CNF TRANSPORTATION, INC.
Mailing Address:	3240 HILLVIEW AVE.
Mailing Address 2:	Not reported
Mailing City,St,Zip:	PALO ALTO,, CA 94304
Mailing Contact:	ROBERT J.CLARK
Mailing Telephone:	(650) 494-2900
Owner Mark:	Second Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is

CON-WAY FREIGHT-XBY (Continued) **U001839170**

	greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	49-15 MASPETH AVENUE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	19990506
Inspector:	ZHAO
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	03/16/2001
Expiration Date:	07/14/2005
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	4000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19811201
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	Impressed Current
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Impressed Current
Second Containment:	None
Leak Detection:	In-tank System
Overfill Prot:	Automatic Shut-Off, Catch Basin
Dispenser:	Suction
Date Tested:	02/13/2001
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Proeco Sewer Test or U2 Ullage
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Tank Converted To Non-Regulated Use

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Install Date:	19811201
Capacity (gals):	1000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	08/01/1996
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19631201
Capacity (gals):	250
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19631201
Capacity (gals):	250
Product Stored:	UNLEADED GASOLINE

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19631201
Capacity (gals):	250
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19631201
Capacity (gals):	250
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	007
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19631201
Capacity (gals):	250
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	008
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19631201
Capacity (gals):	250
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported

CON-WAY FREIGHT-XBY (Continued) **U001839170**

Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1992
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Z432 **CONWAY CENTRAL EXPRESS** **RCRA-SQG** **1004759853**
SSW **49-15 MASPETH AVE** **FINDS** **NYR000023424**
< 1/8 **MASPETH, NY 11378** **MANIFEST**
0.124 mi. **MANIFEST**
654 ft. **Site 11 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

RCRA-SQG:

Date form received by agency:	01/01/2007
Facility name:	CONWAY CENTRAL EXPRESS
Facility address:	49-15 MASPETH AVE MASPETH, NY 11378
EPA ID:	NYR000023424
Mailing address:	MASPETH AVE MASPETH, NY 11378
Contact:	JIM BETHELL
Contact address:	MASPETH AVE MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 381-3700
Contact email:	Not reported
EPA Region:	02
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	JOHNSON AVENUE REALTY CO
Owner/operator address:	79 WHEATLEY RD OLD WESTBURY, NY 11568
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	JOHNSON AVENUE REALTY CO
Owner/operator address:	79 WHEATLEY RD OLD WESTBURY, NY 11568
Owner/operator country:	US

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: CONWAY CENTRAL EXPRESS
Classification: Small Quantity Generator

Date form received by agency: 05/02/1996
Facility name: CONWAY CENTRAL EXPRESS
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004524630

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NJ MANIFEST:
Manifest Code: 004285519JJK
EPA ID: NYR000023424
Date Shipped: 5/23/2008
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	5/23/2008
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	5/29/2008
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	D001
Manifest Year:	2008 New Jersey Manifest Data
Quantity:	45
Unit:	G
Hand Code:	H061

Waste Code:	D001
Manifest Year:	2008 New Jersey Manifest Data
Quantity:	55
Unit:	G
Hand Code:	H141

Manifest Code:	NJA5055986
EPA ID:	NYR000023424
Date Shipped:	20040220
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	040220
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 040220
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 03290425
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5024774
EPA ID: NYR000023424
Date Shipped: 20040721
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 040721
Date Trans2 Transported Waste: 000000
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 040722
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 08170422
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5016926
EPA ID: NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Shipped:	20041022
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	041022
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	041028
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	12060425
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code: Not reported	
Manifest Year: Not reported	
Quantity: Not reported	
Unit: Not reported	
Hand Code: Not reported	

Manifest Code:	NJA5234358
EPA ID:	NYR000023424
Date Shipped:	20060111
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	060111
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 060119
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 02280621
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5234425
EPA ID: NYR000023424
Date Shipped: 20060224
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 060224
Date Trans2 Transported Waste: 000000
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 060303
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 04270621
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: 001707558JJK
EPA ID: NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Shipped:	2/13/200
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	2/13/2
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	2/22/2
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	D001
Manifest Year:	2007 New Jersey Manifest Data
Quantity:	30
Unit:	G
Hand Code:	H06

Manifest Code:	NJA5227575
EPA ID:	NYR000023424
Date Shipped:	20050302
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	050302
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 050309
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 04250525
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5016994
EPA ID: NYR000023424
Date Shipped: 20051115
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 051115
Date Trans2 Transported Waste: 000000
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 051122
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 02140621
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5016987
EPA ID: NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Shipped:	20050607
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	050607
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	050615
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	07130521
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	Not reported
Manifest Year:	Not reported
Quantity:	Not reported
Unit:	Not reported
Hand Code:	Not reported

Manifest Code:	NJA5235126
EPA ID:	NYR000023424
Date Shipped:	20050128
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	050128
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 050128
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 02250521
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5016992
EPA ID: NYR000023424
Date Shipped: 20051031
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 051031
Date Trans2 Transported Waste: 000000
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 051102
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 01060625
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5227574
EPA ID: NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Shipped:	20051212
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	051212
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	051213
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	01240621
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code: Not reported	
Manifest Year: Not reported	
Quantity: Not reported	
Unit: Not reported	
Hand Code: Not reported	

Manifest Code:	005395643JJK
EPA ID:	NYR000023424
Date Shipped:	12/17/2008
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	12/17/2008
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 12/18/2008
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: D001
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 45
Unit: G
Hand Code: H061

Manifest Code: 005068523JJK
EPA ID: NYR000023424
Date Shipped: 9/3/2008
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 9/3/2008
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 9/12/2008
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: D001
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 130
Unit: G
Hand Code: H061

Manifest Code: 005396491JJK
EPA ID: NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Shipped:	03/10/09
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	03/10/09
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	03/16/09
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	D001
Manifest Year:	2009 New Jersey Manifest Data
Quantity:	10
Unit:	G
Hand Code:	H061

Manifest Code:	NJA5235178
EPA ID:	NYR000023424
Date Shipped:	20050224
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJD045995693
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	050224
Date Trans2 Transported Waste:	000000
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 050225
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 04280521
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA5228005
EPA ID: NYR000023424
Date Shipped: 20050113
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 050113
Date Trans2 Transported Waste: 000000
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 050113
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: 02070521
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: 004276907JJK
EPA ID: NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Shipped: 7/30/2008
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 7/30/2008
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 7/31/2008
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: D001
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 185
Unit: G
Hand Code: H061

Waste Code: D002
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 35
Unit: G
Hand Code: H141

Manifest Code: 003985779JJK
EPA ID: NYR000023424
Date Shipped: 3/3/2008
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD045995693
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 3/3/2008
Date Trans2 Transported Waste: Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 3/7/2008
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: D002
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 35
Unit: G
Hand Code: H141

Waste Code: D001
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 10
Unit: G
Hand Code: H061

NY MANIFEST:
EPA ID: NYR000023424
Country: USA
Mailing Name: CONWAY CENTRAL EXPRESS
Mailing Contact: JIM BETHELL/PAT CAPUTO
Mailing Address: 49-15 MASPETH AVENUE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-381-3700

Document ID: NJA5053106
Manifest Status: Not reported
Trans1 State ID: NJD045995693
Trans2 State ID: Not reported
Generator Ship Date: 11/06/2003
Trans1 Recv Date: 11/06/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/13/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000023424
Trans1 EPA ID: NJD002200046
Trans2 EPA ID: Not reported

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

TSDF ID: XS6747
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00020
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 03

Document ID: NJA5053874
Manifest Status: Not reported
Trans1 State ID: NJD045995693
Trans2 State ID: Not reported
Generator Ship Date: 08/06/2003
Trans1 Recv Date: 08/06/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/14/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000023424
Trans1 EPA ID: NJD002200046
Trans2 EPA ID: Not reported
TSDF ID: 06747
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00040
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 03

Document ID: NJA3113708
Manifest Status: Not reported
Trans1 State ID: NJD045995693
Trans2 State ID: Not reported
Generator Ship Date: 07/01/2003
Trans1 Recv Date: 07/01/2003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/09/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000023424
Trans1 EPA ID: NJD002200046
Trans2 EPA ID: Not reported
TSDF ID: XS6747
Waste Code: D002 - NON-LISTED CORROSIVE WASTES
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 03

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	11/7/2007
Trans1 Recv Date:	11/7/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/7/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	35
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	003285495JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	2009-03-10
Trans1 Recv Date:	2009-03-10
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-03-16
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	10.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Year:	09
Manifest Tracking Num:	005396491JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H061

Document ID:	MDC0797940
Manifest Status:	Not reported
Trans1 State ID:	SCD987574647
Trans2 State ID:	NJD054126164
Generator Ship Date:	01/04/1999
Trans1 Recv Date:	01/04/1999
Trans2 Recv Date:	01/08/1999
TSD Site Recv Date:	01/13/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	MDD980554653
Trans2 EPA ID:	Not reported
TSDF ID:	HWH32399A
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00050
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00020
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	99

Document ID:	MDC0797366
Manifest Status:	Not reported
Trans1 State ID:	SCD987574647
Trans2 State ID:	NJD054126164
Generator Ship Date:	08/17/1999
Trans1 Recv Date:	08/17/1999
Trans2 Recv Date:	08/18/1999
TSD Site Recv Date:	08/19/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Trans1 EPA ID: MDD980554653
Trans2 EPA ID: Not reported
TSDF ID: HWH32399A
Waste Code: D002 - NON-LISTED CORROSIVE WASTES
Quantity: 00200
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: F003 - UNKNOWN
Quantity: 00150
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

Document ID: MDC0798720
Manifest Status: Not reported
Trans1 State ID: SCD987574647
Trans2 State ID: NJD054126164
Generator Ship Date: 05/24/1999
Trans1 Recv Date: 05/24/1999
Trans2 Recv Date: 05/26/1999
TSD Site Recv Date: 05/27/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000023424
Trans1 EPA ID: MDD980554653
Trans2 EPA ID: Not reported
TSDF ID: HWH32399A
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00075
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00035
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 99

Document ID: MDC0806510
Manifest Status: Not reported
Trans1 State ID: SCD987574647
Trans2 State ID: NJD054126164
Generator Ship Date: 10/06/1999
Trans1 Recv Date: 10/06/1999

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Trans2 Recv Date:	10/11/1999
TSD Site Recv Date:	10/12/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	MDD980554653
Trans2 EPA ID:	Not reported
TSDF ID:	HWH32399A
Waste Code:	F003 - UNKNOWN
Quantity:	00025
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	F003 - UNKNOWN
Quantity:	00035
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	99

Document ID:	MDC0806574
Manifest Status:	Not reported
Trans1 State ID:	SCD987574647
Trans2 State ID:	NJD054126164
Generator Ship Date:	07/06/1999
Trans1 Recv Date:	07/06/1999
Trans2 Recv Date:	07/07/1999
TSD Site Recv Date:	07/08/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	MDD980554653
Trans2 EPA ID:	Not reported
TSDF ID:	HWH32399A
Waste Code:	F003 - UNKNOWN
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00030
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00030
Units:	P - Pounds
Number of Containers:	001

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: D002 - NON-LISTED CORROSIVE WASTES
Quantity: 00500
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 99

Document ID: NJA5016987
Manifest Status: Not reported
Trans1 State ID: NJD045995693
Trans2 State ID: Not reported
Generator Ship Date: 06/07/2005
Trans1 Recv Date: 06/07/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 06/15/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000023424
Trans1 EPA ID: X06747
Trans2 EPA ID: Not reported
TSDF ID: NJD002200046
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00035
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00035
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: Not reported
Specific Gravity: 01.00
Waste Code: Not reported
Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: Not reported
Year: Not reported

Document ID: NJA5016992
Manifest Status: Not reported
Trans1 State ID: NJD045995693
Trans2 State ID: Not reported
Generator Ship Date: 10/31/2005
Trans1 Recv Date: 10/31/2005

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/02/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	00085
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00035
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	Not reported
Specific Gravity:	01.00
Waste Code:	Not reported
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	Not reported
Year:	Not reported

Document ID:	NJA5016994
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	11/15/2005
Trans1 Recv Date:	11/15/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/22/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00007
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	Not reported

Document ID:	NJA5235178

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2005
Trans1 Recv Date:	02/24/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/25/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00090
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00035
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	Not reported
Specific Gravity:	01.00
Waste Code:	Not reported
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	Not reported
Year:	Not reported

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	2/13/2007
Trans1 Recv Date:	2/13/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2/22/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	30
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Specific Gravity:	1
Year:	07
Manifest Tracking Num:	001707558JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	Y
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H061

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	11/7/2007
Trans1 Recv Date:	11/7/2007
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/7/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	Not reported
Quantity:	35
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1
Year:	07
Manifest Tracking Num:	003285495JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	NJA5235126
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	01/28/2005

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Trans1 Recv Date:	01/28/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/28/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00015
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	Not reported

Document ID:	NJA5227574
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	12/12/2005
Trans1 Recv Date:	12/12/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/13/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00035
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	Not reported

Document ID:	NJA5227575
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	03/02/2005
Trans1 Recv Date:	03/02/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/09/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046

CONWAY CENTRAL EXPRESS (Continued) **1004759853**

Waste Code:	D003 - NON-LISTED REACTIVE WASTES
Quantity:	00080
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	008
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	Not reported

Document ID:	NJA5228005
Manifest Status:	Not reported
Trans1 State ID:	NJD045995693
Trans2 State ID:	Not reported
Generator Ship Date:	01/13/2005
Trans1 Recv Date:	01/13/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/13/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000023424
Trans1 EPA ID:	X06747
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	Not reported

Click this hyperlink while viewing on your computer to access
62 additional NY_MANIFEST: record(s) in the EDR Site Report.

Z433 **HMIRS** **2005010881**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 12 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access
additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z434 **HMIRS** **2003123196**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 13 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access
additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z435 **49-15 MASPETH AVE** **HMIRS** **2009058608**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY 11378**
0.124 mi.
654 ft. **Site 14 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z436 **HMIRS** **2000101191**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 15 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z437 **CCX RAILROAD** **LTANKS** **S104877261**
SSW **49-15 MASPETH AVE** **HIST LTANKS** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 16 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

LTANKS:

Site ID:	66893
Spill No:	0009572
Spill Date:	11/21/2000
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/6/2006
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	4101
Investigator:	JBMCCULL
Referred To:	Not reported
Reported to Dept:	11/21/2000
CID:	205
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	11/21/2000
Spill Record Last Update:	3/6/2006
Spiller Name:	Not reported
Spiller Company:	CCX RAILROAD
Spiller Address:	49-15 MASPETH AVE
Spiller City,St,Zip:	MASPETH, NY
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	63995

CCX RAILROAD (Continued) **S104877261**

Remarks: TESTED TANK, TANK FAILED.

Material:
Site ID: 66893
Operable Unit ID: 830672
Operable Unit: 01
Material ID: 543511
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:
Region of Spill: 2
Spill Number: 0009572
Spill Date: 11/21/2000
Spill Time: 09:29
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: DEMEO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 11/21/00
Reported to Department Time: 09:29
SWIS: 63

CCX RAILROAD (Continued) **S104877261**

Spiller Contact: CALLER
Spiller Phone: ( ) -
Spiller Extention: Not reported
Spiller Name: CCX RAILROAD
Spiller Address: 49-15 MASPETH AVE
Spiller City,St,Zip: MASPETH, NY
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: ( ) -
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/21/00
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/07/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: 03/07/01 Reassigned from Saccacio to Demeo
Spill Cause: TESTED TANK, TANK FAILED.

Z438 **CON WAY CENTRAL EXPRESS XBY** **FINDS** **1007767125**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **QUEENS, NY 11378**
0.124 mi.
654 ft. **Site 17 of 21 in cluster Z**

Relative:
Higher

FINDS:

Registry ID: 110019295582

Actual:
13 ft.

Environmental Interest/Information System

CON WAY CENTRAL EXPRESS XBY (Continued) **1007767125**

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Z439 **49-15 MASPETH AVE** **HMIRS** **2008437466**
SSW **49-15 MASPETH AVE** **N/A**
< 1/8 **MASPETH, NY**
0.124 mi.
654 ft. **Site 18 of 21 in cluster Z**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

Z440 **PRESTON TRUCKING COMPANY** **UST** **U003074666**
SSW **49-40 MASPETH AVENUE** **HIST UST** **N/A**
< 1/8 **MASPETH, NY 11378** **AST**
0.125 mi. **HIST AST**
660 ft. **Site 19 of 21 in cluster Z** **MANIFEST**

Relative:
Higher

Actual:
13 ft.

UST:

Facility Id:	2-032808
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591352.72375999996
UTM Y:	4508502.7396600004

Affiliation Records:

Site Id:	243
Affiliation Type:	Owner
Company Name:	51 SOUTH PORTLAND REALTY CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	11 WEST ST
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11222
Country Code:	001
Phone:	(718) 389-0570
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	243
Affiliation Type:	Mail Contact
Company Name:	51 SOUTH PORTLAND REALTY CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	11 WEST ST
Address2:	Not reported
City:	BROOKLYN

PRESTON TRUCKING COMPANY (Continued) **U003074666**

State: NY
Zip Code: 11222
Country Code: 001
Phone: (718) 389-0570
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 243
Affiliation Type: On-Site Operator
Company Name: PRESTON TRUCKING COMPANY
Contact Type: Not reported
Contact Name: PRESTON TRUCKING COMPANY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 456-9690
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 243
Affiliation Type: Emergency Contact
Company Name: 51 SOUTH PORTLAND REALTY CORP
Contact Type: Not reported
Contact Name: MR JOHN STYER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 456-9690
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
G00 - Tank Secondary Containment - None

PRESTON TRUCKING COMPANY (Continued) **U003074666**

A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
I00 - Overfill - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
I00 - Overfill - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
I00 - Overfill - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None

PRESTON TRUCKING COMPANY (Continued) **U003074666**

D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
I00 - Overfill - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction

Tank Info:

Site ID:	243
Tank Number:	001
Tank ID:	30503
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	002
Tank ID:	30504
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	003
Tank ID:	30505
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	004
Tank ID:	30506
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	005
Tank ID:	30507
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	006
Tank ID:	30508
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	007
Tank ID:	30509
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	008
Tank ID:	30510
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	243
Tank Number:	010
Tank ID:	30512
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1946
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-032808
SPDES Number:	Not reported
Emergency Contact:	MR JOHN STYER
Emergency Telephone:	(718) 456-9690
Operator:	PRESTON TRUCKING COMPANY
Operator Telephone:	(718) 456-9690
Owner Name:	51 SOUTH PORTLAND REALTY CORP
Owner Address:	11 WEST ST
Owner City,St,Zip:	BROOKLYN, NY 11222
Owner Telephone:	(718) 389-0570
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	51 SOUTH PORTLAND REALTY CORP
Mailing Address:	11 WEST ST
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BROOKLYN, NY 11222
Mailing Contact:	Not reported
Mailing Telephone:	(718) 389-0570
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	49040 MASPETH AVENUE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	04/25/1991
Expiration Date:	07/01/1996
Renew Flag:	False

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	05/01/1961
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	05/01/1961
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	05/01/1961
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Date Closed: 05/01/1961
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 005
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19610501
Capacity (gals): 550
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 05/01/1961
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 006
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19610501
Capacity (gals): 550
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 05/01/1961
Test Method: Not reported
Deleted: False

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Updated:	True
Lat/long:	Not reported

Tank Id:	007
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	05/01/1961
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	008
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	05/01/1961
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Tank Id:	010
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	19460601
Capacity (gals):	550
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

AST:

Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Facility Id:	2-032808
Program Type:	PBS
UTM X:	591352.72375999996
UTM Y:	4508502.7396600004
Expiration Date:	N/A

Affiliation Records:

Site Id:	243
Affiliation Type:	Owner
Company Name:	51 SOUTH PORTLAND REALTY CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	11 WEST ST
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11222
Country Code:	001
Phone:	(718) 389-0570
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	243
Affiliation Type:	Mail Contact

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Company Name:	51 SOUTH PORTLAND REALTY CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	11 WEST ST
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11222
Country Code:	001
Phone:	(718) 389-0570
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	243
Affiliation Type:	On-Site Operator
Company Name:	PRESTON TRUCKING COMPANY
Contact Type:	Not reported
Contact Name:	PRESTON TRUCKING COMPANY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 456-9690
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	243
Affiliation Type:	Emergency Contact
Company Name:	51 SOUTH PORTLAND REALTY CORP
Contact Type:	Not reported
Contact Name:	MR JOHN STYER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 456-9690
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping

PRESTON TRUCKING COMPANY (Continued) **U003074666**

J02 - Dispenser - Suction
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
I00 - Overfill - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
I00 - Overfill - None
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
I00 - Overfill - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None

PRESTON TRUCKING COMPANY (Continued) **U003074666**

G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
I00 - Overfill - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction

Tank Info:

Tank Number:	009
Tank Id:	30511
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	5/1/1961
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	5/1/1961
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST AST:

PBS Number:	2-032808
SWIS Code:	6301
Operator:	PRESTON TRUCKING COMPANY
Facility Phone:	(718) 456-9690
Facility Addr2:	49040 MASPETH AVENUE
Facility Type:	TRUCKING/TRANSPORTATION
Emergency:	MR JOHN STYER
Emergency Tel:	(718) 456-9690

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	51 SOUTH PORTLAND REALTY CORP
Owner Address:	11 WEST ST
Owner City,St,Zip:	BROOKLYN, NY 11222
Federal ID:	Not reported
Owner Tel:	(718) 389-0570
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	Not reported
Mailing Name:	51 SOUTH PORTLAND REALTY CORP
Mailing Address:	11 WEST ST
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BROOKLYN, NY 11222
Mailing Telephone:	(718) 389-0570
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Certification Flag:	False
Certification Date:	04/25/1991
Expiration:	07/01/1996
Renew Flag:	False
Renew Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City Code:	01
Region:	2

Tank ID:	009
Tank Location:	ABOVEGROUND
Tank Status:	Closed-Removed
Install Date:	19610501
Capacity (Gal):	275
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing

PRESTON TRUCKING COMPANY (Continued) **U003074666**

Date Closed: 05/01/1961
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

NY MANIFEST:
EPA ID: NYP000788158
Country: USA
Mailing Name: PRESTON TRUCKING COMPANY
Mailing Contact: PRESTON TRUCKING COMPANY
Mailing Address: 49-40 MASPETH AVENUE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-456-9690

NY MANIFEST:
No Manifest Records Available

Z441 **5-GAL NOS,QUEENS** **NY Spills** **S102144045**
SSW **4940 MASPETH AVE.** **NY Hist Spills** **N/A**
< 1/8 **NYC (MASPETH), NY**
0.125 mi.
660 ft. **Site 20 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

NY Spills:
Site ID: 202437
Facility Addr2: Not reported
Facility ID: 8602633
Spill Number: 8602633
Facility Type: ER
SWIS: 4101
Investigator: UNASSIGNED
Referred To: Not reported
Spill Date: 7/22/1986
Reported to Dept: 7/22/1986
CID: Not reported
Spill Cause: Human Error
Water Affected: NONE
Spill Source: Vessel
Spill Notifier: Responsible Party
Cleanup Ceased: 7/23/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Not reported
Spill Closed Dt: 7/23/1986
Remediation Phase: 0
Date Entered In Computer: 7/28/1986
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported

5-GAL NOS,QUEENS (Continued) **S102144045**

Spiller Company:	UNK.
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	168396
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was " " 10/10/95: This is additional information about material spilled from the translation of the old spill file: LIQUID, NOS 5- GAL.
Remarks:	MARINE POLLUTION CONTROL (JIM DAVEY 5166544900) WILL CLEAN -5 GAL. PAIL ROLLED OFF TRUCK . PAIL CONTAINS CRYSALLIC ACID (CORROSIVE)

Material:

Site ID:	202437
Operable Unit ID:	899370
Operable Unit:	01
Material ID:	479059
Material Code:	0002
Material Name:	#4 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	8602633
Investigator:	Not reported
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	07/22/1986 03:00
Reported to Dept Date/Time:	07/22/86 15:40
SWIS:	63
Spiller Name:	UNK.
Spiller Contact:	Not reported

5-GAL NOS,QUEENS (Continued) **S102144045**

Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: NONE
Spill Source: 10
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 07/23/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 07/23/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/28/86
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: LIQUID, NOS 5- GAL.
Remark: MARINE POLLUTION CONTROL JIM DAVEY 5166544900) WILL CLEAN -5 GAL. PAIL ROLLED OFF TRUCK . PAIL CONTAINS CRYSALLIC ACID CORROSIVE)

Z442 **PRESTON TRUCKING COMPANY** **MANIFEST** **1009231783**
SSW **4940 MASPETH AVENUE** **N/A**
1/8-1/4 **MASPETH, NY**
0.125 mi.
662 ft. **Site 21 of 21 in cluster Z**

Relative:
Higher

Actual:
13 ft.

NY MANIFEST:

EPA ID:	NYP000787853
Country:	USA
Mailing Name:	PRESTON TRUCKING COMPANY
Mailing Contact:	PRESTON TRUCKING COMPANY
Mailing Address:	4940 MASPETH AVENUE
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-488-0000

Document ID:	NYA3028691
Manifest Status:	Completed copy
Trans1 State ID:	NY89851GC
Trans2 State ID:	Not reported
Generator Ship Date:	860725
Trans1 Recv Date:	860725
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	860725
Part A Recv Date:	860801
Part B Recv Date:	860801
Generator EPA ID:	NYP000787853
Trans1 EPA ID:	NYD049178296
Trans2 EPA ID:	Not reported
TSDF ID:	NYD049178296
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	01200
Units:	P - Pounds
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	86

AA443 **NOMAD MEDIA LLC - 49-29 MASPETH AVE** **FINDS** **1007742035**
SSW **49-29 MASPETH AVE** **N/A**
1/8-1/4 **QUEENS, NY 11378**
0.126 mi.
664 ft. **Site 5 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

FINDS:

Registry ID: 110019044041

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AA444
SSW
1/8-1/4
0.126 mi.
664 ft.

TRANSPORTATION DISPLAYS INC.
49-29 MASPETH AVENUE
MASPETH, NY 11378

Site 6 of 9 in cluster AA

HIST AST **S107781305**
N/A

Relative:
Higher

Actual:
14 ft.

HIST AST:

PBS Number:	2-151122
SWIS Code:	6301
Operator:	STEVE CHARMIN
Facility Phone:	(718) 366-6180
Facility Addr2:	49029 MASPETH AVE
Facility Type:	MANUFACTURING
Emergency:	STEVE CHARMIN
Emergency Tel:	(718) 366-6180
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	TRANSPORTATION DISPLAYS INCORPORATED
Owner Address:	275 MADISON AVENUE
Owner City,St,Zip:	NEW YORK, NY 10016
Federal ID:	Not reported
Owner Tel:	(718) 366-6180
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	STEPHEN HILLWIG
Mailing Name:	TRANSPORTATION DISPLAYS INC.
Mailing Address:	49-29 MASPETH AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Telephone:	(718) 366-6180
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	True
Certification Date:	02/19/1998
Expiration:	08/26/2002
Renew Flag:	False
Renew Date:	Not reported
Total Capacity:	4275
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City Code:	01
Region:	2
Tank ID:	050
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status:	In Service
Install Date:	19970701
Capacity (Gal):	275
Product Stored:	USED OIL

TRANSPORTATION DISPLAYS INC. (Continued) **S107781305**

Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	01
Pipe Location:	Aboveground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	00
Tank Containment:	None
Leak Detection:	00
Overfill Protection:	00
Dispenser Method:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

AA445 **TRANSPORTATION DISPLAYS INC.** **HIST UST** **U003153146**
SSW **49-29 MASPETH AVENUE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.126 mi.
664 ft. **Site 7 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

HIST UST:

PBS Number:	2-151122
SPDES Number:	Not reported
Emergency Contact:	STEVE CHARMIN
Emergency Telephone:	(718) 366-6180
Operator:	STEVE CHARMIN
Operator Telephone:	(718) 366-6180
Owner Name:	TRANSPORTATION DISPLAYS INCORPORATED
Owner Address:	275 MADISON AVENUE
Owner City,St,Zip:	NEW YORK, NY 10016
Owner Telephone:	(718) 366-6180
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	TRANSPORTATION DISPLAYS INC.
Mailing Address:	49-29 MASPETH AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	STEPHEN HILLWIG
Mailing Telephone:	(718) 366-6180
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	49029 MASPETH AVE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported

TRANSPORTATION DISPLAYS INC. (Continued) **U003153146**

Certification Flag: True
Certification Date: 02/19/1998
Expiration Date: 08/26/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 4275
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 63
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19661201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19661201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported

TRANSPORTATION DISPLAYS INC. (Continued) **U003153146**

Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 01/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19661201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19661201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported

TRANSPORTATION DISPLAYS INC. (Continued) **U003153146**

Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 005
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19661201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 010
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge, Vent Whistle
Dispenser: 0
Date Tested: 01/01/1998
Next Test Date: Not reported

TRANSPORTATION DISPLAYS INC. (Continued) **U003153146**

Missing Data for Tank:	No Missing Data
Date Closed:	11/01/2001
Test Method:	Tank Auditor
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	101
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19961001
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass coated steel
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	Fiberglass Liner (FRP)
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	Electronic
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

AA446 **CBS OUTDOOR INC** **UST** **U004064821**
SSW **49-29 MASPETH AVENUE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.126 mi.
664 ft. **Site 8 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

UST:

Facility Id:	2-151122
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2012/08/26
UTM X:	591312.21589999995
UTM Y:	4508513.4542199997

Affiliation Records:

Site Id:	4657
Affiliation Type:	On-Site Operator
Company Name:	CBS OUTDOOR INC
Contact Type:	Not reported
Contact Name:	STEVE CHARMAN
Address1:	Not reported
Address2:	Not reported

CBS OUTDOOR INC (Continued) **U004064821**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Site Id:	4657
Affiliation Type:	Mail Contact
Company Name:	CBS OUTDOOR INC
Contact Type:	Not reported
Contact Name:	DAVID DORION
Address1:	49-29 MASPETH AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Site Id:	4657
Affiliation Type:	Owner
Company Name:	CBS OUTDOOR INC
Contact Type:	V.P. OPERATIONS
Contact Name:	STEVE CHARMAN
Address1:	49-29 MASPETH AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Site Id:	4657
Affiliation Type:	Emergency Contact
Company Name:	CBS OUTDOOR INC
Contact Type:	Not reported
Contact Name:	STEVE CHARMAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported

CBS OUTDOOR INC (Continued) **U004064821**

Country Code: 999
Phone: (718) 366-6180
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: BVCAMPBE
Date Last Modified: 1/12/2011

Equipment Records:

L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
G03 - Tank Secondary Containment - Vault (w/o access)
C02 - Pipe Location - Underground/On-ground
I00 - Overfill - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B00 - Tank External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
H05 - Tank Leak Detection - In-Tank System (ATG)
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
C01 - Pipe Location - Aboveground
L08 - Piping Leak Detection - Tank Top Sump
G03 - Tank Secondary Containment - Vault (w/o access)
A00 - Tank Internal Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
L09 - Piping Leak Detection - Exempt Suction Piping
G03 - Tank Secondary Containment - Vault (w/o access)
C00 - Pipe Location - No Piping
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
K00 - Spill Prevention - None
D02 - Pipe Type - Galvanized Steel
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
J00 - Dispenser - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
F04 - Pipe External Protection - Fiberglass
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
E00 - Piping Secondary Containment - None

CBS OUTDOOR INC (Continued) **U004064821**

G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
I05 - Overfill - Vent Whistle
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
J02 - Dispenser - Suction
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
I00 - Overfill - None
I00 - Overfill - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
D02 - Pipe Type - Galvanized Steel

Tank Info:

Site ID:	4657
Tank Number:	001
Tank ID:	19308
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1996
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	4657
Tank Number:	002
Tank ID:	19309
Tank Status:	Closed - Removed

CBS OUTDOOR INC (Continued) **U004064821**

Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	1/1/1996
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	4657
Tank Number:	003
Tank ID:	19310
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1996
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	4657
Tank Number:	004
Tank ID:	19311
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1996
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	4657
Tank Number:	005
Tank ID:	19312
Tank Status:	Closed - Removed

CBS OUTDOOR INC (Continued) **U004064821**

Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1966
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	10/1/1996
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	4657
Tank Number:	010
Tank ID:	19313
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5000
Tightness Test Method:	02
Next Test Date:	Not reported
Date Tank Closed:	11/1/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	1/1/1998
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	4657
Tank Number:	101
Tank ID:	51576
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1996
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Fiberglass coated steel
Date Test:	Not reported
Register:	True
Modified By:	BVCAMPBE
Last Modified:	1/12/2011

AA447 **CBS OUTDOOR INC** **AST** **A100193889**
SSW **49-29 MASPETH AVENUE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.126 mi.
664 ft. **Site 9 of 9 in cluster AA**

Relative:
Higher

Actual:
14 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-151122
Program Type:	PBS
UTM X:	591312.21589999995
UTM Y:	4508513.4542199997
Expiration Date:	2012/08/26

Affiliation Records:

Site Id:	4657
Affiliation Type:	On-Site Operator
Company Name:	CBS OUTDOOR INC
Contact Type:	Not reported
Contact Name:	STEVE CHARMAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Site Id:	4657
Affiliation Type:	Mail Contact
Company Name:	CBS OUTDOOR INC
Contact Type:	Not reported
Contact Name:	DAVID DORION
Address1:	49-29 MASPETH AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Site Id:	4657
Affiliation Type:	Owner
Company Name:	CBS OUTDOOR INC
Contact Type:	V.P. OPERATIONS
Contact Name:	STEVE CHARMAN
Address1:	49-29 MASPETH AVENUE
Address2:	Not reported

CBS OUTDOOR INC (Continued) **A100193889**

City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Site Id:	4657
Affiliation Type:	Emergency Contact
Company Name:	CBS OUTDOOR INC
Contact Type:	Not reported
Contact Name:	STEVE CHARMAN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 366-6180
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	BVCAMPBE
Date Last Modified:	1/12/2011

Equipment Records:

L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
G03 - Tank Secondary Containment - Vault (w/o access)
C02 - Pipe Location - Underground/On-ground
I00 - Overfill - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B00 - Tank External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
H05 - Tank Leak Detection - In-Tank System (ATG)
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
C01 - Pipe Location - Aboveground
L08 - Piping Leak Detection - Tank Top Sump
G03 - Tank Secondary Containment - Vault (w/o access)
A00 - Tank Internal Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

CBS OUTDOOR INC (Continued) **A100193889**

F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
L09 - Piping Leak Detection - Exempt Suction Piping
G03 - Tank Secondary Containment - Vault (w/o access)
C00 - Pipe Location - No Piping
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
K00 - Spill Prevention - None
D02 - Pipe Type - Galvanized Steel
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
J00 - Dispenser - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
F04 - Pipe External Protection - Fiberglass
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
E00 - Piping Secondary Containment - None
G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
I05 - Overfill - Vent Whistle
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
J02 - Dispenser - Suction
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
I00 - Overfill - None
I00 - Overfill - None
J02 - Dispenser - Suction
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
D02 - Pipe Type - Galvanized Steel

Tank Info:

Tank Number: 050
Tank Id: 52992

CBS OUTDOOR INC (Continued) **A100193889**

Tank Location:	3
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	7/1/1997
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	BVCAMPBE
Last Modified:	1/12/2011

AC448 **CHERRY ST. & SCOTT ST.** **NY Spills** **S102143845**
SW **CHERRY ST/SCOTT ST** **NY Hist Spills** **N/A**
1/8-1/4 **BROOKLYN, NY**
0.126 mi.
667 ft. **Site 2 of 3 in cluster AC**

Relative:
Higher

Actual:
15 ft.

NY Spills:

Site ID:	176920
Facility Addr2:	Not reported
Facility ID:	9213507
Spill Number:	9213507
Facility Type:	ER
SWIS:	2401
Investigator:	SJMILLER
Referred To:	Not reported
Spill Date:	3/8/1993
Reported to Dept:	3/8/1993
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/26/2002
Remediation Phase:	0
Date Entered In Computer:	3/9/1993
Spill Record Last Update:	12/26/2002
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	148677
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was

CHERRY ST. & SCOTT ST. (Continued) **S102143845**

"MILLER" 10/10/95: This is additional information about material spilled from the translation of the old spill file: LOOKS LIKE CRUDE OIL.

Remarks: OIL DISCOV. ON CHERRY ST. NEAR PRESTON TRUCKING FENCE - DYKES W/SPEEDI-DRI. & SAWDUST - NOTIF. USEPA - NOTIFIED NYC SANITATION TO SAND STREET - P/U WILL DISPOSE CONTAM. MATERIAL.

Material:

Site ID:	176920
Operable Unit ID:	980679
Operable Unit:	01
Material ID:	403289
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9213507
Investigator:	MILLER
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	03/08/1993 07:00
Reported to Dept Date/Time:	03/08/93 13:26
SWIS:	61
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	12

CHERRY ST. & SCOTT ST. (Continued) **S102143845**

Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/09/93
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/09/95
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 10
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: LOOKS LIKE CRUDE OIL.
Remark: OIL DISCOV. ON CHERRY ST. NEAR PRESTON TRUCKING FENCE - DYKES W/SPEEDI-DRI. SAWDUST - NOTIF. USEPA - NOTIFIED NYC SANITATION TO SAND STREET - P/U WILL DISPOSE CONTAM. MATERIAL.

V449 **BQE SERVICES INC-475 SCOTT AVE** **FINDS** **1007795749**
WSW **475 SCOTT AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11222**
0.127 mi.
673 ft. **Site 28 of 30 in cluster V**

Relative:
Higher

FINDS:

Registry ID: 110019582575

Actual:
15 ft.

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking

BQE SERVICES INC-475 SCOTT AVE (Continued) **1007795749**

environmental facility information found across the State.

V450 **WASTE MANAGEMENT OF NEW YORK, LLC** **HIST UST** **U000411919**
WSW **475 SCOTT AVENUE AKA** **HIST AST** **N/A**
1/8-1/4 **BROOKLYN, NY 11222**
0.127 mi.
673 ft. **Site 29 of 30 in cluster V**

Relative:
Higher

Actual:
15 ft.

HIST UST:

PBS Number:	2-600179
SPDES Number:	Not reported
Emergency Contact:	CARLOS RIVERA
Emergency Telephone:	(718) 387-2794
Operator:	CARLOS RIVERA
Operator Telephone:	(718) 387-2794
Owner Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Owner Address:	123 VARICK AVENUE
Owner City,St,Zip:	BROOKLYN, NY 11237
Owner Telephone:	(718) 533-5310
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Mailing Address:	123 VARICK AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BROOKLYN, NY 11237
Mailing Contact:	JAY KAPLAN
Mailing Telephone:	(718) 533-5310
Owner Mark:	Second Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	75 THOMAS STREET
SWIS ID:	6101
Old PBS Number:	Not reported
Facility Type:	OTHER
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	03/23/2001
Expiration Date:	06/11/2006
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	2550
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	61
Town or City:	01
Region:	2
Tank Id:	001

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U000411919**

Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19901001
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Other
Tank Internal:	None
Tank External:	None
Pipe Location:	None
Pipe Type:	OTHER
Pipe Internal:	None
Pipe External:	None
Second Containment:	Vault (w/access)
Leak Detection:	41
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	06/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19901001
Capacity (gals):	2000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Other
Tank Internal:	None
Tank External:	None
Pipe Location:	None
Pipe Type:	OTHER
Pipe Internal:	None
Pipe External:	None
Second Containment:	Other
Leak Detection:	41
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	06/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19990601

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U000411919**

Capacity (gals):	2000
Product Stored:	DIESEL
Tank Type:	Fiberglass coated steel
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Impressed Current
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Automatic Shut-Off
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

HIST AST:

PBS Number:	2-600179
SWIS Code:	6101
Operator:	CARLOS RIVERA
Facility Phone:	(718) 387-2794
Facility Addr2:	75 THOMAS STREET
Facility Type:	OTHER
Emergency:	CARLOS RIVERA
Emergency Tel:	(718) 387-2794
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Owner Address:	123 VARICK AVENUE
Owner City,St,Zip:	BROOKLYN, NY 11237
Federal ID:	Not reported
Owner Tel:	(718) 533-5310
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	JAY KAPLAN
Mailing Name:	WASTE MANAGEMENT OF NEW YORK, LLC
Mailing Address:	123 VARICK AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BROOKLYN, NY 11237
Mailing Telephone:	(718) 533-5310
Owner Mark:	Second Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	False
Certification Date:	03/23/2001
Expiration:	06/11/2006
Renew Flag:	False
Renew Date:	Not reported

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U000411919**

Total Capacity: 2550
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City Code: 01
Region: 2

Tank ID: 004
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 275
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 1
Pipe Location: None
Pipe Type: NONE
Pipe Internal: None
Pipe External: 0
Tank Containment: Excavation/Tranch Liner
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Tank ID: 005
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 275
Product Stored: USED OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 1
Pipe Location: None
Pipe Type: NONE
Pipe Internal: None
Pipe External: 0
Tank Containment: Excavation/Tranch Liner
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction

WASTE MANAGEMENT OF NEW YORK, LLC (Continued) **U000411919**

Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

V451 **WASTE MANAG.** **LTANKS** **S107410462**
WSW **475 SCOTT AVE** **N/A**
1/8-1/4 **BROOKLYN, NY**
0.127 mi.
673 ft. **Site 30 of 30 in cluster V**

Relative:
Higher

Actual:
15 ft.

LTANKS:

Site ID:	352065
Spill No:	0506785
Spill Date:	4/18/2005
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/29/2006
Facility Addr2:	Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	2401
Investigator:	rmpiper
Referred To:	Not reported
Reported to Dept:	9/2/2005
CID:	444
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	9/2/2005
Spill Record Last Update:	8/29/2006
Spiller Name:	WASTE MANAGMENT
Spiller Company:	WASTE MANAG.
Spiller Address:	475 SCOTT AVE
Spiller City,St,Zip:	BROOKLYN, NY
Spiller County:	001
Spiller Contact:	WASTE MANAGMENT
Spiller Phone:	(631) 864-4200
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	299364
Remarks:	2000 GALLON DIESEL: TEST CAME BACK FINDING CONTAMINATION

Material:

Site ID:	352065
Operable Unit ID:	1109580
Operable Unit:	01

WASTE MANAG. (Continued) **S107410462**

Material ID:	2099589
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

AD452 **NABISCO** **UST** **U000412067**
East **58-19 MASPETH AVENUE** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.132 mi.
699 ft. **Site 1 of 3 in cluster AD**

Relative:
Higher

Actual:
39 ft.

UST:

Facility Id:	2-600351
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591853.68015000003
UTM Y:	4508586.7553200005

Affiliation Records:

Site Id:	22334
Affiliation Type:	Owner
Company Name:	RIDGEWOOD ART WOODCRAFT INC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	58-24 MAURICE AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 894-7972
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

NABISCO (Continued) **U000412067**

Site Id:	22334
Affiliation Type:	On-Site Operator
Company Name:	NABISCO
Contact Type:	Not reported
Contact Name:	ADRIEN MONGUILLOT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 894-6190
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	22334
Affiliation Type:	Mail Contact
Company Name:	RIDGEWOOD ART WOODCRAFT INC
Contact Type:	Not reported
Contact Name:	A SAMIDE
Address1:	58-24 MAURICE AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 894-7972
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	22334
Affiliation Type:	Emergency Contact
Company Name:	RIDGEWOOD ART WOODCRAFT INC
Contact Type:	Not reported
Contact Name:	ADRIEN MONGUILLOT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 631-1608
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

NABISCO (Continued) **U000412067**

I05 - Overfill - Vent Whistle
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
I05 - Overfill - Vent Whistle
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J00 - Dispenser - None

Tank Info:

Site ID:	22334
Tank Number:	001
Tank ID:	42294
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	1080
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	3/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Site ID:	22334
Tank Number:	002
Tank ID:	42295
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	3/1/1993
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

NABISCO (Continued) **U000412067**

PBS Number:	2-600351
SPDES Number:	Not reported
Emergency Contact:	ADRIEN MONGUILLOT
Emergency Telephone:	(718) 631-1608
Operator:	ADRIEN MONGUILLOT
Operator Telephone:	(718) 894-6190
Owner Name:	RIDGEWOOD ART WOODCRAFT INC
Owner Address:	58-24 MAURICE AVENUE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 894-7972
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	RIDGEWOOD ART WOODCRAFT INC
Mailing Address:	58-24 MAURICE AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	A SAMIDE
Mailing Telephone:	(718) 894-7972
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	58019 MASPETH AVENUE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	10/09/1991
Expiration Date:	09/30/1996
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	1080
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON

NABISCO (Continued) **U000412067**

Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	03/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	03/01/1993
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

AD453 **RIDGEWOOD ART WOODCRAFT** **RCRA-NonGen** **1004755457**
East **58-24 MAURICE AVE** **FINDS** **NY0000002675**
1/8-1/4 **LONG ISLAND CITY, NY 11385** **MANIFEST**
0.132 mi.
699 ft. **Site 2 of 3 in cluster AD**

Relative:
Higher

Actual:
39 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	RIDGEWOOD ART WOODCRAFT
Facility address:	58-24 MAURICE AVE LONG ISLAND CITY, NY 11385
EPA ID:	NY0000002675
Mailing address:	MAURICE AVE LONG ISLAND CITY, NY 11385
Contact:	ADOLF SAMIDE
Contact address:	MAURICE AVE

RIDGEWOOD ART WOODCRAFT (Continued) **1004755457**

LONG ISLAND CITY, NY 11385
Contact country: US
Contact telephone: (718) 894-7992
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: RIDGEWOOD ART WOODCRAFT
Owner/operator address: 58-24 MAURICE AVE
LONG ISLAND CITY, NY 11385
Owner/operator country: US
Owner/operator telephone: (718) 894-7992
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: RIDGEWOOD ART WOODCRAFT
Owner/operator address: 58-24 MAURICE AVE
LONG ISLAND CITY, NY 11385
Owner/operator country: US
Owner/operator telephone: (718) 894-7992
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: RIDGEWOOD ART WOODCRAFT
Classification: Not a generator, verified

Date form received by agency: 09/22/1993
Facility name: RIDGEWOOD ART WOODCRAFT
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

RIDGEWOOD ART WOODCRAFT (Continued) **1004755457**

FINDS:

Registry ID: 110007981979

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID:	NY0000002675
Country:	USA
Mailing Name:	RIDEWOOD ART WOODCRAFT
Mailing Contact:	ADRIEN MONGUILLOT
Mailing Address:	58-24 MAURICE AVE
Mailing Address 2:	Not reported
Mailing City:	LONG ISLAND CITY
Mailing State:	NY
Mailing Zip:	11385
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-894-7992

Document ID:	NYB5177151
Manifest Status:	Completed copy
Trans1 State ID:	PD9938
Trans2 State ID:	Not reported
Generator Ship Date:	931021
Trans1 Recv Date:	931021
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	931021
Part A Recv Date:	Not reported
Part B Recv Date:	931103
Generator EPA ID:	NY0000002675
Trans1 EPA ID:	NYD082785429
Trans2 EPA ID:	Not reported
TSDF ID:	NYD082785429
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00040

RIDGEWOOD ART WOODCRAFT (Continued) **1004755457**

Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	93

---

454 **VIKING CRITERION** **UST U003712154**
NNE **55-30 46TH STREET** **HIST UST N/A**
1/8-1/4 **MASPETH, NY 11378**
0.135 mi.
712 ft.

Relative:
Higher

Actual:
75 ft.

UST:

Facility Id:	2-604380
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	590979.13791000005
UTM Y:	4509258.5496699996

Affiliation Records:

Site Id:	26254
Affiliation Type:	On-Site Operator
Company Name:	VIKING CRITERION
Contact Type:	Not reported
Contact Name:	SHELDON KORN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 392-7400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	26254
Affiliation Type:	Emergency Contact
Company Name:	SHELDON KORN
Contact Type:	Not reported
Contact Name:	SHELDON KORN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 392-7400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT

VIKING CRITERION (Continued) **U003712154**

Date Last Modified: 3/4/2004

Site Id: 26254
Affiliation Type: Owner
Company Name: SHELDON KORN
Contact Type: Not reported
Contact Name: Not reported
Address1: 55-30 46TH STREET
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 392-7400
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 26254
Affiliation Type: Mail Contact
Company Name: CIKING CRITERION
Contact Type: Not reported
Contact Name: SHELDON KORN
Address1: 55-30 46TH STREET
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 392-7400
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

G01 - Tank Secondary Containment - Diking (Aboveground)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
I00 - Overfill - None
J00 - Dispenser - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
J00 - Dispenser - None

VIKING CRITERION (Continued) **U003712154**

B00 - Tank External Protection - None
G01 - Tank Secondary Containment - Diking (Aboveground)
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
J00 - Dispenser - None
B00 - Tank External Protection - None
J00 - Dispenser - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
I00 - Overfill - None

Tank Info:

Site ID:	26254
Tank Number:	001
Tank ID:	57498
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	12/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Site ID:	26254
Tank Number:	002
Tank ID:	57499
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	12/1/1999
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

VIKING CRITERION (Continued) **U003712154**

Site ID: 26254

Tank Number: 003
Tank ID: 57500
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 12/1/1999
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Site ID: 26254

Tank Number: 004
Tank ID: 57501
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 10000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 12/1/1999
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:
PBS Number: 2-604380
SPDES Number: Not reported
Emergency Contact: SHELDON KORN
Emergency Telephone: (718) 392-7400
Operator: SHELDON KORN
Operator Telephone: (718) 392-7400
Owner Name: SHELDON KORN
Owner Address: 55-30 46TH STREET
Owner City,St,Zip: MASPETH, NY 11378
Owner Telephone: (718) 392-7400
Owner Type: Private Resident
Owner Subtype: Not reported
Mailing Name: CIKING CRITERION
Mailing Address: 55-30 46TH STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: MASPETH, NY 11378
Mailing Contact: SHELDON KORN
Mailing Telephone: (718) 392-7400

VIKING CRITERION (Continued) **U003712154**

Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	Not reported
Expiration Date:	12/28/2004
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	08
Leak Detection:	Not reported
Overfill Prot:	Not reported
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	12/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND

VIKING CRITERION (Continued) **U003712154**

Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	08
Leak Detection:	Not reported
Overfill Prot:	Not reported
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	12/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	08
Leak Detection:	Not reported
Overfill Prot:	Not reported
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	12/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	10000

VIKING CRITERION (Continued) **U003712154**

Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Not reported
Leak Detection:	Not reported
Overfill Prot:	Not reported
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	12/01/1999
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

---

455 **ELM COATED FABRICS DIVISION** **RCRA-NonGen** **1000108044**
SSE **57-27 49TH ST** **FINDS** **NYD089724975**
1/8-1/4 **MASPETH, NY 11378**
0.139 mi.
733 ft.

Relative:
Higher

Actual:
12 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	ELM COATED FABRICS DIVISION
Facility address:	57-27 49TH ST MASPETH, NY 113782013
EPA ID:	NYD089724975
Mailing address:	STEWART AVE BROOKLYN, NY 11237
Contact:	Not reported
Contact address:	STEWART AVE BROOKLYN, NY 11237
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	KALEX CHEMICAL PRODUCTS INC
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

ELM COATED FABRICS DIVISION (Continued) **1000108044**

Owner/operator name: KALEX CHEMICAL PRODUCTS INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: ELM COATED FABRICS DIVISION
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: ELM COATED FABRICS DIVISION
Classification: Not a generator, verified

Date form received by agency: 01/27/1983
Facility name: ELM COATED FABRICS DIVISION
Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 06/24/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004373730

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of

ELM COATED FABRICS DIVISION (Continued) **1000108044**

events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

X456 **VEHICARE NORTHERN NJ CO INC** **RCRA-NonGen** **1001113354**
ENE **58-15 MAURICE AVE** **FINDS** **NYR000023440**
1/8-1/4 **MASPETH, NY 11378**
0.140 mi.
737 ft. **Site 8 of 12 in cluster X**

Relative:
Higher

Actual:
29 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	VEHICARE NORTHERN NJ CO INC
Facility address:	58-15 MAURICE AVE MASPETH, NY 11378
EPA ID:	NYR000023440
Mailing address:	MAURICE AVE MASPETH, NY 11378
Contact:	Not reported
Contact address:	MAURICE AVE MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	JOHN OKANE
Owner/operator address:	72-01 GRAND AVE MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 526-1225
Legal status:	Other
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	JOHN OKANE
Owner/operator address:	72-01 GRAND AVE MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 526-1225
Legal status:	Other
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No

VEHICARE NORTHERN NJ CO INC (Continued) **1001113354**

Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: VEHICARE NORTHERN NJ CO INC
Classification: Not a generator, verified

Date form received by agency: 09/10/1996
Facility name: VEHICARE NORTHERN NJ CO INC
Classification: Not a generator, verified

Date form received by agency: 05/06/1996
Facility name: VEHICARE NORTHERN NJ CO INC
Classification: Not a generator, verified

Violation Status: No violations found

FINDS:

Registry ID: 110004524658

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

X457 **58-24 MAURICE** **LTANKS** **S105996055**
ENE **58-24 MAURICE AV** **N/A**
1/8-1/4 **MASPETH, NY**
0.145 mi.
768 ft. **Site 9 of 12 in cluster X**

Relative:
Higher

Actual:
28 ft.

LTANKS:
Site ID: 97350
Spill No: 0202678
Spill Date: 6/10/2002
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 9/1/2005
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 4101

58-24 MAURICE (Continued) **S105996055**

Investigator:	RWAUSTIN
Referred To:	Not reported
Reported to Dept:	6/12/2002
CID:	405
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	6/12/2002
Spill Record Last Update:	9/1/2005
Spiller Name:	DAVE FAZIN
Spiller Company:	RIDGEWOOD ART WOODCRAFT
Spiller Address:	58-24 MAURICE AV
Spiller City,St,Zip:	MASPETH, NY 11378-
Spiller County:	001
Spiller Contact:	DAVE FAZIN
Spiller Phone:	(516) 939-2959
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	86778
Remarks:	tank cleaners will be digging up the tank and disconnecting everything and doing a tank only test - jeff vought advised

Material:

Site ID:	97350
Operable Unit ID:	855781
Operable Unit:	01
Material ID:	520523
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

X458 **RIDGEWOOD ART WOODCRAFT INC** **UST** **U004048140**
ENE **58-24 MAURICE AVENUE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.145 mi.
768 ft. **Site 10 of 12 in cluster X**

Relative:
Higher

Actual:
28 ft.

UST:

Facility Id:	2-607614
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591903.56721999997
UTM Y:	4508664.4242099999

Affiliation Records:

Site Id:	29466
Affiliation Type:	Mail Contact
Company Name:	RIDGEWWOD ART WOODCRAFT INC
Contact Type:	Not reported
Contact Name:	ADOLPH SAMIDE
Address1:	58- 24 MAURICE AVENUE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 894-7992
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	8/22/2005

Site Id:	29466
Affiliation Type:	On-Site Operator
Company Name:	RIDGEWOOD ART WOODCRAFT INC
Contact Type:	Not reported
Contact Name:	ADOLPH SAMIDE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 894-7992
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	29466
Affiliation Type:	Owner
Company Name:	RIDGEWOOD ART WOODCRAFT INC
Contact Type:	PRES.
Contact Name:	ADOLPH SAMIDE
Address1:	58-24 MAURICE AVE
Address2:	Not reported

RIDGEWOOD ART WOODCRAFT INC (Continued) **U004048140**

City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 894-7992
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	8/22/2005

Site Id:	29466
Affiliation Type:	Emergency Contact
Company Name:	RIDGEWOOD ART WOODCRAFT INC
Contact Type:	Not reported
Contact Name:	ADOLPH SAMIDE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 894-7992
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C03 - Pipe Location - Aboveground/Underground Combination
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
I05 - Overfill - Vent Whistle
H00 - Tank Leak Detection - None
C03 - Pipe Location - Aboveground/Underground Combination
G00 - Tank Secondary Containment - None
I05 - Overfill - Vent Whistle
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
L09 - Piping Leak Detection - Exempt Suction Piping
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None

Tank Info:

Site ID:	29466

Tank Number:	01
Tank ID:	63263
Tank Status:	Closed - In Place

RIDGEWOOD ART WOODCRAFT INC (Continued) **U004048140**

Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	1080
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	8/18/2005
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	8/22/2005
Site ID:	29466
Tank Number:	02
Tank ID:	63264
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	2500
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	8/18/2005
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/19/2002
Register:	True
Modified By:	NRLOMBAR
Last Modified:	8/22/2005

X459 **INDUSTRIAL BUILDING** **NY Spills** **S107408474**
ENE **58-24 MAURICE AVE** **N/A**
1/8-1/4 **MASPETH, NY**
0.145 mi.
768 ft. **Site 11 of 12 in cluster X**

Relative:
Higher

Actual:
28 ft.

NY Spills:

Site ID:	351641
Facility Addr2:	Not reported
Facility ID:	0506425
Spill Number:	0506425
Facility Type:	ER
SWIS:	4101
Investigator:	KSTANG
Referred To:	Not reported
Spill Date:	8/24/2005
Reported to Dept:	8/24/2005
CID:	407
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported

INDUSTRIAL BUILDING (Continued) **S107408474**

Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	6/28/2007
Remediation Phase:	0
Date Entered In Computer:	8/24/2005
Spill Record Last Update:	6/28/2007
Spiller Name:	ART SAMIDE
Spiller Company:	INDUSTRIAL BUILDING
Spiller Address:	5824 VORHEES AVE
Spiller City,St,Zip:	MASPETH, NY
Spiller Company:	001
Contact Name:	ART SAMIDE
Contact Phone:	(718) 894-7992
DEC Region:	2
DER Facility ID:	298913
DEC Memo:	Soil sampling conducted during tank closure found contaminated soil Contaminated Soil Letter sent to PBS owner: Mr. Adolph Samide Ridgewood Art Woodcraft Inc. 58-24 Maurice Ave. Maspeth, NY 11378 9/1/05 - Austin - Rec'd call from Jaoel Rogers of Gannett Fleming. They are investigating this tank as part of owner's desire to close out any liabilities on his property. Tank was opened/cleaned out, and coupons cut on sides and bottom to conduct soil sampling. They found excursions above TAGM in samples bellow tank bottom. They wish to dis a test pit through bottom, to further explore the extent of the contamination. If the contamination is captured through this effort, they will conduct post-ex sampling to confirm the removal and submit the results. If the test pit yields even more contamination is present, they will contact the DEC project manager for further guidance on how to proceed with the delineation of the contamination. It is noted that the tank lies beneath the basement floor of this facility, within the foundation, so care must be taken in any excavation work. This was told to Mr. Rogers, and he acknowledged this issue. Spill is being reassigned to Sharif Rahman, due to his prior involvement with this location via spill # 0202678. That spill was closed, and referenced to this spill report, for further action. See the '02 spill report, for further info. - end 9/9/05-Vought-Spoke to Joel Rogers (Gannett Fleming 516-671-8440). One of the bottom endpoint samples was contaminated. PID contamination extended to 5' below tank bottom. No construction plans for building. Well will be installed upgradient and at source area and monitored. Geoprobe delineation will be performed and groundwater samples will be taken. Upon collection of groundwater samples determination will be made for either further excavation and or spill closure with quarterly groundwater monitoring. Gannett Fleming will contact Rahaman with groundwater sample results. 12/09/05-Sharif// Case was transferred from S.Rahman to Koon Tang for reassignment. 3/3/06 - Joe Rogers called. He explained that he has excavated >50 yrds of contaminated soil under the tank. PID readings of bottom of excavation range from ND to 400 ppm. The 400 ppm reading was taken at a rocky area, and is hard to collect soil for lab analysis. One soil sample was collected and the result is ND for VOCs and SVOCs. One GW sample about 50 feet from the excavation was taken and the only compound detected is trimethylbenzene at 24 ppb. Asked Joe Rogers to try to collect 2 more water or soil samples at the water table to make sure that no free phase product on the GW table, then submit a closur petition. - KST

INDUSTRIAL BUILDING (Continued) **S107408474**

11/04/07 - Vadim Brevdo spoke with Brian Dortch (631-234-4280). Brian advised that they completed supplemental sampling requested by Koon Tang above, and will be submitting spill closure petition report. V. Brevdo 05/11/07 - Brian Dorch is leaving Gannett Flemming. New contact person is Anthony Vanatta. 516-671-8440. 06/21/07 - Returned call to Anthony Vanatta of Gannett Fleming. I asked that CD with the February 2007 Spill Closure Report be submitted to me so that I can proceed with spill closure. No NFA seems to be needed. No aubstantial groundwater contamination - the highest levels in the groundwater are total xylens at up to 120 ppb levels. Samples at gw table did not show any free product. Tanks have been removed and soil associated with tanks have been excavated. Spill can be closed. VB 06/28/07 - CD with Closure Report received on 6/28/07. Spill has been closed on 6/28/2007 based on low concentrations of xylenes in groundwater, absence of free product. Tanks have been removed and contamintated soil associated with tanks has been excavated. VB

Remarks: Not reported

Material:

Site ID:	351641
Operable Unit ID:	1109141
Operable Unit:	01
Material ID:	2099128
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

X460 **RIDGEWOOD FURNITURE-MAURICE AVE** **FINDS** **1007790604**
ENE **58-24 MAURICE AVENUE** **N/A**
1/8-1/4 **QUEENS, NY 11378**
0.145 mi.
768 ft. **Site 12 of 12 in cluster X**

Relative:
Higher

Actual:
28 ft.

FINDS:

Registry ID: 110019530989

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department

RIDGEWOOD FURNITURE-MAURICE AVE (Continued) **1007790604**

of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AE461 **AWTSCO NEW YORK CORP** **RCRA-NonGen** **1004760491**
NNE **55-15 43RD ST** **FINDS** **NYR000046706**
1/8-1/4 **MASPETH, NY 11378**
0.146 mi.
771 ft. **Site 1 of 9 in cluster AE**

Relative:
Higher

Actual:
38 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	AWTSCO NEW YORK CORP
Facility address:	55-15 43RD ST MASPETH, NY 11378
EPA ID:	NYR000046706
Mailing address:	43RD ST MASPETH, NY 11378
Contact:	BILL KUBLER
Contact address:	43RD ST MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 786-7788
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	BERNARD ROBINSON
Owner/operator address:	55-15 43RD ST MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 786-7788
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	BERNARD ROBINSON
Owner/operator address:	55-15 43RD ST MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 786-7788
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No

AWTSCO NEW YORK CORP (Continued) **1004760491**

Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Historical Generators:

Date form received by agency:	01/01/2006
Facility name:	AWTSCO NEW YORK CORP
Classification:	Not a generator, verified

Date form received by agency:	11/10/1997
Facility name:	AWTSCO NEW YORK CORP
Classification:	Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004538439

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

AE462 **ALLMANDINGER PROPERTIES, INC.** **UST** **U003128254**
NNE **55-15 43RD STREET** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.146 mi.
771 ft. **Site 2 of 9 in cluster AE**

Relative:
Higher

Actual:
38 ft.

UST:

Facility Id:	2-601714
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	590731.83859000006
UTM Y:	4509327.6847799998

Affiliation Records:

Site Id:	23676
Affiliation Type:	Emergency Contact
Company Name:	ALLMANDINGER PROP., INC. C/O CAROL JO ALLMANDINGER
Contact Type:	Not reported
Contact Name:	ALLMANDINGER PROP.
Address1:	Not reported
Address2:	Not reported
City:	Not reported

ALLMANDINGER PROPERTIES, INC. (Continued) **U003128254**

State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 746-1769
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 23676
Affiliation Type: Mail Contact
Company Name: TANK SPECIALISTS, INC.
Contact Type: Not reported
Contact Name: MARK A. MILLWATER
Address1: 2 PARK PLACE
Address2: Not reported
City: GLEN COVE
State: NY
Zip Code: 11542
Country Code: 001
Phone: (516) 759-9318
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 23676
Affiliation Type: Owner
Company Name: ALLMANDINGER PROP., INC. C/O CAROL JO ALLMANDINGER
Contact Type: Not reported
Contact Name: Not reported
Address1: 160-32 12TH ROAD
Address2: Not reported
City: BEECHHURST
State: NY
Zip Code: 11357
Country Code: 001
Phone: (718) 746-1769
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 23676
Affiliation Type: On-Site Operator
Company Name: ALLMANDINGER PROPERTIES, INC.
Contact Type: Not reported
Contact Name: ALLMANDINGER PROP.
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001

ALLMANDINGER PROPERTIES, INC. (Continued) **U003128254**

Phone: (718) 746-1769
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None

Tank Info:

Site ID: 23676

Tank Number: 002
Tank ID: 47581
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 5000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 3/11/1994
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Site ID: 23676

Tank Number: 003
Tank ID: 47582
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 5000
Tightness Test Method: NN

ALLMANDINGER PROPERTIES, INC. (Continued) **U003128254**

Next Test Date:	Not reported
Date Tank Closed:	3/11/1994
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-601714
SPDES Number:	Not reported
Emergency Contact:	ALLMANDINGER PROP.
Emergency Telephone:	(718) 746-1769
Operator:	ALLMANDINGER PROP.
Operator Telephone:	(718) 746-1769
Owner Name:	ALLMANDINGER PROP., INC. C/O CAROL JO ALLMANDINGER
Owner Address:	160-32 12TH ROAD
Owner City,St,Zip:	BEECHHURST, NY 11357
Owner Telephone:	(718) 746-1769
Owner Type:	Private Resident
Owner Subtype:	Not reported
Mailing Name:	TANK SPECIALISTS, INC.
Mailing Address:	2 PARK PLACE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	GLEN COVE, NY 11542
Mailing Contact:	MARK A. MILLWATER
Mailing Telephone:	(516) 759-9318
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	55015 43RD STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	01/28/1994
Expiration Date:	01/27/1999
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	10000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

ALLMANDINGER PROPERTIES, INC. (Continued) **U003128254**

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Temporarily Out Of Service
Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	12/27/1987
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Temporarily Out Of Service
Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	12/27/1987
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

AF463 **RAJA FOODS** **ICIS** **1011526128**
NE **56-05 55TH DRIVE MASPETH NY 11378** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.147 mi.
774 ft. **Site 1 of 4 in cluster AF**

Relative:
Higher

Actual:
33 ft.

ICIS:

Enforcement Action ID:	02-2004-5204
FRS ID:	110017713820
Program ID:	NCDB I02#2004040623484 1
Action Name:	RADHASWAMY INC, DBA RAJA FOODS
Facility Name:	RAJA FOODS
Facility Address:	56-05 55TH DRIVE MASPETH NY 11378 MASPETH, New York 11378
Enforcement Action Type:	FIFRA 14A Action For Penalty
Facility County:	Queens
EPA Region #:	3

Enforcement Action ID:	02-2004-5204
FRS ID:	110017713820
Program ID:	NCDB D02#F-02-2004-5204
Action Name:	RADHASWAMY INC, DBA RAJA FOODS
Facility Name:	RADHASWAMY INC, DBA RAJA FOODS
Facility Address:	56-05 55TH DRIVE MASPETH NY 11378 MASPETH, New York 11378
Enforcement Action Type:	FIFRA 14A Action For Penalty
Facility County:	Queens
EPA Region #:	3

Enforcement Action ID:	02-2004-5204
FRS ID:	110017713820
Program ID:	FRS 110017713820
Action Name:	RADHASWAMY INC, DBA RAJA FOODS
Facility Name:	RAJA FOODS
Facility Address:	56-05 55TH DRIVE MASPETH NY 11378 MASPETH, New York 11378
Enforcement Action Type:	FIFRA 14A Action For Penalty
Facility County:	Queens
EPA Region #:	3

Program ID:	FRS 110017713820
Facility Name:	RAJA FOODS
Address:	56-05 55TH DRIVE
Tribal Indicator:	N
Fed Facility:	Not reported
NAIC Code:	Not reported
SIC Code:	2879

Program ID:	NCDB D02#F-02-2004-5204
Facility Name:	RAJA FOODS
Address:	56-05 55TH DRIVE
Tribal Indicator:	N
Fed Facility:	Not reported
NAIC Code:	Not reported
SIC Code:	2879

Program ID:	NCDB I02#2004040623484 1
Facility Name:	RAJA FOODS

RAJA FOODS (Continued) **1011526128**

Address: 56-05 55TH DRIVE
Tribal Indicator: N
Fed Facility: Not reported
NAIC Code: Not reported
SIC Code: 2879

AF464 **RAJA FOODS** **FINDS** **1007465119**
NE **56-05 55TH DRIVE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.147 mi.
774 ft. **Site 2 of 4 in cluster AF**

Relative:
Higher

Actual:
33 ft.

FINDS:

Registry ID: 110017713820

Environmental Interest/Information System

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

AF465 **RADHASWAMY INC, DBA RAJA FOODS** **FTTS** **1008187961**
NE **56-05 55TH DR** **HIST FTTS** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.147 mi.
774 ft. **Site 3 of 4 in cluster AF**

Relative:
Higher

Actual:
33 ft.

FTTS:

Case Number: Not reported
Docket Number: F-02-2004-5204
Complaint Issue Date: 06/24/04
Abatement Amount: 0.0000
Proposed Penalty: 67000.0000
Final Assessment: 32830.0000
Final Order Date: 09/28/04
Close Date: / /
Violations(s): Sold or distributed a pesticide NOT REGISTERED under section 3 or was CANCELLED or SUSPENDED.

RADHASWAMY INC, DBA RAJA FOODS (Continued) **1008187961**

HIST FTTS:
Case Number: Not reported
Docket Number: F-02-2004-5204
Complaint Issue Date: 06/24/2004
Abatement Amount: 0.0000
Proposed Penalty: 67000.0000
Final Assessment: 32830.0000
Final Order Date: 09/28/2004
Close Date: / /
Violations(s): Sold or distributed a pesticide NOT REGISTERED under section 3 or was CANCELLED or SUSPENDED.

AF466 **INTERSTATE ENVELOPE MFG CORP** **RCRA-NonGen** **1000218891**
NE **56-15 55TH DR** **FINDS** **NYD003925179**
1/8-1/4 **MASPETH, NY 11378** **MANIFEST**
0.149 mi.
787 ft. **Site 4 of 4 in cluster AF**

Relative:
Higher

Actual:
34 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: INTERSTATE ENVELOPE MFG CORP
Facility address: 56-15 55TH DR
MASPETH, NY 11378
EPA ID: NYD003925179
Mailing address: 55TH DR
MASPETH, NY 11378
Contact: ALFRED WILKOWSKI
Contact address: 55TH DR
MASPETH, NY 11378
Contact country: US
Contact telephone: (718) 326-2424
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: INTERSTATE ENVELOPE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: INTERSTATE ENVELOPE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: INTERSTATE ENVELOPE MFG CORP
Classification: Not a generator, verified

Date form received by agency: 12/30/1987
Facility name: INTERSTATE ENVELOPE MFG CORP
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004342186

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYD003925179
Country: USA
Mailing Name: INTERSTATE ENVELOPE MANUFACTURING CO
Mailing Contact: INTERSTATE ENVELOPE MANUFACTURING CO
Mailing Address: 56-15 55TH DRIVE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-326-2424

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Document ID:	NYC5055006
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	Not reported
Generator Ship Date:	01/05/1999
Trans1 Recv Date:	01/05/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/08/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	AM6252NY
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00002
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	99

Document ID:	NYC5882916
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	SCD987574647
Generator Ship Date:	09/01/1999
Trans1 Recv Date:	09/01/1999
Trans2 Recv Date:	09/02/1999
TSD Site Recv Date:	09/03/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	NYJE5256
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00038
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	99

Document ID:	NYC5962094
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	SCD987574647
Generator Ship Date:	12/20/1999
Trans1 Recv Date:	12/20/1999
Trans2 Recv Date:	12/23/1999
TSD Site Recv Date:	12/23/1999
Part A Recv Date:	Not reported

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Part B Recv Date: Not reported
Generator EPA ID: NYD003925179
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: ILP284920
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00019
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 99

Document ID: NYC5681687
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCD987574647
Generator Ship Date: 07/12/1999
Trans1 Recv Date: 07/12/1999
Trans2 Recv Date: 07/13/1999
TSD Site Recv Date: 07/13/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD003925179
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: AM6252NY
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00039
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 99

Document ID: NYC6281471
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 11/28/2000
Trans1 Recv Date: 11/28/2000
Trans2 Recv Date: 11/30/2000
TSD Site Recv Date: 11/30/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD003925179
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: Not reported
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00030
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 00

Document ID: NYC6295274
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 10/05/2000
Trans1 Recv Date: 10/05/2000
Trans2 Recv Date: 10/10/2000
TSD Site Recv Date: 10/11/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD003925179
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: ILP28420
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00036
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 00

Document ID: NYC6208503
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 06/14/2000
Trans1 Recv Date: 06/14/2000
Trans2 Recv Date: 06/15/2000
TSD Site Recv Date: 06/19/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD003925179
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: ILP284920
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00032
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 00

Document ID: NYC4249236
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: IL2233P

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Trans2 State ID:	Not reported
Generator Ship Date:	961120
Trans1 Recv Date:	961120
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	961127
Part A Recv Date:	Not reported
Part B Recv Date:	961218
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	00052
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	004
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	96

Document ID:	NYC5097971
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	SCR000074591
Generator Ship Date:	02/16/2000
Trans1 Recv Date:	02/16/2000
Trans2 Recv Date:	02/18/2000
TSD Site Recv Date:	02/18/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	NYAP6277
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00022
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	00

Document ID:	NYC6069295
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	SCR000074591
Generator Ship Date:	04/14/2000
Trans1 Recv Date:	04/14/2000
Trans2 Recv Date:	04/18/2000
TSD Site Recv Date:	04/19/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	NYD000708198

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Trans2 EPA ID:	Not reported
TSDF ID:	NYCGE7532
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00027
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	00

Document ID:	NYC6228516
Manifest Status:	Not reported
Trans1 State ID:	SCR000075150
Trans2 State ID:	SCR000074591
Generator Ship Date:	08/10/2000
Trans1 Recv Date:	08/10/2000
Trans2 Recv Date:	08/15/2000
TSD Site Recv Date:	08/16/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	ILP284920
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00005
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	00

Document ID:	NYC4481662
Manifest Status:	Completed copy
Trans1 State ID:	ILLP32335
Trans2 State ID:	Not reported
Generator Ship Date:	970313
Trans1 Recv Date:	970313
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970319
Part A Recv Date:	970321
Part B Recv Date:	970331
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	00045
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Year: 97

Document ID: NYC4435391
Manifest Status: Completed copy
Trans1 State ID: NYDL7554
Trans2 State ID: Not reported
Generator Ship Date: 970115
Trans1 Recv Date: 970115
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970117
Part A Recv Date: Not reported
Part B Recv Date: 970128
Generator EPA ID: NYD003925179
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD000708198
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 00051
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 97

Document ID: NYC4714536
Manifest Status: Completed copy
Trans1 State ID: NYAP6277
Trans2 State ID: Not reported
Generator Ship Date: 970513
Trans1 Recv Date: 970513
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970516
Part A Recv Date: Not reported
Part B Recv Date: 970527
Generator EPA ID: NYD003925179
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD000708198
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 00050
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NYC4932617
Manifest Status: Completed copy
Trans1 State ID: ILLP24639
Trans2 State ID: Not reported
Generator Ship Date: 971219
Trans1 Recv Date: 971219

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	971229
Part A Recv Date:	980107
Part B Recv Date:	980108
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	00015
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	97

Document ID:	NYC4565158
Manifest Status:	Completed copy
Trans1 State ID:	NYAP6277
Trans2 State ID:	Not reported
Generator Ship Date:	971107
Trans1 Recv Date:	971107
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	971112
Part A Recv Date:	Not reported
Part B Recv Date:	971126
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	00034
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	97

Document ID:	NYC4848851
Manifest Status:	Completed copy
Trans1 State ID:	ILLP24639
Trans2 State ID:	Not reported
Generator Ship Date:	970915
Trans1 Recv Date:	970915
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970917
Part A Recv Date:	Not reported
Part B Recv Date:	971003
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Quantity: 00040
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NJA0462436
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: S5811
Trans2 State ID: Not reported
Generator Ship Date: 880713
Trans1 Recv Date: 880713
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880713
Part A Recv Date: 880831
Part B Recv Date: 880721
Generator EPA ID: NYD003925179
Trans1 EPA ID: NJD982281016
Trans2 EPA ID: Not reported
TSDF ID: NJD002200046
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00165
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88

Document ID: NJA0462411
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: S5811
Trans2 State ID: Not reported
Generator Ship Date: 880810
Trans1 Recv Date: 880810
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880811
Part A Recv Date: 880926
Part B Recv Date: 880823
Generator EPA ID: NYD003925179
Trans1 EPA ID: NJD982281016
Trans2 EPA ID: Not reported
TSDF ID: NJD002200046
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00165
Units: G - Gallons (liquids only)* (8.3 pounds)

INTERSTATE ENVELOPE MFG CORP (Continued) **1000218891**

Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	88

Document ID:	NYC4786481
Manifest Status:	Completed copy
Trans1 State ID:	NYAP6277
Trans2 State ID:	Not reported
Generator Ship Date:	970711
Trans1 Recv Date:	970711
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970716
Part A Recv Date:	Not reported
Part B Recv Date:	970804
Generator EPA ID:	NYD003925179
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Quantity:	00033
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	97

Click this hyperlink while viewing on your computer to access
8 additional NY_MANIFEST: record(s) in the EDR Site Report.

AG467 **CONSOLIDATED EDISON** **MANIFEST** **S110046431**
NW **LAUREL HILL BLVD & 56 RD** **N/A**
1/8-1/4 **LONG ISLAND CITY, NY 11101**
0.152 mi.
804 ft. **Site 1 of 3 in cluster AG**

Relative:
Higher

Actual:
14 ft.

NY MANIFEST:

EPA ID:	NYP004195715
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLYN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD003812047
Trans2 State ID:	Not reported

CONSOLIDATED EDISON (Continued) **S110046431**

Generator Ship Date:	2009-10-07
Trans1 Recv Date:	2009-10-07
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-10-07
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004195715
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	900.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000893778GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD003812047
Trans2 State ID:	Not reported
Generator Ship Date:	2009-10-06
Trans1 Recv Date:	2009-10-06
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-10-06
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004195715
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	1200.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000893790GBF
Import Ind:	N
Export Ind:	N

CONSOLIDATED EDISON (Continued) **S110046431**

Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD003812047
Trans2 State ID:	Not reported
Generator Ship Date:	2009-10-06
Trans1 Recv Date:	2009-10-06
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-10-06
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004195715
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	1100.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000893791GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

AG468 **CON EDISON** **RCRA-CESQG** **1014397254**
NW **LAUREL HILL BLVD & REVIEW AVE** **NYP004195723**
1/8-1/4 **LONG ISLAND CITY, NY 11101**
0.152 mi.
805 ft. **Site 2 of 3 in cluster AG**

Relative:
Higher

Actual:
14 ft.

RCRA-CESQG:

Date form received by agency:	09/18/2009
Facility name:	CON EDISON
Facility address:	LAUREL HILL BLVD & REVIEW AVE LONG ISLAND CITY, NY 11101
EPA ID:	NYP004195723

CON EDISON (Continued) **1014397254**

Mailing address: 4 IRVING PL, RM 828
NEW YORK, NY 10003
Contact: CAROLINE ISKANDER
Contact address: Not reported
Not reported
Contact country: Not reported
Contact telephone: (718) 666-4714
Contact email: Not reported
EPA Region: 02
Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

AH469 **MANHOLE 180** **NY Spills** **S106470909**
SSE **58T AVE/RUST ST** **N/A**
1/8-1/4 **QUEENS, NY**
0.156 mi.
824 ft. **Site 1 of 5 in cluster AH**

Relative:
Higher

Actual:
29 ft.

NY Spills:
Site ID: 63202
Facility Addr2: Not reported
Facility ID: 0403854
Spill Number: 0403854
Facility Type: ER
SWIS: 4101
Investigator: SKARAKHA

MANHOLE 180 (Continued) **S106470909**

Referred To:	Not reported
Spill Date:	7/11/2004
Reported to Dept:	7/11/2004
CID:	64
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/29/2004
Remediation Phase:	0
Date Entered In Computer:	7/11/2004
Spill Record Last Update:	9/29/2004
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ERT DESK
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	61113
DEC Memo:	e2mis no 154297 Bartolomei found 1/2 pint unknown oil on mud. Sample taken. Structure has an earthen sump. Lab result: LSN# 04-05410-001 268 ppm 7/12/04 = 0715 Hrs Fernandez reports that 8 drums of debris (6 solid and 2 w/ cable joints) were removed from structure. 10 gallons of BioGen 760 and water were used to wash the structure and an Astoria tanker removed the liquids. Job is 100 % complete. Update - 2305hrs - 7/12/04 T. Fernandez confirms that earthen sump was sealed by A. Stubbs. (Earlier report of earthen sump was just dirt in concrete sump.)
Remarks:	1/2 pint of unknown oil spilled in the manhole.

Material:

Site ID:	63202
Operable Unit ID:	886417
Operable Unit:	01
Material ID:	491407
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Pounds
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported

MANHOLE 180 (Continued) **S106470909**

Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

AB470 **GEYSER REALTY LLC** **HIST UST** **U003644541**
SSW **57-65 48TH STREET** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.156 mi.
824 ft. **Site 2 of 5 in cluster AB**

Relative:
Higher

Actual:
14 ft.

HIST UST:

PBS Number:	2-603059
SPDES Number:	Not reported
Emergency Contact:	HAROLD BARON
Emergency Telephone:	(718) 821-2200
Operator:	BIG GEYSER, INC.
Operator Telephone:	(718) 821-2000
Owner Name:	GEYSER REALTY LLC
Owner Address:	57-65 48TH STREET
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 821-2200
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	GEYSER REALTY LLC
Mailing Address:	57-65 48TH STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	HAROLD BARON
Mailing Telephone:	(718) 821-2200
Owner Mark:	Second Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	02/09/2001
Expiration Date:	02/06/2006
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	7500
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False

GEYSER REALTY LLC (Continued) **U003644541**

CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 63
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 7500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Gravity
Date Tested: 06/07/1999
Next Test Date: 06/07/2004
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

AB471 **GEYSER REALTY LLC** **UST** **U004079170**
SSW **57-65 48TH STREET** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.156 mi.
824 ft. **Site 3 of 5 in cluster AB**

Relative:
Higher

Actual:
14 ft.

UST:
Facility Id: 2-603059
Region: STATE
DEC Region: 2
Site Status: Unregulated
Program Type: PBS
Expiration Date: N/A
UTM X: 591077.60008
UTM Y: 4508476.04079

Affiliation Records:
Site Id: 25013
Affiliation Type: Mail Contact
Company Name: GEYSER REALTY LLC
Contact Type: Not reported
Contact Name: HAROLD BARON
Address1: 57-65 48TH STREET
Address2: Not reported
City: MASPETH
State: NY

GEYSER REALTY LLC (Continued) **U004079170**

Zip Code:	11378
Country Code:	001
Phone:	(718) 821-2200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	25013
Affiliation Type:	Owner
Company Name:	GEYSER REALTY LLC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	57-65 48TH STREET
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 821-2200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	25013
Affiliation Type:	On-Site Operator
Company Name:	GEYSER REALTY LLC
Contact Type:	Not reported
Contact Name:	BIG GEYSER, INC.
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 821-2000
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	25013
Affiliation Type:	Emergency Contact
Company Name:	GEYSER REALTY LLC
Contact Type:	Not reported
Contact Name:	HAROLD BARON
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 821-2200

GEYSER REALTY LLC (Continued) **U004079170**

Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
I00 - Overfill - None

Tank Info:

Site ID:	25013
Tank Number:	001
Tank ID:	52831
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	7500
Tightness Test Method:	03
Next Test Date:	Not reported
Date Tank Closed:	7/16/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	6/7/1999
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

AB472 **CANOVER INDUSTRIES, INC.** **UST** **U003644527**
SSW **57-65 48TH STREET** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.156 mi.
824 ft. **Site 4 of 5 in cluster AB**

Relative:
Higher

Actual:
14 ft.

UST:

Facility Id:	2-601894
Region:	STATE
DEC Region:	2
Site Status:	Administratively Closed
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591077.60008
UTM Y:	4508476.04079

Affiliation Records:

Site Id:	23856
Affiliation Type:	On-Site Operator
Company Name:	CANOVER INDUSTRIES, INC.
Contact Type:	Not reported
Contact Name:	CANOVER INDUSTRIES, INC.

CANOVER INDUSTRIES, INC. (Continued) **U003644527**

Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 456-8900
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23856
Affiliation Type:	Owner
Company Name:	VAN DAM REALTY CO.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1700 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10019
Country Code:	001
Phone:	(212) 582-1600
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23856
Affiliation Type:	Mail Contact
Company Name:	VAN DAM REALTY CO.
Contact Type:	Not reported
Contact Name:	HENRY EISENBERG
Address1:	1700 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10019
Country Code:	001
Phone:	(212) 582-1600
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23856
Affiliation Type:	Emergency Contact
Company Name:	VAN DAM REALTY CO.
Contact Type:	Not reported
Contact Name:	DAN SFORZA
Address1:	Not reported
Address2:	Not reported
City:	Not reported

CANOVER INDUSTRIES, INC. (Continued) **U003644527**

State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 326-3134
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
C02 - Pipe Location - Underground/On-ground
I02 - Overfill - High Level Alarm
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Info:
Site ID: 23856

Tank Number: 001
Tank ID: 48230
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 7500
Tightness Test Method: 21
Next Test Date: Not reported
Date Tank Closed: 4/1/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 6/7/1999
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:
PBS Number: 2-601894
SPDES Number: Not reported
Emergency Contact: DAN SFORZA
Emergency Telephone: (718) 326-3134
Operator: CANOVER INDUSTRIES, INC.
Operator Telephone: (718) 456-8900
Owner Name: VAN DAM REALTY CO.
Owner Address: 1700 BROADWAY
Owner City,St,Zip: NEW YORK, NY 10019
Owner Telephone: (212) 582-1600
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: VAN DAM REALTY CO.
Mailing Address: 1700 BROADWAY
Mailing Address 2: Not reported

CANOVER INDUSTRIES, INC. (Continued) **U003644527**

Mailing City,St,Zip:	NEW YORK, NY 10019
Mailing Contact:	HENRY EISENBERG
Mailing Telephone:	(212) 582-1600
Owner Mark:	First Owner
Facility Status:	3 - Administratively closed (reasons include business is closed and/or mail is undeliverable, and staff cannot check if tanks were removed; or a duplicate registration was generated).
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	07/01/1994
Expiration Date:	06/13/1999
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Undefined
Install Date:	Not reported
Capacity (gals):	7500
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Not reported
Second Containment:	Not reported
Leak Detection:	Not reported
Overfill Prot:	High Level Alarm
Dispenser:	Suction
Date Tested:	06/07/1999
Next Test Date:	06/07/2004
Missing Data for Tank:	Minor Data Missing
Date Closed:	04/01/1998
Test Method:	21
Deleted:	False
Updated:	True
Lat/long:	Not reported

AB473 **GEYSER REALTY LLC** **UST** **U003178598**
SSW **57-65 48TH STREET** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.156 mi.
824 ft. **Site 5 of 5 in cluster AB**

Relative:
Higher

Actual:
14 ft.

UST:

Facility Id:	2-603060
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591077.60008
UTM Y:	4508476.04079

Affiliation Records:

Site Id:	25014
Affiliation Type:	On-Site Operator
Company Name:	GEYSER REALTY LLC
Contact Type:	Not reported
Contact Name:	LEWIS HERSHKOWITZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 821-2200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	25014
Affiliation Type:	Owner
Company Name:	GEYSER REALTY LLC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	57-65, 57-85 & 58-07 48TH STRET
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 821-2200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	25014
Affiliation Type:	Emergency Contact
Company Name:	GEYSER REALTY LLC
Contact Type:	Not reported
Contact Name:	MATTHEW MADONNA
Address1:	Not reported
Address2:	Not reported

GEYSER REALTY LLC (Continued) **U003178598**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(917) 759-5530
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	25014
Affiliation Type:	Mail Contact
Company Name:	BIG GEYSER INC.
Contact Type:	Not reported
Contact Name:	MATTHEW MADONNA
Address1:	57-65 48TH STREET
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 821-2200
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
I05 - Overfill - Vent Whistle
I05 - Overfill - Vent Whistle

Tank Info:

Site ID:	25014

Tank Number:	001
Tank ID:	52832
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported

GEYSER REALTY LLC (Continued) **U003178598**

Install Date:	Not reported
Capacity Gallons:	2500
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	7/1/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	6/7/1999
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	25014
Tank Number:	002
Tank ID:	61536
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	7500
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	7/1/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	6/7/1999
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-603060
SPDES Number:	Not reported
Emergency Contact:	MATTHEW MADONNA
Emergency Telephone:	(917) 759-5530
Operator:	LEWIS HERSHKOWITZ
Operator Telephone:	(718) 821-2200
Owner Name:	GEYSER REALTY LLC
Owner Address:	57-65, 57-85 & 58-07 48TH STRET
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 821-2200
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	BIG GEYSER INC.
Mailing Address:	57-65 48TH STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	MATTHEW MADONNA
Mailing Telephone:	(718) 821-2200
Owner Mark:	Second Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	57-85 & 58-07 48TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER

GEYSER REALTY LLC (Continued) **U003178598**

Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	04/10/2001
Expiration Date:	02/06/2006
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	2500
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	06/07/1999
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/2001
Test Method:	21
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	7500
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None

GEYSER REALTY LLC (Continued) **U003178598**

Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Vent Whistle
Dispenser:	Suction
Date Tested:	06/07/1999
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	07/01/2001
Test Method:	21
Deleted:	False
Updated:	True
Lat/long:	Not reported

AI474 **ELECTRONICS PLATING CORP** **ICIS 1011617469**
ESE **5815 57TH DR MASPETH NY 11378-2232** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.157 mi.
828 ft. **Site 1 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

ICIS:

Enforcement Action ID:	02-1985-0068
FRS ID:	110019181222
Program ID:	FIS 2-6304-00660
Action Name:	ELECTRONICS PLATING CORP
Facility Name:	ELECTRONICS PLATING CORP
Facility Address:	5815 57TH DR MASPETH NY 11378-2232 MASPETH, New York 11378-2232
Enforcement Action Type:	Civil Judicial Action
Facility County:	Queens
EPA Region #:	3

Enforcement Action ID:	02-1985-0068
FRS ID:	110019181222
Program ID:	FRS 110019181222
Action Name:	ELECTRONICS PLATING CORP
Facility Name:	ELECTRONICS PLATING CORP
Facility Address:	5815 57TH DR MASPETH NY 11378-2232 MASPETH, New York 11378-2232
Enforcement Action Type:	Civil Judicial Action
Facility County:	Queens
EPA Region #:	3

Enforcement Action ID:	02-1985-0068
FRS ID:	110019181222
Program ID:	RCRAINFO NYD056413388
Action Name:	ELECTRONICS PLATING CORP
Facility Name:	ELECTRONICS PLATING CORP
Facility Address:	5815 57TH DR MASPETH NY 11378-2232 MASPETH, New York 11378-2232
Enforcement Action Type:	Civil Judicial Action
Facility County:	Queens
EPA Region #:	3

Enforcement Action ID:	02-1985-0068

ELECTRONICS PLATING CORP (Continued) **1011617469**

FRS ID: 110019181222
Program ID: TRIS 11378LCTRN58155
Action Name: ELECTRONICS PLATING CORP
Facility Name: ELECTRONICS PLATING CORP.
Facility Address: 5815 57TH DR MASPETH NY 11378-2232
MASPETH, New York 11378-2232
Enforcement Action Type: Civil Judicial Action
Facility County: Queens
EPA Region #: 3

Enforcement Action ID: 02-1985-0068
FRS ID: 110019181222
Program ID: NCDB I02#19990526007 1
Action Name: ELECTRONICS PLATING CORP
Facility Name: ELECTRONICS PLATING CORP
Facility Address: 5815 57TH DR MASPETH NY 11378-2232
MASPETH, New York 11378-2232
Enforcement Action Type: Civil Judicial Action
Facility County: Queens
EPA Region #: 3

Program ID: FIS 2-6304-00660
Facility Name: ELECTRONICS PLATING CORP
Address: 5815 57TH DR
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Program ID: FRS 110019181222
Facility Name: ELECTRONICS PLATING CORP
Address: 5815 57TH DR
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Program ID: NCDB I02#19990526007 1
Facility Name: ELECTRONICS PLATING CORP
Address: 5815 57TH DR
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Program ID: RCRAINFO NYD056413388
Facility Name: ELECTRONICS PLATING CORP
Address: 5815 57TH DR
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Program ID: TRIS 11378LCTRN58155
Facility Name: ELECTRONICS PLATING CORP
Address: 5815 57TH DR

ELECTRONICS PLATING CORP (Continued) **1011617469**

Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

AI475 **ELECTRONICS PLATING CORP** **FINDS** **1007755720**
ESE **5815 57TH DR** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.157 mi.
828 ft. **Site 2 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

FINDS:

Registry ID: 110019181222

Environmental Interest/Information System

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

AI476 **ELECTRONICS PLATING CORP** **RCRA-SQG** **1000181435**
ESE **58-15 57TH DR** **MANIFEST** **NYD056413388**
1/8-1/4 **MASPETH, NY 11378**
0.157 mi.
831 ft. **Site 3 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

RCRA-SQG:

Date form received by agency:	01/01/2007
Facility name:	ELECTRONICS PLATING CORP
Facility address:	58-15 57TH DR MASPETH, NY 11378
EPA ID:	NYD056413388
Mailing address:	57TH DR MASPETH, NY 11378
Contact:	Not reported
Contact address:	57TH DR MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	MICHAEL MALLARDI
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	MICHAEL MALLARDI
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No

ELECTRONICS PLATING CORP (Continued) **1000181435**

Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: ELECTRONICS PLATING CORP
Classification: Not a generator, verified

Date form received by agency: 03/22/1995
Facility name: ELECTRONICS PLATING CORP
Classification: Not a generator, verified

Date form received by agency: 07/29/1980
Facility name: ELECTRONICS PLATING CORP
Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 02/18/1998
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 07/09/1986
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

NY MANIFEST:
EPA ID: NYD056413388
Country: USA
Mailing Name: ELECTRONICS PLATING
Mailing Contact: N/S
Mailing Address: 58-15 57TH DRIVE
Mailing Address 2: Not reported
Mailing City: FLUSHING
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-894-6107

Document ID: NJA9622083
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: S10344
Trans2 State ID: Not reported
Generator Ship Date: 890809

ELECTRONICS PLATING CORP (Continued) **1000181435**

Trans1 Recv Date:	890809
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	890811
Part A Recv Date:	890922
Part B Recv Date:	890822
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NJD055090815
Trans2 EPA ID:	Not reported
TSDF ID:	NJD055090815
Waste Code:	F007 - PLATING BATH SOL FM ELECTROPLATING OPER
Quantity:	00155
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	004
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	89

Document ID:	PAE1826705
Manifest Status:	Completed copy
Trans1 State ID:	PAAH0317
Trans2 State ID:	Not reported
Generator Ship Date:	941117
Trans1 Recv Date:	941117
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	941118
Part A Recv Date:	941130
Part B Recv Date:	941205
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	PAD982661381
Trans2 EPA ID:	Not reported
TSDF ID:	PAD085690592
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	01002
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	94

Document ID:	NJA2893264
Manifest Status:	Not reported
Trans1 State ID:	NJR000023325
Trans2 State ID:	Not reported
Generator Ship Date:	02/17/1999
Trans1 Recv Date:	02/17/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NJR000022442
Trans2 EPA ID:	Not reported
TSDF ID:	50163

ELECTRONICS PLATING CORP (Continued) **1000181435**

Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	01400
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	99

Document ID:	NJA3126704
Manifest Status:	Not reported
Trans1 State ID:	NJR000023325
Trans2 State ID:	Not reported
Generator Ship Date:	08/24/1999
Trans1 Recv Date:	08/24/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/24/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NJR000022442
Trans2 EPA ID:	Not reported
TSDF ID:	50163
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	00055
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Year:	99

Document ID:	NJA3066914
Manifest Status:	Not reported
Trans1 State ID:	NJR000023325
Trans2 State ID:	Not reported
Generator Ship Date:	12/01/1999
Trans1 Recv Date:	12/01/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/01/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NJR000022442
Trans2 EPA ID:	Not reported
TSDF ID:	50163
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	00600
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	99

ELECTRONICS PLATING CORP (Continued) **1000181435**

Document ID:	NYB2110635
Manifest Status:	Completed copy
Trans1 State ID:	GX6293
Trans2 State ID:	Not reported
Generator Ship Date:	900314
Trans1 Recv Date:	900314
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900314
Part A Recv Date:	900403
Part B Recv Date:	900404
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NYD000691949
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000691949
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	00900
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	90

Document ID:	PAE4137490
Manifest Status:	Completed copy
Trans1 State ID:	PAAH0317
Trans2 State ID:	Not reported
Generator Ship Date:	950523
Trans1 Recv Date:	950523
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950526
Part A Recv Date:	950614
Part B Recv Date:	950612
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	PAD982661381
Trans2 EPA ID:	Not reported
TSDF ID:	PAD085690592
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	01100
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	95

Document ID:	NJA0701643
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	000000000
Trans2 State ID:	000000000
Generator Ship Date:	900523
Trans1 Recv Date:	900523
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900524
Part A Recv Date:	900711

ELECTRONICS PLATING CORP (Continued) **1000181435**

Part B Recv Date: 900606
Generator EPA ID: NYD056413388
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD002182897
Waste Code: F001 - UNKNOWN
Quantity: 01100
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 90

Document ID: NYB2116296
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NYGX6293
Trans2 State ID: Not reported
Generator Ship Date: 901213
Trans1 Recv Date: 901213
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901213
Part A Recv Date: 910115
Part B Recv Date: 910109
Generator EPA ID: NYD056413388
Trans1 EPA ID: NYD000691949
Trans2 EPA ID: Not reported
TSDF ID: NYD000691949
Waste Code: F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity: 02500
Units: P - Pounds
Number of Containers: 005
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 90

Document ID: NJA3206036
Manifest Status: Not reported
Trans1 State ID: NJR000023325
Trans2 State ID: Not reported
Generator Ship Date: 11/09/2000
Trans1 Recv Date: 11/09/2000
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/13/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD056413388
Trans1 EPA ID: NJR000022442
Trans2 EPA ID: Not reported
TSDF ID: 50163
Waste Code: F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity: 00700
Units: P - Pounds
Number of Containers: 001

ELECTRONICS PLATING CORP (Continued) **1000181435**

Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 00

Document ID: PAE4395462
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: PAAH0317
Trans2 State ID: Not reported
Generator Ship Date: 951115
Trans1 Recv Date: 951115
Trans2 Recv Date: Not reported
TSD Site Recv Date: 951116
Part A Recv Date: 951208
Part B Recv Date: 951211
Generator EPA ID: NYD056413388
Trans1 EPA ID: PAD982661381
Trans2 EPA ID: Not reported
TSDF ID: PAD085690592
Waste Code: F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity: 00680
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 95

Document ID: NJA3168151
Manifest Status: Not reported
Trans1 State ID: NJR000023325
Trans2 State ID: Not reported
Generator Ship Date: 06/09/2000
Trans1 Recv Date: 06/09/2000
Trans2 Recv Date: Not reported
TSD Site Recv Date: 06/09/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD056413388
Trans1 EPA ID: NJR000022442
Trans2 EPA ID: Not reported
TSDF ID: 50163
Waste Code: F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity: 00700
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 00

Document ID: PAE6105805
Manifest Status: Completed copy
Trans1 State ID: PAAH0317

ELECTRONICS PLATING CORP (Continued) **1000181435**

Trans2 State ID: Not reported
Generator Ship Date: 960628
Trans1 Recv Date: 960628
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960630
Part A Recv Date: 960718
Part B Recv Date: 960722
Generator EPA ID: NYD056413388
Trans1 EPA ID: PAD982661381
Trans2 EPA ID: Not reported
TSDF ID: PAD085690592
Waste Code: F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity: 00650
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 96

Document ID: PAE6257812
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: PAAH0317
Trans2 State ID: Not reported
Generator Ship Date: 961204
Trans1 Recv Date: 961204
Trans2 Recv Date: Not reported
TSD Site Recv Date: 961206
Part A Recv Date: 961227
Part B Recv Date: 961231
Generator EPA ID: NYD056413388
Trans1 EPA ID: PAD982661381
Trans2 EPA ID: Not reported
TSDF ID: PAD085690592
Waste Code: F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity: 00600
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 96

Document ID: 06
Manifest Status: 001032517JJK
Trans1 State ID: NYD056413388
Trans2 State ID: Not reported
Generator Ship Date: NJD002200046
Trans1 Recv Date: Not reported
Trans2 Recv Date: NJ0000027193
TSD Site Recv Date: Not reported
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: N
Trans1 EPA ID: N

ELECTRONICS PLATING CORP (Continued) **1000181435**

Trans2 EPA ID:	N
TSDF ID:	N
Waste Code:	N
Quantity:	Not reported
Units:	1
Number of Containers:	DF
Container Type:	55
Handling Method:	G
Specific Gravity:	1
Waste Code:	T
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	Not reported
Specific Gravity:	Not reported
Year:	Not reported

Document ID:	06
Manifest Status:	001032552JJK
Trans1 State ID:	NYD056413388
Trans2 State ID:	Not reported
Generator Ship Date:	NJD002200046
Trans1 Recv Date:	Not reported
Trans2 Recv Date:	NJ0000027193
TSD Site Recv Date:	Not reported
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	N
Trans1 EPA ID:	N
Trans2 EPA ID:	N
TSDF ID:	N
Waste Code:	N
Quantity:	Not reported
Units:	2
Number of Containers:	DM
Container Type:	800
Handling Method:	P
Specific Gravity:	1
Waste Code:	T
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	Not reported
Specific Gravity:	Not reported
Year:	Not reported

Document ID:	06
Manifest Status:	001032552JJK
Trans1 State ID:	NYD056413388
Trans2 State ID:	Not reported
Generator Ship Date:	NJD002200046
Trans1 Recv Date:	Not reported
Trans2 Recv Date:	NJ0000027193

ELECTRONICS PLATING CORP (Continued) **1000181435**

TSD Site Recv Date:	Not reported
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	N
Trans1 EPA ID:	N
Trans2 EPA ID:	N
TSDF ID:	N
Waste Code:	N
Quantity:	Not reported
Units:	2
Number of Containers:	DM
Container Type:	800
Handling Method:	P
Specific Gravity:	1
Waste Code:	T
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	Not reported
Specific Gravity:	Not reported
Year:	Not reported

Document ID:	06
Manifest Status:	001035330JJK
Trans1 State ID:	NYD056413388
Trans2 State ID:	Not reported
Generator Ship Date:	NJD002200046
Trans1 Recv Date:	Not reported
Trans2 Recv Date:	NJ0000027193
TSD Site Recv Date:	Not reported
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	N
Trans1 EPA ID:	N
Trans2 EPA ID:	N
TSDF ID:	N
Waste Code:	N
Quantity:	Not reported
Units:	4
Number of Containers:	DF
Container Type:	220
Handling Method:	G
Specific Gravity:	1
Waste Code:	T
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	Not reported
Specific Gravity:	Not reported
Year:	Not reported

Document ID:	NJA4020125
Manifest Status:	Not reported

ELECTRONICS PLATING CORP (Continued) **1000181435**

Trans1 State ID:	NJR000023325
Trans2 State ID:	Not reported
Generator Ship Date:	06/05/2001
Trans1 Recv Date:	06/05/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/05/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NJR000022442
Trans2 EPA ID:	Not reported
TSDF ID:	050163
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	00240
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	01

Document ID:	PAE8312080
Manifest Status:	Completed copy
Trans1 State ID:	PX3640
Trans2 State ID:	X1518247P
Generator Ship Date:	970917
Trans1 Recv Date:	970917
Trans2 Recv Date:	970918
TSD Site Recv Date:	970919
Part A Recv Date:	971003
Part B Recv Date:	971008
Generator EPA ID:	NYD056413388
Trans1 EPA ID:	NYD082785429
Trans2 EPA ID:	PAD982661381
TSDF ID:	PAD085690592
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Quantity:	00650
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	97

Click this hyperlink while viewing on your computer to access
7 additional NY_MANIFEST: record(s) in the EDR Site Report.

AI477 **ELECTRONICS PLATING CORP** **FTTS** **1009513941**
ESE **58-15 57TH DRIVE** **HIST FTTS** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.157 mi.
831 ft. **Site 4 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

FTTS INSP:

Inspection Number:	19990526007 1
Region:	02
Inspection Date:	05/26/99
Inspector:	A.J. MULLIN, PV
Violation occurred:	No
Investigation Type:	EPCRA, Enforcement, SEE Conducted
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	EPCRA
Facility Function:	Manufacturer

HIST FTTS INSP:

Inspection Number:	19990526007 1
Region:	02
Inspection Date:	Not reported
Inspector:	A.J. MULLIN, PV
Violation occurred:	No
Investigation Type:	EPCRA, Enforcement, SEE Conducted
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	EPCRA
Facility Function:	Manufacturer

AJ478 **YELLOW FREIGHT SYSTEMS /** **NY Spills** **S104495126**
WSW **57-54 PAGE PLACE** **NY Hist Spills** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 1 of 44 in cluster AJ**

Relative:
Higher

Actual:
13 ft.

NY Spills:

Site ID:	289311
Facility Addr2:	Not reported
Facility ID:	8700031
Spill Number:	8700031
Facility Type:	ER
SWIS:	4101
Investigator:	UNASSIGNED
Referred To:	Not reported
Spill Date:	4/1/1987
Reported to Dept:	4/1/1987
CID:	Not reported
Spill Cause:	Abandoned Drums
Water Affected:	POSSIBLY SURFACE H2O
Spill Source:	Commercial/Industrial
Spill Notifier:	Citizen
Cleanup Ceased:	4/1/1987
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Not reported
Spill Closed Dt:	4/1/1987

YELLOW FREIGHT SYSTEMS / (Continued) **S104495126**

Remediation Phase:	0
Date Entered In Computer:	4/3/1987
Spill Record Last Update:	11/13/2002
Spiller Name:	Not reported
Spiller Company:	YELLOW FREIGHT SYSTEMS
Spiller Address:	57-54 PAGE PLACE
Spiller City,St,Zip:	MASPETH, QUEENS, NY
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	234279
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was " " 10/10/95: This is additional information about material spilled from the translation of the old spill file: COROSIVE,FLAMMABLE.
Remarks:	SIX DRUMS CONTAINING HAZARDOUS MATERIALS LEAKING.

Material:

Site ID:	Not reported
Operable Unit ID:	Not reported
Operable Unit:	Not reported
Material ID:	Not reported
Material Code:	Not reported
Material Name:	Not reported
Case No.:	Not reported
Material FA:	Not reported
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	8700031
Investigator:	Not reported
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	04/01/1987 16:30
Reported to Dept Date/Time:	04/01/87 16:30

YELLOW FREIGHT SYSTEMS / (Continued) **S104495126**

SWIS:	63
Spiller Name:	YELLOW FREIGHT SYSTEMS
Spiller Contact:	Not reported
Spiller Phone:	(718) 821-3700
Spiller Address:	57-54 PAGE PLACE
Spiller City,St,Zip:	MASEPETH, QUEENS NEW YORK
Spill Cause:	Abandoned Drums
Reported to Dept:	On Land
Water Affected:	POSSIBLY SURFACE H2O
Spill Source:	01
Spill Notifier:	Citizen
PBS Number:	Not reported
Cleanup Ceased:	04/01/87
Cleanup Meets Std:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	04/01/87
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	04/03/87
Date Spill Entered In Computer Data File:	Not reported
Update Date:	/ /
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	Not reported
Quantity Spilled:	Not reported
Unkonwn Quantity Spilled:	Not reported
Units:	Not reported
Quantity Recovered:	Not reported
Unkonwn Quantity Recovered:	Not reported
Material:	Not reported
Class Type:	Not reported
Times Material Entry In File:	Not reported
CAS Number:	Not reported
Last Date:	Not reported
DEC Remarks:	10/10/95: This is additional information about material spilled from the translation of the old spill file: COROSIVE,FLAMMABLE.
Remark:	SIX DRUMS CONTAINING HAZARDOUS MATERIALS LEAKING.

AJ479 **5754 PAGE PLACE** **HMIRS** **2007444659**
WSW **5754 PAGE PLACE** **N/A**
1/8-1/4 **QUEENS, NY**
0.163 mi.
863 ft. **Site 2 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ480 **57 54 PAGE PLACE** **HMIRS** **2008447769**
WSW **57 54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 3 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ481 **HMIRS** **2001806**
WSW **57-54 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 4 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ482 **HMIRS** **2002055791**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 5 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ483 **HMIRS** **96080219**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 6 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ484 **57-54 PAGE PLACE** **HMIRS** **2007442949**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 7 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ485 **HMIRS** **94080208**
WSW **5754 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 8 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ486 **HMIRS** **96060463**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 9 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ487 **HMIRS** **9998100855**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 10 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ488 **HMIRS** **9999051274**
WSW **5754 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 11 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ489 **HMIRS** **9999031235**
WSW **5754 PAGE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 12 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ490 **57 54 PAGE PL.** **HMIRS** **2008439073**
WSW **57 54 PAGE PL.** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 13 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ491 **HMIRS** **92120410**
WSW **5754 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 14 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ492 **HMIRS** **20011930**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 15 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ493 **HMIRS** **2003123433**
WSW **57-54 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 16 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ494 **57-54 PAGE PLACE** **HMIRS** **2005703283**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 17 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ495 **57 54 PAGE PLACE** **HMIRS** **2009056083**
WSW **57 54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 18 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ496 **HMIRS** **9998060429**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 19 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ497
WSW
1/8-1/4
0.163 mi.
863 ft.
Relative: Higher
Actual: 13 ft.

57 54 PAGE PLACE — **HMIRS** — **2007432624**
57 54 PAGE PLACE — **N/A**
MASPETH, NY

Site 20 of 44 in cluster AJ

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

AJ498
WSW
1/8-1/4
0.163 mi.
863 ft.
Relative: Higher
Actual: 13 ft.

HMIRS — **2003130870**
57-54 PAGE PL — **N/A**
MASPETH, NY

Site 21 of 44 in cluster AJ

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

AJ499
WSW
1/8-1/4
0.163 mi.
863 ft.
Relative: Higher
Actual: 13 ft.

YELLOW TRANSPORTATION - QNS — **FINDS** — **1010685868**
57-54 PAGE PL — **N/A**
MASPETH, NY 11378

Site 22 of 44 in cluster AJ

FINDS:

Registry ID: 110033202326

Environmental Interest/Information System

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

AJ500
WSW
1/8-1/4
0.163 mi.
863 ft.
Relative: Higher
Actual: 13 ft.

HMIRS — **2002055571**
57-54 PAGE PLACE — **N/A**
MASPETH, NY

Site 23 of 44 in cluster AJ

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

AJ501 **57-54 PAGE PL** **HMIRS** **2005703005**
WSW **57-54 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 24 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ502 **HMIRS** **2000024619**
WSW **5754 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 25 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ503 **HMIRS** **9998050630**
WSW **57-54 PAG PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 26 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ504 **HMIRS** **2000024620**
WSW **5754 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 27 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ505 **57 54 PAGE PLACE** **HMIRS** **2008436155**
WSW **57 54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 28 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ506 **57 54 PAGE PLACE** **HMIRS** **2008427784**
WSW **57 54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 29 of 44 in cluster AJ**

Relative: Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual: 13 ft.

AJ507
WSW **57-54 PAGE PL** **HMIRS** **2001021066**
1/8-1/4 **MASPETH, NY** **N/A**
0.163 mi.
863 ft. **Site 30 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ508
WSW **57-54 PAGE PLACE** **HMIRS** **95120142**
1/8-1/4 **MASPETH, NY** **N/A**
0.163 mi.
863 ft. **Site 31 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ509
WSW **5754 PAGE PLACE** **HMIRS** **9998050390**
1/8-1/4 **MASPETH, NY** **N/A**
0.163 mi.
863 ft. **Site 32 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ510
WSW **5754 PAGE** **HMIRS** **9900002742**
1/8-1/4 **MASPETH, NY** **N/A**
0.163 mi.
863 ft. **Site 33 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ511
WSW **57-54 PAGE PLACE** **HMIRS** **2004010753**
1/8-1/4 **MASPETH, NY** **N/A**
0.163 mi.
863 ft. **Site 34 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ512 **YELLOW FREIGHT SYSTEM INC - QNS** **RCRA-NonGen** **1001119648**
WSW **57-54 PAGE PL** **FINDS** **NYR000029371**
1/8-1/4 **MASPETH, NY 11378** **MANIFEST**
0.163 mi. **NY Spills**
863 ft. **Site 35 of 44 in cluster AJ**

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: YELLOW FREIGHT SYSTEM INC - QNS
Facility address: 57-54 PAGE PL
MASPETH, NY 113782236

Actual:
13 ft.

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

EPA ID: NYR000029371
Mailing address: ROE AVE
OVERLAND PARK, NY 66211
Contact: Not reported
Contact address: ROE AVE
OVERLAND PARK, NY 66211
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: YELLOW FREIGHT SYSTEM INC
Owner/operator address: 10990 ROE AVE
OVERLAND PARK, KS 66211
Owner/operator country: US
Owner/operator telephone: (913) 344-5446
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: YELLOW FREIGHT SYSTEM INC
Owner/operator address: 10990 ROE AVE
OVERLAND PARK, KS 66211
Owner/operator country: US
Owner/operator telephone: (913) 344-5446
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: YELLOW FREIGHT SYSTEM INC - QNS
Classification: Not a generator, verified

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Date form received by agency: 07/08/1999
Facility name: YELLOW FREIGHT SYSTEM INC - QNS
Classification: Not a generator, verified

Date form received by agency: 08/16/1996
Facility name: YELLOW FREIGHT SYSTEM INC - QNS
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004528510

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYR000029371
Country: USA
Mailing Name: YELLOW FREIGHT SYSTEM INC - QNS
Mailing Contact: RICHARD WILLARD
Mailing Address: 10990 ROE AVE
Mailing Address 2: Not reported
Mailing City: OVERLAND PARK
Mailing State: KS
Mailing Zip: 66211
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-821-3700

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: MAD039322250
Trans2 State ID: OHD009865825
Generator Ship Date: 2008-04-09
Trans1 Recv Date: 2008-04-09
Trans2 Recv Date: 2008-04-09
TSD Site Recv Date: 2008-04-19
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000029371
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: ARD069748192
Waste Code: Not reported
Quantity: 60.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	08
Manifest Tracking Num:	001883631FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Trans2 State ID:	OHD009865825
Generator Ship Date:	2008-04-09
Trans1 Recv Date:	2008-04-09
Trans2 Recv Date:	2008-04-09
TSD Site Recv Date:	2008-04-19
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	ARD069748192
Waste Code:	Not reported
Quantity:	60.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	08
Manifest Tracking Num:	001883631FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	VTA0106859
Manifest Status:	Completed copy
Trans1 State ID:	NYPB9830
Trans2 State ID:	Not reported

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Generator Ship Date:	970422
Trans1 Recv Date:	970422
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970423
Part A Recv Date:	970505
Part B Recv Date:	970508
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	NYD980769947
Trans2 EPA ID:	Not reported
TSDF ID:	VTD982766537
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00005
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00020
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00020
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00020
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	97

Document ID:	VTA0106860
Manifest Status:	Completed copy
Trans1 State ID:	NYPB9830
Trans2 State ID:	Not reported
Generator Ship Date:	970422
Trans1 Recv Date:	970422
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970423
Part A Recv Date:	970505
Part B Recv Date:	970508
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	NYD980769947
Trans2 EPA ID:	Not reported
TSDF ID:	VTD982766537
Waste Code:	F003 - UNKNOWN
Quantity:	00020

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00020
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00070
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00020
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	97

Document ID:	VTA0106882
Manifest Status:	Completed copy
Trans1 State ID:	NYPB9830
Trans2 State ID:	Not reported
Generator Ship Date:	970422
Trans1 Recv Date:	970422
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970423
Part A Recv Date:	970505
Part B Recv Date:	970508
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	NYD980769947
Trans2 EPA ID:	Not reported
TSDF ID:	VTD982766537
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	97

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Trans2 State ID:	OHD009865825

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Generator Ship Date:	2008-04-09
Trans1 Recv Date:	2008-04-09
Trans2 Recv Date:	2008-04-09
TSD Site Recv Date:	2008-04-19
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	ARD069748192
Waste Code:	Not reported
Quantity:	60.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	08
Manifest Tracking Num:	001883631FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H040

Document ID:	NYC5000703
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NYJE4550
Trans2 State ID:	Not reported
Generator Ship Date:	970223
Trans1 Recv Date:	970223
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	980225
Part A Recv Date:	Not reported
Part B Recv Date:	980312
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD000708198
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00012
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	97

Document ID:	ALA0067510

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Manifest Status:	Not reported
Trans1 State ID:	PAD987358587
Trans2 State ID:	Not reported
Generator Ship Date:	09/03/1998
Trans1 Recv Date:	09/03/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	ALD981020894
Trans2 EPA ID:	Not reported
TSDF ID:	PA250
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00450
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	98

Document ID:	NYC5412352
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	SCD987574647
Generator Ship Date:	10/05/1998
Trans1 Recv Date:	10/05/1998
Trans2 Recv Date:	10/06/1998
TSD Site Recv Date:	10/06/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000029371
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	NYAP6277
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity:	00012
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	98

NY Spills:

Site ID:	414172
Facility Addr2:	Not reported
Facility ID:	0902139
Spill Number:	0902139
Facility Type:	ER
SWIS:	4101
Investigator:	vszhune
Referred To:	Not reported
Spill Date:	5/22/2009
Reported to Dept:	5/22/2009

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

CID:	Not reported
Spill Cause:	Other
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Not reported
Spill Closed Dt:	Not Closed
Remediation Phase:	1
Date Entered In Computer:	5/22/2009
Spill Record Last Update:	3/18/2010
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ERIN KELLY
Contact Phone:	(215) 591-3800
DEC Region:	2
DER Facility ID:	363267
DEC Memo:	05/22/09-Vought-Duty desk officer. Called Erin Kelly (GZA (215) 591-3800 fax:215-591-3810) for status of site. Vought called and spoke to Erin Kelly and she received portion of Phase II report (unsure of who performed Phase II) and boring were installed and no staining or odors or elevated PIDS. Soil analyticals showed PAHs and some acetone and chrysene. Groundwater analyticals shows detections of benzene above TOGS and TCE above TOGS. Not sure why work was performed and they will receive more information. Property is a trucking terminal with no indications of development. Contact is Steve Shinners -YRC American Transport-913-344-3615). Request for two month turn deadline on CSL. See also PBS record 2-317071. Vought sent CSL to: Mr. Steve Shinners YRC American Transport Yellow Transportation 10990 Roe Avenue Overland Park. KS 66211 Ph: (913) 344-3615 with requiremenst of: 1)Full list analysis on all future samples due to TCE in groundwater sample 2)delineation of contamination 3)cc to GZA Kelly
Remarks:	CALLER STATES THAT THEY GOT RESULTS BACK FROM A PHASE 2 SHOWING GROUNDWATER CONTAMINATION AND SOIL CONTAMINATION. CLEAN UP IS PENDING.

Material:

Site ID:	414172
Operable Unit ID:	1170564
Operable Unit:	01
Material ID:	2162299
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False
Site ID:	414172

YELLOW FREIGHT SYSTEM INC - QNS (Continued) **1001119648**

Operable Unit ID:	1170564
Operable Unit:	01
Material ID:	2162300
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

AJ513 **HMIRS** **2001040659**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 36 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ514 **HMIRS** **97121179**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **QUEENS, NY**
0.163 mi.
863 ft. **Site 37 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ515 **HMIRS** **20016222**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 38 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ516 **HMIRS** **2001807**
WSW **57-54 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 39 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ517 **HMIRS** **2004010790**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 40 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ518 **YELLOW TRANSPORTATION (QNS)** **UST** **U001834613**
WSW **57-54 PAGE PLACE** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11385**
0.163 mi.
863 ft. **Site 41 of 44 in cluster AJ**

Relative:
Higher

Actual:
13 ft.

UST:

Facility Id:	2-317071
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2012/07/07
UTM X:	591470.38439000002
UTM Y:	4508324.9972200003

Affiliation Records:

Site Id:	14567
Affiliation Type:	Mail Contact
Company Name:	YELLOW TRANSPORTATION
Contact Type:	Not reported
Contact Name:	ENVIRONMENTAL SERVICES
Address1:	10990 ROE AVENUE
Address2:	Not reported
City:	OVERLAND PARK
State:	KS
Zip Code:	66211
Country Code:	001
Phone:	(913) 344-3000
Phone Ext:	Not reported
Email:	STEVE.SHINNERS@YROW.COM
Fax Number:	Not reported
Modified By:	DXLIVING
Date Last Modified:	6/15/2007

Site Id:	14567
Affiliation Type:	Owner
Company Name:	YELLOW FREIGHT SYSTEM
Contact Type:	SR. MGR - ENV. SRVCS.
Contact Name:	STEVEN SHINNERS
Address1:	10990 ROE AVENUE, ATTN: ENV. SERVICES
Address2:	Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

City:	OVERLAND PARK
State:	KS
Zip Code:	66211
Country Code:	001
Phone:	(913) 344-3000
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	11/6/2007

Site Id:	14567
Affiliation Type:	On-Site Operator
Company Name:	YELLOW TRANSPORTATION (QNS)
Contact Type:	Not reported
Contact Name:	PAUL DODLEY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 821-3700
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	11/6/2007

Site Id:	14567
Affiliation Type:	Emergency Contact
Company Name:	YELLOW FREIGHT SYSTEM
Contact Type:	Not reported
Contact Name:	PAUL DODLEY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(631) 421-4849
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	11/6/2007

Equipment Records:

B03 - Tank External Protection - Original Impressed Current
B03 - Tank External Protection - Original Impressed Current
C02 - Pipe Location - Underground/On-ground
I00 - Overfill - None
I00 - Overfill - None
I02 - Overfill - High Level Alarm
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

G00 - Tank Secondary Containment - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
I03 - Overfill - Automatic Shut-Off
I02 - Overfill - High Level Alarm
B00 - Tank External Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
D00 - Pipe Type - No Piping
B00 - Tank External Protection - None
E00 - Piping Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
D00 - Pipe Type - No Piping
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
D00 - Pipe Type - No Piping
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
I00 - Overfill - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
H05 - Tank Leak Detection - In-Tank System (ATG)
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
D00 - Pipe Type - No Piping
I00 - Overfill - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
F03 - Pipe External Protection - Original Impressed Current
H00 - Tank Leak Detection - None
F03 - Pipe External Protection - Original Impressed Current
H00 - Tank Leak Detection - None
I03 - Overfill - Automatic Shut-Off
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
D00 - Pipe Type - No Piping
J02 - Dispenser - Suction
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

H05 - Tank Leak Detection - In-Tank System (ATG)
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
B00 - Tank External Protection - None

Tank Info:

Site ID:	14567
Tank Number:	001
Tank ID:	12213
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1985
Capacity Gallons:	4000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	3/18/2011
Register:	True
Modified By:	BKFALVEY
Last Modified:	4/5/2011
Site ID:	14567
Tank Number:	002
Tank ID:	12214
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Install Date:	12/1/1985
Capacity Gallons:	4000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	3/18/2011
Register:	True
Modified By:	BKFALVEY
Last Modified:	4/5/2011
Site ID:	14567
Tank Number:	101
Tank ID:	12215
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	575
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14567
Tank Number:	102
Tank ID:	12216
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	575
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14567
Tank Number:	103
Tank ID:	12217
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Install Date:	Not reported
Capacity Gallons:	575
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14567
Tank Number:	104
Tank ID:	12218
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	575
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14567
Tank Number:	105
Tank ID:	12219
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	575
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	14567
Tank Number:	106
Tank ID:	12220
Tank Status:	Closed Prior to Micro Conversion, 03/91
Tank Model:	Not reported
Pipe Model:	Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Install Date: Not reported
Capacity Gallons: 575
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Site ID: 14567

Tank Number: 107
Tank ID: 12221
Tank Status: Closed Prior to Micro Conversion, 03/91
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 575
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Site ID: 14567

Tank Number: 108
Tank ID: 12222
Tank Status: Closed Prior to Micro Conversion, 03/91
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 575
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:
PBS Number: 2-317071
SPDES Number: Not reported
Emergency Contact: RICHARD P. WILLARD
Emergency Telephone: (201) 402-1459
Operator: RICHARD P. WILLARD
Operator Telephone: (718) 821-3700

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Owner Name:	YELLOW FREIGHT SYSTEM
Owner Address:	10990 ROE AVENUE, ATTN: ENV. SERVICES
Owner City,St,Zip:	OVERLAND PARK, KS 66211
Owner Telephone:	(913) 344-3000
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	YELLOW FREIGHT SYSTEM, INC.
Mailing Address:	10990 ROE AVENUE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	OVERLAND PARK, KS 66211
Mailing Contact:	ENVIRONMENTAL SERVICES
Mailing Telephone:	(913) 344-3000
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	57054 PAGE PLACE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	07/25/1997
Expiration Date:	07/07/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	8000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19851201
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Impressed Current
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Impressed Current
Second Containment:	None
Leak Detection:	In-tank System
Overfill Prot:	High Level Alarm, Automatic Shut-Off

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Dispenser: Suction
Date Tested: 06/01/1996
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Tracer Tight
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19851201
Capacity (gals): 4000
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Impressed Current
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: Impressed Current
Second Containment: None
Leak Detection: In-tank System
Overfill Prot: High Level Alarm, Automatic Shut-Off
Dispenser: Suction
Date Tested: 08/01/1996
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Tracer Tight
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 101
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: Not reported
Capacity (gals): 575
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	102
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	103
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	104
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	105
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Tank Id:	106
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	107
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	108
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991

YELLOW TRANSPORTATION (QNS) (Continued) **U001834613**

Install Date:	Not reported
Capacity (gals):	575
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

AJ519 **HMIRS** **2001021067**
WSW **57-54 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 42 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ520 **HMIRS** **9900005223**
WSW **5754 PAGE PL** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 43 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AJ521 **HMIRS** **92110613**
WSW **57-54 PAGE PLACE** **N/A**
1/8-1/4 **MASPETH, NY**
0.163 mi.
863 ft. **Site 44 of 44 in cluster AJ**

Relative:
Higher

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:
13 ft.

AE522 **TREASURE ISLAND RECOVERY** **SWRCY** **S105842311**
NNE **55-06 43RD STREET** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.164 mi.
867 ft. **Site 3 of 9 in cluster AE**

Relative:
Higher

Actual:
44 ft.

SWRCY:

Region:	2
Facility Address 2:	Not reported
Phone Number:	7183619815
Owner Type:	Not reported
Owner Name:	Not reported
Owner Address:	Not reported
Owner Address 2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	James P. McMahon
Contact Address:	Not reported
Contact Address 2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	Recylables handling and recovery facilities
Activity Number:	[41MA4]
Active:	No
East Coordinate:	Not reported
North Coordinate:	Not reported
Accuracy Code:	Not reported
Regulatory Status:	Not reported
Permit #:	None
Auth. Date:	Not reported
Expiration Date:	Not reported
Waste Types:	Not reported

AG523 **39-90 REVIEW AVENUE** **LTANKS** **S101509033**
WNW **39-90 REVIEW AVENUE** **HIST LTANKS** **N/A**
1/8-1/4 **LONG ISLAND CITY, NY**
0.165 mi.
870 ft. **Site 3 of 3 in cluster AG**

Relative:
Higher

Actual:
14 ft.

LTANKS:

Site ID:	287035
Spill No:	9416828
Spill Date:	3/28/1995
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	3/28/1995
Facility Addr2:	Not reported
Cleanup Ceased:	3/28/1995
Cleanup Meets Standard:	True
SWIS:	4101
Investigator:	SMMARTIN
Referred To:	Not reported
Reported to Dept:	3/28/1995
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party

39-90 REVIEW AVENUE (Continued) **S101509033**

Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	5/3/1995
Spill Record Last Update:	9/30/2004
Spiller Name:	Not reported
Spiller Company:	VIJAX FUEL CORP
Spiller Address:	26 VARICK AVENUE
Spiller City,St,Zip:	BROOKLYN, NY 11237
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	232511
Remarks:	OVERFILL WHILE FILLING THE TANK - CLEANING UP NOW.

Material:

Site ID:	287035
Operable Unit ID:	1010646
Operable Unit:	01
Material ID:	368455
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3
Units:	Gallons
Recovered:	3
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

HIST LTANKS:

Region of Spill:	2
Spill Number:	9416828
Spill Date:	03/28/1995
Spill Time:	16:30
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.

39-90 REVIEW AVENUE (Continued) **S101509033**

Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/28/95
Cleanup Ceased: 03/28/95
Cleanup Meets Standard: True
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/28/95
Reported to Department Time: 16:32
SWIS: 63
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: VIJAX FUEL CORP
Spiller Address: 26 VARICK AVENUE
Spiller City,St,Zip: BROOKLYN, NEW YORK 11237
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 497-4491
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/03/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 3
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 3
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL

39-90 REVIEW AVENUE (Continued) **S101509033**

Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: OVERFILL WHILE FILLING THE TANK - CLEANING UP NOW.

AC524
SW
1/8-1/4
0.167 mi.
882 ft.

ASTORIA RUBBISH-177-187 CHERRY ST **FINDS** **1007811275**
177-187 CHERRY STREET **N/A**
BROOKLYN, NY 11222

Site 3 of 3 in cluster AC

Relative:
Higher

Actual:
18 ft.

FINDS:

Registry ID: 110019738168

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AE525
NNE
1/8-1/4
0.168 mi.
885 ft.

HADSON TOKO TRADING CO, INC **FINDS** **1004566248**
55-05 43RD ST **N/A**
MASPETH, NY 11378

Site 4 of 9 in cluster AE

Relative:
Higher

Actual:
45 ft.

FINDS:

Registry ID: 110011615396

Environmental Interest/Information System
NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

526
ENE
1/8-1/4
0.169 mi.
890 ft.

WELLINGTON CLUB AUTO BODY **FINDS** **1007774984**
56-15 58TH STREET **N/A**
MASPETH, NY 11378

Relative:
Higher

Actual:
34 ft.

FINDS:

Registry ID: 110019374345

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AK527 **CANOVER INDASTIES , INC** **UST** **U002034247**
SSW **57-85 48TH ST** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.169 mi.
892 ft. **Site 1 of 5 in cluster AK**

Relative:
Higher

Actual:
14 ft.

UST:

Facility Id:	2-601899
Region:	STATE
DEC Region:	2
Site Status:	Administratively Closed
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591070.33982999995
UTM Y:	4508448.1956799999

Affiliation Records:

Site Id:	23861
Affiliation Type:	On-Site Operator
Company Name:	CANOVER INDUSTRIES, INC.
Contact Type:	Not reported
Contact Name:	CANOVER INDUSTRIES, INC.
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 456-8900
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23861
Affiliation Type:	Mail Contact
Company Name:	VAN DAM REALTY CO.
Contact Type:	Not reported
Contact Name:	HENRY EISENBERG
Address1:	57-65 48TH ST
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 456-8900
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23861
Affiliation Type:	Owner
Company Name:	VAN DAM REALTY CO.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	57-65 48TH ST
Address2:	Not reported

CANOVER INDASTIES , INC (Continued) **U002034247**

City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 456-8900
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23861
Affiliation Type:	Emergency Contact
Company Name:	VAN DAM REALTY CO.
Contact Type:	Not reported
Contact Name:	DAN SFORZA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 326-3134
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

D00 - Pipe Type - No Piping
J02 - Dispenser - Suction
C01 - Pipe Location - Aboveground
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
B02 - Tank External Protection - Original Sacrificial Anode
H00 - Tank Leak Detection - None
I02 - Overfill - High Level Alarm

Tank Info:

Site ID:	23861

Tank Number:	001
Tank ID:	48235
Tank Status:	Administratively Closed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	2500
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	1/23/2001
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	6/7/1999

CANOVER INDASTIES , INC (Continued) **U002034247**

Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-601899
SPDES Number:	Not reported
Emergency Contact:	DAN SFORZA
Emergency Telephone:	(718) 326-3134
Operator:	CANOVER INDASTRIES, INC
Operator Telephone:	(718) 456-8900
Owner Name:	VAN DAM REALTY CO.
Owner Address:	57-65 48TH ST
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 456-8900
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	VAN DAM REALTY CO.
Mailing Address:	57-65 48TH ST
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	HENRY EISENBERG
Mailing Telephone:	(718) 456-8900
Owner Mark:	First Owner
Facility Status:	3 - Administratively closed (reasons include business is closed and/or mail is undeliverable, and staff cannot check if tanks were removed; or a duplicate registration was generated).
Facility Addr2:	Not reported
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	06/13/1994
Expiration Date:	06/13/1999
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Undefined
Install Date:	Not reported
Capacity (gals):	2500

CANOVER INDASTIES , INC (Continued) **U002034247**

Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	12
Pipe Location:	Aboveground
Pipe Type:	NONE
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	High Level Alarm
Dispenser:	Suction
Date Tested:	06/07/1999
Next Test Date:	06/07/2004
Missing Data for Tank:	No Missing Data
Date Closed:	01/23/2001
Test Method:	21
Deleted:	False
Updated:	True
Lat/long:	Not reported

AD528 **MANHOLE 17302** **NY Spills** **S106969939**
East **58 PLACE / MASPETH AVE** **N/A**
1/8-1/4 **QUEENS, NY**
0.169 mi.
893 ft. **Site 3 of 3 in cluster AD**

Relative:
Higher

Actual:
39 ft.

NY Spills:

Site ID:	349762
Facility Addr2:	Not reported
Facility ID:	0504843
Spill Number:	0504843
Facility Type:	ER
SWIS:	4101
Investigator:	GDBREEN
Referred To:	Not reported
Spill Date:	7/21/2005
Reported to Dept:	7/21/2005
CID:	64
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	9/26/2005
Remediation Phase:	0
Date Entered In Computer:	7/22/2005
Spill Record Last Update:	9/26/2005
Spiller Name:	ERT DESK
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	MANHATTAN, NY 10003

MANHOLE 17302 (Continued) **S106969939**

Spiller Company:	999
Contact Name:	ERT DESK
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	296190
DEC Memo:	159906. 7/21/05 0025 HRS. BUIVIDA #07074 FOD REPORTS FOUND APPROX 1PT OF DIELECTRIC FLUID THAT SPILLED FROM 3W1W RAYCHEM JOINT IN MH-17303. IT APPEARS TO BE CONTAINED AT THIS TIME NO SEWERS OR WATERWAYS AFFECTED. NO FIRE OR SMOKE OR PRIVATE INVOLVED. 1-SAMPLE TAKEN ON 24HR DEC PROGRAM. ENVIR TAG31462 PLACED. #DD03580. G DONATONE 7/21/2005 07:53 HRS. PCB RESULTS 23 PPM, AROCLOR 1254, LAB SEQ # 05-07473-001. -- W.W. #17344 -- 7/21/05 1093 HRS. O.S. BOB HUTCHINSON REPORTS EARTHEN SUMP WAS FOUND IN STRUCTURE. CLEANUP CONTINUES. IINCIDENT WILL BE TAKEN OFF 24HR DEC PROGRAM. G DONATONE 7/21/05 2030HRS G.CASTRO ENVIR OPPS REPORTS CLEANUP COMPLETED DOULBED WASHED STRUCTURE USING BIO GEN 760. SEALED EARTHEN SUMP. REMOVED ENVIR TAG#31646. G DONATONE Closed. 9-26-05. GB
Remarks:	1 pint spilled. Caused by leaking joint. No to five questions. Sample taken. Coming off 72 hr clock due to earthen sump finding. Con-Ed # 159906. Lab results = 23 ppm.

Material:

Site ID:	349762
Operable Unit ID:	1107350
Operable Unit:	01
Material ID:	2097241
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

AH529 **COYNE FAMILY SVCE STA** **FINDS** **1007762335**
SSE **58-09 RUST ST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.170 mi.
899 ft. **Site 2 of 5 in cluster AH**

Relative:
Higher

Actual:
29 ft.

FINDS:

Registry ID: 110019247554

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AH530 **COYNE FAMILY SS INC** **RCRA-NonGen** **1001229355**
SSE **58-09 RUST ST** **FINDS** **NYR000059261**
1/8-1/4 **MASPETH, NY 11378** **MANIFEST**
0.170 mi.
899 ft. **Site 3 of 5 in cluster AH**

Relative:
Higher

Actual:
29 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	COYNE FAMILY SS INC
Facility address:	58-09 RUST ST MASPETH, NY 113782228
EPA ID:	NYR000059261
Mailing address:	RUST ST MASPETH, NY 11378
Contact:	PATRICK COYNE
Contact address:	RUST ST MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 894-5987
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	PATRICK COYNE
Owner/operator address:	58-09 RUST ST MASPETH, NY 11378
Owner/operator country:	US
Owner/operator telephone:	(718) 894-5987
Legal status:	Private

COYNE FAMILY SS INC (Continued) **1001229355**

Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: PATRICK COYNE
Owner/operator address: 58-09 RUST ST
MASPETH, NY 11378
Owner/operator country: US
Owner/operator telephone: (718) 894-5987
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: COYNE FAMILY SS INC
Classification: Not a generator, verified

Date form received by agency: 08/14/1998
Facility name: COYNE FAMILY SS INC
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004545939

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

COYNE FAMILY SS INC (Continued) **1001229355**

EPA ID:	NYR000059261
Country:	USA
Mailing Name:	COYNE FAMILY SERVICE STATION
Mailing Contact:	PATRICK COYNE
Mailing Address:	58-09 RUST ST
Mailing Address 2:	Not reported
Mailing City:	MASPETH
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	718-626-8083

Document ID:	NYG1417239
Manifest Status:	Not reported
Trans1 State ID:	NYD077444263
Trans2 State ID:	Not reported
Generator Ship Date:	09/28/1998
Trans1 Recv Date:	09/28/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/29/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000059261
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	PD1011NY
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	98

Document ID:	NYG1419534
Manifest Status:	Not reported
Trans1 State ID:	NYD077444263
Trans2 State ID:	Not reported
Generator Ship Date:	08/21/1998
Trans1 Recv Date:	08/21/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/24/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000059261
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	PD1011NY
Waste Code:	D018 - BENZENE 0.5 MG/L TCLP
Quantity:	00300
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels

COYNE FAMILY SS INC (Continued) **1001229355**

Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 98

AH531 **COYNE FAMILY SERV STA INC** **UST** **U003127951**
SSE **58-09 RUST ST** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.170 mi.
899 ft. **Site 4 of 5 in cluster AH**

Relative:
Higher

Actual:
29 ft.

UST:
Facility Id: 2-321974
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2012/08/28
UTM X: 591911.11797000002
UTM Y: 4508259.6125400001

Affiliation Records:
Site Id: 14986
Affiliation Type: Owner
Company Name: COYNE FAMILY SERVICE STATION,INC
Contact Type: PRES
Contact Name: PATRICK COYNE
Address1: 58-09 RUST STREET
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 326-7285
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: msbaptis
Date Last Modified: 8/29/2007

Site Id: 14986
Affiliation Type: Mail Contact
Company Name: COYNE FAMILY SERVICE STATION, INC
Contact Type: Not reported
Contact Name: MR.PATRICK COYNE,PRES.
Address1: 58-09 RUST STREET
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 326-7285
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 14986

COYNE FAMILY SERV STA INC (Continued) **U003127951**

Affiliation Type:	On-Site Operator
Company Name:	COYNE FAMILY SERV STA INC
Contact Type:	Not reported
Contact Name:	PATRICK COYNE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 326-7285
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	ANAUSTIN
Date Last Modified:	7/5/2005

Site Id:	14986
Affiliation Type:	Emergency Contact
Company Name:	COYNE FAMILY SERVICE STATION,INC
Contact Type:	Not reported
Contact Name:	PATRICK COYNE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 326-7285
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	ANAUSTIN
Date Last Modified:	7/5/2005

Equipment Records:

I02 - Overfill - High Level Alarm
I02 - Overfill - High Level Alarm
F08 - Pipe External Protection - Retrofitted Impressed Current
J02 - Dispenser - Suction
F08 - Pipe External Protection - Retrofitted Impressed Current
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H05 - Tank Leak Detection - In-Tank System (ATG)
G00 - Tank Secondary Containment - None
K01 - Spill Prevention - Catch Basin
D02 - Pipe Type - Galvanized Steel
F08 - Pipe External Protection - Retrofitted Impressed Current
A01 - Tank Internal Protection - Epoxy Liner
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction
H05 - Tank Leak Detection - In-Tank System (ATG)
H05 - Tank Leak Detection - In-Tank System (ATG)

COYNE FAMILY SERV STA INC (Continued) **U003127951**

B08 - Tank External Protection - Retrofitted Impressed Current
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
A01 - Tank Internal Protection - Epoxy Liner
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I02 - Overfill - High Level Alarm
B08 - Tank External Protection - Retrofitted Impressed Current
J02 - Dispenser - Suction
K01 - Spill Prevention - Catch Basin
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
F08 - Pipe External Protection - Retrofitted Impressed Current
H05 - Tank Leak Detection - In-Tank System (ATG)
A01 - Tank Internal Protection - Epoxy Liner
K01 - Spill Prevention - Catch Basin
A01 - Tank Internal Protection - Epoxy Liner
I02 - Overfill - High Level Alarm
B08 - Tank External Protection - Retrofitted Impressed Current
B01 - Tank External Protection - Painted/Asphalt Coating
B08 - Tank External Protection - Retrofitted Impressed Current
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Info:

Site ID:	14986
Tank Number:	001
Tank ID:	19863
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1974
Capacity Gallons:	1080
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/12/2008
Register:	True
Modified By:	bkfalvey
Last Modified:	9/29/2008
Site ID:	14986
Tank Number:	002
Tank ID:	19864
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	12/1/1974
Capacity Gallons:	1080
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel

COYNE FAMILY SERV STA INC (Continued) **U003127951**

Date Test:	9/12/2008
Register:	True
Modified By:	bkfalvey
Last Modified:	9/29/2008
Site ID:	14986
Tank Number:	003
Tank ID:	19865
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	3/1/1985
Capacity Gallons:	4000
Tightness Test Method:	21
Next Test Date:	9/12/2013
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/12/2008
Register:	True
Modified By:	bkfalvey
Last Modified:	9/29/2008
Site ID:	14986
Tank Number:	004
Tank ID:	19866
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	3/1/1985
Capacity Gallons:	4000
Tightness Test Method:	21
Next Test Date:	9/12/2013
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/12/2008
Register:	True
Modified By:	bkfalvey
Last Modified:	9/29/2008

HIST UST:

PBS Number:	2-321974
SPDES Number:	Not reported
Emergency Contact:	PATRICK COYNE
Emergency Telephone:	(718) 326-7285
Operator:	PATRICK COYNE
Operator Telephone:	(718) 326-7285
Owner Name:	COYNE FAMILY SERVICE STATION,INC
Owner Address:	58-09 RUST STREET
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 326-7285
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	COYNE FAMILY SERVICE STATION, INC

COYNE FAMILY SERV STA INC (Continued) **U003127951**

Mailing Address:	58-09 RUST STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	MR.PATRICK COYNE,PRES.
Mailing Telephone:	(718) 326-7285
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	58009 RUST ST
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	RETAIL GASOLINE SALES
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	04/21/1998
Expiration Date:	08/28/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	10160
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19741201
Capacity (gals):	1080
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	13
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Impressed Current
Second Containment:	None
Leak Detection:	In-tank System
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction
Date Tested:	08/01/1989
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Tank Auditor
Deleted:	False

COYNE FAMILY SERV STA INC (Continued) **U003127951**

Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19741201
Capacity (gals): 1080
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: 13
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: Impressed Current
Second Containment: None
Leak Detection: In-tank System
Overfill Prot: High Level Alarm, Catch Basin
Dispenser: Suction
Date Tested: 08/01/1989
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Tank Auditor
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19850301
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: 13
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: Impressed Current
Second Containment: None
Leak Detection: In-tank System
Overfill Prot: High Level Alarm, Catch Basin
Dispenser: Suction
Date Tested: 06/01/1995
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

COYNE FAMILY SERV STA INC (Continued) **U003127951**

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19850301
Capacity (gals):	4000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Epoxy Liner
Tank External:	13
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Impressed Current
Second Containment:	None
Leak Detection:	In-tank System
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction
Date Tested:	06/01/1995
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Horner EZ Check
Deleted:	False
Updated:	True
Lat/long:	Not reported

---

532 **251 LOMBARDI STREET** **NY Spills** **S102147439**
SW **251 LOMBARDI STREET** **NY Hist Spills** **N/A**
1/8-1/4 **QUEENS, NY**
0.171 mi.
902 ft.

Relative:
Higher

Actual:
20 ft.

NY Spills:

Site ID:	282382
Facility Addr2:	Not reported
Facility ID:	9311219
Spill Number:	9311219
Facility Type:	ER
SWIS:	4101
Investigator:	SJMILLER
Referred To:	Not reported
Spill Date:	12/16/1993
Reported to Dept:	12/16/1993
CID:	Not reported
Spill Cause:	Deliberate
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	12/16/1993
Remediation Phase:	0
Date Entered In Computer:	12/16/1993

251 LOMBARDI STREET (Continued) **S102147439**

Spill Record Last Update:	12/30/2002
Spiller Name:	Not reported
Spiller Company:	TRUCK
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	229240
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MILLER" 12/16/93 @1406HRS, MILLER SPOKE WITH FF. BOSCO, FDNY: NYFD TOOK UP - DEP WAS NOTIFIED; FDNY CAUGHT SPILLER PUMPING GASOLINE FROM TANKS TO TRUCK TANKERS - UNAWARE IF NYC VIOLATIONS HAD BEEN GIVEN. 12/16/93 @1430HRS, MILLER MET DEP/IWCS AND SPILLER AT SPILL: CLEANUP NEAR COMPLETE.
Remarks:	FD AT SCENE WITH SPILLER - WOULD LIKE CALL BACK & OR SOMEONE FROM DEC AT SCENE.

Material:

Site ID:	282382
Operable Unit ID:	989855
Operable Unit:	01
Material ID:	390264
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9311219
Investigator:	MILLER
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported

251 LOMBARDI STREET (Continued) **S102147439**

Spill Date/Time: 12/16/1993 12:46
Reported to Dept Date/Time: 12/16/93 13:42
SWIS: 63
Spiller Name: TRUCK
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Deliberate
Reported to Dept: In Sewer
Water Affected: Not reported
Spill Source: 08
Spill Notifier: Fire Department
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/16/93
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: FD AT SCENE WITH SPILLER - WOULD LIKE CALL BACK OR SOMEONE FROM DEC AT SCENE.

AL533 **NEWTOWN CREEK PLANT** **UST** **U004063730**
NNE **33-05 LAUREL HILL BLVD** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.171 mi.
904 ft. **Site 1 of 2 in cluster AL**

Relative:
Higher

Actual:
24 ft.

UST:

Facility Id:	2-206334
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	Not reported
UTM X:	590601.37335000001
UTM Y:	4509381.0461299997

Affiliation Records:

Site Id:	7265
Affiliation Type:	On-Site Operator
Company Name:	NEWTOWN CREEK PLANT
Contact Type:	Not reported
Contact Name:	MASPETH CONC. LOADING
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 474-4741
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	1/8/2009

Site Id:	7265
Affiliation Type:	Owner
Company Name:	MASPETH CONCRETE LOADING CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	PO BOX 960493
Address2:	Not reported
City:	INWOOD
State:	NY
Zip Code:	11096
Country Code:	001
Phone:	(718) 474-4741
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	1/8/2009

Site Id:	7265
Affiliation Type:	Emergency Contact
Company Name:	MASPETH CONCRETE LOADING CORP
Contact Type:	Not reported
Contact Name:	JOHN QUADROZZI
Address1:	Not reported
Address2:	Not reported

NEWTOWN CREEK PLANT (Continued) **U004063730**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 474-4333
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	1/8/2009

Site Id:	7265
Affiliation Type:	Mail Contact
Company Name:	MASPETH CONCRETE LOADING CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	PO BOX 920158
Address2:	Not reported
City:	AVERNE
State:	NY
Zip Code:	11692
Country Code:	001
Phone:	(718) 474-4741
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	9/30/2008

Equipment Records:

I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

NEWTOWN CREEK PLANT (Continued) **U004063730**

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
J02 - Dispenser - Suction
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
I00 - Overfill - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron

NEWTOWN CREEK PLANT (Continued) **U004063730**

C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I00 - Overfill - None

Tank Info:

Site ID:	7265
Tank Number:	0D1
Tank ID:	9498
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1967
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	7265
Tank Number:	0D2
Tank ID:	9499
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1967
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	7265
Tank Number:	0D3
Tank ID:	9500
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported

NEWTOWN CREEK PLANT (Continued) **U004063730**

Install Date:	4/1/1967
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	7265
Tank Number:	0G1
Tank ID:	9505
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1967
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	7265
Tank Number:	G10
Tank ID:	9504
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1967
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

AL534 **NEWTOWN CREEK PLANT** **HIST UST** **U003074438**
NNE **33-05 LAUREL HILL BLVD** **AST** **N/A**
1/8-1/4 **MASPETH, NY 11378** **HIST AST**
0.171 mi.
904 ft. **Site 2 of 2 in cluster AL**

Relative:
Higher

Actual:
24 ft.

HIST UST:

PBS Number:	2-206334
SPDES Number:	Not reported
Emergency Contact:	JOHN QUADROZZI
Emergency Telephone:	(718) 474-4333
Operator:	MASPETH CONC. LOADING
Operator Telephone:	(718) 474-4741
Owner Name:	MASPETH CONCRETE LOADING CORP
Owner Address:	PO BOX 960493
Owner City,St,Zip:	INWOOD, NY 11096
Owner Telephone:	(718) 474-4741
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	PO BOX 960493
Mailing Address:	Not reported
Mailing Address 2:	Not reported
Mailing City,St,Zip:	INWOOD, NY 11096-0493
Mailing Contact:	MASPETH CONCRETE LOADING
Mailing Telephone:	(718) 474-4741
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	33005 LAUREL HILL BLVD
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	11/12/1997
Expiration Date:	06/30/2002
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	12025
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	0D1
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (gals):	550

NEWTOWN CREEK PLANT (Continued) **U003074438**

Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	0D2
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	0D3
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported

NEWTOWN CREEK PLANT (Continued) **U003074438**

Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	0G1
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	G10
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (gals):	550
Product Stored:	UNLEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON

NEWTOWN CREEK PLANT (Continued) **U003074438**

Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Diking
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-206334
Program Type:	PBS
UTM X:	590601.37335000001
UTM Y:	4509381.0461299997
Expiration Date:	Not reported

Affiliation Records:

Site Id:	7265
Affiliation Type:	On-Site Operator
Company Name:	NEWTOWN CREEK PLANT
Contact Type:	Not reported
Contact Name:	MASPETH CONC. LOADING
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 474-4741
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	1/8/2009

Site Id:	7265
Affiliation Type:	Owner
Company Name:	MASPETH CONCRETE LOADING CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	PO BOX 960493
Address2:	Not reported
City:	INWOOD
State:	NY
Zip Code:	11096
Country Code:	001
Phone:	(718) 474-4741
Phone Ext:	Not reported

NEWTOWN CREEK PLANT (Continued) **U003074438**

Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	1/8/2009

Site Id:	7265
Affiliation Type:	Emergency Contact
Company Name:	MASPETH CONCRETE LOADING CORP
Contact Type:	Not reported
Contact Name:	JOHN QUADROZZI
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 474-4333
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	1/8/2009

Site Id:	7265
Affiliation Type:	Mail Contact
Company Name:	MASPETH CONCRETE LOADING CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	PO BOX 920158
Address2:	Not reported
City:	AVERNE
State:	NY
Zip Code:	11692
Country Code:	001
Phone:	(718) 474-4741
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	9/30/2008

Equipment Records:

I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction

NEWTOWN CREEK PLANT (Continued) **U003074438**

H00 - Tank Leak Detection - None
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
C00 - Pipe Location - No Piping
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
J02 - Dispenser - Suction
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
I00 - Overfill - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None

NEWTOWN CREEK PLANT (Continued) **U003074438**

D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I00 - Overfill - None

Tank Info:

Tank Number:	002
Tank Id:	9502
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1978
Capacity Gallons:	1500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	003
Tank Id:	9503
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1967
Capacity Gallons:	2000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True

NEWTOWN CREEK PLANT (Continued) **U003074438**

Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	0D4
Tank Id:	9501
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	6/1/1978
Capacity Gallons:	1500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	0H1
Tank Id:	9506
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	8/1/1977
Capacity Gallons:	2000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	0H2
Tank Id:	9507
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1967
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

NEWTOWN CREEK PLANT (Continued) **U003074438**

Tank Number:	0M1
Tank Id:	9508
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	8/1/1977
Capacity Gallons:	2000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST AST:

PBS Number:	2-206334
SWIS Code:	6301
Operator:	MASPETH CONC. LOADING
Facility Phone:	(718) 474-4741
Facility Addr2:	33005 LAUREL HILL BLVD
Facility Type:	Not reported
Emergency:	JOHN QUADROZZI
Emergency Tel:	(718) 474-4333
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	MASPETH CONCRETE LOADING CORP
Owner Address:	PO BOX 960493
Owner City,St,Zip:	INWOOD, NY 11096
Federal ID:	Not reported
Owner Tel:	(718) 474-4741
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	MASPETH CONCRETE LOADING
Mailing Name:	PO BOX 960493
Mailing Address:	Not reported
Mailing Address 2:	Not reported
Mailing City,St,Zip:	INWOOD, NY 11096-0493
Mailing Telephone:	(718) 474-4741
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	False
Certification Date:	11/12/1997
Expiration:	06/30/2002
Renew Flag:	False
Renew Date:	Not reported
Total Capacity:	12025
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing

NEWTOWN CREEK PLANT (Continued) **U003074438**

Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City Code:	01
Region:	2

Tank ID:	002
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	19780601
Capacity (Gal):	1500
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	003
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (Gal):	2000
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported

NEWTOWN CREEK PLANT (Continued) **U003074438**

Deleted:	False
Updated:	False
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	0D4
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	19780601
Capacity (Gal):	1500
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	0H1
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	19770801
Capacity (Gal):	2000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False

NEWTOWN CREEK PLANT (Continued) **U003074438**

Updated:	False
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	0H2
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	19670401
Capacity (Gal):	275
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	0M1
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	19770801
Capacity (Gal):	2000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	None
Leak Detection:	0
Overfill Protection:	Not reported
Dispenser Method:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False

NEWTOWN CREEK PLANT (Continued) **U003074438**

SPDES Number: Not reported
Lat/Long: Not reported

AH535 **OLD COUNTRY-AUTOBODY** **FINDS** **1007802105**
SE **58-02 58TH AVENUE** **N/A**
1/8-1/4 **QUEENS, NY 11378**
0.171 mi.
905 ft. **Site 5 of 5 in cluster AH**

Relative:
Higher

Actual:
29 ft.

FINDS:

Registry ID: 110019646329

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AE536 **CONSOLIDATED EDISON** **MANIFEST** **S110137898**
NNE **43-01 43 ST & 55 AVE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.177 mi.
933 ft. **Site 5 of 9 in cluster AE**

Relative:
Higher

Actual:
48 ft.

NY MANIFEST:

EPA ID:	NYP004195681
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLYN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD003812047
Trans2 State ID:	NJD003812047
Generator Ship Date:	2009-10-12
Trans1 Recv Date:	2009-10-12
Trans2 Recv Date:	2009-10-13
TSD Site Recv Date:	2009-10-13
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004195681
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD991291105
Waste Code:	Not reported
Quantity:	31340.0

CONSOLIDATED EDISON (Continued) **S110137898**

Units:	P - Pounds
Number of Containers:	1.0
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000893904GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H111

AE537 **CON EDISON - MANHOLE 168** **RCRA-LQG** **1014397250**
NNE **43-01 43 ST & 55 AVE** **NYP004195681**
1/8-1/4 **MASPETH, NY 11378**
0.177 mi.
933 ft. **Site 6 of 9 in cluster AE**

Relative:
Higher

Actual:
48 ft.

RCRA-LQG:

Date form received by agency:	03/23/2010
Facility name:	CON EDISON - MANHOLE 168
Facility address:	43-01 43 ST & 55 AVE MASPETH, NY 11378
EPA ID:	NYP004195681
Mailing address:	4 IRVING PLACE NEW YORK, NY 10003
Contact:	FRANKLYN MURRAY
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	(212) 460-2808
Contact email:	MURRAYFR@CONED.COM
EPA Region:	02
Classification:	Large Quantity Generator
Description:	Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	4 IRVING PLACE

CON EDISON - MANHOLE 168 (Continued) **1014397250**

NEW YORK, NY 10003
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 09/18/2009
Owner/Op end date: Not reported

Owner/operator name: CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address: 4 IRVING PLACE
NEW YORK, NY 10003
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 09/18/2009
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 09/18/2009
Facility name: CON EDISON - MANHOLE 168
Site name: CON EDISON
Classification: Conditionally Exempt Small Quantity Generator

Hazardous Waste Summary:
Waste code: D008
Waste name: LEAD

Violation Status: No violations found

AM538 **TRIBORO PLATERS INC** **UST** **U001831419**
NNE **44-11 55TH AVE** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.177 mi.
935 ft. **Site 1 of 3 in cluster AM**

Relative:
Higher

Actual:
70 ft.

UST:
Facility Id: 2-045403
Region: STATE
DEC Region: 2

TRIBORO PLATERS INC (Continued) **U001831419**

Site Status: Active
Program Type: PBS
Expiration Date: 1996/12/02
UTM X: 590877.32028999995
UTM Y: 4509331.0208700001

Affiliation Records:

Site Id: 564
Affiliation Type: Owner
Company Name: TRIBORO PLATING
Contact Type: Not reported
Contact Name: Not reported
Address1: 44-11 55TH AVE
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 784-4131
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 564
Affiliation Type: Mail Contact
Company Name: TRIBORO PLATERS
Contact Type: Not reported
Contact Name: ABE LASKER
Address1: 44-11 55TH AVE
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378
Country Code: 001
Phone: (718) 784-4131
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 564
Affiliation Type: On-Site Operator
Company Name: TRIBORO PLATERS INC
Contact Type: Not reported
Contact Name: ABE LASKER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 784-4131
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

TRIBORO PLATERS INC (Continued) **U001831419**

Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 564
Affiliation Type: Emergency Contact
Company Name: TRIBORO PLATING
Contact Type: Not reported
Contact Name: ABE LASKER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 339-3193
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None
F01 - Pipe External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L09 - Piping Leak Detection - Exempt Suction Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)
J02 - Dispenser - Suction
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Info:
Site ID: 564

Tank Number: 001
Tank ID: 1429
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 2000
Tightness Test Method: 00
Next Test Date: 12/27/1987
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:
PBS Number: 2-045403
SPDES Number: Not reported
Emergency Contact: ABE LASKER

TRIBORO PLATERS INC (Continued) **U001831419**

Emergency Telephone:	(718) 339-3193
Operator:	ABE LASKER
Operator Telephone:	(718) 784-4131
Owner Name:	TRIBORO PLATING
Owner Address:	44-11 55TH AVE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 784-4131
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	TRIBORO PLATERS
Mailing Address:	44-11 55TH AVE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	ABE LASKER
Mailing Telephone:	(718) 784-4131
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	44011 55TH AVE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	MANUFACTURING
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	11/29/1991
Expiration Date:	12/02/1996
Renew Flag:	False
Renewal Date:	19930614
Total Capacity:	2000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	2000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating

TRIBORO PLATERS INC (Continued) **U001831419**

Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

AM539 **Z & V REALTY** **MANIFEST** **S109787565**
NNE **44-11 55TH AVE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.177 mi.
935 ft. **Site 2 of 3 in cluster AM**

Relative:
Higher

Actual:
70 ft.

CT MANIFEST:

Waste:
Manifest No: CTF0546064
Waste Occurence: 1
UNNA: 3082
Hazard Class: 9
US Dot Description: env. Hazardous substance liquid nos
No of Containers: 001
Container Type: TT
Quantity: 640
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 4/26/2004
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0546064
Waste Occurence: 1
EPA Waste Code: D007
Recycled Waste?: F
Date Record Was Last Modified: 4/26/2004
DEO Who Last Modified Record: IG

Detail:
Year: 1996
Manifest ID: CTF0546064
TSDF EPA ID: CTD072138969
TSDF Name: ENVIRONMENTAL WASTE RESOURCES
TSDF Address: 130 FREIGHT ST. WATERBURY
TSDF City,St,Zip: CT 06725
TSDF Country: USA
TSDF Telephone: Not reported
Transport Date: 9/3/1996
Transporter EPA ID: CTD016424210
Transporter Name: TRI-S, INCORPORATED
Transporter Country: USA

Z & V REALTY (Continued) **S109787565**

Transporter Phone:	Not reported
Trans 2 Date:	Not reported
Trans 2 EPA ID:	Not reported
Trans 2 Name:	Not reported
Trans 2 Address:	Not reported
Trans 2 City,St,Zip:	CT
Trans 2 Country:	USA
Trans 2 Phone:	Not reported
EPA ID:	NYR000021931
Generator Phone:	5168627550
Generator Mailing Addr:	44-11 55TH AVE
Generator Mailing Town:	MASPETH
Generator Mailing State:	NY
Generator Mailing Zip:	11378
Generator Mailing Country:	USA
Special Handling:	Not reported
Discrepancies:	Not reported
Date Shipped:	9/3/1996
Date Received:	Not reported
Last modified date:	4/26/2004
Last modified by:	IG
Comments:	Not reported

AM540 **Z & V REALTY** **RCRA-NonGen** **1001090356**
NNE **44-11 55TH AVE** **FINDS** **NYR000021931**
1/8-1/4 **MASPETH, NY 11378** **MANIFEST**
0.177 mi. **MANIFEST**
935 ft. **Site 3 of 3 in cluster AM**

Relative:
Higher

Actual:
70 ft.

RCRA-NonGen:

Date form received by agency:	01/01/2007
Facility name:	Z & V REALTY
Facility address:	44-11 55TH AVE MASPETH, NY 113781023
EPA ID:	NYR000021931
Mailing address:	PIPER LANE ST JAMES, NY 11780
Contact:	Not reported
Contact address:	PIPER LANE ST JAMES, NY 11780
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Private
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	BRUNO ZUCCHELLI
Owner/operator address:	9 PARADE PL NEW WINDSOR, NY 12553
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator

Z & V REALTY (Continued) **1001090356**

Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: BRUNO ZUCCHELLI
Owner/operator address: 9 PARADE PL
NEW WINDSOR, NY 12553
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: Z & V REALTY
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: Z & V REALTY
Classification: Not a generator, verified

Date form received by agency: 04/04/1996
Facility name: Z & V REALTY
Classification: Small Quantity Generator

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Generators - Records/Reporting
Date violation determined: 08/26/1997
Date achieved compliance: 10/15/1997
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/26/1997
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 0
Final penalty amount: 0

Z & V REALTY (Continued) **1001090356**

Paid penalty amount: 0

Evaluation Action Summary:
Evaluation date: 03/01/1997
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - Records/Reporting
Date achieved compliance: 10/15/1997
Evaluation lead agency: State

FINDS:

Registry ID: 110004523784

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MANIFEST:
GEN Cert Date: 9/10/1996
Transporter Recpt Date: Not reported
Number Of Containers: 0
Container Type: Not reported
Waste Code1: D003
Waste Code2: Not reported
Waste Code3: Not reported
Comment: Not reported
Fee Exempt Code: Not reported
TSDF Name: ETICAM WARWICK FACILITY
TSDF ID: RID980906986
TSDF Date: Not reported
Date Imported: 1/27/1997
Transporter 2 Name: Not reported
Transporter 2 ID: Not reported
Manifest Docket Number: CTF0412313
Waste Description: CYANIDE
Quantity: 1450
WT/Vol Units: G
Item Number: 1
Transporter Name: TRI S INC
Transporter EPA ID: CTD016424210
GEN Cert Date: 9/10/1996
Transporter Recpt Date: Not reported
Transporter 2 Recpt Date: Not reported
TSDF Recpt Date: Not reported
EPA ID: NYR000021931
Transporter 2 ID: Not reported

NY MANIFEST:
EPA ID: NYR000021931
Country: USA

Z & V REALTY (Continued) **1001090356**

Mailing Name:	TRIBOROUGH PLATING
Mailing Contact:	JUNIOR DIAZA
Mailing Address:	1 PIPER LANE
Mailing Address 2:	Not reported
Mailing City:	ST JAMES
Mailing State:	NY
Mailing Zip:	11780
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	516-862-7550

Document ID:	CTF0412013
Manifest Status:	Completed copy
Trans1 State ID:	V12631CT
Trans2 State ID:	Not reported
Generator Ship Date:	960409
Trans1 Recv Date:	960409
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	960409
Part A Recv Date:	Not reported
Part B Recv Date:	960424
Generator EPA ID:	NYR000021931
Trans1 EPA ID:	CTD016424210
Trans2 EPA ID:	Not reported
TSDF ID:	RID980906986
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Quantity:	01038
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	96

Document ID:	CTF0412017
Manifest Status:	Completed copy
Trans1 State ID:	V12631CT
Trans2 State ID:	Not reported
Generator Ship Date:	960411
Trans1 Recv Date:	960411
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	960411
Part A Recv Date:	Not reported
Part B Recv Date:	960424
Generator EPA ID:	NYR000021931
Trans1 EPA ID:	CTD016424210
Trans2 EPA ID:	Not reported
TSDF ID:	RID980906986
Waste Code:	D003 - NON-LISTED REACTIVE WASTES
Quantity:	01457
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100

Z & V REALTY (Continued) **1001090356**

Year: 96

Document ID: NYB8532135
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 8801ST
Trans2 State ID: Not reported
Generator Ship Date: 961106
Trans1 Recv Date: 961106
Trans2 Recv Date: Not reported
TSD Site Recv Date: 961107
Part A Recv Date: 961220
Part B Recv Date: 961216
Generator EPA ID: NYR000021931
Trans1 EPA ID: CTD016424210
Trans2 EPA ID: Not reported
TSDF ID: NYD057770109
Waste Code: D006 - CADMIUM 1.0 MG/L TCLP
Quantity: 00002
Units: Y - Cubic yards* (.85 tons)
Number of Containers: 002
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00550
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 010
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00715
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 013
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 96

Document ID: CTF0546064
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: V12631
Trans2 State ID: Not reported
Generator Ship Date: 960903
Trans1 Recv Date: 960903
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960903
Part A Recv Date: 960919

Z & V REALTY (Continued) **1001090356**

Part B Recv Date: 961003
Generator EPA ID: NYR000021931
Trans1 EPA ID: CTD016424210
Trans2 EPA ID: Not reported
TSDF ID: CTD072138969
Waste Code: D007 - CHROMIUM 5.0 MG/L TCLP
Quantity: 00640
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 96

Document ID: CTF0412016
Manifest Status: Completed copy
Trans1 State ID: V12631CT
Trans2 State ID: Not reported
Generator Ship Date: 960410
Trans1 Recv Date: 960410
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960410
Part A Recv Date: Not reported
Part B Recv Date: 960424
Generator EPA ID: NYR000021931
Trans1 EPA ID: CTD016424210
Trans2 EPA ID: Not reported
TSDF ID: RID980906986
Waste Code: D007 - CHROMIUM 5.0 MG/L TCLP
Quantity: 03795
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 96

Document ID: CTF0412313
Manifest Status: Completed copy
Trans1 State ID: 92012CT
Trans2 State ID: Not reported
Generator Ship Date: 960910
Trans1 Recv Date: 960910
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960910
Part A Recv Date: 960919
Part B Recv Date: 961004
Generator EPA ID: NYR000021931
Trans1 EPA ID: CTD016424210
Trans2 EPA ID: Not reported
TSDF ID: RID980906986
Waste Code: D003 - NON-LISTED REACTIVE WASTES
Quantity: 01450
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001

Z & V REALTY (Continued) **1001090356**

Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 96

Document ID: NYB8532144
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 11284PNY
Trans2 State ID: Not reported
Generator Ship Date: 961107
Trans1 Recv Date: 961107
Trans2 Recv Date: Not reported
TSD Site Recv Date: 961108
Part A Recv Date: 961220
Part B Recv Date: 961205
Generator EPA ID: NYR000021931
Trans1 EPA ID: NYD980769947
Trans2 EPA ID: Not reported
TSDF ID: NYD057770109
Waste Code: F008 - PLAT SLDG FM BTM PLAT BATH OPER CYANIDE.
Quantity: 00990
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 018
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00007
Units: Y - Cubic yards* (.85 tons)
Number of Containers: 007
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00880
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 016
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

AE541 **UPS** **NY Spills** **S106015899**
NNE **43-22 55TH AVE** **N/A**
1/8-1/4 **QUEENS, NY**
0.177 mi.
936 ft. **Site 7 of 9 in cluster AE**

Relative:
Higher

Actual:
51 ft.

NY Spills:

Site ID:	234506
Facility Addr2:	Not reported
Facility ID:	0303712
Spill Number:	0303712
Facility Type:	ER
SWIS:	4101
Investigator:	JXZHAO
Referred To:	Not reported
Spill Date:	7/9/2003
Reported to Dept:	7/9/2003
CID:	257
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	11/14/2003
Remediation Phase:	0
Date Entered In Computer:	7/9/2003
Spill Record Last Update:	11/14/2003
Spiller Name:	Not reported
Spiller Company:	WASTE MANAGEMENT
Spiller Address:	123 VARICK AVE
Spiller City,St,Zip:	BROOKLYN, NY -
Spiller Company:	001
Contact Name:	JAY KAPLIN
Contact Phone:	(718) 533-5310
DEC Region:	2
DER Facility ID:	193173
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ZHAO" 7/9/2003 - Zhao spoke with Jay Kaplan, Waste Management. Spill due to faulty valves at bottom of saddle tank. All street spill cleanned up by speedy dry. Partial spill went to a dry well. All State Power Vac. hired for dry well clean up. Power wash will apply. Jay will send statement and Manifest for spill closure.
Remarks:	cleanup is in process - spill in on road way and might have gotten into a drywell - clean up contractor being contacted to clean drywell

Material:

Site ID:	234506
Operable Unit ID:	870821
Operable Unit:	01
Material ID:	504574
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum

UPS (Continued) **S106015899**

Quantity:	40
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

AE542 **UNITED PARCEL SERVICE** **RCRA-SQG** **1000398435**
NNE **43-22 55TH AVE** **FINDS** **NYD986874576**
1/8-1/4 **MASPETH, NY 11378** **HIST UST**
0.177 mi. **AST**
936 ft. **Site 8 of 9 in cluster AE** **HIST AST**
MANIFEST

Relative:
Higher

Actual:
51 ft.

RCRA-SQG:

Date form received by agency:	01/01/2007
Facility name:	UNITED PARCEL SERVICE
Facility address:	43-22 55TH AVE MASPETH, NY 11378
EPA ID:	NYD986874576
Mailing address:	55TH AVE MASPETH, NY 11378
Contact:	Not reported
Contact address:	55TH AVE MASPETH, NY 11378
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	UNITED PARCEL SERVICE
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Owner/Op end date: Not reported

Owner/operator name: UNITED PARCEL SERVICE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: UNITED PARCEL SERVICE
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/14/1999
Facility name: UNITED PARCEL SERVICE
Classification: Small Quantity Generator

Date form received by agency: 09/01/1988
Facility name: UNITED PARCEL SERVICE
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004437789

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department

UNITED PARCEL SERVICE (Continued) **1000398435**

of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

HIST UST:

PBS Number:	2-511803
SPDES Number:	Not reported
Emergency Contact:	PAUL VETRANO
Emergency Telephone:	(718) 706-3105
Operator:	PAUL VETRANO
Operator Telephone:	(718) 706-3105
Owner Name:	UPS
Owner Address:	43-22 55 AVE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 706-3121
Owner Type:	Corporate/Commercial
Owner Subtype:	51
Mailing Name:	UPS
Mailing Address:	46-05 55TH ROAD
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	PAUL VETRANO
Mailing Telephone:	(718) 706-3121
Owner Mark:	First Owner
Facility Status:	4 - Subpart 360-14 only (active)
Facility Addr2:	43-22 55 AVE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	OTHER
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	True
Certification Date:	Not reported
Expiration Date:	03/28/2007
Renew Flag:	False
Renewal Date:	20011113
Total Capacity:	1055
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2
Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19680601
Capacity (gals):	1000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel

UNITED PARCEL SERVICE (Continued) **1000398435**

Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	09/01/1990
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19680601
Capacity (gals):	1000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	09/01/1990
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-Removed
Install Date:	19680601
Capacity (gals):	1000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	09/01/1990
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-511803
Program Type:	PBS
UTM X:	590778.53992000001
UTM Y:	4509376.3297699997
Expiration Date:	2012/03/28

Affiliation Records:

Site Id:	21978
Affiliation Type:	Mail Contact
Company Name:	UPS - PLANT ENGINEERING
Contact Type:	Not reported
Contact Name:	PAUL VETRANO
Address1:	46-05 56TH ROAD
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 706-3121
Phone Ext:	Not reported
Email:	PVETRANO@UPS.COM
Fax Number:	Not reported
Modified By:	DXLIVING
Date Last Modified:	12/28/2006

Site Id:	21978
Affiliation Type:	Emergency Contact
Company Name:	UPS
Contact Type:	Not reported
Contact Name:	PAUL VETRANO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 706-3105

UNITED PARCEL SERVICE (Continued) **1000398435**

Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	21978
Affiliation Type:	On-Site Operator
Company Name:	UPS
Contact Type:	Not reported
Contact Name:	PAUL VETRANO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 706-3105
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	21978
Affiliation Type:	Owner
Company Name:	UPS
Contact Type:	PE SUPV
Contact Name:	PAUL VETRANO
Address1:	43-22 55 AVE
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 706-3121
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	DXLIVING
Date Last Modified:	12/28/2006

Equipment Records:

F00 - Pipe External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
D00 - Pipe Type - No Piping
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
J00 - Dispenser - None
G00 - Tank Secondary Containment - None

UNITED PARCEL SERVICE (Continued) **1000398435**

J00 - Dispenser - None
H05 - Tank Leak Detection - In-Tank System (ATG)
C02 - Pipe Location - Underground/On-ground
D02 - Pipe Type - Galvanized Steel
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
I02 - Overfill - High Level Alarm
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
D00 - Pipe Type - No Piping
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
K00 - Spill Prevention - None
J00 - Dispenser - None
I00 - Overfill - None
B07 - Tank External Protection - Retrofitted Sacrificial Anode
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
D02 - Pipe Type - Galvanized Steel
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None

Tank Info:

Tank Number:	004
Tank Id:	51588
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

Tank Number:	005
Tank Id:	62649
Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Install Date:	1/1/1997
Capacity Gallons:	55
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DXLIVING
Last Modified:	12/28/2006

HIST AST:

PBS Number:	2-511803
SWIS Code:	6301
Operator:	PAUL VETRANO
Facility Phone:	(718) 706-3105
Facility Addr2:	43-22 55 AVE
Facility Type:	OTHER
Emergency:	PAUL VETRANO
Emergency Tel:	(718) 706-3105
Old PBSNO:	Not reported
Date Inspected:	Not reported
Inspector:	Not reported
Result of Inspection:	Not reported
Owner Name:	UPS
Owner Address:	43-22 55 AVE
Owner City,St,Zip:	MASPETH, NY 11378
Federal ID:	Not reported
Owner Tel:	(718) 706-3121
Owner Type:	Corporate/Commercial
Owner Subtype:	51
Mailing Contact:	PAUL VETRANO
Mailing Name:	UPS
Mailing Address:	46-05 55TH ROAD
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Telephone:	(718) 706-3121
Owner Mark:	First Owner
Facility Status:	4 - Subpart 360-14 only (active)
Certification Flag:	True
Certification Date:	Not reported
Expiration:	03/28/2007
Renew Flag:	False
Renew Date:	20011113
Total Capacity:	1055
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City Code:	01
Region:	2

Tank ID:	004
Tank Location:	ABOVEGROUND

UNITED PARCEL SERVICE (Continued) **1000398435**

Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (Gal):	275
Product Stored:	USED OIL
Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	00
Pipe Location:	None
Pipe Type:	NONE
Pipe Internal:	None
Pipe External:	00
Tank Containment:	None
Leak Detection:	00
Overfill Protection:	00
Dispenser Method:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

Tank ID:	005
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (Gal):	55
Product Stored:	USED OIL
Tank Type:	Steel/carbon steel
Tank Internal:	0
Tank External:	0
Pipe Location:	None
Pipe Type:	NONE
Pipe Internal:	None
Pipe External:	00
Tank Containment:	None
Leak Detection:	00
Overfill Protection:	00
Dispenser Method:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
SPDES Number:	Not reported
Lat/Long:	Not reported

NY MANIFEST:

EPA ID:	NYD986874576
Country:	USA
Mailing Name:	UNITED PARCEL SERVICE

UNITED PARCEL SERVICE (Continued) **1000398435**

Mailing Contact:	UNITED PARCEL SERVICE
Mailing Address:	43-22 55TH AVE
Mailing Address 2:	Not reported
Mailing City:	FLUSHING
Mailing State:	NY
Mailing Zip:	11378
Mailing Zip4:	1043
Mailing Country:	USA
Mailing Phone:	718-784-3060

Document ID:	ILA0890437
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	05/06/2003
Trans1 Recv Date:	05/06/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/15/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD980613913
Trans2 EPA ID:	Not reported
TSDF ID:	UPW151288
Waste Code:	F005 - UNKNOWN
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	ILA0600790
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	02/10/2003
Trans1 Recv Date:	02/10/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/20/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD980613913
Trans2 EPA ID:	Not reported
TSDF ID:	UPW151288
Waste Code:	F005 - UNKNOWN
Quantity:	00036
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

UNITED PARCEL SERVICE (Continued) **1000398435**

Document ID:	ILA0604396
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	03/10/2003
Trans1 Recv Date:	03/10/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/20/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD980613913
Trans2 EPA ID:	Not reported
TSDF ID:	UPW151288
Waste Code:	F005 - UNKNOWN
Quantity:	00112
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	F005 - UNKNOWN
Quantity:	00006
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	ILA0879231
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	12/23/2003
Trans1 Recv Date:	12/23/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/06/2004
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD980613913
Trans2 EPA ID:	Not reported
TSDF ID:	UPW151288
Waste Code:	F005 - UNKNOWN
Quantity:	00036
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	ILA0855780
Manifest Status:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	04/10/2003
Trans1 Recv Date:	04/10/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/24/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD980613913
Trans2 EPA ID:	Not reported
TSDF ID:	UPW151288
Waste Code:	F005 - UNKNOWN
Quantity:	00020
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	03

Document ID:	NYC3187168
Manifest Status:	Completed copy
Trans1 State ID:	AM6252NY
Trans2 State ID:	Not reported
Generator Ship Date:	940909
Trans1 Recv Date:	940909
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940909
Part A Recv Date:	940916
Part B Recv Date:	940919
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980785760
Waste Code:	F005 - UNKNOWN
Quantity:	00036
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00224
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94

Document ID:	NYC3181825
Manifest Status:	Completed copy
Trans1 State ID:	AM6252NY
Trans2 State ID:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Generator Ship Date:	941004
Trans1 Recv Date:	941004
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	941004
Part A Recv Date:	941013
Part B Recv Date:	941014
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980785760
Waste Code:	F005 - UNKNOWN
Quantity:	00036
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00224
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94

Document ID:	NYC3262173
Manifest Status:	Completed copy
Trans1 State ID:	AM6252NY
Trans2 State ID:	Not reported
Generator Ship Date:	950321
Trans1 Recv Date:	950321
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950321
Part A Recv Date:	950331
Part B Recv Date:	950329
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980785760
Waste Code:	F005 - UNKNOWN
Quantity:	00036
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00112
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	95

UNITED PARCEL SERVICE (Continued) **1000398435**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	2009-03-19
Trans1 Recv Date:	2009-03-19
Trans2 Recv Date:	2009-03-27
TSD Site Recv Date:	2009-03-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002182897
Waste Code:	Not reported
Quantity:	110.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001356169SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	2009-05-13
Trans1 Recv Date:	2009-05-13
Trans2 Recv Date:	2009-05-22
TSD Site Recv Date:	2009-05-22
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002182897
Waste Code:	Not reported
Quantity:	110.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0

UNITED PARCEL SERVICE (Continued) **1000398435**

Year:	09
Manifest Tracking Num:	001918746SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	2009-04-07
Trans1 Recv Date:	2009-04-07
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-04-21
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	ILD980613913
Waste Code:	Not reported
Quantity:	36.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001677835SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	2009-06-30
Trans1 Recv Date:	2009-06-30

UNITED PARCEL SERVICE (Continued) **1000398435**

Trans2 Recv Date:	2009-07-07
TSD Site Recv Date:	2009-07-21
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	ILD980613913
Waste Code:	Not reported
Quantity:	36.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001877730SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	2009-06-03
Trans1 Recv Date:	2009-06-03
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-06-16
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	ILD980613913
Waste Code:	Not reported
Quantity:	36.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001846729SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N

UNITED PARCEL SERVICE (Continued) **1000398435**

Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-03-24
Trans1 Recv Date:	2009-03-24
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-04-08
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	531.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000232429WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	2009-01-28
Trans1 Recv Date:	2009-01-28
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-02-10
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Trans2 EPA ID:	Not reported
TSDF ID:	ILD980613913
Waste Code:	Not reported
Quantity:	36.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001643150SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	2009-07-27
Trans1 Recv Date:	2009-07-27
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-08-04
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	ILD980613913
Waste Code:	Not reported
Quantity:	36.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	002076269SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported

UNITED PARCEL SERVICE (Continued) **1000398435**

Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: Not reported
Generator Ship Date: 2009-03-11
Trans1 Recv Date: 2009-03-11
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2009-03-24
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986874576
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: ILD980613913
Waste Code: Not reported
Quantity: 36.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 09
Manifest Tracking Num: 001600491SKS
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: Not reported
Generator Ship Date: 2009-05-04
Trans1 Recv Date: 2009-05-04
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2009-05-12
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986874576
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: ILD980613913
Waste Code: Not reported
Quantity: 36.0
Units: P - Pounds
Number of Containers: 1.0

UNITED PARCEL SERVICE (Continued) **1000398435**

Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	001910898SKS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H020

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114
Trans2 State ID:	Not reported
Generator Ship Date:	2009-08-10
Trans1 Recv Date:	2009-08-10
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-08-27
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	531.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000272228WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	IND058484114

UNITED PARCEL SERVICE (Continued) **1000398435**

Trans2 State ID:	Not reported
Generator Ship Date:	2009-05-18
Trans1 Recv Date:	2009-05-18
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	2009-06-01
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986874576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	IND093219012
Waste Code:	Not reported
Quantity:	345.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	09
Manifest Tracking Num:	000244679WAS
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Click this hyperlink while viewing on your computer to access
431 additional NY_MANIFEST: record(s) in the EDR Site Report.

AE543 **UNITED PARCEL SERVICE** **MANIFEST** **S108794061**
NNE **43-22 55TH AVE** **N/A**
1/8-1/4 **QUEENS, NY 11378**
0.177 mi.
936 ft. **Site 9 of 9 in cluster AE**

Relative:
Higher

Actual:
51 ft.

NJ MANIFEST:

Manifest Code:	001918746SKS
EPA ID:	NYD986874576
Date Shipped:	05/13/09
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	NJD071629976
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	05/13/09
Date Trans2 Transported Waste:	5/22/09
Date Trans3 Transported Waste:	Not reported

UNITED PARCEL SERVICE (Continued) **S108794061**

Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 05/22/09
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: F005
Manifest Year: 2009 New Jersey Manifest Data
Quantity: 110
Unit: P
Hand Code: H020

Manifest Code: 000281988CEX
EPA ID: NYD986874576
Date Shipped: 11/20/09
TSDF EPA ID: NJD002182897
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 11/20/09
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 12/04/09
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: F005
Manifest Year: 2009 New Jersey Manifest Data
Quantity: 110
Unit: P
Hand Code: H020

UNITED PARCEL SERVICE (Continued) **S108794061**

Manifest Code:	001356169SKS
EPA ID:	NYD986874576
Date Shipped:	03/19/09
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	NJD071629976
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	03/19/09
Date Trans2 Transported Waste:	3/27/09
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	03/27/09
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	F005
Manifest Year:	2009 New Jersey Manifest Data
Quantity:	110
Unit:	P
Hand Code:	H020

Manifest Code:	000309835SKS
EPA ID:	NYD986874576
Date Shipped:	5/23/200
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	5/23/2
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported

UNITED PARCEL SERVICE (Continued) **S108794061**

Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 6/5/20
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: F005
Manifest Year: 2007 New Jersey Manifest Data
Quantity: 119
Unit: P
Hand Code: H02

Manifest Code: 000049695SKS
EPA ID: NYD986874576
Date Shipped: 6/14/200
TSDF EPA ID: NJD002182897
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: MOD095038998
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 6/14/2
Date Trans2 Transported Waste: 6/21/2
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 6/21/2
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: F005
Manifest Year: 2007 New Jersey Manifest Data
Quantity: 112
Unit: P
Hand Code: H02

UNITED PARCEL SERVICE (Continued) **S108794061**

Manifest Code:	000369769SKS
EPA ID:	NYD986874576
Date Shipped:	2/12/200
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	2/12/2
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	2/20/2
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	F005
Manifest Year:	2007 New Jersey Manifest Data
Quantity:	232
Unit:	P
Hand Code:	H02

Manifest Code:	000958916SKS
EPA ID:	NYD986874576
Date Shipped:	1/15/2008
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	NJD071629976
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	1/15/2008
Date Trans2 Transported Waste:	1/25/2008
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported

UNITED PARCEL SERVICE (Continued) **S108794061**

Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	1/25/2008
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	F005
Manifest Year:	2008 New Jersey Manifest Data
Quantity:	100
Unit:	P
Hand Code:	H020

Manifest Code:	000092679SKS
EPA ID:	NYD986874576
Date Shipped:	10/26/20
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	10/26/
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	11/6/2
Tranporter 1 Decal:	Not reported
Tranporter 2 Decal:	Not reported
Data Entry Number:	Not reported
Reference Manifest Number:	Not reported
Was Load Rejected (Y/N):	No
Reason Load Was Rejected:	Not reported
Waste Code:	Not reported
Manifest Year:	Not reported
Quantity:	Not reported
Unit:	Not reported
Hand Code:	Not reported

AK544 **DSNY QUEENS DISTRICT 5A GARAGE** **UST** **U003790792**
SSW **58-02 48TH STREET** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.180 mi.
953 ft. **Site 2 of 5 in cluster AK**

Relative:
Higher

Actual:
14 ft.

UST:

Facility Id:	2-605735
Region:	STATE
DEC Region:	2
Site Status:	Active
Program Type:	PBS
Expiration Date:	2016/04/23
UTM X:	591052.27041
UTM Y:	4508426.9903100003

Affiliation Records:

Site Id:	27602
Affiliation Type:	Emergency Contact
Company Name:	NYC DEPARTMENT OF SANITATION
Contact Type:	Not reported
Contact Name:	BUREAU OF CLEANING & COLLECTIONS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 885-4874
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	12/8/2010

Site Id:	27602
Affiliation Type:	On-Site Operator
Company Name:	DSNY QUEENS DISTRICT 5A GARAGE
Contact Type:	Not reported
Contact Name:	GARAGE SUPERVISOR
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 497-6244
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	8/20/2010

Site Id:	27602
Affiliation Type:	Owner
Company Name:	NYC DEPARTMENT OF SANITATION
Contact Type:	ASST CHIEF
Contact Name:	ANTHONY
Address1:	125 WORTH ST., RM 823 B
Address2:	Not reported

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

City:	NEW YORK
State:	NY
Zip Code:	10013
Country Code:	001
Phone:	(646) 885-4874
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	4/12/2011

Site Id:	27602
Affiliation Type:	Mail Contact
Company Name:	NYC DEPT. OF SANITATION
Contact Type:	Not reported
Contact Name:	A/C M. BONACORSA
Address1:	125 WORTH STREET
Address2:	ROOM 823 B
City:	NEW YORK
State:	NY
Zip Code:	10013
Country Code:	001
Phone:	(646) 885-4874
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	8/20/2010

Equipment Records:

L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
E04 - Piping Secondary Containment - Double-Walled (Underground)
L00 - Piping Leak Detection - None
F00 - Pipe External Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
K01 - Spill Prevention - Catch Basin
K01 - Spill Prevention - Catch Basin
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
E00 - Piping Secondary Containment - None
I02 - Overfill - High Level Alarm
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
H05 - Tank Leak Detection - In-Tank System (ATG)
C03 - Pipe Location - Aboveground/Underground Combination
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
H05 - Tank Leak Detection - In-Tank System (ATG)
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

L09 - Piping Leak Detection - Exempt Suction Piping
H05 - Tank Leak Detection - In-Tank System (ATG)
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H05 - Tank Leak Detection - In-Tank System (ATG)
H05 - Tank Leak Detection - In-Tank System (ATG)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G04 - Tank Secondary Containment - Double-Walled (Underground)
I02 - Overfill - High Level Alarm
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
E00 - Piping Secondary Containment - None
J00 - Dispenser - None
E00 - Piping Secondary Containment - None
I00 - Overfill - None
B04 - Tank External Protection - Fiberglass
B04 - Tank External Protection - Fiberglass
F02 - Pipe External Protection - Original Sacrificial Anode
I02 - Overfill - High Level Alarm
H00 - Tank Leak Detection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
K00 - Spill Prevention - None
B04 - Tank External Protection - Fiberglass
J00 - Dispenser - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
J00 - Dispenser - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
C03 - Pipe Location - Aboveground/Underground Combination
E00 - Piping Secondary Containment - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
F02 - Pipe External Protection - Original Sacrificial Anode
C03 - Pipe Location - Aboveground/Underground Combination
D02 - Pipe Type - Galvanized Steel
D02 - Pipe Type - Galvanized Steel
D01 - Pipe Type - Steel/Carbon Steel/Iron
K01 - Spill Prevention - Catch Basin
I02 - Overfill - High Level Alarm
J01 - Dispenser - Submersible
L08 - Piping Leak Detection - Tank Top Sump
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
D02 - Pipe Type - Galvanized Steel
L09 - Piping Leak Detection - Exempt Suction Piping
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
G04 - Tank Secondary Containment - Double-Walled (Underground)
K00 - Spill Prevention - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C03 - Pipe Location - Aboveground/Underground Combination
J01 - Dispenser - Submersible

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

F00 - Pipe External Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
F04 - Pipe External Protection - Fiberglass
F04 - Pipe External Protection - Fiberglass
K01 - Spill Prevention - Catch Basin
I02 - Overfill - High Level Alarm
F02 - Pipe External Protection - Original Sacrificial Anode
D02 - Pipe Type - Galvanized Steel
G04 - Tank Secondary Containment - Double-Walled (Underground)
B04 - Tank External Protection - Fiberglass
C03 - Pipe Location - Aboveground/Underground Combination
B04 - Tank External Protection - Fiberglass
E00 - Piping Secondary Containment - None
C03 - Pipe Location - Aboveground/Underground Combination
E00 - Piping Secondary Containment - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C03 - Pipe Location - Aboveground/Underground Combination
G04 - Tank Secondary Containment - Double-Walled (Underground)
J01 - Dispenser - Submersible
L08 - Piping Leak Detection - Tank Top Sump
H05 - Tank Leak Detection - In-Tank System (ATG)
B04 - Tank External Protection - Fiberglass
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
C03 - Pipe Location - Aboveground/Underground Combination
C03 - Pipe Location - Aboveground/Underground Combination
H05 - Tank Leak Detection - In-Tank System (ATG)
F04 - Pipe External Protection - Fiberglass
K01 - Spill Prevention - Catch Basin
D02 - Pipe Type - Galvanized Steel
B04 - Tank External Protection - Fiberglass
H05 - Tank Leak Detection - In-Tank System (ATG)
G04 - Tank Secondary Containment - Double-Walled (Underground)
H05 - Tank Leak Detection - In-Tank System (ATG)
G04 - Tank Secondary Containment - Double-Walled (Underground)
C03 - Pipe Location - Aboveground/Underground Combination
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
H05 - Tank Leak Detection - In-Tank System (ATG)
I03 - Overfill - Automatic Shut-Off
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
E00 - Piping Secondary Containment - None
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
F02 - Pipe External Protection - Original Sacrificial Anode
K01 - Spill Prevention - Catch Basin
G04 - Tank Secondary Containment - Double-Walled (Underground)
I02 - Overfill - High Level Alarm
E00 - Piping Secondary Containment - None
E00 - Piping Secondary Containment - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
E00 - Piping Secondary Containment - None
B04 - Tank External Protection - Fiberglass

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

G04 - Tank Secondary Containment - Double-Walled (Underground)
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
B04 - Tank External Protection - Fiberglass
H05 - Tank Leak Detection - In-Tank System (ATG)
A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
D02 - Pipe Type - Galvanized Steel
L08 - Piping Leak Detection - Tank Top Sump
I02 - Overfill - High Level Alarm
F02 - Pipe External Protection - Original Sacrificial Anode
L08 - Piping Leak Detection - Tank Top Sump
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
J00 - Dispenser - None
I02 - Overfill - High Level Alarm

Tank Info:

Site ID:	27602
Tank Number:	001
Tank ID:	60354
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	2/1/2001
Capacity Gallons:	2500
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	3/30/2001
Register:	True
Modified By:	NRLOMBAR
Last Modified:	4/18/2011
Site ID:	27602
Tank Number:	002
Tank ID:	60355
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Number:	003
Tank ID:	60356
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	4000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602
Tank Number:	004
Tank ID:	60368
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	1000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	7/2/2009
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602
Tank Number:	005
Tank ID:	60369
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Number:	006
Tank ID:	60370
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	1000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	7/2/2009
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602
Tank Number:	007
Tank ID:	60371
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	1000
Tightness Test Method:	21
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	7/22/2009
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602
Tank Number:	008
Tank ID:	60372
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Number:	009
Tank ID:	60373
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	550
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011
Site ID:	27602
Tank Number:	010
Tank ID:	60377
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	2500
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	4/15/2010
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	8/20/2010
Site ID:	27602
Tank Number:	010A
Tank ID:	235604
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	7/15/2010
Capacity Gallons:	2500
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	4/18/2011
Site ID:	27602

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Number:	011
Tank ID:	233246
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	1/2/1990
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Equivalent technology
Date Test:	Not reported
Register:	True
Modified By:	MSBAPTIS
Last Modified:	4/12/2011

HIST UST:

PBS Number:	2-605735
SPDES Number:	Not reported
Emergency Contact:	PETER SAMPIERI
Emergency Telephone:	(212) 788-4077
Operator:	PETER SAMPIERI
Operator Telephone:	(212) 788-4077
Owner Name:	NYC DEPARTMENT OF SANITATION
Owner Address:	125 WORTH ST.
Owner City,St,Zip:	NEW YORK, NY 10013
Owner Telephone:	(212) 788-4077
Owner Type:	Local Government
Owner Subtype:	Not reported
Mailing Name:	NYC DEPARTMENT OF SANITATION
Mailing Address:	125 WORTH ST. R-823
Mailing Address 2:	Not reported
Mailing City,St,Zip:	NEW YORK, NY 10013
Mailing Contact:	CHIEF OF EQUIPMENT & FAC.
Mailing Telephone:	(212) 788-4077
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	MASPETH & 47TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	05/04/2001
Expiration Date:	04/23/2006
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	18550
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	Minor Data Missing

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	00
Tank Location:	Not reported
Tank Status:	Closed-Removed
Install Date:	Not reported
Capacity (gals):	0
Product Stored:	Not reported
Tank Type:	Not reported
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	Not reported
Leak Detection:	Not reported
Overfill Prot:	Not reported
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Major Data Missing (which is on the certificate)
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	2500
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	4000
Product Stored:	DIESEL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Submersible
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Id:	004
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	UNKNOWN
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	005
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	UNKNOWN
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	006
Tank Location:	UNDERGROUND
Tank Status:	In Service

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	UNKNOWN
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	007
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	USED OIL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	008
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	USED OIL

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	009
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	1000
Product Stored:	USED OIL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass
Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	010
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (gals):	2500
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Fiberglass reinforced plastic [FRP]
Tank Internal:	None
Tank External:	Fiberglass

DSNY QUEENS DISTRICT 5A GARAGE (Continued) **U003790792**

Pipe Location:	Underground
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	None
Pipe External:	Fiberglass
Second Containment:	Vault (w/access)
Leak Detection:	14
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Gravity
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

AI545 **CONSOLIDATED EDISON** **MANIFEST** **1009243017**
ESE **57-34 58TH PL** **N/A**
1/8-1/4 **QUEENS, NY**
0.183 mi.
965 ft. **Site 5 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

NY MANIFEST:

EPA ID:	NYP004123410
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLIN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	NYE0620208
Manifest Status:	Not reported
Trans1 State ID:	46299JM
Trans2 State ID:	Not reported
Generator Ship Date:	08/05/2004
Trans1 Recv Date:	08/05/2004
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/06/2004
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004123410
Trans1 EPA ID:	NYD006982359
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980593
Waste Code:	B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB
Quantity:	02564
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.

CONSOLIDATED EDISON (Continued) **1009243017**

Specific Gravity: 01.00
Year: 04

AI546 **VS #6040** **NY Spills** **S106698051**
ESE **57-34 58 PLACE** **N/A**
1/8-1/4 **QUEENS, NY**
0.183 mi.
965 ft. **Site 6 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

NY Spills:

Site ID:	287133
Facility Addr2:	Not reported
Facility ID:	0404930
Spill Number:	0404930
Facility Type:	ER
SWIS:	4101
Investigator:	JHOCONNE
Referred To:	Not reported
Spill Date:	8/5/2004
Reported to Dept:	8/5/2004
CID:	444
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	10/22/2004
Remediation Phase:	0
Date Entered In Computer:	8/5/2004
Spill Record Last Update:	10/22/2004
Spiller Name:	ERT DESK
Spiller Company:	VS #6040
Spiller Address:	57-34 58 PLACE
Spiller City,St,Zip:	QUEENS, NY
Spiller Company:	001
Contact Name:	ERT DESK
Contact Phone:	(212) 580-8383
DEC Region:	2
DER Facility ID:	232587
DEC Memo:	e2mis no. 154719: 10 gallons unknown oil (appears to be motor oil) on 1500 gallons water in VS0640. Wikane states this is possibly motor oil - see where substance was poured thru top of grating of structure. There is a car repair shop across the street. Clean up will need to proceed as 50-499. TRANSFORMER PASSED PRESSURE TEST AND IS NOT LEAKING. A LARGE DRIVEWAY CONTAINING APPROX. 20 JUNKED CARS. OWNER CLAIMS HE DID NOT DUMP ANY OIL INTO OUR STRUCTURE. DUE TO PRIOR INCIDENTS OF OIL DUMPED INTO THIS STRUCTURE, STATHIS WILL REFER THIS TO SECURITY TO INVESTIGATE. STATHIS IS LEAVING LOCATION AT THIS TIME. EQUIPMENT GROUP REMAINS ON LOCATION PENDING ARRIVAL OF TANKER AND ENV. OPS. CREWS. 8/05/2004 20:36 HRS. -- Lab Sequence Number: 04-06197-001: Analysis indicates the presence of a substance similar to a lubricating oil. 8/05/2004 21:00 HRS. -- LSN 04-06196-001, PCB

VS #6040 (Continued) **S106698051**

RESULTS < 1.0 PPM. Update - 8/6/04 - 1110hrs I. Ahluwahlia env. ops mech reports clean up completed using 760 biogen and <50 tanker. No leaking co equipment found. Removed env. stop tag # 14932. Clean up completed 100%.

Remarks: IS CONTAINED, POSSIBLE 3RD PARTY SPILL: EVIDENCE OIL WAS POURED THROUGH THE GRADING INTO STRUCTURE; NO TO 5 QUESTIONS: CONED # 154719

Material:

Site ID:	287133
Operable Unit ID:	887850
Operable Unit:	01
Material ID:	488902
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

AI547 **SV 640** **NY Spills** **S104953713**
ESE **57-34 58TH PLACE** **NY Hist Spills** **N/A**
1/8-1/4 **QUEENS, NY**
0.183 mi.
968 ft. **Site 7 of 10 in cluster AI**

Relative:
Higher

Actual:
29 ft.

NY Spills:

Site ID:	254980
Facility Addr2:	Not reported
Facility ID:	0013602
Spill Number:	0013602
Facility Type:	ER
SWIS:	4101
Investigator:	KMFOLEY
Referred To:	Not reported
Spill Date:	3/28/2001
Reported to Dept:	3/28/2001
CID:	389
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported

SV 640 (Continued) **S104953713**

Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	5/17/2001
Remediation Phase:	0
Date Entered In Computer:	3/28/2001
Spill Record Last Update:	5/17/2001
Spiller Name:	UNKNOWN
Spiller Company:	UNKNOWN
Spiller Address:	UNKNOWN
Spiller City,St,Zip:	UNKNOWN, NY
Spiller Company:	999
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	208863
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY"
Remarks:	caller reporting a spill of material posibly dumped into service box coned#136177 samples taken clean up pending lab results

Material:

Site ID:	254980
Operable Unit ID:	835086
Operable Unit:	01
Material ID:	540310
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	8
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Site ID:	173216
Facility Addr2:	Not reported
Facility ID:	0209021
Spill Number:	0209021
Facility Type:	ER

SV 640 (Continued) **S104953713**

SWIS:	4101
Investigator:	KMFOLEY
Referred To:	Not reported
Spill Date:	12/2/2002
Reported to Dept:	12/3/2002
CID:	397
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	2/21/2003
Remediation Phase:	0
Date Entered In Computer:	12/3/2002
Spill Record Last Update:	2/21/2003
Spiller Name:	UNKNOWN
Spiller Company:	UNKNOWN
Spiller Address:	UNKNOWN
Spiller City,St,Zip:	UNKNOWN, NY
Spiller Company:	999
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	145723
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY" Con Ed e2mis #146200: 02-DEC-2002 0930HRS BRENSEKE # 74960 BQE GROUP REPORTS FOUND 2 GALLONS UNKNOWN OIL ON 400 GALLONS WATER IN VS640. NO FIRE OR SMOKE. NO PRIVATE PROPERTYS AFFECTED. TOOK SAMPLE ON A 4 TO 6 HOUR PRIORITY TURNAROUND. CLEANUP PENDING RESULTS. STOP TAG # 00607 FOUND WHILE DOING MAINTENCE. UNIT PRESSURED TESTED OK. NO PARKING RESTRICTIONS. CAN NOT SEE SUMP IN STRUCTURE. NO VISUAL WATER MOVEMENT. CHAIN OF CUSTODY # IS CC13568. THIS IS ON THE 24 HOUR DIMINIMIS PROGRAM. CIG MCARDLE NOTIFIED@ 0947HRS UPDATE @ 2003 HRS 12/2 LAB RESULTS RECEIVED SEQ #02-11206-001 @ <1PPM PCB. UPDATE 12/02/02 21:08 HRS -- 2ND LAB RESULTS RCD # 02-11207-001 OIL ID RESULTS: "Analysis indicates the presence of a substance similar to a lubricating oil." 12/03/02 05:15 HRS. -- REMOVED INCIDENT FROM 24-HOUR DEMINIMIS PROGRAM AS PER SUPERVISOR E.VESCE SINCE CLEANUP WILL NOT COMPLETED BEFORE 09:00 HRS. BECAUSE ENV. OPS. CREW REPORTED CARS BLOCKING ACCESS AND ALSO THAT A TANKER WILL BE REQUIRED DUE TO AMOUNT OF WATER. UPDATE********** 12-03-02 16:15HRS J. STEVENS (ENV OPS) REPORTS, DOUBLE WASHED STRUCTURE WITH BIO GEN 760, TANKER REMOVED ALL LIQUIDS, SUMP FOUND CEMENTED AND TAG REMOVED.
Remarks:	2 gallons on top of 500 gallons of water con ed#146200

Material:

Site ID:	173216
Operable Unit ID:	862208
Operable Unit:	01
Material ID:	516007
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM

SV 640 (Continued) **S104953713**

Case No.: Not reported
Material FA: Petroleum
Quantity: 2
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Click this hyperlink while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:
Region of Spill: 2
Spill Number: 0013602
Investigator: FOLEY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/28/2001 17:00
Reported to Dept Date/Time: 03/28/01 18:51
SWIS: 63
Spiller Name: UNK
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Contact: CALLER
Spiller Phone: ( ) -
Spiller Address: UNK
Spiller City,St,Zip: UNK
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /

SV 640 (Continued) **S104953713**

Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/17/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/28/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 05/17/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 8
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: caller reporting a spill of material posibly dumped into service box coned 136177 samples taken clean up pending lab results

---

AI548 **S & L METAL PRODUCTS** **MANIFEST** **S109533640**
ESE **58-29 57TH DRIVE** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.184 mi.
972 ft. **Site 8 of 10 in cluster AI**

Relative:
Higher

Actual:
28 ft.

NJ MANIFEST:
Manifest Code: 001026939JJK
EPA ID: NYD001280569
Date Shipped: 3/18/2008
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJ0000027193
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 3/18/2008
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported

S & L METAL PRODUCTS (Continued) **S109533640**

Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 3/18/2008
Tranporter 1 Decal: Not reported
Tranporter 2 Decal: Not reported
Data Entry Number: Not reported
Reference Manifest Number: Not reported
Was Load Rejected (Y/N): No
Reason Load Was Rejected: Not reported
Waste Code: D002
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 10
Unit: G
Hand Code: H141

Waste Code: D002
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 15
Unit: G
Hand Code: H141

Waste Code: D002
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 5
Unit: G
Hand Code: H141

Waste Code: D002
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 30
Unit: G
Hand Code: H141

Waste Code: D001
Manifest Year: 2008 New Jersey Manifest Data
Quantity: 5
Unit: G
Hand Code: H141

AI549 **S & L METAL PRODUCTS** **RCRA-SQG** **1000121676**
ESE **58-29 57TH DR** **FINDS** **NYD001280569**
1/8-1/4 **MASPETH, NY 11378** **MANIFEST**
0.184 mi.
972 ft. **Site 9 of 10 in cluster AI**

Relative:
Higher

Actual:
28 ft.

RCRA-SQG:
Date form received by agency: 01/01/2007
Facility name: S & L METAL PRODUCTS CORP
Facility address: 58-29 57TH DR
MASPETH, NY 11378
EPA ID: NYD001280569

S & L METAL PRODUCTS (Continued) **1000121676**

Mailing address:	57TH DR - PO BOX 238 MASPETH, NY 11378
Contact:	PHILIP DILEONARDO
Contact address:	57TH DR - PO BOX 238 MASPETH, NY 11378
Contact country:	US
Contact telephone:	(718) 894-4042
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	S&L METAL PRODUCTS CORP
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	S&L METAL PRODUCTS CORP
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

S & L METAL PRODUCTS (Continued) **1000121676**

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: S & L METAL PRODUCTS CORP
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 02/25/1992
Facility name: S & L METAL PRODUCTS CORP
Site name: S&L METAL PR
Classification: Large Quantity Generator

Date form received by agency: 05/12/1989
Facility name: S & L METAL PRODUCTS CORP
Classification: Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 03/17/2009
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

FINDS:

Registry ID: 110004333267

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:
EPA ID: NYD001280569
Country: USA
Mailing Name: S & L METAL PRODUCTS
Mailing Contact: S & L METAL PRODUCTS
Mailing Address: P.O. BOX 541457
Mailing Address 2: Not reported
Mailing City: FLUSHING
Mailing State: NY
Mailing Zip: 14702
Mailing Zip4: 0460
Mailing Country: USA
Mailing Phone: 718-894-4042

Document ID: NJA1960701
Manifest Status: Completed copy
Trans1 State ID: NJDEPE086
Trans2 State ID: 08690
Generator Ship Date: 940714

S & L METAL PRODUCTS (Continued) **1000121676**

Trans1 Recv Date:	940714
Trans2 Recv Date:	940718
TSD Site Recv Date:	940719
Part A Recv Date:	940725
Part B Recv Date:	940801
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	ILD984908202
TSDF ID:	NJD002182897
Waste Code:	F001 - UNKNOWN
Quantity:	00435
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94

Document ID:	NJA1958665
Manifest Status:	Completed copy
Trans1 State ID:	DL8162
Trans2 State ID:	Not reported
Generator Ship Date:	941208
Trans1 Recv Date:	941208
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	941212
Part A Recv Date:	941216
Part B Recv Date:	941223
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002182897
Waste Code:	F001 - UNKNOWN
Quantity:	00435
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	94

Document ID:	NYC3459025
Manifest Status:	Completed copy
Trans1 State ID:	GF2858
Trans2 State ID:	Not reported
Generator Ship Date:	950209
Trans1 Recv Date:	950209
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950209
Part A Recv Date:	950223
Part B Recv Date:	950217
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980785760

S & L METAL PRODUCTS (Continued) **1000121676**

Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00080
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	005
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	95

Document ID:	NJA3013643
Manifest Status:	Not reported
Trans1 State ID:	ILD984908202
Trans2 State ID:	SCD987574647
Generator Ship Date:	07/09/1999
Trans1 Recv Date:	07/09/1999
Trans2 Recv Date:	07/14/1999
TSD Site Recv Date:	07/19/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	NJD002182897
Trans2 EPA ID:	Not reported
TSDF ID:	08690
Waste Code:	F001 - UNKNOWN
Quantity:	01740
Units:	P - Pounds
Number of Containers:	004
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	99

Document ID:	NYA7008651
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	IA7667
Trans2 State ID:	Not reported
Generator Ship Date:	900108
Trans1 Recv Date:	900108
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900110
Part A Recv Date:	900305
Part B Recv Date:	900214
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	NYD057722258
Trans2 EPA ID:	Not reported
TSDF ID:	NYD057722258
Waste Code:	F001 - UNKNOWN
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	90

S & L METAL PRODUCTS (Continued) **1000121676**

Document ID:	NYC3347392
Manifest Status:	Completed copy
Trans1 State ID:	GF2858
Trans2 State ID:	Not reported
Generator Ship Date:	941116
Trans1 Recv Date:	941116
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	941116
Part A Recv Date:	941125
Part B Recv Date:	941125
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980785760
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00031
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	94

Document ID:	NYC3206068
Manifest Status:	Completed copy
Trans1 State ID:	JU4818
Trans2 State ID:	Not reported
Generator Ship Date:	940822
Trans1 Recv Date:	940822
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940822
Part A Recv Date:	940909
Part B Recv Date:	940830
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NYD980785760
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00032
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	94

Document ID:	NYC3144330
Manifest Status:	Completed copy
Trans1 State ID:	MU4522
Trans2 State ID:	Not reported
Generator Ship Date:	940711
Trans1 Recv Date:	940711
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940711
Part A Recv Date:	940725

S & L METAL PRODUCTS (Continued) **1000121676**

Part B Recv Date: 940719
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 94

Document ID: NJA1938166
Manifest Status: Completed copy
Trans1 State ID: NJDEPE086
Trans2 State ID: 08690
Generator Ship Date: 940923
Trans1 Recv Date: 940923
Trans2 Recv Date: 940926
TSD Site Recv Date: 940927
Part A Recv Date: 941007
Part B Recv Date: 941011
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: ILD984908202
TSDF ID: NJD002182897
Waste Code: F001 - UNKNOWN
Quantity: 00435
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 94

Document ID: NYC3254940
Manifest Status: Completed copy
Trans1 State ID: GF2858
Trans2 State ID: Not reported
Generator Ship Date: 941003
Trans1 Recv Date: 941003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 941003
Part A Recv Date: 941014
Part B Recv Date: 941013
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00032
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002

S & L METAL PRODUCTS (Continued) **1000121676**

Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 94

Document ID: NYC3397342
Manifest Status: Completed copy
Trans1 State ID: MV4522
Trans2 State ID: Not reported
Generator Ship Date: 950105
Trans1 Recv Date: 950105
Trans2 Recv Date: Not reported
TSD Site Recv Date: 950105
Part A Recv Date: 950117
Part B Recv Date: 950113
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00050
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 004
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95

Document ID: NYC5512667
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCD987574647
Generator Ship Date: 01/26/1999
Trans1 Recv Date: 01/26/1999
Trans2 Recv Date: 01/28/1999
TSD Site Recv Date: 01/29/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD001280569
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: AM6252
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00015
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 99

Document ID: NYC5098533
Manifest Status: Not reported
Trans1 State ID: ILD984908202

S & L METAL PRODUCTS (Continued) **1000121676**

Trans2 State ID:	SCD987574647
Generator Ship Date:	03/05/1999
Trans1 Recv Date:	03/05/1999
Trans2 Recv Date:	03/09/1999
TSD Site Recv Date:	03/10/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	AM6252
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00022
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	99

Document ID:	NYC5602555
Manifest Status:	Not reported
Trans1 State ID:	SCD987574647
Trans2 State ID:	SCD987574647
Generator Ship Date:	04/23/1999
Trans1 Recv Date:	04/23/1999
Trans2 Recv Date:	04/27/1999
TSD Site Recv Date:	04/28/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00034
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	99

Document ID:	NYC3849895
Manifest Status:	Completed copy
Trans1 State ID:	MU4522
Trans2 State ID:	Not reported
Generator Ship Date:	950502
Trans1 Recv Date:	950502
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950502
Part A Recv Date:	950510
Part B Recv Date:	950510
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	ILD984908202

S & L METAL PRODUCTS (Continued) **1000121676**

Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95

Document ID: NYC2929140
Manifest Status: Completed copy
Trans1 State ID: MU4522
Trans2 State ID: Not reported
Generator Ship Date: 950320
Trans1 Recv Date: 950320
Trans2 Recv Date: Not reported
TSD Site Recv Date: 950320
Part A Recv Date: 950330
Part B Recv Date: 950328
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00048
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95

Document ID: NJA2085399
Manifest Status: Completed copy
Trans1 State ID: 08690
Trans2 State ID: S10342
Generator Ship Date: 950907
Trans1 Recv Date: 950907
Trans2 Recv Date: 950913
TSD Site Recv Date: 950914
Part A Recv Date: 950915
Part B Recv Date: 951002
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: NJD000813477
TSDF ID: NJD002182897
Waste Code: F001 - UNKNOWN
Quantity: 01740
Units: P - Pounds
Number of Containers: 004
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100

S & L METAL PRODUCTS (Continued) **1000121676**

Year: 95

Document ID: NYC3910983
Manifest Status: Completed copy
Trans1 State ID: MU4522
Trans2 State ID: Not reported
Generator Ship Date: 950612
Trans1 Recv Date: 950612
Trans2 Recv Date: Not reported
TSD Site Recv Date: 950612
Part A Recv Date: 950623
Part B Recv Date: 950622
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00023
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95

Document ID: NJA2054596
Manifest Status: Completed copy
Trans1 State ID: NJDEPE086
Trans2 State ID: Not reported
Generator Ship Date: 950301
Trans1 Recv Date: 950301
Trans2 Recv Date: Not reported
TSD Site Recv Date: 950302
Part A Recv Date: 950321
Part B Recv Date: 950315
Generator EPA ID: NYD001280569
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NJD002182897
Waste Code: F001 - UNKNOWN
Quantity: 00870
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95

Document ID: NYC5935151
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCD987574647
Generator Ship Date: 09/24/1999
Trans1 Recv Date: 09/24/1999

S & L METAL PRODUCTS (Continued) **1000121676**

Trans2 Recv Date:	09/28/1999
TSD Site Recv Date:	09/30/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001280569
Trans1 EPA ID:	NYD000708198
Trans2 EPA ID:	Not reported
TSDF ID:	ILP284920
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00030
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Year:	99

Click this hyperlink while viewing on your computer to access
114 additional NY_MANIFEST: record(s) in the EDR Site Report.

AI550 **RR ENTERPRISES USA INC** **FINDS** **1011974690**
ESE **58-29 57TH DR** **N/A**
1/8-1/4 **FLUSHING, NY 11378**
0.184 mi.
972 ft. **Site 10 of 10 in cluster AI**

Relative:
Higher

Actual:
28 ft.

FINDS:

Registry ID: 110038042864

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

AN551 **POLE 7652** **NY Spills** **S105140969**
North **55TH AVE/ 50TH ST** **NY Hist Spills** **N/A**
1/8-1/4 **QUEENS, NY**
0.184 mi.
972 ft. **Site 1 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY Spills:

Site ID:	307037
Facility Addr2:	Not reported
Facility ID:	0104436
Spill Number:	0104436
Facility Type:	ER

POLE 7652 (Continued) **S105140969**

SWIS:	4101
Investigator:	KMFOLEY
Referred To:	Not reported
Spill Date:	7/25/2001
Reported to Dept:	7/25/2001
CID:	389
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/24/2001
Remediation Phase:	0
Date Entered In Computer:	7/25/2001
Spill Record Last Update:	7/5/2005
Spiller Name:	BILL MURPHY
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	247962
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY" Con Ed e2mis Notes: Reference #s 0104438, 0104439. 1 pint cable oil spilled from overhead pole #7652 onto concrete sidewalk. Environmental Operations dispatched to do 50-499ppm PCB cleanup. 7-25-01 2030hrs. Cleanup completed. Double washed concrete sidewalk with oil absorbant, placed debris in drum marked 50-499. 8-06-01 13:19hrs. Investigation revealed the cable was replaced and spliced on July 26th,2001.
Remarks:	LEAKING MATERIAL FROM AN ARIAL CABLE JOINT CLEAN UP IS 50-499 CONED#138493 NO CALLBACK

Material:

Site ID:	307037
Operable Unit ID:	841182
Operable Unit:	01
Material ID:	532928
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

POLE 7652 (Continued) **S105140969**

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	0104436
Investigator:	FOLEY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	07/25/2001 16:30
Reported to Dept Date/Time:	07/25/01 18:07
SWIS:	63
Spiller Name:	CON EDISON
Spiller Contact:	BILL MURPHY
Spiller Phone:	(212) 580-6763
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003-
Spill Cause:	Equipment Failure
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	01
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	08/24/01
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	07/25/01
Date Spill Entered In Computer Data File:	Not reported
Update Date:	09/07/01
Is Updated:	False

Tank:

PBS Number:	Not reported
Tank Number:	Not reported

POLE 7652 (Continued) **S105140969**

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Con Ed e2mis Notes: Reference s 0104438, 0104439. 1 pint cable oil spilled from overhead pole 7652 onto concrete sidewalk. Environmental Operations dispatched to do 50-499ppm PCB cleanup. 7-25-01 2030hrs. Cleanup completed. Double washed concrete sidewalk with oil absorbant, placed debris in drum marked 50-499. 8-06-01 13:19hrs. Investigation revealed the cable was replaced and spliced on July 26th,2001.
Remark: LEAKING MATERIAL FROM AN ARIAL CABLE JOINT CLEAN UP IS 50-499 CONED 138493 NO CALLBACK

AN552 **POLE 7491** **NY Spills** **S105140972**
North **50TH AVE/50TH ST** **NY Hist Spills** **N/A**
1/8-1/4 **QUEENS, NY**
0.184 mi.
972 ft. **Site 2 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY Spills:
Site ID: 309336
Facility Addr2: Not reported
Facility ID: 0104439
Spill Number: 0104439
Facility Type: ER
SWIS: 4101
Investigator: KMFOLEY
Referred To: Not reported
Spill Date: 7/25/2001
Reported to Dept: 7/25/2001
CID: 389
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 8/24/2001
Remediation Phase: 0
Date Entered In Computer: 7/25/2001

POLE 7491 (Continued) **S105140972**

Spill Record Last Update:	9/7/2001
Spiller Name:	Not reported
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	249728
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY" Con Ed e2mis Notes: Reference #s 0104438, 0104436. 7/25/01 1 pint cable oil that spilled from overhead pole #7491 onto concrete sidewalk. Environmental Operations dispatched to do 50-499ppm PCB cleanup. 2050hrs. Cleanup completed by double washing concrete sidewalk using oil absorbant. Debris placed in 50-499 barrell. 8-06-01 13:19 Cable was replaced and spliced on 7-26-01
Remarks:	SPILL FROM AN ARIAL CABLE JOINT 1 PT SPILLED CONED#138494 CLEAN UP IS PER 50-499 NO CALLBACK

Material:

Site ID:	309336
Operable Unit ID:	842818
Operable Unit:	01
Material ID:	532931
Material Code:	0541A
Material Name:	DIELECTRIC FLUID
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	0104439
Investigator:	FOLEY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported

POLE 7491 (Continued) **S105140972**

Notifier Phone: Not reported
Spill Date/Time: 07/25/2001 16:30
Reported to Dept Date/Time: 07/25/01 18:18
SWIS: 63
Spiller Name: CON EDISON
Spiller Contact: Not reported
Spiller Phone: (212) 580-6763
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/24/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/25/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/07/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Con Ed e2mis Notes: Reference s 0104438, 0104436. 7/25/01 1 pint cable oil that spilled from overhead pole 7491 onto concrete sidewalk. Environmental Operations dispatched to do 50-499ppm PCB cleanup. 2050hrs. Cleanup completed by double washing concrete sidewalk using oil absorbant. Debris placed in 50-499 barrell. 8-06-01 13:19 Cable was replaced and

POLE 7491 (Continued) **S105140972**

spliced on 7-26-01
Remark: SPILL FROM AN ARIAL CABLE JOINT 1 PT SPILLED CONED 138494 CLEAN UP IS PER 50-499 NO CALLBACK

AN553 **POLE 7651** **NY Spills** **S105140971**
North **55TH AVE/50TH ST** **NY Hist Spills** **N/A**
1/8-1/4 **QUEENS, NY**
0.184 mi.
972 ft. **Site 3 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY Spills:

Site ID:	209772
Facility Addr2:	Not reported
Facility ID:	0104438
Spill Number:	0104438
Facility Type:	ER
SWIS:	4101
Investigator:	KMFOLEY
Referred To:	Not reported
Spill Date:	7/25/2001
Reported to Dept:	7/25/2001
CID:	389
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/23/2001
Remediation Phase:	0
Date Entered In Computer:	7/25/2001
Spill Record Last Update:	9/7/2001
Spiller Name:	Not reported
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller City,St,Zip:	NEW YORK, NY 10003
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	2
DER Facility ID:	173907
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY" Con Ed e2mis Notes: Reference #s 0104439, 0104436. 1 pint cable oil spilled from overhead onto concrete sidewalk. Environmental Operations dispatched to location. 7-25-01 2130hrs. Cleanup completed by double washing concrete sidewalk using oil absorbant. Approx. 30 drops of lead reported released from cable. All debris pplaced in 50-499 barrell. 8-06-01 13:19hrs. Investigation revealed the cable was replaced and spliced on July 26th 2001.
Remarks:	SPILL FROM AN ARIAL JOINT CONED#138496 CLEAN UP 50-499 NO CALLBACK

Material:

Site ID:	209772

POLE 7651 (Continued) **S105140971**

Operable Unit ID: 842816
Operable Unit: 01
Material ID: 532930
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0104438
Investigator: FOLEY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/25/2001 16:30
Reported to Dept Date/Time: 07/25/01 18:18
SWIS: 63
Spiller Name: CON EDISON
Spiller Contact: Not reported
Spiller Phone: (212) 580-6763
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /

POLE 7651 (Continued) **S105140971**

Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/23/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/25/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/07/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIELECTRIC FLUID
Class Type: DIELECTRIC FLUID
Times Material Entry In File: 41
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Con Ed e2mis Notes: Reference s 0104439, 0104436. 1 pint cable oil spilled from overhead onto concrete sidewalk. Environmental Operations dispatched to location. 7-25-01 2130hrs. Cleanup completed by double washing concrete sidewalk using oil absorbant. Approx. 30 drops of lead reported released from cable. All debris pplaced in 50-499 barrell. 8-06-01 13:19hrs. Investigation revealed the cable was replaced and spliced on July 26th 2001.
Remark: SPILL FROM AN ARIAL JOINT CONED 138496 CLEAN UP 50-499 NO CALLBACK

AK554 **CIPICO CONSTRUCTION, INC.** **UST U001854655**
SSW **58-08 48TH STREET** **HIST UST N/A**
1/8-1/4 **MASPETH, NY 11378**
0.184 mi.
974 ft. **Site 3 of 5 in cluster AK**

Relative:
Higher

Actual:
14 ft.

UST:
Facility Id: 2-601565
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2013/08/10
UTM X: 591050.09228999994
UTM Y: 4508418.6367800003

Affiliation Records:
Site Id: 23527

CIPICO CONSTRUCTION, INC. (Continued) **U001854655**

Affiliation Type:	On-Site Operator
Company Name:	CIPICO CONSTRUCTION, INC.
Contact Type:	Not reported
Contact Name:	MICHAEL G. SCHNEIDER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 628-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	8/20/2010

Site Id:	23527
Affiliation Type:	Mail Contact
Company Name:	CIPICO CONSTRUCTION, INC.
Contact Type:	Not reported
Contact Name:	MR. DOMENICK CIPOLLONE
Address1:	58-08 48TH STREET
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 628-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	23527
Affiliation Type:	Emergency Contact
Company Name:	CIPICO CONSTRUCTION, INC.
Contact Type:	Not reported
Contact Name:	DOMENICK CIPOLLONE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 628-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	11/19/2007

Site Id:	23527
Affiliation Type:	Owner
Company Name:	CIPICO CONSTRUCTION, INC.
Contact Type:	OFFICE MANAGER

CIPICO CONSTRUCTION, INC. (Continued) **U001854655**

Contact Name:	MICHAEL G. SCHNEIDER
Address1:	58-08 48TH STREET
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 628-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	dxliving
Date Last Modified:	6/20/2008

Equipment Records:

F99 - Pipe External Protection - Other
F99 - Pipe External Protection - Other
B05 - Tank External Protection - Jacketed
B05 - Tank External Protection - Jacketed
F02 - Pipe External Protection - Original Sacrificial Anode
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction
C02 - Pipe Location - Underground/On-ground
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
H05 - Tank Leak Detection - In-Tank System (ATG)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
G04 - Tank Secondary Containment - Double-Walled (Underground)
H05 - Tank Leak Detection - In-Tank System (ATG)
K01 - Spill Prevention - Catch Basin
G04 - Tank Secondary Containment - Double-Walled (Underground)
F02 - Pipe External Protection - Original Sacrificial Anode
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
I02 - Overfill - High Level Alarm
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

Tank Info:

Site ID:	23527
Tank Number:	00001
Tank ID:	46881
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	8/1/1993
Capacity Gallons:	1000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Fiberglass coated steel
Date Test:	Not reported
Register:	True

CIPICO CONSTRUCTION, INC. (Continued) **U001854655**

Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	23527
Tank Number:	00002
Tank ID:	56591
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	8/1/1993
Capacity Gallons:	2000
Tightness Test Method:	NN
Next Test Date:	8/1/2008
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Fiberglass coated steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-601565
SPDES Number:	Not reported
Emergency Contact:	FRANK PANNICO
Emergency Telephone:	(718) 628-5555
Operator:	MICHAEL G. SCHNEIDER
Operator Telephone:	(718) 628-5555
Owner Name:	CIPICO CONSTRUCTION, INC.
Owner Address:	58-08 48TH STREET
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 628-5555
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	CIPICO CONSTRUCTION, INC.
Mailing Address:	58-08 48TH STREET
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	MR. FRANK PANNICO
Mailing Telephone:	(718) 628-5555
Owner Mark:	First Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2:	58008 48TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	05/27/1999
Expiration Date:	08/10/2003
Renew Flag:	False

CIPICO CONSTRUCTION, INC. (Continued) **U001854655**

Renewal Date:	Not reported
Total Capacity:	3000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	No Missing Data
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	00001
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19930801
Capacity (gals):	1000
Product Stored:	UNLEADED GASOLINE
Tank Type:	Fiberglass coated steel
Tank Internal:	None
Tank External:	Jacketed
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	29
Second Containment:	Vault (w/access)
Leak Detection:	41
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	00002
Tank Location:	UNDERGROUND
Tank Status:	In Service
Install Date:	19930801
Capacity (gals):	2000
Product Stored:	DIESEL
Tank Type:	Fiberglass coated steel
Tank Internal:	None
Tank External:	Jacketed
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	29
Second Containment:	Vault (w/access)
Leak Detection:	41
Overfill Prot:	High Level Alarm, Catch Basin
Dispenser:	Suction

CIPICO CONSTRUCTION, INC. (Continued) **U001854655**

Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	No Missing Data
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported

AK555 **MASPETH RECYCLING CIPICO** **SWF/LF** **S105841245**
SSW **58-08 48 STREET** **N/A**
1/8-1/4 **MASPETH, NY 11106**
0.184 mi.
974 ft. **Site 4 of 5 in cluster AK**

Relative:
Higher

Actual:
14 ft.

SWF/LF:

Flag:	ACTIVE
Region Code:	2
Phone Number:	7186281290
Owner Name:	Domenick Cysollone
Owner Type:	Not reported
Owner Address:	58-08 48th St.
Owner Addr2:	Not reported
Owner City,St,Zip:	Maspeth, NY 11378
Owner Email:	Not reported
Owner Phone:	7186281290
Contact Name:	Mike Schneider
Contact Address:	58-08 48th St.
Contact Addr2:	Not reported
Contact City,St,Zip:	Maspeth, NY 11378
Contact Email:	Not reported
Contact Phone:	7186281290
Activity Desc:	C&D processing - registered
Activity Number:	[41W39]
Active:	Yes
East Coordinate:	591000
North Coordinate:	4508900
Accuracy Code:	2.1 - NYSDEC 100 m grid collection
Regulatory Status:	Not reported
Waste Type:	Not reported
Authorization #:	2-6304-00215
Authorization Date:	Not reported
Expiration Date:	Not reported

AK556 **CIPICO CONST INC** **FINDS** **1007772325**
SSW **58-08 48TH STREET** **N/A**
1/8-1/4 **QUEENS, NY 11378**
0.184 mi.
974 ft. **Site 5 of 5 in cluster AK**

Relative:
Higher

Actual:
14 ft.

FINDS:

Registry ID: 110019347697

Environmental Interest/Information System
FIS (New York - Facility Information System) is New York's Department

CIPICO CONST INC (Continued) **1007772325**

of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AN557 **NY Spills** **S104646680**
North **50-02 55TH AVE** **NY Hist Spills** **N/A**
1/8-1/4 **MASPETH, NY**
0.185 mi.
975 ft. **Site 4 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY Spills:

Site ID:	259547
Facility Addr2:	Not reported
Facility ID:	9712735
Spill Number:	9712735
Facility Type:	ER
SWIS:	4101
Investigator:	MXTIPPLE
Referred To:	Not reported
Spill Date:	2/6/1998
Reported to Dept:	2/13/1998
CID:	322
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/1/2003
Remediation Phase:	0
Date Entered In Computer:	2/13/1998
Spill Record Last Update:	8/1/2003
Spiller Name:	Not reported
Spiller Company:	UNK- POSS CONTINENTAL CAN
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	BLOOMINGSDALE
Contact Phone:	(513) 579-7241
DEC Region:	2
DER Facility ID:	212272
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE" 01/31/01 Reassigned from Tomasello to Tipple. Herbert Cary requested info regarding the location of the tanks before they do borings. Also see 9807643. 8/1/03 tipple reviewed atc report/ nfa
Remarks:	historical spill -bloomingsdale is prepare to sublease property and a tank integrity test was done - soil borring and water samples taken and contamination found - written report will be sent to dec to show specific results

Material:

Site ID:	259547
Operable Unit ID:	1055596

(Continued) **S104646680**

Operable Unit: 01
Material ID: 327327
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9712735
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/06/1998 12:00
Reported to Dept Date/Time: 02/13/98 18:09
SWIS: 63
Spiller Name: UNK- POSS CONTINENTAL CAN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: BLOOMINGSDALE
Spiller Phone: (513) 579-7241
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /

(Continued) **S104646680**

Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/13/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/31/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 01/31/01 Reassigned from Tomasello to Tipple. Herbert Cary requested info regarding the location of the tanks before they do borings. Also see 9807643.
Remark: historical spill -bloomingsdale is prepare to sublease property and a tank integrity test was done - soil borring and water samples taken and contamination found - written report will be sent to dec to show specific results

---

AN558 **BLOOMINGDALES WAREHOUSE** **RCRA-NonGen** **1000334704**
North **50-02 55TH AVENUE** **FINDS** **NYD040380842**
1/8-1/4 **MASPETH, NY 11378** **MANIFEST**
0.185 mi.
975 ft. **Site 5 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

RCRA-NonGen:
Date form received by agency: 07/27/2010
Facility name: DUANE READE WAREHOUSE
Facility address: 50-02 55TH AVE
MASPETH, NY 113781103
EPA ID: NYD040380842
Mailing address: 55TH AVE
MASPETH, NY 11378
Contact: KYLE MCGREGOR
Contact address: 55TH AVE
MASPETH, NY 11378
Contact country: US
Contact telephone: (718) 361-3930

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Contact email: MCGREGOK@DUANEREADE.COM
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: GSL ENTERPRISES INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: Not reported
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GSL ENTERPRISES INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GSL ENTERPRISES INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2007
Facility name: DUANE READE WAREHOUSE

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Site name: BLOOMINGDALES WAREHOUSE - FEDERATED DEPT
Classification: Not a generator, verified

Date form received by agency: 01/01/2006
Facility name: DUANE READE WAREHOUSE
Site name: BLOOMINGDALES WAREHOUSE - FEDERATED DEPT
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: DUANE READE WAREHOUSE
Site name: BLOOMINGDALES WAREHOUSE - FEDERATED DEPT
Classification: Not a generator, verified

Date form received by agency: 04/25/1988
Facility name: DUANE READE WAREHOUSE
Site name: BLOOMINGDALES WAREHOUSE - FEDERATED DEPT
Classification: Large Quantity Generator

Hazardous Waste Summary:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: F001
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F005
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: X002
Waste name: POLYCHLORINATED BIPHENOLS (PCBs)

Waste code: X003
Waste name: OTHER STATE REGULATED WASTES [i.e., DIESEL FUEL, GASOLINE AND HOME HEATING OIL]

Waste code: D009
Waste name: MERCURY

Violation Status: No violations found

FINDS:

Registry ID: 110009472819

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

NY MANIFEST:

EPA ID: NYD040380842
Country: USA
Mailing Name: BLOOMINGDALES
Mailing Contact: BLOOMINGDALES
Mailing Address: 50-02 55TH AVENUE
Mailing Address 2: Not reported
Mailing City: MASPETH
Mailing State: NY
Mailing Zip: 11378
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-784-5754

Document ID: NYB2081826
Manifest Status: Completed copy
Trans1 State ID: NY23561B
Trans2 State ID: Not reported
Generator Ship Date: 891020
Trans1 Recv Date: 891020
Trans2 Recv Date: Not reported
TSD Site Recv Date: 891020
Part A Recv Date: 891031
Part B Recv Date: 891030
Generator EPA ID: NYD040380842

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Trans1 EPA ID: NYD000691949
Trans2 EPA ID: Not reported
TSDF ID: NYD000691949
Waste Code: F003 - UNKNOWN
Quantity: 00165
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00165
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 89

Document ID: NYB1040652
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: PTC2148
Trans2 State ID: Not reported
Generator Ship Date: 900421
Trans1 Recv Date: 900421
Trans2 Recv Date: 900421
TSD Site Recv Date: 900501
Part A Recv Date: 900907
Part B Recv Date: 900627
Generator EPA ID: NYD040380842
Trans1 EPA ID: MOD095038998
Trans2 EPA ID: Not reported
TSDF ID: KSD980964993
Waste Code: B006 - PCB TRANSFORMERS WITH 500 PPM OR > PCB
Quantity: 09315
Units: P - Pounds
Number of Containers: 001
Container Type: CM - Metal boxes, cases, roll-offs
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 03816
Units: P - Pounds
Number of Containers: 009
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 03015
Units: K - Kilograms (2.2 pounds)
Number of Containers: 010
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00037

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	90

Document ID:	NJA1002526
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS103
Trans2 State ID:	Not reported
Generator Ship Date:	900718
Trans1 Recv Date:	900718
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900719
Part A Recv Date:	900907
Part B Recv Date:	900824
Generator EPA ID:	NYD040380842
Trans1 EPA ID:	NYD000691949
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002454544
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00385
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	007
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	90

Document ID:	NYB7606629
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	2D300
Trans2 State ID:	Not reported
Generator Ship Date:	960917
Trans1 Recv Date:	960917
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	961002
Part A Recv Date:	Not reported
Part B Recv Date:	961115
Generator EPA ID:	NYD040380842
Trans1 EPA ID:	NYX720000000
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00180
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	006
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00050
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD080631369
Trans2 State ID: Not reported
Generator Ship Date: 2010-08-04
Trans1 Recv Date: 2010-08-04
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2010-08-09
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD040380842
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: NJD980536593
Waste Code: Not reported
Quantity: 1120.0
Units: P - Pounds
Number of Containers: 14.0
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 1.0
Year: 2010
Manifest Tracking Num: 000400542VES
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD080631369
Trans2 State ID: Not reported
Generator Ship Date: 2010-08-10
Trans1 Recv Date: 2010-08-10
Trans2 Recv Date: Not reported
TSD Site Recv Date: 2010-08-10

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD040380842
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID:	NJD980536593
Waste Code:	Not reported
Quantity:	640.0
Units:	P - Pounds
Number of Containers:	8.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	000400607VES
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141

Document ID:	NYB4212423
Manifest Status:	Completed copy
Trans1 State ID:	PD1011
Trans2 State ID:	Not reported
Generator Ship Date:	930511
Trans1 Recv Date:	930511
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	930511
Part A Recv Date:	Not reported
Part B Recv Date:	930525
Generator EPA ID:	NYD040380842
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00080
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	006
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	93

Document ID:	NYB1040490
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	PTC1974
Trans2 State ID:	Not reported
Generator Ship Date:	900428

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Trans1 Recv Date:	900428
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900501
Part A Recv Date:	900622
Part B Recv Date:	900625
Generator EPA ID:	NYD040380842
Trans1 EPA ID:	MOD095038998
Trans2 EPA ID:	Not reported
TSDF ID:	KSD980964993
Waste Code:	B006 - PCB TRANSFORMERS WITH 500 PPM OR > PCB
Quantity:	07791
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	002
Container Type:	CM - Metal boxes, cases, roll-offs
Handling Method:	L Landfill.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00074
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	04685
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	016
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	90

Document ID:	NYB4222899
Manifest Status:	Completed copy
Trans1 State ID:	PD1011
Trans2 State ID:	Not reported
Generator Ship Date:	940503
Trans1 Recv Date:	940503
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940503
Part A Recv Date:	Not reported
Part B Recv Date:	940517
Generator EPA ID:	NYD040380842
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00165
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00100
Units:	P - Pounds

BLOOMINGDALES WAREHOUSE (Continued) **1000334704**

Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 94

AN559 **MASPETH DISTRIBUTION CENTER** **RCRA-NonGen** **1000346705**
North **50-02 55TH AVE** **NYD981487200**
1/8-1/4 **MASPETH, NY 11378**
0.185 mi.
975 ft. **Site 6 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: MASPETH DISTRIBUTION CENTER
Facility address: 50-02 55TH AVE
MASPETH, NY 113781103
EPA ID: NYD981487200
Mailing address: 55TH AVE
MASPETH, NY 11378
Contact: Not reported
Contact address: 55TH AVE
MASPETH, NY 11378
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: GSL ENTERPRISES INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GSL ENTERPRISES INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No

MASPETH DISTRIBUTION CENTER (Continued) **1000346705**

Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Facility name: MASPETH DISTRIBUTION CENTER
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: MASPETH DISTRIBUTION CENTER
Classification: Not a generator, verified

Date form received by agency: 05/21/1986
Facility name: MASPETH DISTRIBUTION CENTER
Classification: Small Quantity Generator

Violation Status: No violations found

AN560 **DUANE READE DISTRIBUTION CENTER** **UST** **U001832418**
North **50-02 55TH AVE** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378** **CBS**
0.185 mi.
975 ft. **Site 7 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

UST:
Facility Id: 2-094080
Region: STATE
DEC Region: 2
Site Status: Unregulated
Program Type: PBS
Expiration Date: N/A
UTM X: 591562.32343999995
UTM Y: 4509129.3909499999

Affiliation Records:
Site Id: 2529
Affiliation Type: Emergency Contact
Company Name: FEDERATED DEPARTMENT STORES
Contact Type: Not reported
Contact Name: PHIL BOTCHER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (917) 337-3134
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT

DUANE READE DISTRIBUTION CENTER (Continued) **U001832418**

Date Last Modified:	3/4/2004
Site Id:	2529
Affiliation Type:	Mail Contact
Company Name:	FEDERATED DEPARTMENT STORES
Contact Type:	Not reported
Contact Name:	PHILLIP BUERK
Address1:	7 WEST 7TH STREET
Address2:	Not reported
City:	CINCINNATI
State:	OH
Zip Code:	45213
Country Code:	001
Phone:	(513) 579-7625
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	2529
Affiliation Type:	Owner
Company Name:	FEDERATED DEPARTMENT STORES
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	7 WEST 7TH STREET
Address2:	Not reported
City:	CINCINNATI
State:	OH
Zip Code:	45202
Country Code:	001
Phone:	(513) 579-7625
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	2529
Affiliation Type:	On-Site Operator
Company Name:	DUANE READE DISTRIBUTION CENTER
Contact Type:	Not reported
Contact Name:	DUANE READE INC
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 361-3937
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

DUANE READE DISTRIBUTION CENTER (Continued) **U001832418**

Equipment Records:

H04 - Tank Leak Detection - Groundwater Well
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
I00 - Overfill - None
J02 - Dispenser - Suction
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
H04 - Tank Leak Detection - Groundwater Well
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Info:

Site ID:	2529
Tank Number:	001
Tank ID:	40069
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

DUANE READE DISTRIBUTION CENTER (Continued) **U001832418**

Site ID:	2529
Tank Number:	002
Tank ID:	40070
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	5000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	2529
Tank Number:	003
Tank ID:	63717
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	30000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/2002
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	2529
Tank Number:	004
Tank ID:	63718
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	30000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	6/1/2002
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	Not reported
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

DUANE READE DISTRIBUTION CENTER (Continued) **U001832418**

HIST UST:

PBS Number:	2-094080
SPDES Number:	Not reported
Emergency Contact:	GLEN SCHULMAN
Emergency Telephone:	(718) 784-5700
Operator:	BLOOMINGDALES
Operator Telephone:	(718) 784-5700
Owner Name:	BLOOMINGDALES
Owner Address:	50-02 55TH AVE
Owner City,St,Zip:	MASPETH, NY 11378
Owner Telephone:	(718) 784-5700
Owner Type:	Not reported
Owner Subtype:	Not reported
Mailing Name:	BLOOMINGDALES
Mailing Address:	50-02 55TH AVE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MASPETH, NY 11378
Mailing Contact:	Not reported
Mailing Telephone:	(718) 784-5700
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	50002 55TH AVE
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	Not reported
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	Not reported
Expiration Date:	12/18/1991
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	Minor Data Missing
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported

DUANE READE DISTRIBUTION CENTER (Continued) **U001832418**

Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	Groundwater Well
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed Before April 1, 1991
Install Date:	Not reported
Capacity (gals):	5000
Product Stored:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	STEEL/IRON
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	Groundwater Well
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
Lat/long:	Not reported

CBS:

CBS Number:	2-000392
Program Type:	CBS
Dec Region:	2
Expiration Date:	N/A
Facility Status:	Unregulated
UTMX:	591379.62370999
UTMY:	4509173.9433000

AN561 **CONSOLIDATED EDISON** **MANIFEST** **1009240773**
North **50TH ST & 55TH AVE** **N/A**
1/8-1/4 **MASPETH, NY 10003**
0.185 mi.
975 ft. **Site 8 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY MANIFEST:

EPA ID:	NYP004087045
Country:	USA
Mailing Name:	CONSOLIDATED EDISON
Mailing Contact:	FRANKLIN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808

Document ID:	NYE0499914
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	07/25/2001
Trans1 Recv Date:	07/25/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/26/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004087045
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	74791AV
Waste Code:	B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity:	00062
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	01

AN562 **CON ED** **MANIFEST** **1009242089**
North **50 ST & 55 AVE** **N/A**
1/8-1/4 **QUEENS, NY**
0.185 mi.
976 ft. **Site 9 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY MANIFEST:

EPA ID:	NYP004107488
Country:	USA
Mailing Name:	CON ED
Mailing Contact:	FRANKLIN MURRAY
Mailing Address:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003

CON ED (Continued) **1009242089**

Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-460-2808
Document ID:	NYE1323945
Manifest Status:	Not reported
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	03/05/2003
Trans1 Recv Date:	03/05/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/06/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004107488
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	96590JE
Waste Code:	B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity:	00127
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	01.00
Year:	03

AN563 **NY Spills** **S104647902**
North **50-02 55TH AVE** **NY Hist Spills** **N/A**
1/8-1/4 **QUEENS, NY**
0.185 mi.
976 ft. **Site 10 of 10 in cluster AN**

Relative:
Higher

Actual:
59 ft.

NY Spills:

Site ID:	259548
Facility Addr2:	Not reported
Facility ID:	9807643
Spill Number:	9807643
Facility Type:	ER
SWIS:	4101
Investigator:	MXTIPPLE
Referred To:	Not reported
Spill Date:	9/23/1998
Reported to Dept:	9/23/1998
CID:	382
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	8/1/2003

(Continued) **S104647902**

Remediation Phase:	0
Date Entered In Computer:	9/23/1998
Spill Record Last Update:	9/14/2004
Spiller Name:	NANCY MURPHY
Spiller Company:	CANNON -EXPRESS CORP
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	NANCY MURPHY
Contact Phone:	(978) 897-6461
DEC Region:	2
DER Facility ID:	282831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE" CONTACTED NANCY MURPHY AT (978)897-6461. SPILL CAME FROM TRUCK. SPILL OCCURED ON STREET. HMHTTC GROUP HAS GONE TO CLEAN UP. FOR FURTHER INFO CONTACT JOE NEWICK WHO IS IN THIS GROUP AT (908)558-0156. 01/31/01 Reassigned from O'Dowd to Tipple. See also 9701735.
Remarks:	SPILL WAS CALLED IN FROM MASSACHUSETTS. SPILL HAS BEEN CONTAINED

Material:

Site ID:	259548
Operable Unit ID:	1065212
Operable Unit:	01
Material ID:	315201
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	70
Units:	Gallons
Recovered:	70
Resource Affected:	Not reported
Oxygenate:	False

Tank Test:

Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

NY Hist Spills:

Region of Spill:	2
Spill Number:	9807643
Investigator:	TIPPLE
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported

(Continued) **S104647902**

Notifier Phone: Not reported
Spill Date/Time: 09/23/1998 08:00
Reported to Dept Date/Time: 09/23/98 09:49
SWIS: 63
Spiller Name: CANNON -EXPRESS CORP
Spiller Contact: NANCY MURPHY
Spiller Phone: (978) 897-6461
Spiller Contact: NANCY MURPHY
Spiller Phone: (978) 897-6461
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/23/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/18/01
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 70
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 70
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: CONTACTED NANCY MURPHY AT 978)897-6461. SPILL CAME FROM TRUCK. SPILL OCCURED ON STREET. HMHTTC GROUP HAS GONE TO CLEAN UP. FOR FURTHER INFO CONTACT JOE NEWICK WHO IS IN THIS GROUP AT 908)558-0156. 01/31/01 Reassigned from O

(Continued) **S104647902**

Dowd to Tipple.See also 9701735.
Remark: SPILL WAS CALLED IN FROM MASSACHUSETTS. SPILL HAS BEEN CONTAINED

564
ENE
1/8-1/4
0.186 mi.
980 ft.

56 DR & 58 PL
QUEENS, NY

NY Spills **S104650912**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
29 ft.

NY Spills:

Site ID:	95946
Facility Addr2:	Not reported
Facility ID:	0003185
Spill Number:	0003185
Facility Type:	ER
SWIS:	4101
Investigator:	SMSANGES
Referred To:	Not reported
Spill Date:	6/14/2000
Reported to Dept:	6/14/2000
CID:	211
Spill Cause:	Abandoned Drums
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	4/21/2003
Remediation Phase:	0
Date Entered In Computer:	6/14/2000
Spill Record Last Update:	4/21/2003
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ -
Spiller Company:	001
Contact Name:	STANLEY BALDWIN
Contact Phone:	(718) 595-4658
DEC Region:	2
DER Facility ID:	85795
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND"
Remarks:	15 5 gal pails of waste oil - caller states pails have been put into 55 gal drums

Material:

Site ID:	95946
Operable Unit ID:	825388
Operable Unit:	01
Material ID:	551512
Material Code:	0022
Material Name:	Waste Oil/Used Oil
Case No.:	Not reported

(Continued) **S104650912**

Material FA: Petroleum
Quantity: 75
Units: Gallons
Recovered: 75
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0003185
Investigator: SANGESLAND
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/14/2000 08:10
Reported to Dept Date/Time: 06/14/00 09:36
SWIS: 63
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: ( ) -
Spiller Contact: STANLEY BALDWIN
Spiller Phone: (718) 595-4658
Spiller Address: Not reported
Spiller City,St,Zip: -
Spill Cause: Abandoned Drums
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

(Continued) **S104650912**

Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/14/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/14/00
Is Updated: False

Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Petroleum
Quantity Spilled: 75
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 75
Unkonwn Quantity Recovered: False
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported
Last Date: 19940927
DEC Remarks: Not reported
Remark: 15 5 gal pails of waste oil - caller states pails have been put into 55 gal drums

---

AO565 **E GREENE & CO, INC** **UST** **U001839710**
South **57-00 49 ST** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.187 mi.
987 ft. **Site 1 of 2 in cluster AO**

Relative:
Higher

Actual:
14 ft.

UST:
Facility Id: 2-350230
Region: STATE
DEC Region: 2
Site Status: Administratively Closed
Program Type: PBS
Expiration Date: N/A
UTM X: 591213.68579000002
UTM Y: 4508763.9329399997

Affiliation Records:
Site Id: 17274
Affiliation Type: Owner
Company Name: E GREENE & CO, INC
Contact Type: Not reported
Contact Name: Not reported
Address1: 57-00 49 ST
Address2: Not reported
City: MASPETH
State: NY
Zip Code: 11378

E GREENE & CO, INC (Continued) **U001839710**

Country Code:	001
Phone:	(718) 366-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	17274
Affiliation Type:	Emergency Contact
Company Name:	E GREENE & CO, INC
Contact Type:	Not reported
Contact Name:	ROY BITTEL
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 366-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	17274
Affiliation Type:	Mail Contact
Company Name:	E GREENE & CO, INC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	57-00 49 ST
Address2:	Not reported
City:	MASPETH
State:	NY
Zip Code:	11378
Country Code:	001
Phone:	(718) 366-5555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	17274
Affiliation Type:	On-Site Operator
Company Name:	E GREENE & CO, INC
Contact Type:	Not reported
Contact Name:	E GREENE & CO, INC
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 366-5555
Phone Ext:	Not reported

E GREENE & CO, INC (Continued) **U001839710**

Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
C00 - Pipe Location - No Piping
B00 - Tank External Protection - None

Tank Info:
Site ID: 17274

Tank Number: 001
Tank ID: 33784
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/1/1976
Capacity Gallons: 1600
Tightness Test Method: 05
Next Test Date: Not reported
Date Tank Closed: 6/1/1999
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 9/1/1989
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

HIST UST:
PBS Number: 2-350230
SPDES Number: Not reported
Emergency Contact: ROY BITTEL
Emergency Telephone: (718) 366-5555
Operator: E GREENE & CO, INC
Operator Telephone: (718) 366-5555
Owner Name: E GREENE & CO, INC
Owner Address: 57-00 49 ST
Owner City,St,Zip: MASPETH, NY 11378
Owner Telephone: (718) 366-5555
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: E GREENE & CO, INC
Mailing Address: 57-00 49 ST
Mailing Address 2: Not reported
Mailing City,St,Zip: MASPETH, NY 11378
Mailing Contact: Not reported
Mailing Telephone: (718) 366-5555
Owner Mark: First Owner
Facility Status: 3 - Administratively closed (reasons include business is closed and/or

E GREENE & CO, INC (Continued) **U001839710**

mail is undeliverable, and staff cannot check if tanks were removed;
or a duplicate registration was generated).

Facility Addr2:	57000 49 ST
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported
Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	02/23/1993
Expiration Date:	05/19/1998
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	Minor Data Missing
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Undefined
Install Date:	19761001
Capacity (gals):	1600
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Second Containment:	None
Leak Detection:	None
Overfill Prot:	Not reported
Dispenser:	Suction
Date Tested:	09/01/1989
Next Test Date:	09/01/1994
Missing Data for Tank:	Minor Data Missing
Date Closed:	06/01/1999
Test Method:	Ainlay
Deleted:	False
Updated:	False
Lat/long:	Not reported

AO566 **57-00 49TH STREET** **UST** **U001841225**
South **57-00 49TH STREET** **HIST UST** **N/A**
1/8-1/4 **MASPETH, NY 11378**
0.187 mi.
987 ft. **Site 2 of 2 in cluster AO**

Relative:
Higher

Actual:
14 ft.

UST:

Facility Id:	2-511404
Region:	STATE
DEC Region:	2
Site Status:	Unregulated
Program Type:	PBS
Expiration Date:	N/A
UTM X:	591213.68579000002
UTM Y:	4508763.9329399997

Affiliation Records:

Site Id:	21942
Affiliation Type:	Mail Contact
Company Name:	EMANUEL GREENE
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1961 HERITAGE WAY
Address2:	Not reported
City:	MANHASSET
State:	NY
Zip Code:	11030
Country Code:	001
Phone:	(516) 365-8850
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	21942
Affiliation Type:	Emergency Contact
Company Name:	EMANUEL GREENE
Contact Type:	Not reported
Contact Name:	EMANUEL GREENE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(516) 365-8850
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	21942
Affiliation Type:	On-Site Operator
Company Name:	57-00 49TH STREET
Contact Type:	Not reported
Contact Name:	BUNZL
Address1:	Not reported
Address2:	Not reported

57-00 49TH STREET (Continued) **U001841225**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 366-3555
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Site Id:	21942
Affiliation Type:	Owner
Company Name:	EMANUEL GREENE
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1961 HERITAGE WAY
Address2:	Not reported
City:	MANHASSET
State:	NY
Zip Code:	11030
Country Code:	001
Phone:	(516) 365-8850
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction
F01 - Pipe External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
G99 - Tank Secondary Containment - Other
B00 - Tank External Protection - None

57-00 49TH STREET (Continued) **U001841225**

G99 - Tank Secondary Containment - Other
G99 - Tank Secondary Containment - Other
B00 - Tank External Protection - None
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground
C02 - Pipe Location - Underground/On-ground

Tank Info:

Site ID:	21942
Tank Number:	001
Tank ID:	39835
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1973
Capacity Gallons:	550
Tightness Test Method:	05
Next Test Date:	Not reported
Date Tank Closed:	10/1/1998
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/1/1989
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	21942
Tank Number:	002
Tank ID:	56909
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1973
Capacity Gallons:	550
Tightness Test Method:	05
Next Test Date:	Not reported
Date Tank Closed:	10/1/1998
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/1/1989
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	21942
Tank Number:	003
Tank ID:	56910
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	4/1/1973
Capacity Gallons:	550

57-00 49TH STREET (Continued) **U001841225**

Tightness Test Method:	05
Next Test Date:	Not reported
Date Tank Closed:	10/1/1998
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	9/1/1989
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004
Site ID:	21942
Tank Number:	2
Tank ID:	41199
Tank Status:	Closed - In Place
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	10/1/1960
Capacity Gallons:	3000
Tightness Test Method:	01
Next Test Date:	Not reported
Date Tank Closed:	1/1/1991
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	12/1/1991
Register:	True
Modified By:	TRANSLAT
Last Modified:	3/4/2004

HIST UST:

PBS Number:	2-511404
SPDES Number:	Not reported
Emergency Contact:	EMANUEL GREENE
Emergency Telephone:	(516) 365-8850
Operator:	BUNZL
Operator Telephone:	(718) 366-3555
Owner Name:	EMANUEL GREENE
Owner Address:	1961 HERITAGE WAY
Owner City,St,Zip:	MANHASSET, NY 11030
Owner Telephone:	(516) 365-8850
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Name:	EMANUEL GREENE
Mailing Address:	1961 HERITAGE WAY
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MANHASSET, NY 11030
Mailing Contact:	Not reported
Mailing Telephone:	(516) 365-8850
Owner Mark:	First Owner
Facility Status:	2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Addr2:	57000 49TH STREET
SWIS ID:	6301
Old PBS Number:	Not reported
Facility Type:	TRUCKING/TRANSPORTATION
Inspected Date:	Not reported
Inspector:	Not reported

57-00 49TH STREET (Continued) **U001841225**

Inspection Result:	Not reported
Federal ID:	Not reported
Certification Flag:	False
Certification Date:	11/21/1995
Expiration Date:	02/06/2001
Renew Flag:	False
Renewal Date:	Not reported
Total Capacity:	0
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	0
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	63
Town or City:	01
Region:	2

Tank Id:	001
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19730401
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Not reported
Second Containment:	Other
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	09/01/1989
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1998
Test Method:	Ainlay
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	002
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19730401
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON

57-00 49TH STREET (Continued) **U001841225**

Pipe Internal:	None
Pipe External:	Not reported
Second Containment:	Other
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	09/01/1989
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1998
Test Method:	Ainlay
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	003
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19730401
Capacity (gals):	550
Product Stored:	DIESEL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Not reported
Second Containment:	Other
Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	09/01/1989
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1998
Test Method:	Ainlay
Deleted:	False
Updated:	True
Lat/long:	Not reported

Tank Id:	2
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	19601001
Capacity (gals):	3000
Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Not reported
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Containment:	None

57-00 49TH STREET (Continued) **U001841225**

Leak Detection:	None
Overfill Prot:	Product Level Gauge
Dispenser:	Suction
Date Tested:	12/01/1991
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	01/01/1991
Test Method:	Petro-Tite
Deleted:	False
Updated:	True
Lat/long:	Not reported

Count: 20 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
MASPETH	1001224099	TDI ATT - PETER VELAZQUEZ	40-29 MASPETH AVE	11378	FINDS,MANIFEST,RCRA-NLR
MASPETH	1005630384	CON ED - M/H 17826	60 AVE & MT OLIVET	11378	FINDS
MASPETH	1007124746	CON ED - MANHOLE 13829	E SIDE 74TH ST 218 FEET S OF	11378	FINDS
QUEENS	1007124767	CON ED - MH 1276	N/S GRAND AVE 240' E/O PAGE PL	11378	FINDS
QUEENS	1007206445	CONSOLIDATED EDISON	MH11276-GRAND AVE & PAGE PL		RCRA-NLR,MANIFEST
QUEENS	1007206521	CONSOLIDATED EDISON	MH 11276 - GRAND AVE & PAGE PL		RCRA-NLR,MANIFEST
QUEENS	1007207512	CONSOLIDATED EDISON	MH284-56TH DR & 43RD ST		RCRA-NLR,MANIFEST
QUEENS	1007252632	CON ED - MH 11276	N/S GRAND AVE 251 E/O PAGE PL	11378	FINDS
MASPETH	1007252725	CON ED - VS 9335	78TH ST E 55 N 67TH RD	11378	FINDS
MASPETH	1007252789	CON ED - VS 8549	56 AVE S 32 E MAURICE AVE	11378	FINDS
MASPETH	1007254474	CON EDISION - VS9095	GRAND AVE & 57TH ST 350 FEET N	11378	FINDS
QUEENS	1007746196	DEMOLITION TRANSFER - MASPETH FACI	METROPOLITAN-FLUSHING-GRAND ST	11378	FINDS
QUEENS	1007767741	DICKARD WIDDER IND-56-02 MASPETH A	56/02 MASPETH AVENUE	11378	FINDS
QUEENS	1007820680	NYC-TA CENTRAL WAREHOUSE-55 MASPET	55/04 MASPETH AVENUE	11378	FINDS
QUEENS	1008195609	CONSOLIDATED EDISON	FRESH POND RD & ELIOT AVE MH2		RCRA-NLR,MANIFEST
MASPETH	1008229277	CON EDISON - MH 206	FRESH POND AND ELIOT AVE	11378	FINDS
MASPETH	1008233748	CON EDISON - MH MH-17573	59TH ROAD AND 59TH STREET	11378	FINDS
CORONA	1009235574	NYCDEP	340 STATE ST BETWEEN BOND/HOYT	11378	MANIFEST
MASPETH	1010325587	CON EDISON - VAULT V8319	62 DR N24W 99 ST	11378	RCRA-NLR
MASPETH	1010444580	CON EDISON - VAULT V8319	62 DR N24W 99 ST	11378	FINDS

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 03/31/2011
Date Data Arrived at EDR: 04/13/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 62

Source: EPA
Telephone: N/A
Last EDR Contact: 07/12/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 3
Telephone 215-814-5418

EPA Region 4
Telephone 404-562-8033

EPA Region 5
Telephone 312-886-6686

EPA Region 6
Telephone: 214-655-6659

EPA Region 7
Telephone: 913-551-7247

EPA Region 8
Telephone: 303-312-6774

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 03/31/2011
Date Data Arrived at EDR: 04/13/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 62

Source: EPA
Telephone: N/A
Last EDR Contact: 07/12/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 03/31/2011
Date Data Arrived at EDR: 04/13/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 62

Source: EPA
Telephone: N/A
Last EDR Contact: 07/12/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 02/25/2011
Date Data Arrived at EDR: 03/01/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 62

Source: EPA
Telephone: 703-412-9810
Last EDR Contact: 09/01/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPAa??s Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 12/10/2010
Date Data Arrived at EDR: 01/11/2011
Date Made Active in Reports: 02/16/2011
Number of Days to Update: 36

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 07/15/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 02/25/2011
Date Data Arrived at EDR: 03/01/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 62

Source: EPA
Telephone: 703-412-9810
Last EDR Contact: 09/01/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/09/2011
Date Data Arrived at EDR: 03/15/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 91

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 07/07/2011
Date Made Active in Reports: 08/08/2011
Number of Days to Update: 32

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 07/07/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 07/07/2011
Date Made Active in Reports: 08/08/2011
Number of Days to Update: 32

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 07/07/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 07/07/2011
Date Made Active in Reports: 08/08/2011
Number of Days to Update: 32

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 07/07/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 07/07/2011
Date Made Active in Reports: 08/08/2011
Number of Days to Update: 32

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 07/07/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Varies

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 03/16/2011
Date Data Arrived at EDR: 03/25/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 81

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 03/16/2011
Date Data Arrived at EDR: 03/25/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 81

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 04/05/2011
Date Data Arrived at EDR: 04/05/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 70

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Annually

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 07/12/2011
Date Data Arrived at EDR: 07/13/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Annually

VAPOR REOPENED: Vapor Intrustion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 09/14/2010
Date Data Arrived at EDR: 11/24/2010
Date Made Active in Reports: 12/17/2010
Number of Days to Update: 23

Source: Department of Environmenal Conservation
Telephone: 518-402-9814
Last EDR Contact: 08/26/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Varies

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 07/11/2011
Date Data Arrived at EDR: 07/11/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-457-2051
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Semi-Annually

State and tribal leaking storage tank lists

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/01/2011
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 03/03/2011
Date Data Arrived at EDR: 03/18/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 45

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Semi-Annually

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 01/31/2011
Date Data Arrived at EDR: 02/01/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 48

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 05/17/2011
Date Data Arrived at EDR: 05/19/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 26
Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Quarterly

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 03/07/2011
Date Data Arrived at EDR: 05/20/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 25
Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 08/02/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 05/10/2011
Date Data Arrived at EDR: 05/11/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 34
Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 11/04/2009
Date Data Arrived at EDR: 05/04/2010
Date Made Active in Reports: 07/07/2010
Number of Days to Update: 64
Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 08/02/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 05/16/2011
Date Data Arrived at EDR: 05/17/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 28
Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Quarterly

State and tribal registered storage tank lists

TANKS: Storage Tank Faciliy Listing
This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 35
Source: Department of Environmental Conservation
Telephone: 518-402-9543
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

UST: Petroleum Bulk Storage (PBS) Database
Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/05/2011
Number of Days to Update: 31
Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CBS UST: Chemical Bulk Storage Database
Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database
Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: Varies

AST: Petroleum Bulk Storage
Registered Aboveground Storage Tanks.

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/05/2011
Number of Days to Update: 31

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database
Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database
Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF: Major Oil Storage Facility Site Listing
These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

CBS: Chemical Bulk Storage Site Listing
These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 05/10/2011
Date Data Arrived at EDR: 05/11/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 34

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Semi-Annually

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 01/01/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 68

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 03/03/2011
Date Data Arrived at EDR: 03/18/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 45

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Semi-Annually

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 05/18/2011
Date Data Arrived at EDR: 05/26/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 19

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Quarterly

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 05/16/2011
Date Data Arrived at EDR: 05/17/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 28

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Quarterly

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 04/01/2011
Date Data Arrived at EDR: 06/01/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 13
Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 08/02/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 05/17/2011
Date Data Arrived at EDR: 05/19/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 26
Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Quarterly

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 03/07/2011
Date Data Arrived at EDR: 05/04/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 41
Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 08/02/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010
Date Data Arrived at EDR: 02/16/2010
Date Made Active in Reports: 04/12/2010
Number of Days to Update: 55
Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 07/12/2011
Date Data Arrived at EDR: 07/13/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 27
Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 07/12/2011
Date Data Arrived at EDR: 07/13/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 27
Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Quarterly

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 11/18/2010
Date Data Arrived at EDR: 12/23/2010
Date Made Active in Reports: 02/11/2011
Number of Days to Update: 50

Source: NYC Department of City Planning
Telephone: 212-720-3401
Last EDR Contact: 06/29/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: No Update Planned

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 07/12/2011
Date Data Arrived at EDR: 07/13/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9711
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Semi-Annually

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 02/25/2011
Date Data Arrived at EDR: 04/05/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 70

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

State and tribal Brownfields sites

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 07/12/2011
Date Data Arrived at EDR: 07/13/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 09/05/2011
Data Release Frequency: Quarterly

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 07/12/2011
Date Data Arrived at EDR: 07/13/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 03/29/2011
Date Data Arrived at EDR: 03/29/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 77

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 06/27/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 06/27/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: No Update Planned

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 07/11/2011
Date Data Arrived at EDR: 07/11/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-8705
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Semi-Annually

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

Date of Government Version: 08/01/2006
Date Data Arrived at EDR: 11/15/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 15

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 07/29/2011
Next Scheduled EDR Contact: 11/07/2011
Data Release Frequency: Annually

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands
Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52
Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs
A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 02/02/2011
Date Data Arrived at EDR: 03/17/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 46
Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 09/07/2011
Next Scheduled EDR Contact: 12/19/2011
Data Release Frequency: Quarterly

DEL SHWS: Delisted Registry Sites
A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 05/24/2011
Date Data Arrived at EDR: 05/25/2011
Date Made Active in Reports: 07/05/2011
Number of Days to Update: 41
Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Annually

US HIST CDL: National Clandestine Laboratory Register
A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007
Date Data Arrived at EDR: 11/19/2008
Date Made Active in Reports: 03/30/2009
Number of Days to Update: 131
Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/23/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: No Update Planned

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database
These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48
Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/01/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 08/12/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005
Date Data Arrived at EDR: 12/11/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 31

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 09/05/2011
Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 01/05/2011
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 51

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 07/05/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Annually

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 07/05/2011
Date Data Arrived at EDR: 07/05/2011
Date Made Active in Reports: 08/01/2011
Number of Days to Update: 27

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 08/25/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA-NonGen: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 07/07/2011
Date Made Active in Reports: 08/08/2011
Number of Days to Update: 32

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 07/07/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/12/2011
Date Data Arrived at EDR: 02/11/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 80

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 08/09/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 11/10/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 62

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 07/22/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 08/12/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 112

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 06/14/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 04/05/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 70

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 02/25/2011
Date Data Arrived at EDR: 03/16/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 5

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 06/15/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010
Date Data Arrived at EDR: 10/21/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 99

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 08/31/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Varies

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/08/2011
Date Data Arrived at EDR: 03/09/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 54

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 09/08/2011
Next Scheduled EDR Contact: 12/19/2011
Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/17/2010
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 94

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 09/01/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 09/29/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 64

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 06/30/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/31/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/31/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing
A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing
A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems
Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77
Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 08/18/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System
The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 01/07/2011
Date Data Arrived at EDR: 01/21/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 59
Source: Environmental Protection Agency
Telephone: 202-564-5088
Last EDR Contact: 06/27/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 11/01/2010
Date Data Arrived at EDR: 11/10/2010
Date Made Active in Reports: 02/16/2011
Number of Days to Update: 98

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 07/22/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 03/18/2010
Date Data Arrived at EDR: 04/06/2010
Date Made Active in Reports: 05/27/2010
Number of Days to Update: 51

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 01/11/2011
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 02/16/2011
Number of Days to Update: 34

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 07/12/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 04/14/2010
Date Data Arrived at EDR: 04/16/2010
Date Made Active in Reports: 05/27/2010
Number of Days to Update: 41

Source: EPA
Telephone: (212) 637-3000
Last EDR Contact: 06/14/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 03/01/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 62

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 09/01/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Biennially

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 06/13/2011
Date Data Arrived at EDR: 06/15/2011
Date Made Active in Reports: 07/18/2011
Number of Days to Update: 33

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 06/15/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Quarterly

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 05/12/2011
Date Made Active in Reports: 05/24/2011
Number of Days to Update: 12

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 08/09/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Annually

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 06/28/2011
Date Data Arrived at EDR: 06/29/2011
Date Made Active in Reports: 07/05/2011
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 06/20/2011
Next Scheduled EDR Contact: 10/03/2011
Data Release Frequency: Varies

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 07/19/2011
Date Data Arrived at EDR: 07/20/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 20

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 11/02/2010
Date Made Active in Reports: 12/17/2010
Number of Days to Update: 45

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 05/02/2011
Next Scheduled EDR Contact: 08/15/2011
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 06/14/2011
Date Data Arrived at EDR: 07/20/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 20

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 06/30/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 07/22/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 03/07/2011
Date Data Arrived at EDR: 03/09/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 54

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 07/15/2011
Next Scheduled EDR Contact: 11/07/2011
Data Release Frequency: Varies

FINANCIAL ASSURANCE 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 10/31/2008
Date Data Arrived at EDR: 11/25/2008
Date Made Active in Reports: 12/11/2008
Number of Days to Update: 16

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Varies

COAL ASH DOE: Sleam-Electric Plan Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 08/07/2009
Date Made Active in Reports: 10/22/2009
Number of Days to Update: 76

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010
Date Data Arrived at EDR: 01/03/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 77

Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 06/14/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 01/01/2008
Date Data Arrived at EDR: 02/18/2009
Date Made Active in Reports: 05/29/2009
Number of Days to Update: 100

Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 08/05/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

FINANCIAL ASSURANCE 1: Financial Assurance Information Listing
Financial assurance information.

Date of Government Version: 07/11/2011
Date Data Arrived at EDR: 07/11/2011
Date Made Active in Reports: 08/10/2011
Number of Days to Update: 30

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

COAL ASH: Coal Ash Disposal Site Listing
A listing of coal ash disposal site locations.

Date of Government Version: 07/11/2011
Date Data Arrived at EDR: 07/11/2011
Date Made Active in Reports: 08/09/2011
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands
Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 02/06/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 339

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 07/22/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: N/A

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants
The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Historical Auto Stations: EDR Proprietary Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Historical Cleaners: EDR Proprietary Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 06/30/2011
Date Data Arrived at EDR: 06/30/2011
Date Made Active in Reports: 08/05/2011
Number of Days to Update: 36

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Quarterly

Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 06/30/2011
Date Data Arrived at EDR: 06/30/2011
Date Made Active in Reports: 08/05/2011
Number of Days to Update: 36

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003
Date Data Arrived at EDR: 05/27/2003
Date Made Active in Reports: 06/09/2003
Number of Days to Update: 13

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Varies

Registered Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003
Date Data Arrived at EDR: 05/27/2003
Date Made Active in Reports: 06/09/2003
Number of Days to Update: 13

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 07/11/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database
A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 06/17/2011
Date Made Active in Reports: 07/06/2011
Number of Days to Update: 19

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Quarterly

Petroleum Bulk Storage Database
A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 06/17/2011
Date Made Active in Reports: 07/06/2011
Number of Days to Update: 19

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database
A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006
Date Data Arrived at EDR: 01/11/2007
Date Made Active in Reports: 02/07/2007
Number of Days to Update: 27

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Annually

Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006
Date Data Arrived at EDR: 01/11/2007
Date Made Active in Reports: 02/07/2007
Number of Days to Update: 27

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Annually

WESTCHESTER COUNTY:

Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 05/25/2011
Date Data Arrived at EDR: 05/27/2011
Date Made Active in Reports: 07/06/2011
Number of Days to Update: 40

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Varies

Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 05/25/2011
Date Data Arrived at EDR: 05/27/2011
Date Made Active in Reports: 07/06/2011
Number of Days to Update: 40

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2007
Date Data Arrived at EDR: 08/26/2009
Date Made Active in Reports: 09/11/2009
Number of Days to Update: 16

Source: Department of Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 08/26/2011
Next Scheduled EDR Contact: 12/05/2011
Data Release Frequency: Annually

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 07/20/2011
Date Made Active in Reports: 08/11/2011
Number of Days to Update: 22

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 07/20/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2008
Date Data Arrived at EDR: 12/01/2009
Date Made Active in Reports: 12/14/2009
Number of Days to Update: 13

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 07/15/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: Annually

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 06/24/2011
Date Made Active in Reports: 06/30/2011
Number of Days to Update: 6

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 08/31/2011
Next Scheduled EDR Contact: 12/12/2011
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data
Hazardous waste manifest information.

Date of Government Version: 05/13/2011
Date Data Arrived at EDR: 05/20/2011
Date Made Active in Reports: 07/08/2011
Number of Days to Update: 49

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 07/25/2011
Next Scheduled EDR Contact: 11/07/2011
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/06/2010
Date Made Active in Reports: 07/26/2010
Number of Days to Update: 20

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 10/03/2011
Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data
Source: Rextag Strategies Corp.
Telephone: (281) 769-2247
U.S. Electric Transmission and Power Plants Systems Digital GIS Data

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers
Source: Department of Health
Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)
Source: United States Geologic Survey
A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

MASPETH EXPANSION - CROSS HARBOR
MASPETH AVENUE / RUST STREET
MASPETH, NY 11378

TARGET PROPERTY COORDINATES

Latitude (North):	40.72510 - 40° 43' 30.4''
Longitude (West):	73.9195 - 73° 55' 10.2''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	591251.4
UTM Y (Meters):	4508591.5
Elevation:	11 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	40073-F8 BROOKLYN, NY
Most Recent Revision:	1995

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

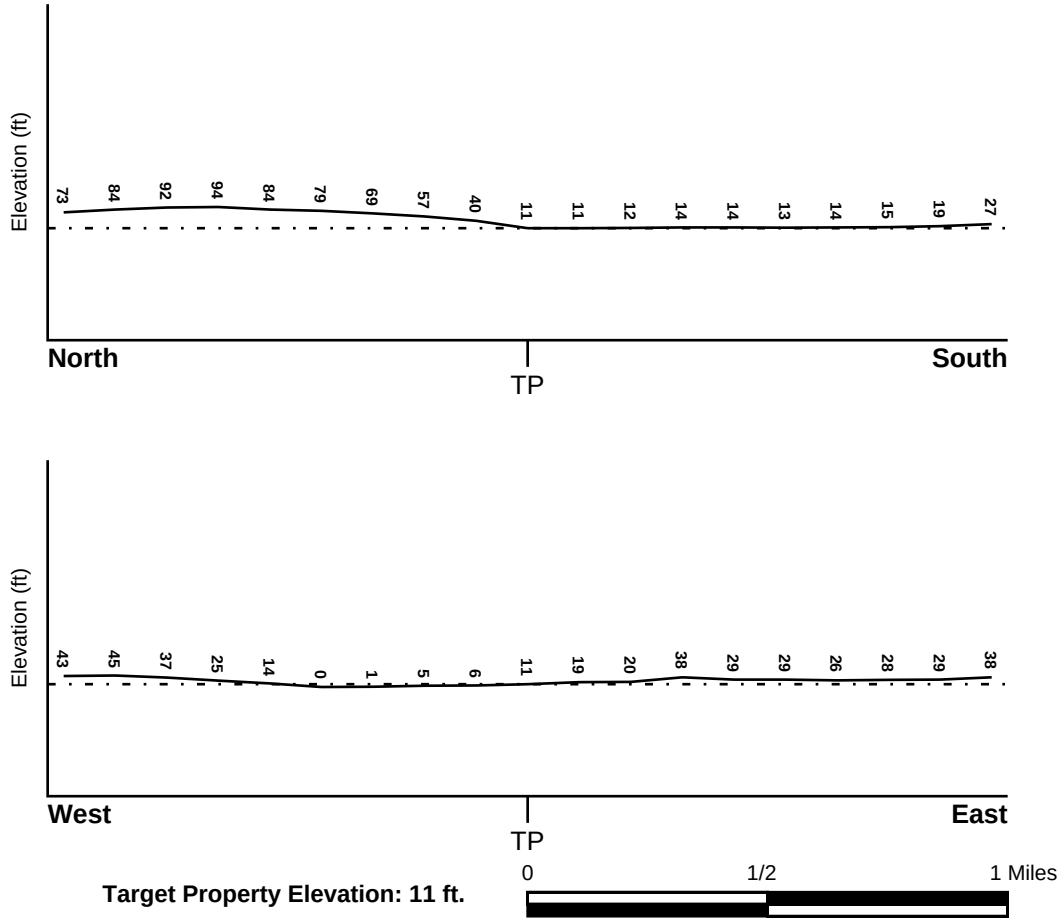

Target Property Elevation: 11 ft.

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County	FEMA Flood Electronic Data
QUEENS, NY	YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 360497 - FEMA DFIRM Flood data

Additional Panels in search area: Not Reported

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
BROOKLYN	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Location Relative to TP:	0 - 1/8 Mile North
Site Name:	Phelps Dodge Refining Corp
Site EPA ID Number:	NYD039138789
Groundwater Flow Direction:	DEPENDENT ON WELL PUMPING RATES.
Measured Depth to Water:	not available.
Hydraulic Connection:	Salt water intrusion may be present at the site. Information about the hydraulic connection between aquifers underlying the site is not available. The depth to bedrock is approximately 60 feet.
Sole Source Aquifer:	No information about a sole source aquifer is available
Data Quality:	Information is inferred in the CERCLIS investigation report(s)

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
Not Reported		

* ©1996 Site--specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Mesozoic
System:	Cretaceous
Series:	Upper Cretaceous
Code:	uK *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
	Boundary			Classification			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: silt loam
loamy sand
sandy loam
fine sandy loam

Surficial Soil Types: silt loam
loamy sand
sandy loam
fine sandy loam

Shallow Soil Types: sandy loam

Deeper Soil Types: unweathered bedrock
very gravelly - loamy sand
stratified
sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	0.189
Federal FRDS PWS	Nearest PWS within 0.189 miles
State Database	0.189

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS2117697	0 - 1/8 Mile WNW
2	USGS2117796	0 - 1/8 Mile SSW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 3164153.2s

- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- GI Indeterminate Groundwater Flow at Location
- GV Groundwater Flow Varies at Location
- HD Closest Hydrogeological Data
- Oil, gas or related wells

SITE NAME:	Maspeth Expansion - Cross Harbor	CLIENT:	STV Inc.
ADDRESS:	Maspeth Avenue / Rust Street Maspeth NY 11378	CONTACT:	Doane E. Cafferty
LAT/LONG:	40.7251 / 73.9195	INQUIRY #:	3164153.2s
		DATE:	September 12, 2011 10:47 am

Copyright © 2011 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

1
WNW
0 - 1/8 Mile
Higher | **FED USGS** | **USGS2117697**

Agency cd:	USGS	Site no:	404332073551701
Site name:	Q 1918. 1		
Latitude:	404332	EDR Site id:	USGS2117697
Longitude:	0735517	Dec lat:	40.72565787
Dec lon:	-73.92097049	Coor meth:	M
Coor accr:	S	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	081
Country:	US	Land net:	Not Reported
Location map:	QF1163	Map scale:	Not Reported
Altitude:	15.0		
Altitude method:	Level or other surveying method		
Altitude accuracy:	0.1		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Northern Long Island. New York. Area = 915 sq.mi.		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	Not Reported	Hole depth:	82.
Source of depth data:	Not Reported		
Project number:	Not Reported		
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported
Peak flow data count:	Not Reported	Water quality data begin date:	Not Reported
Water quality data end date:	Not Reported	Water quality data count:	Not Reported
Ground water data begin date:	Not Reported	Ground water data end date:	Not Reported
Ground water data count:	Not Reported		

Ground-water levels, Number of Measurements: 0

2
SSW
0 - 1/8 Mile
Lower | **FED USGS** | **USGS2117796**

Agency cd:	USGS	Site no:	404325073551401
Site name:	Q 438. 1		
Latitude:	404325	EDR Site id:	USGS2117796
Longitude:	0735514	Dec lat:	40.72371347
Dec lon:	-73.92013713	Coor meth:	M
Coor accr:	S	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	081
Country:	US	Land net:	Not Reported
Location map:	QF1164	Map scale:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Altitude:	4.0		
Altitude method:	Level or other surveying method		
Altitude accuracy:	0.1		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Northern Long Island. New York. Area = 915 sq.mi.		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	Not Reported	Hole depth:	208.
Source of depth data:	Not Reported		
Project number:	Not Reported		
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported
Peak flow data count:	Not Reported	Water quality data begin date:	Not Reported
Water quality data end date:	Not Reported	Water quality data count:	Not Reported
Ground water data begin date:	Not Reported	Ground water data end date:	Not Reported
Ground water data count:	Not Reported		

Ground-water levels, Number of Measurements: 0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

Federal EPA Radon Zone for QUEENS County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for QUEENS COUNTY, NY

Number of sites tested: 81

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	0.620 pCi/L	97%	0%	3%
Basement	0.970 pCi/L	93%	6%	1%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)
Source: United States Geologic Survey
A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Services
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells
Source: New York Department of Health
Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database
Department of Environmental Conservation
Telephone: 518-402-8072
These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon
Source: Department of Health
Telephone: 518-402-7556
Radon Test Results

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

1914 Certified Sanborn Map

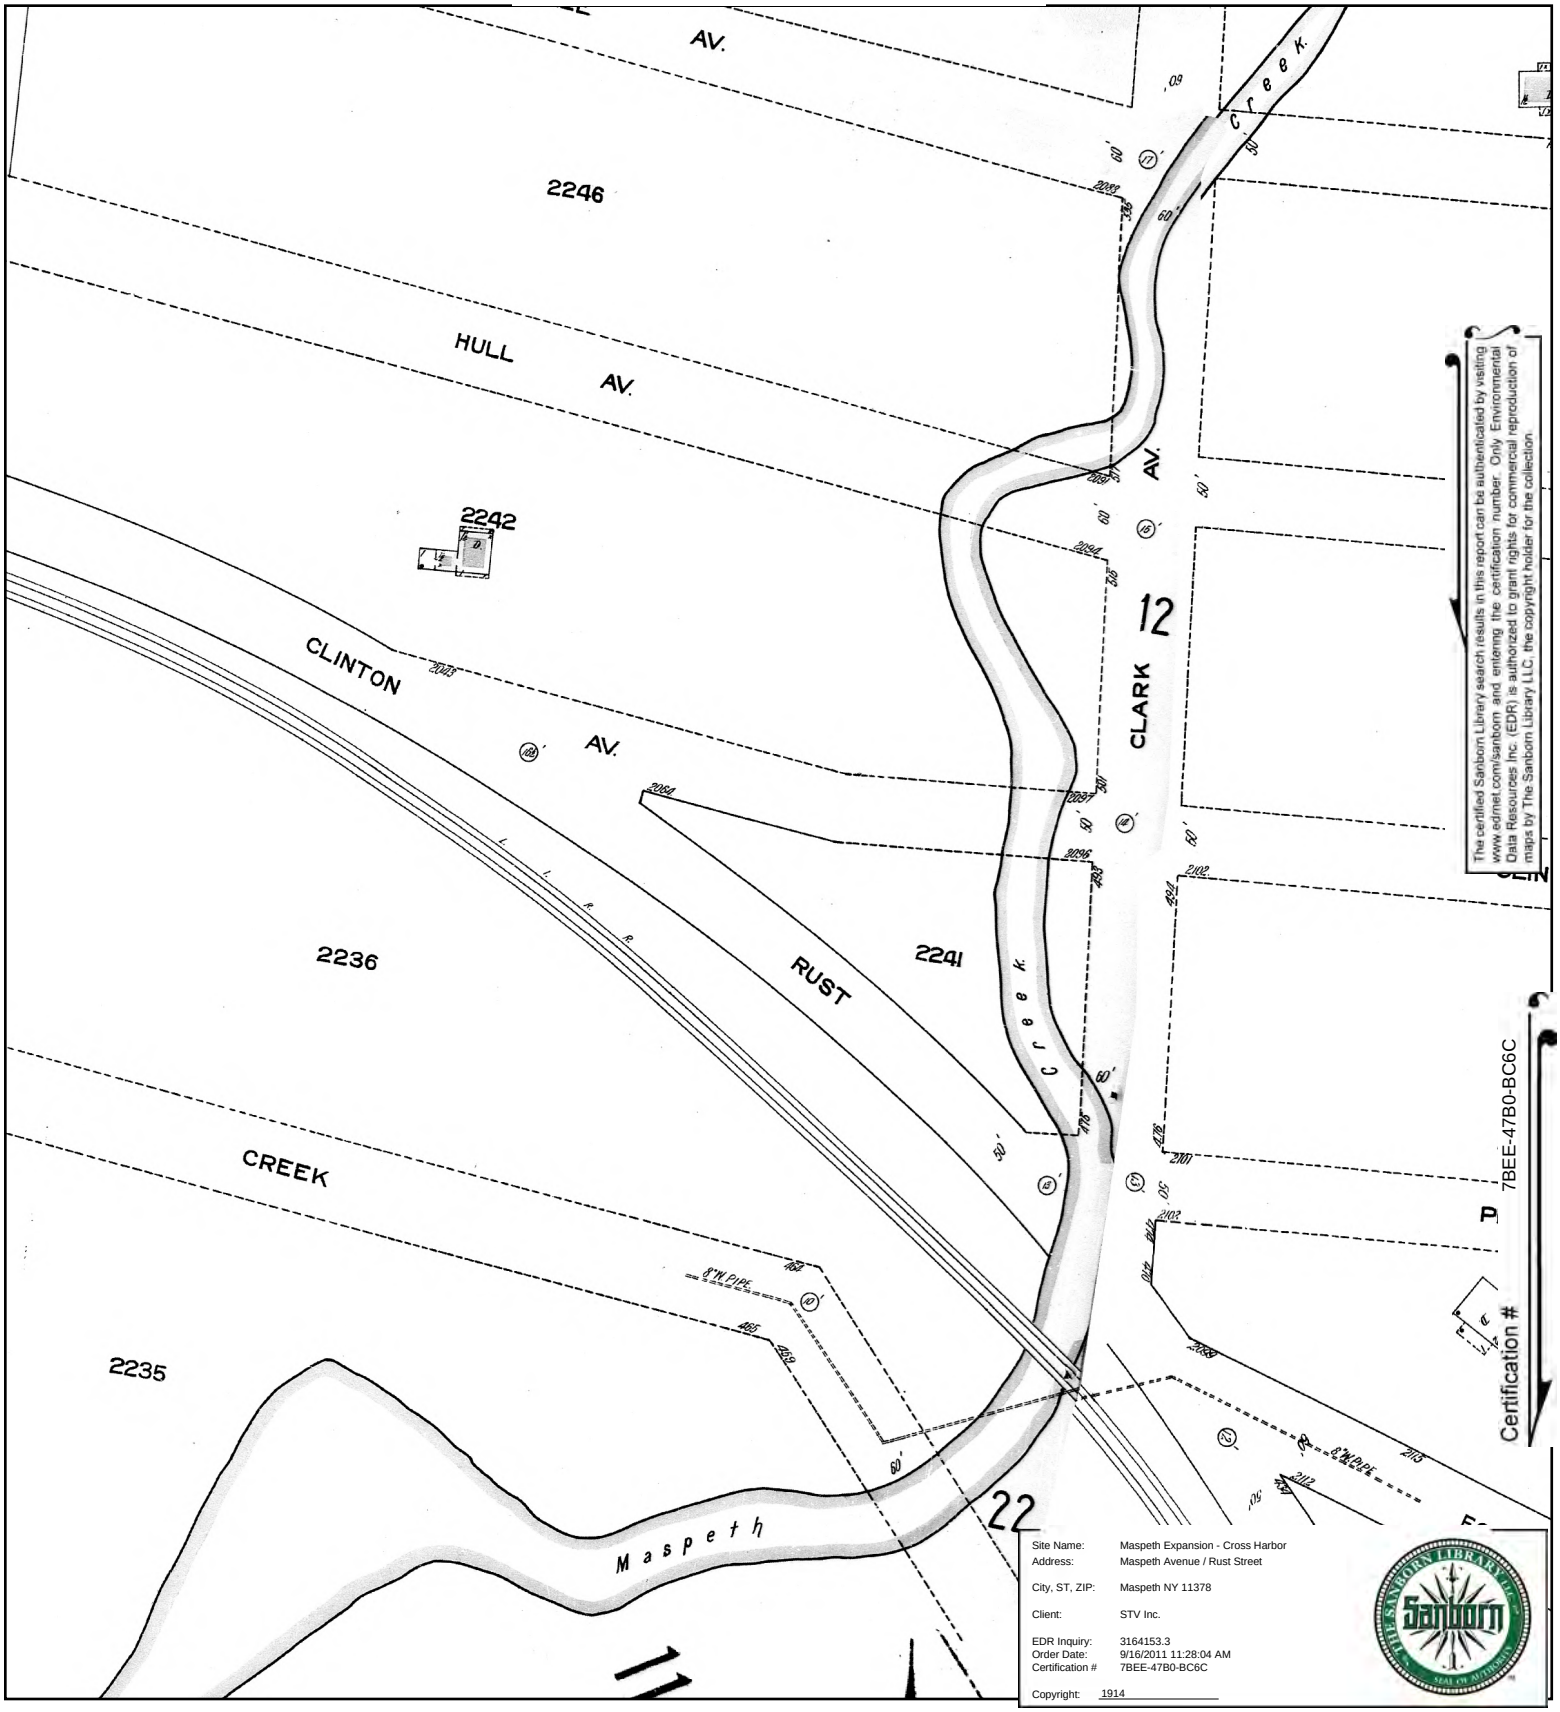

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

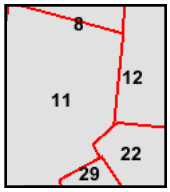

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1902 Certified Sanborn Map

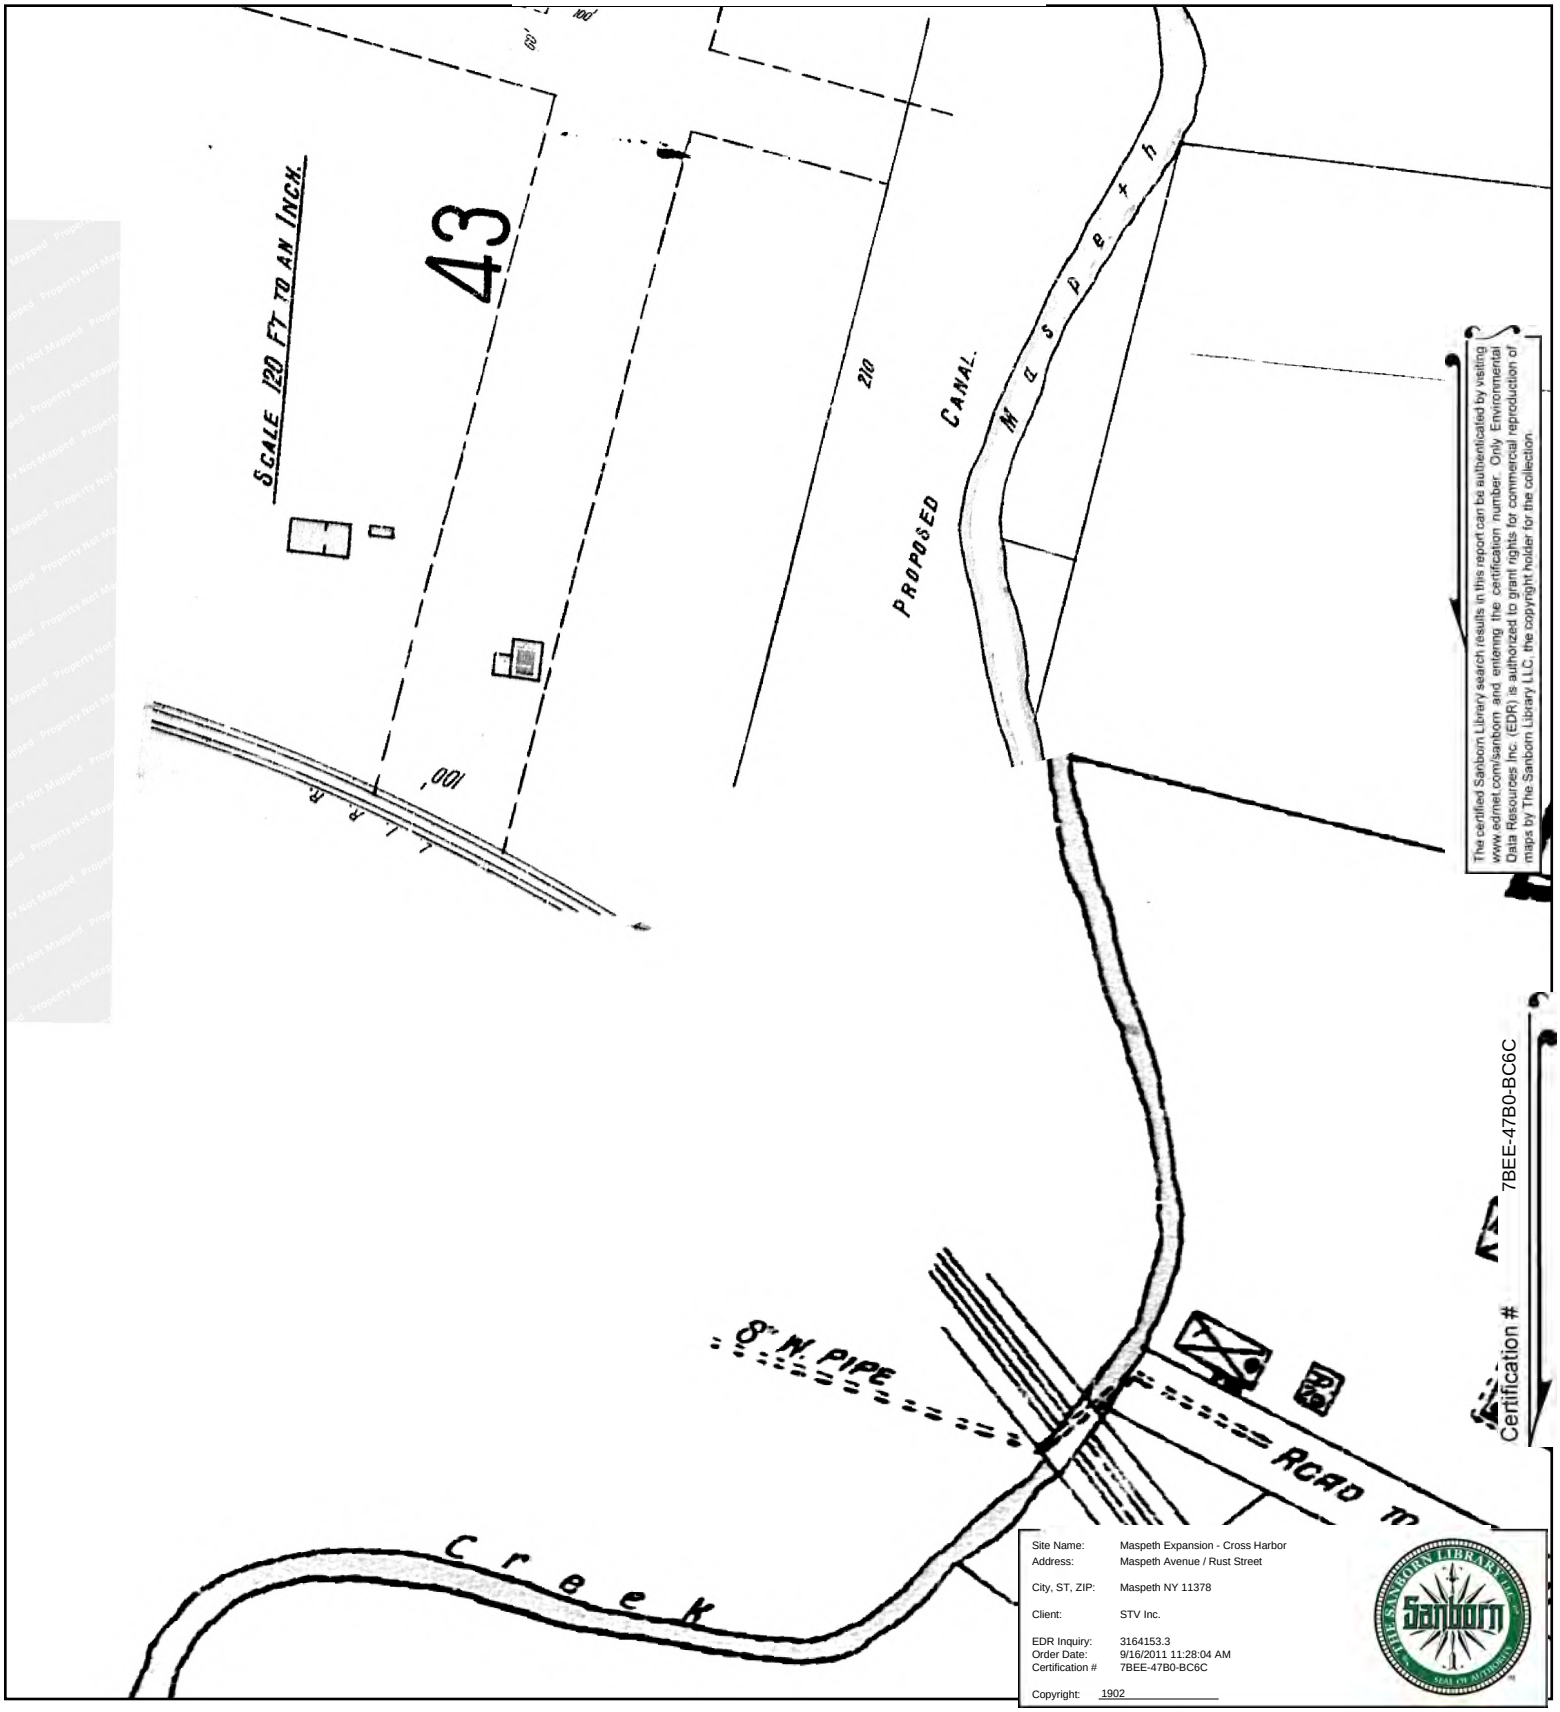

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

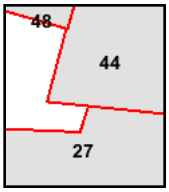

Volume 3, Sheet 27
Volume 3, Sheet 44
Volume 3, Sheet 48

0 Feet 165 330 660

N

1950 Certified Sanborn Map

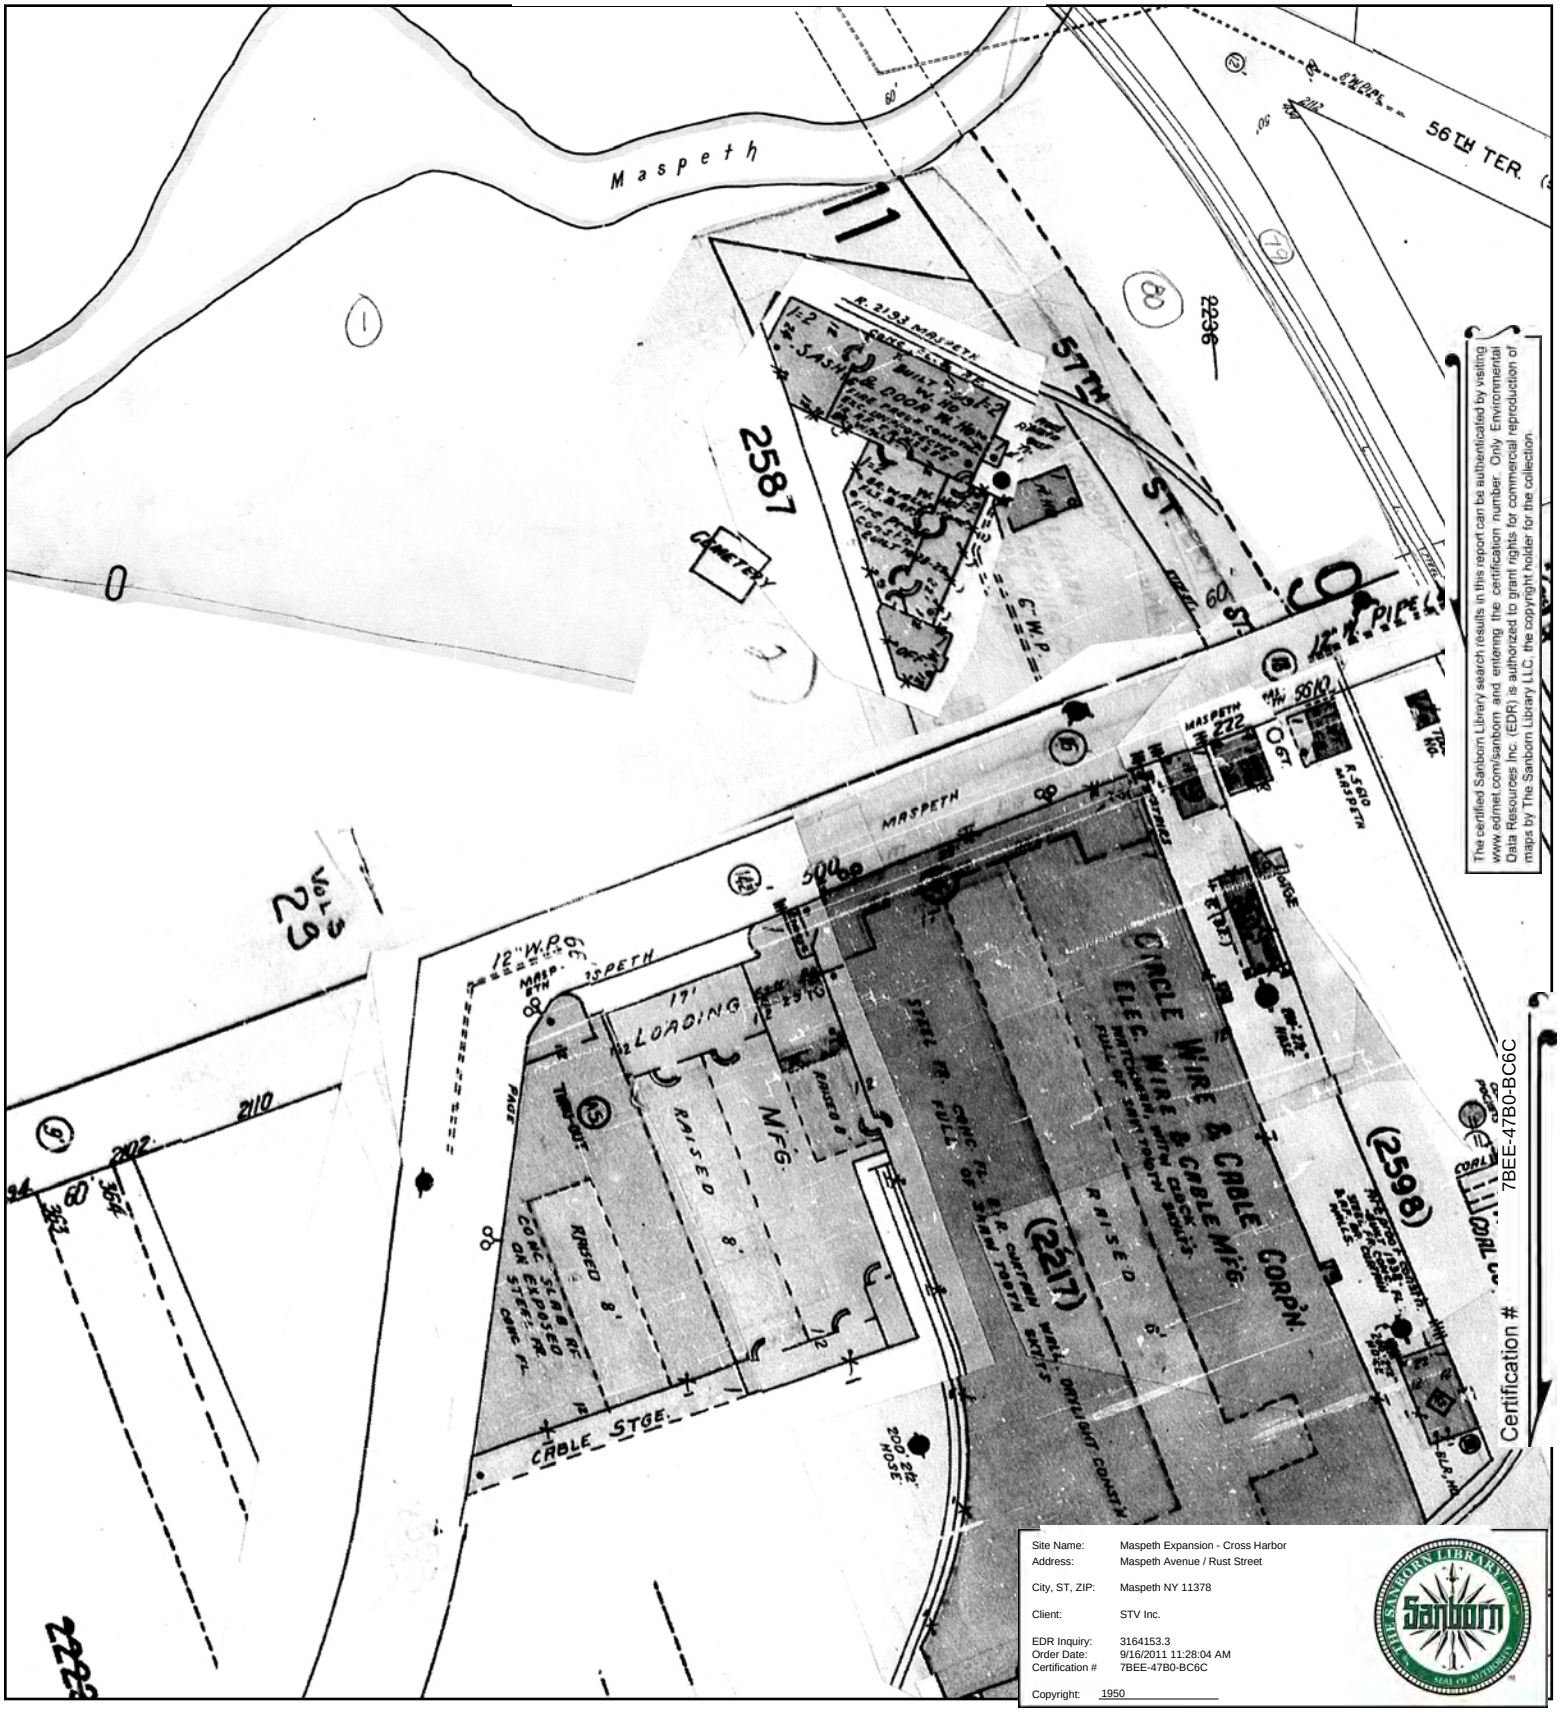

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

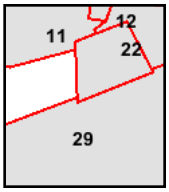

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1936 Certified Sanborn Map

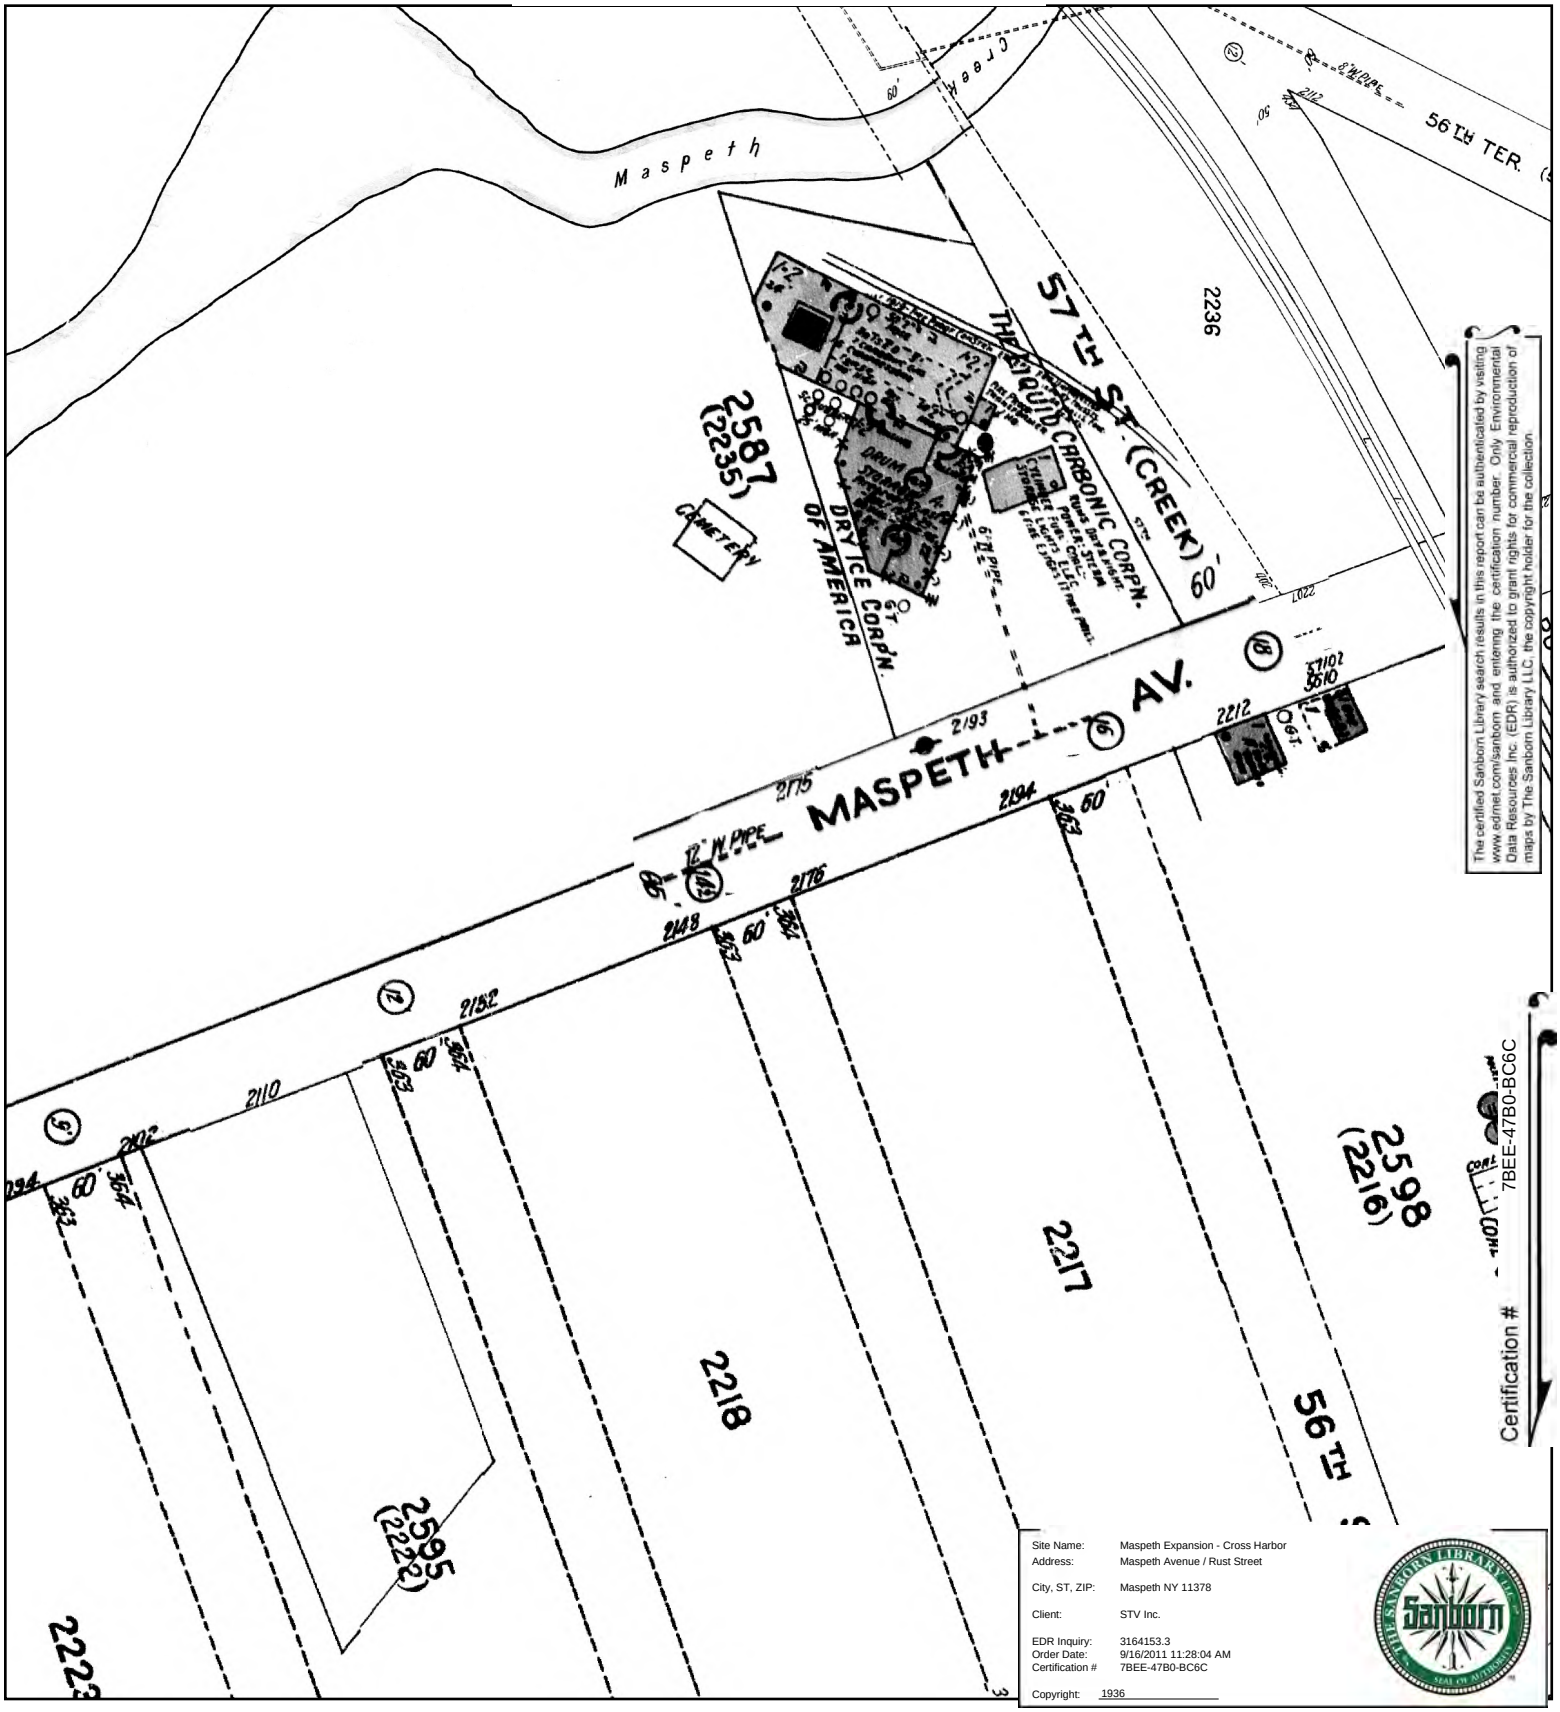

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1936

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

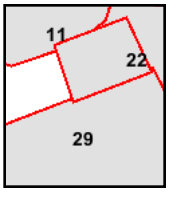

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1914 Certified Sanborn Map

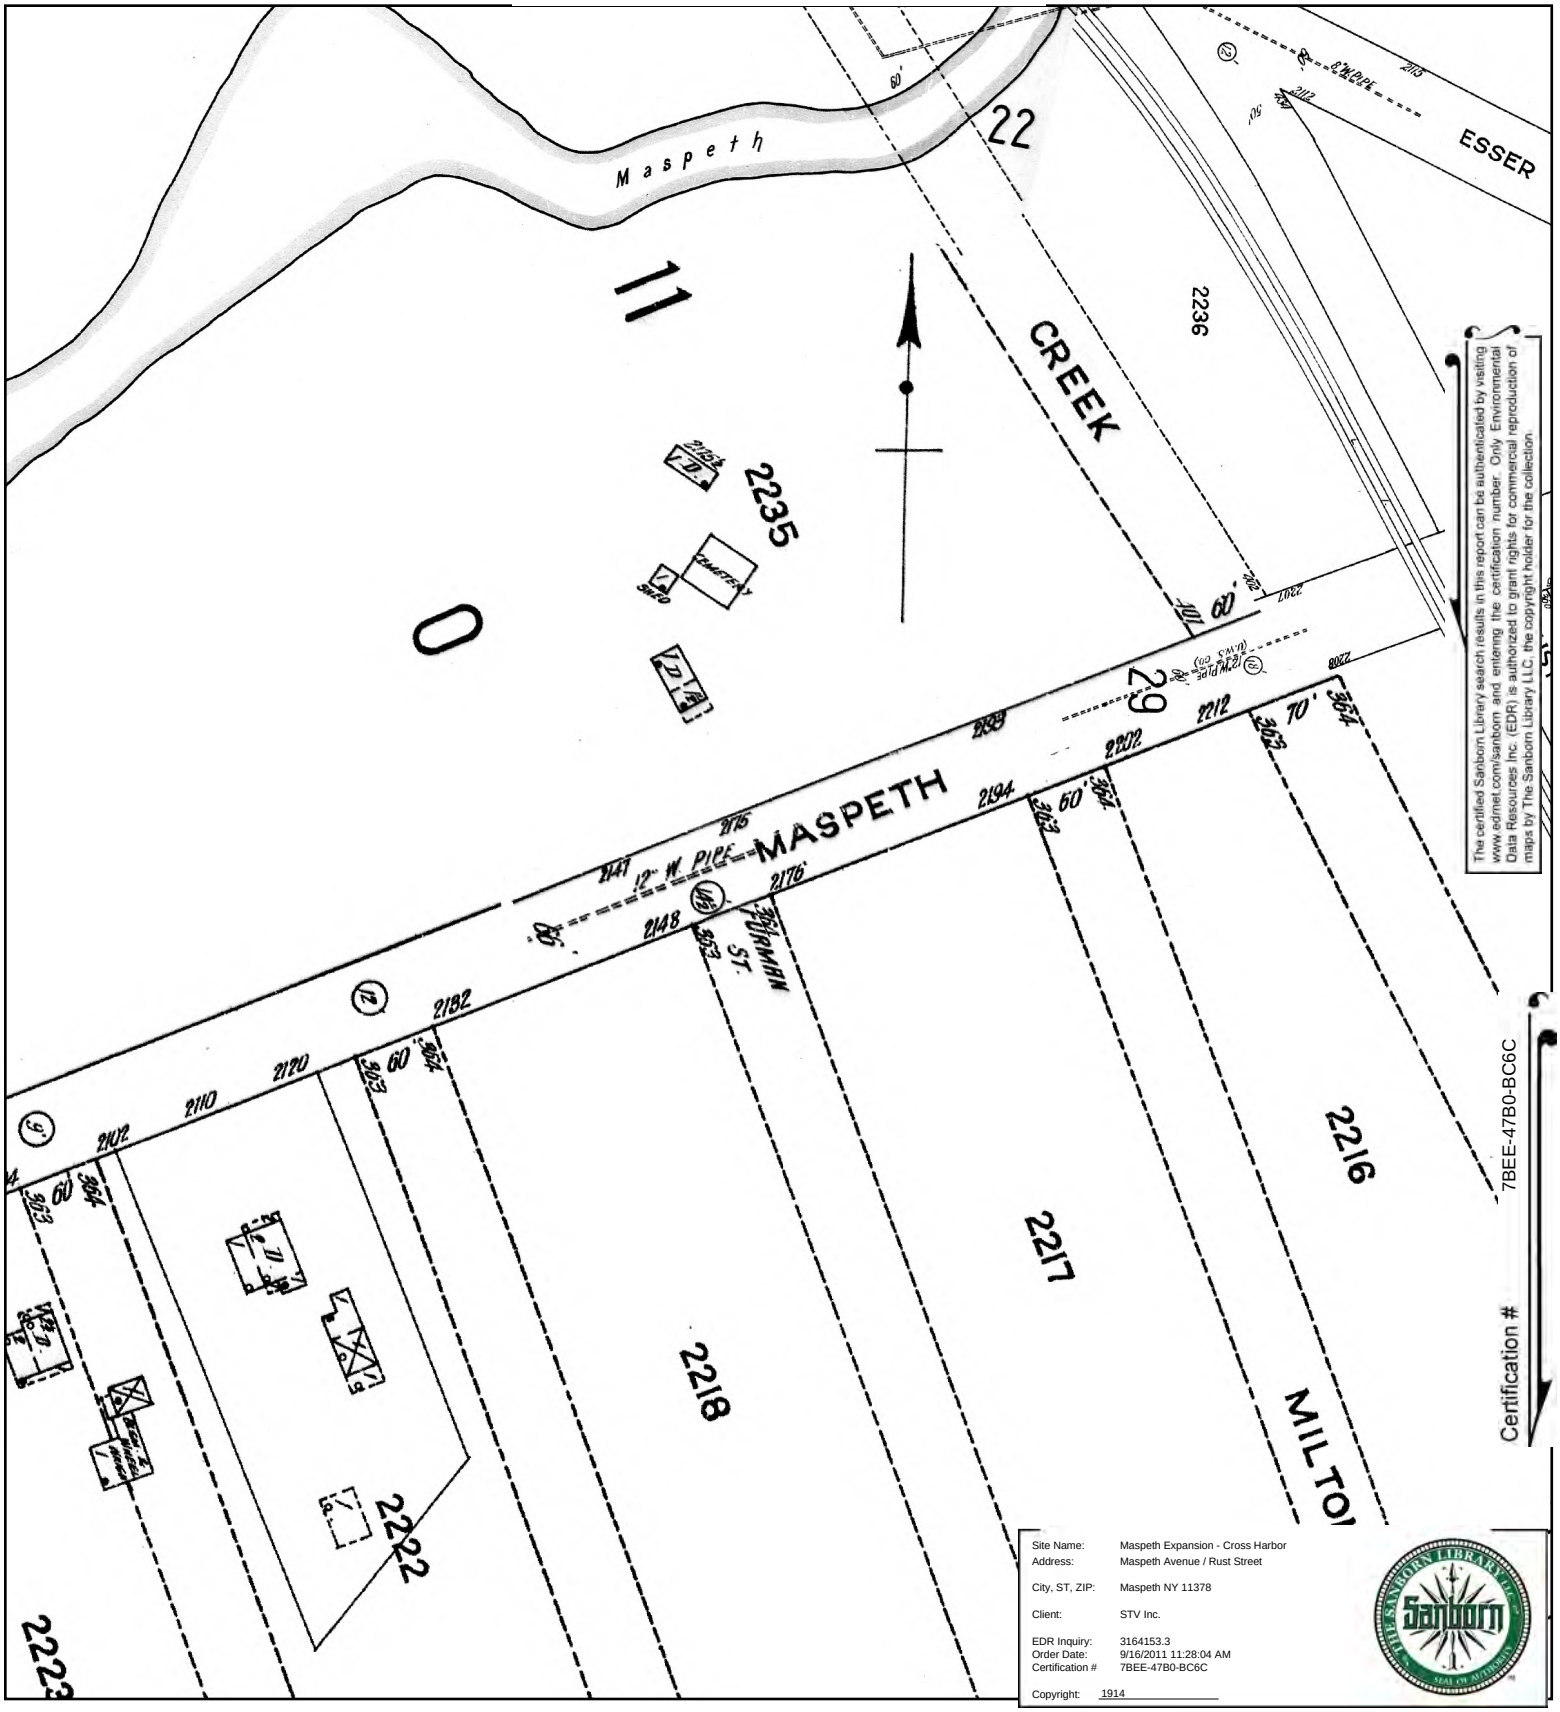

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

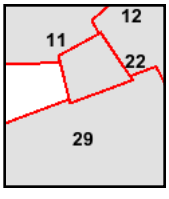

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1902 Certified Sanborn Map

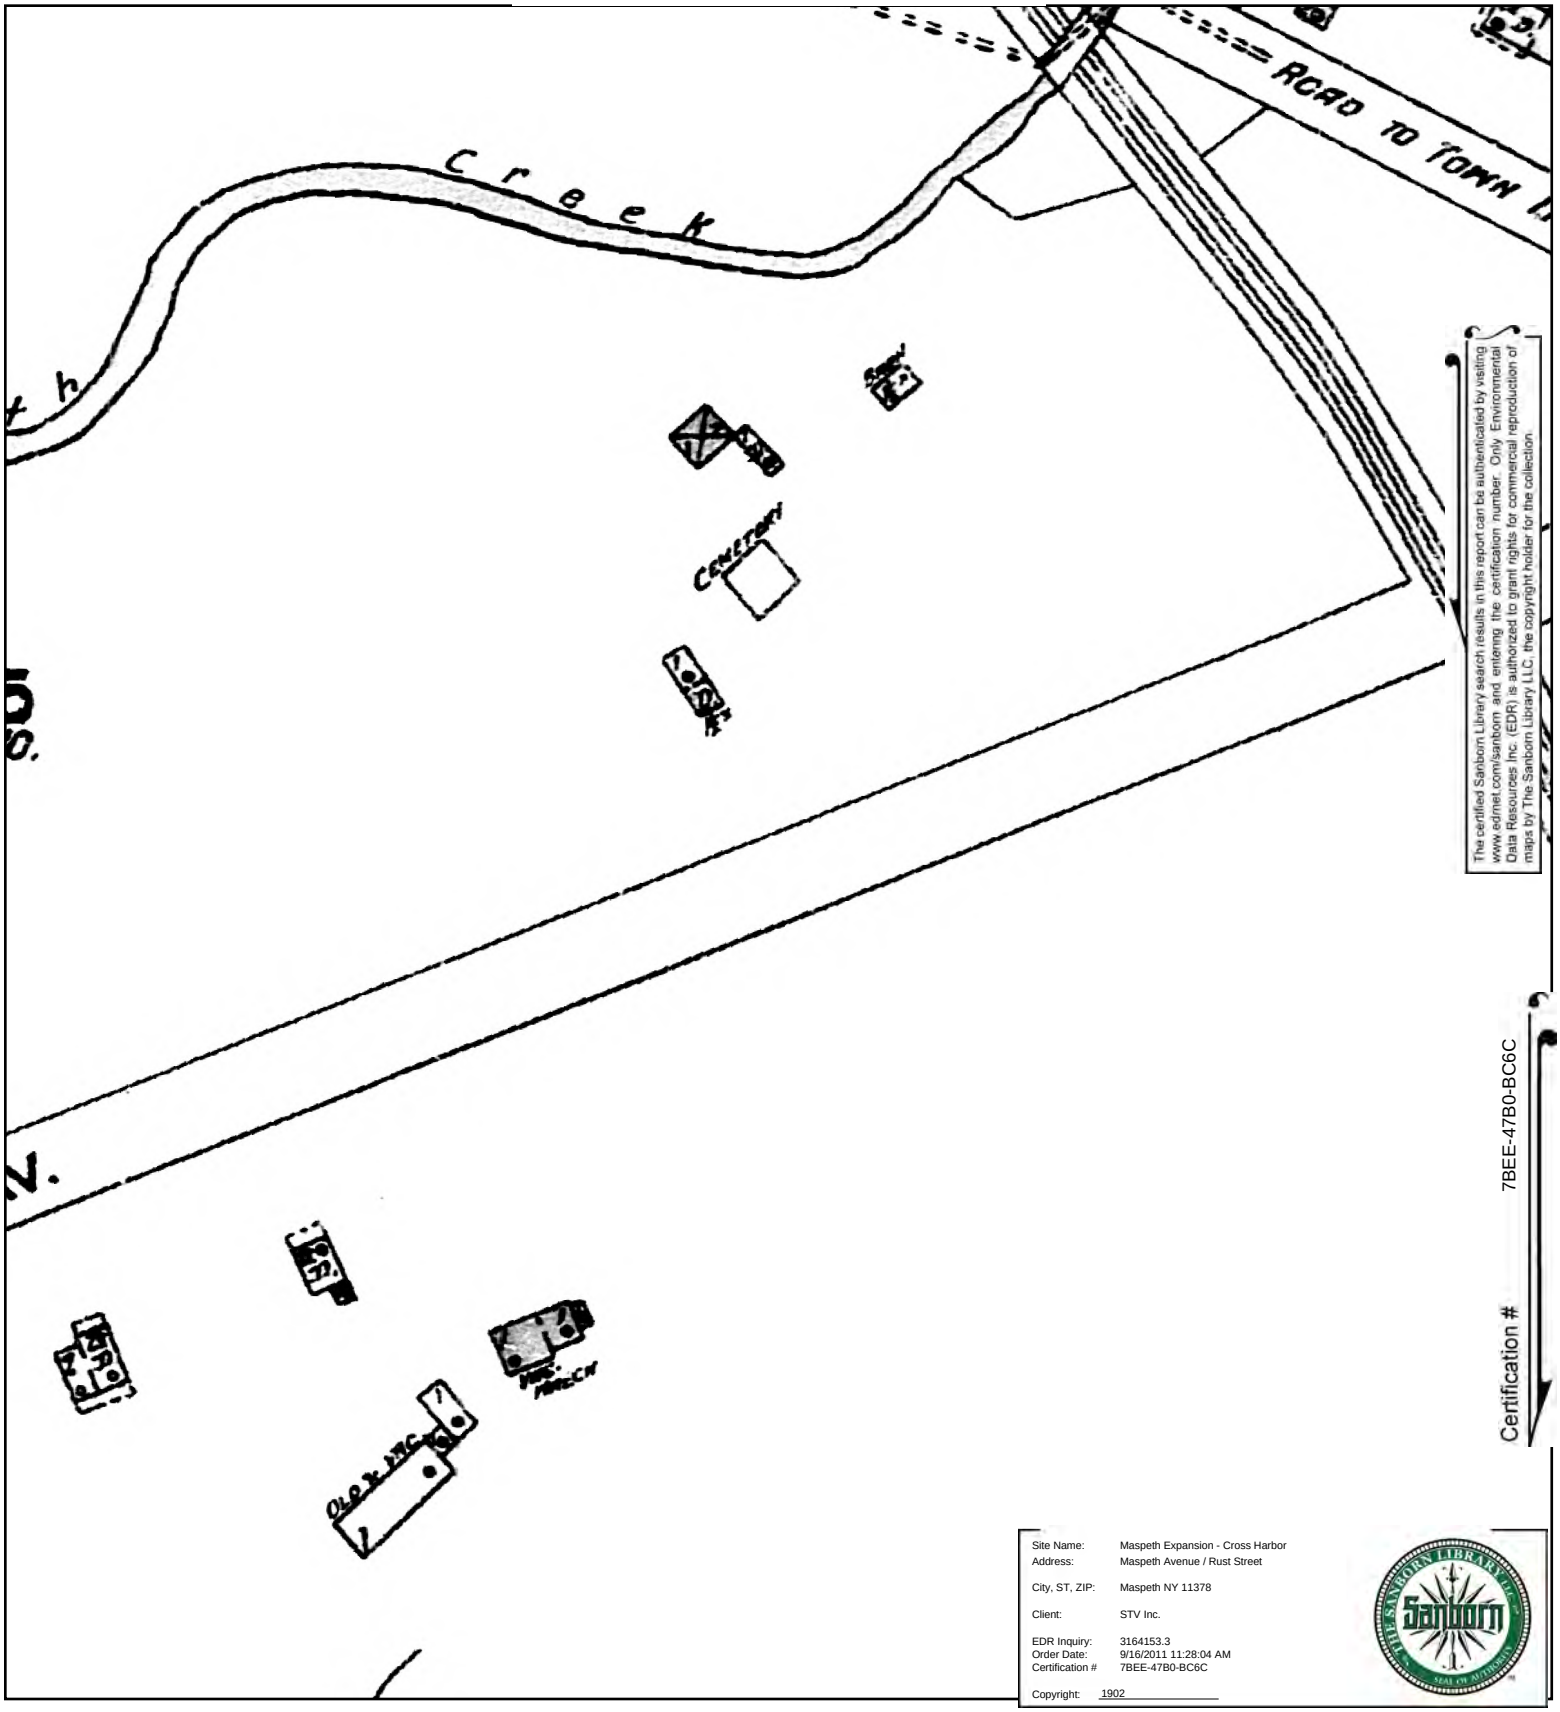

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1902

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

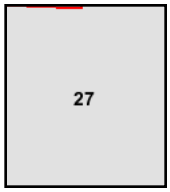

Volume 3, Sheet 27

N

1971 Certified Sanborn Map

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1971

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

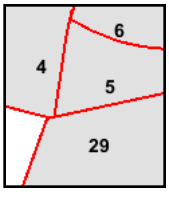

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1950 Certified Sanborn Map

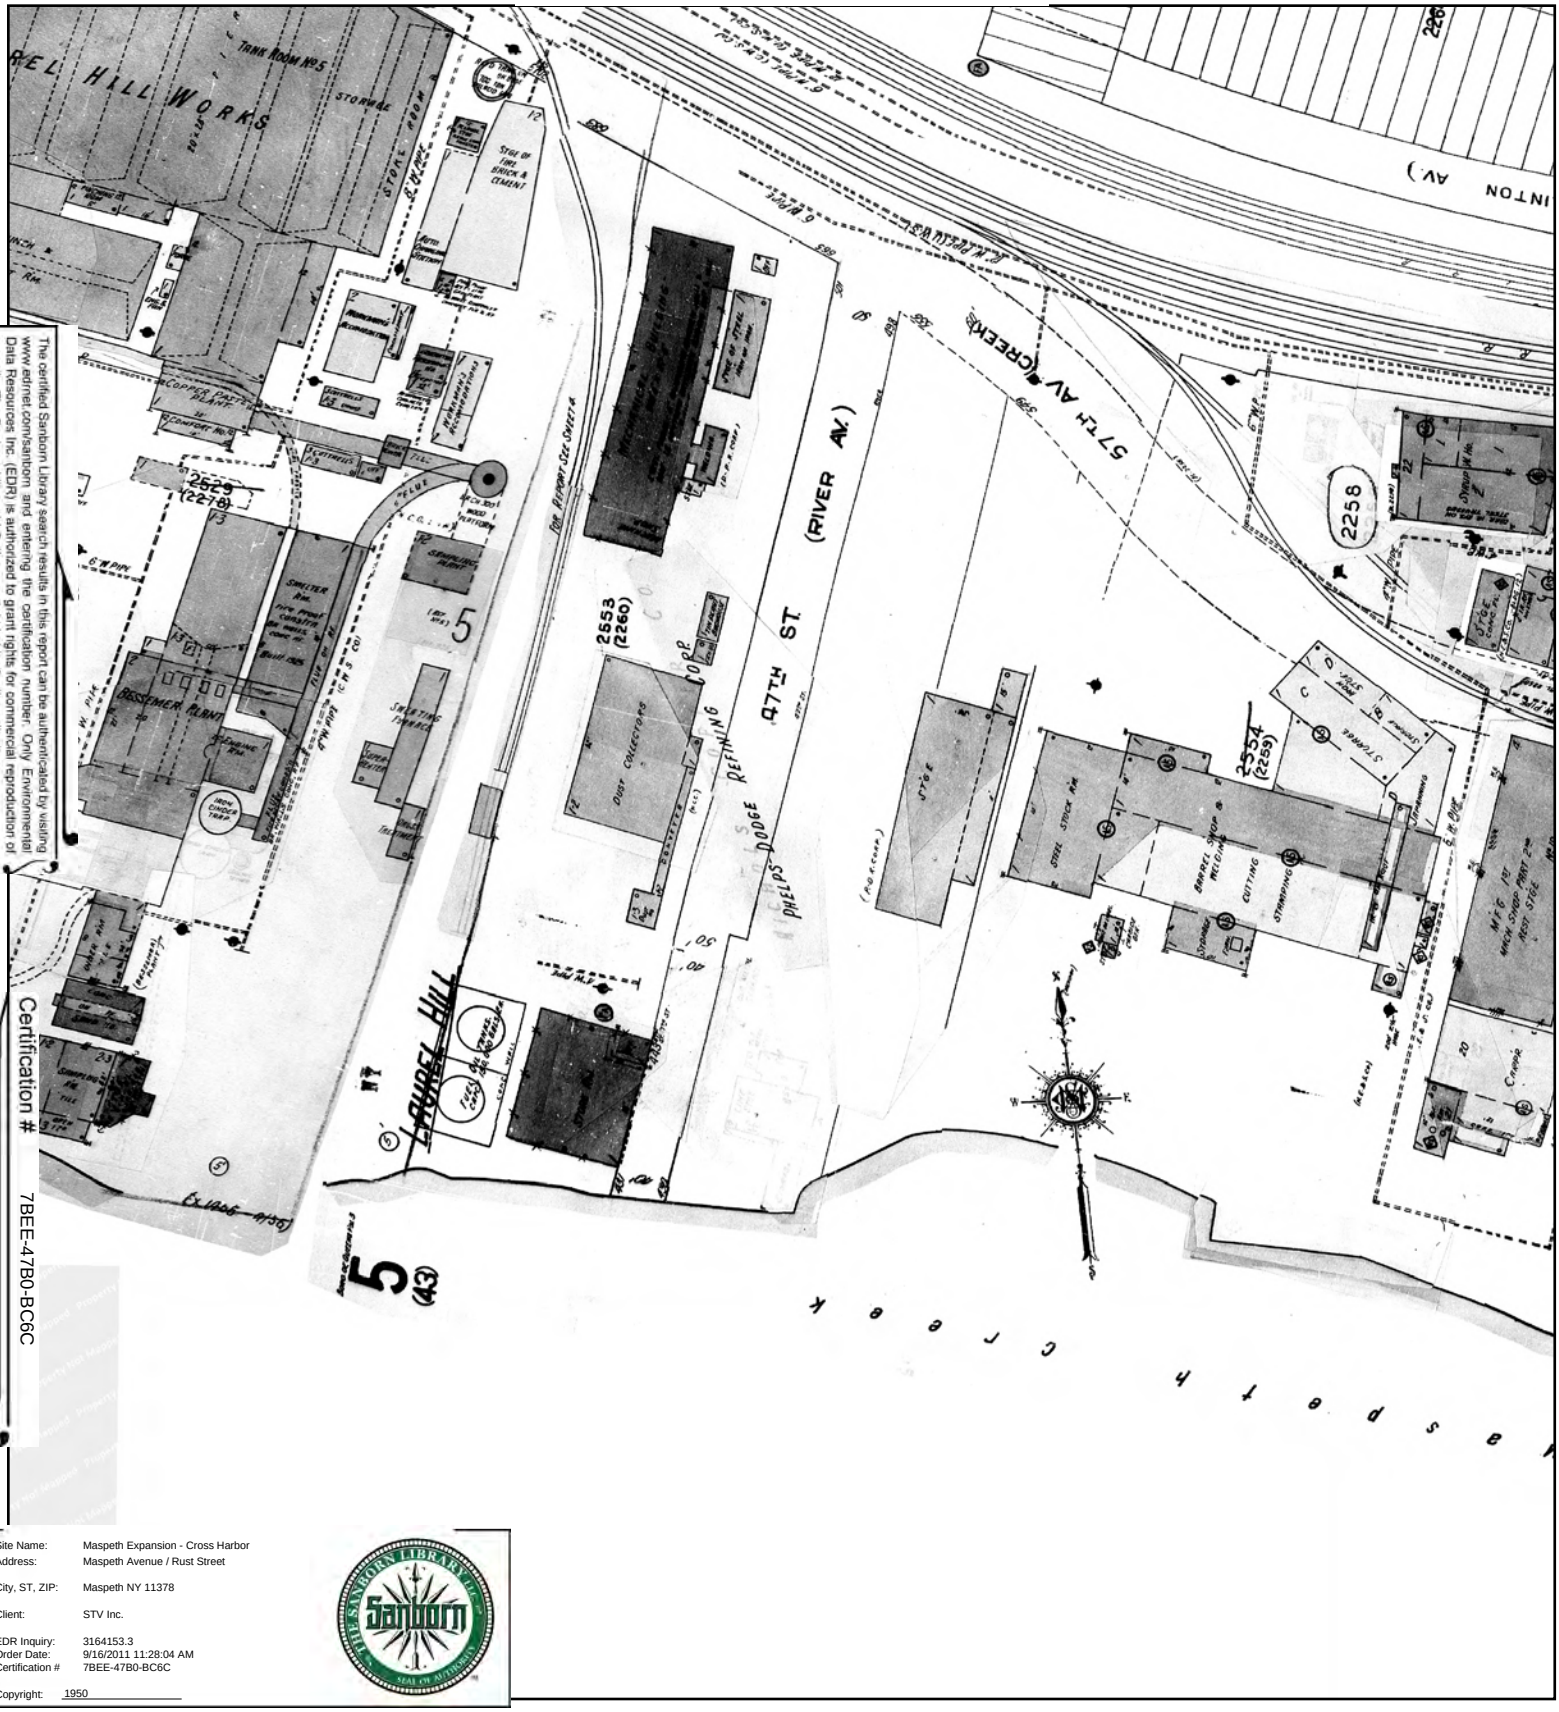

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1950

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

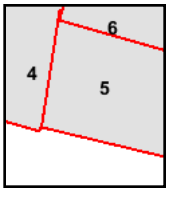

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6

0 Feet 165 330 660

N

1936 Certified Sanborn Map

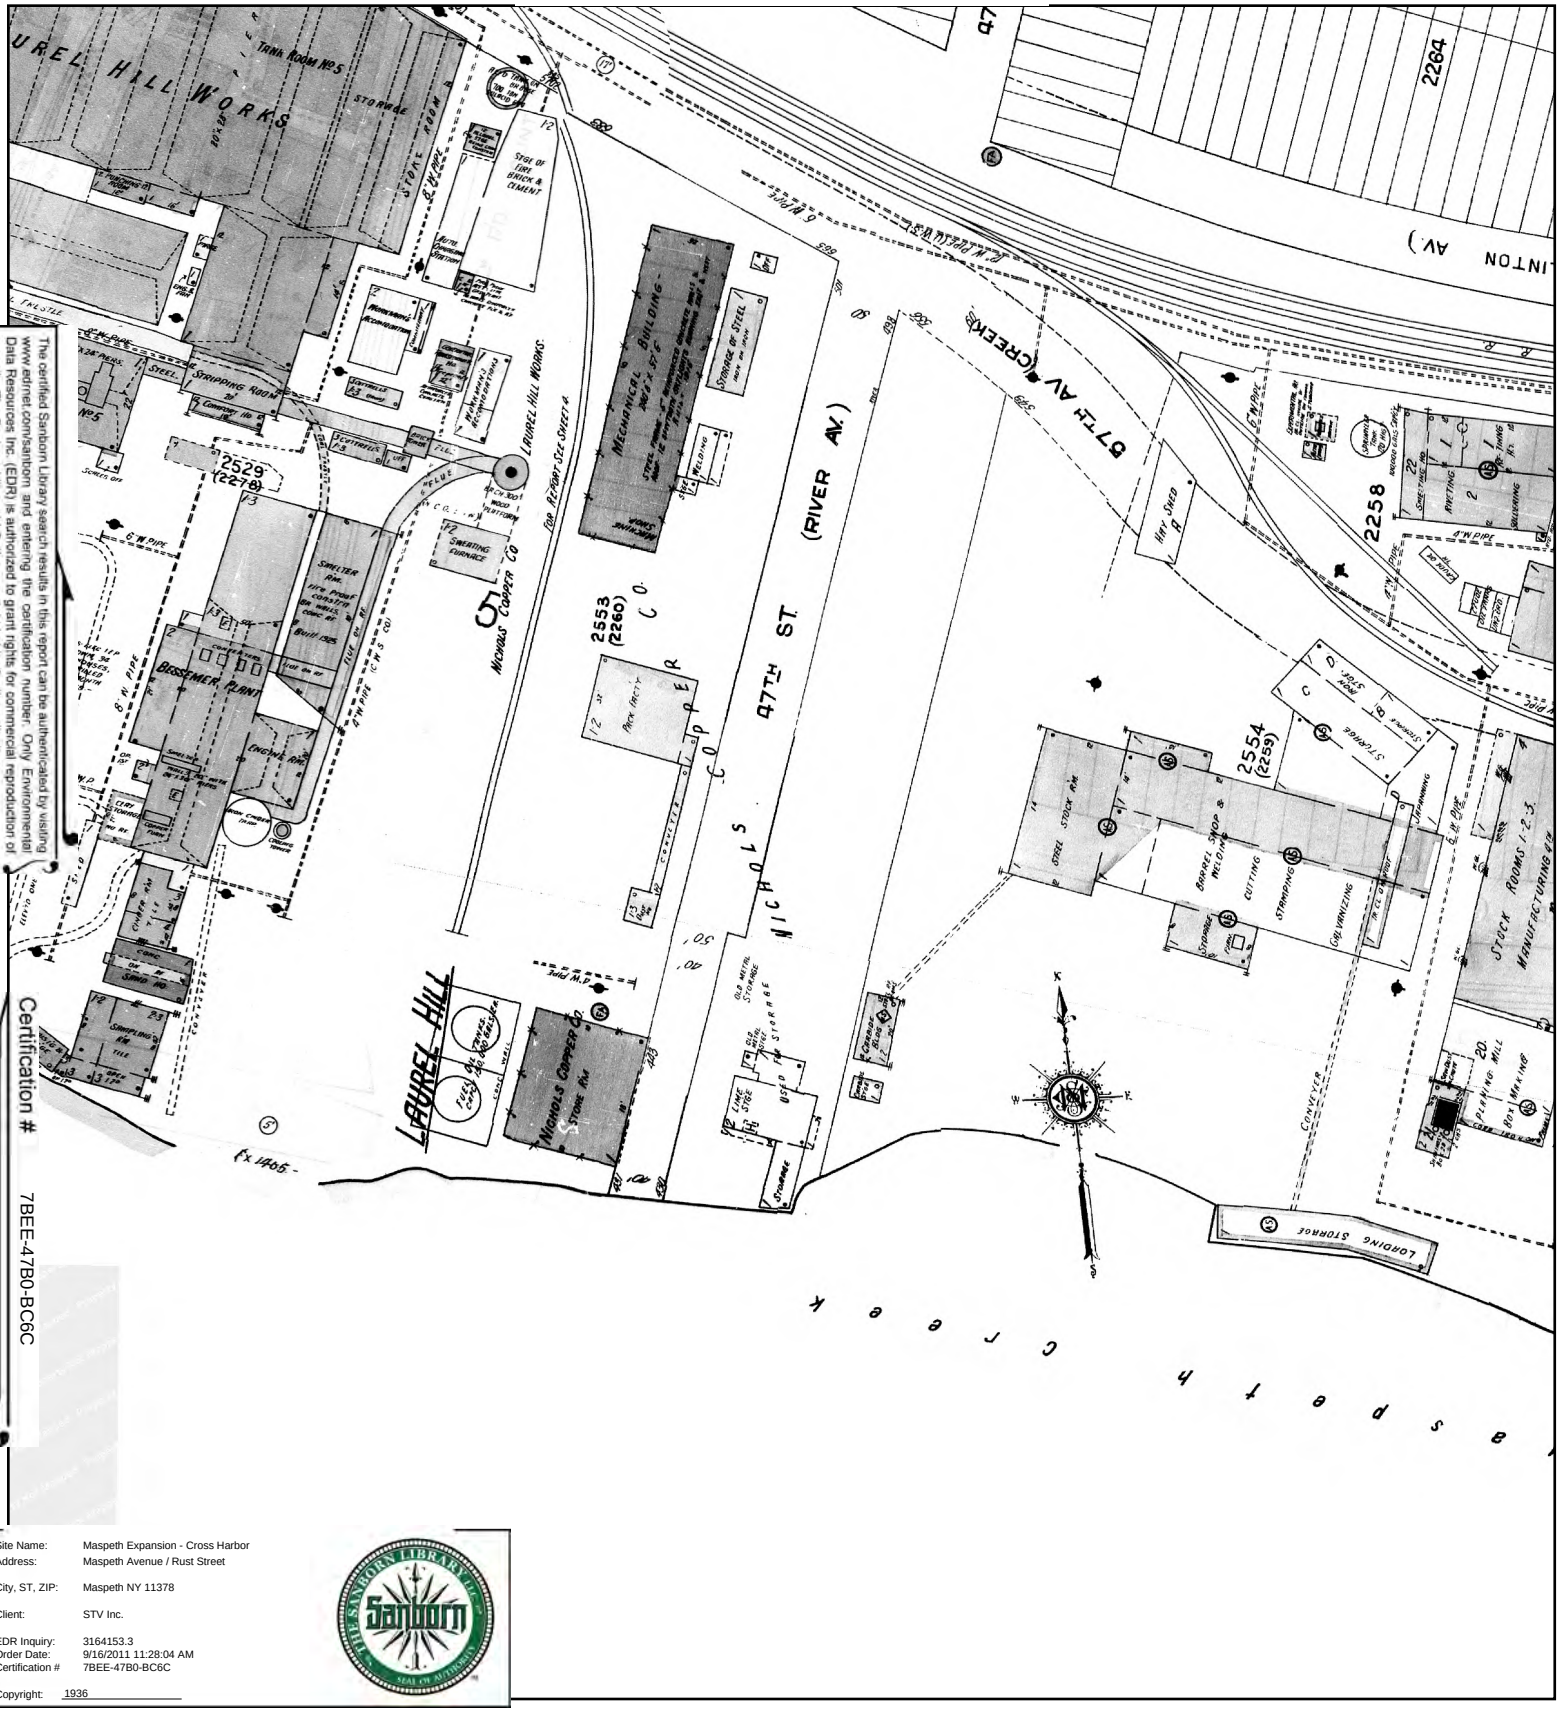

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1936

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

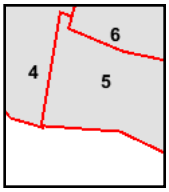

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6

0 Feet 165 330 660

N

1914 Certified Sanborn Map

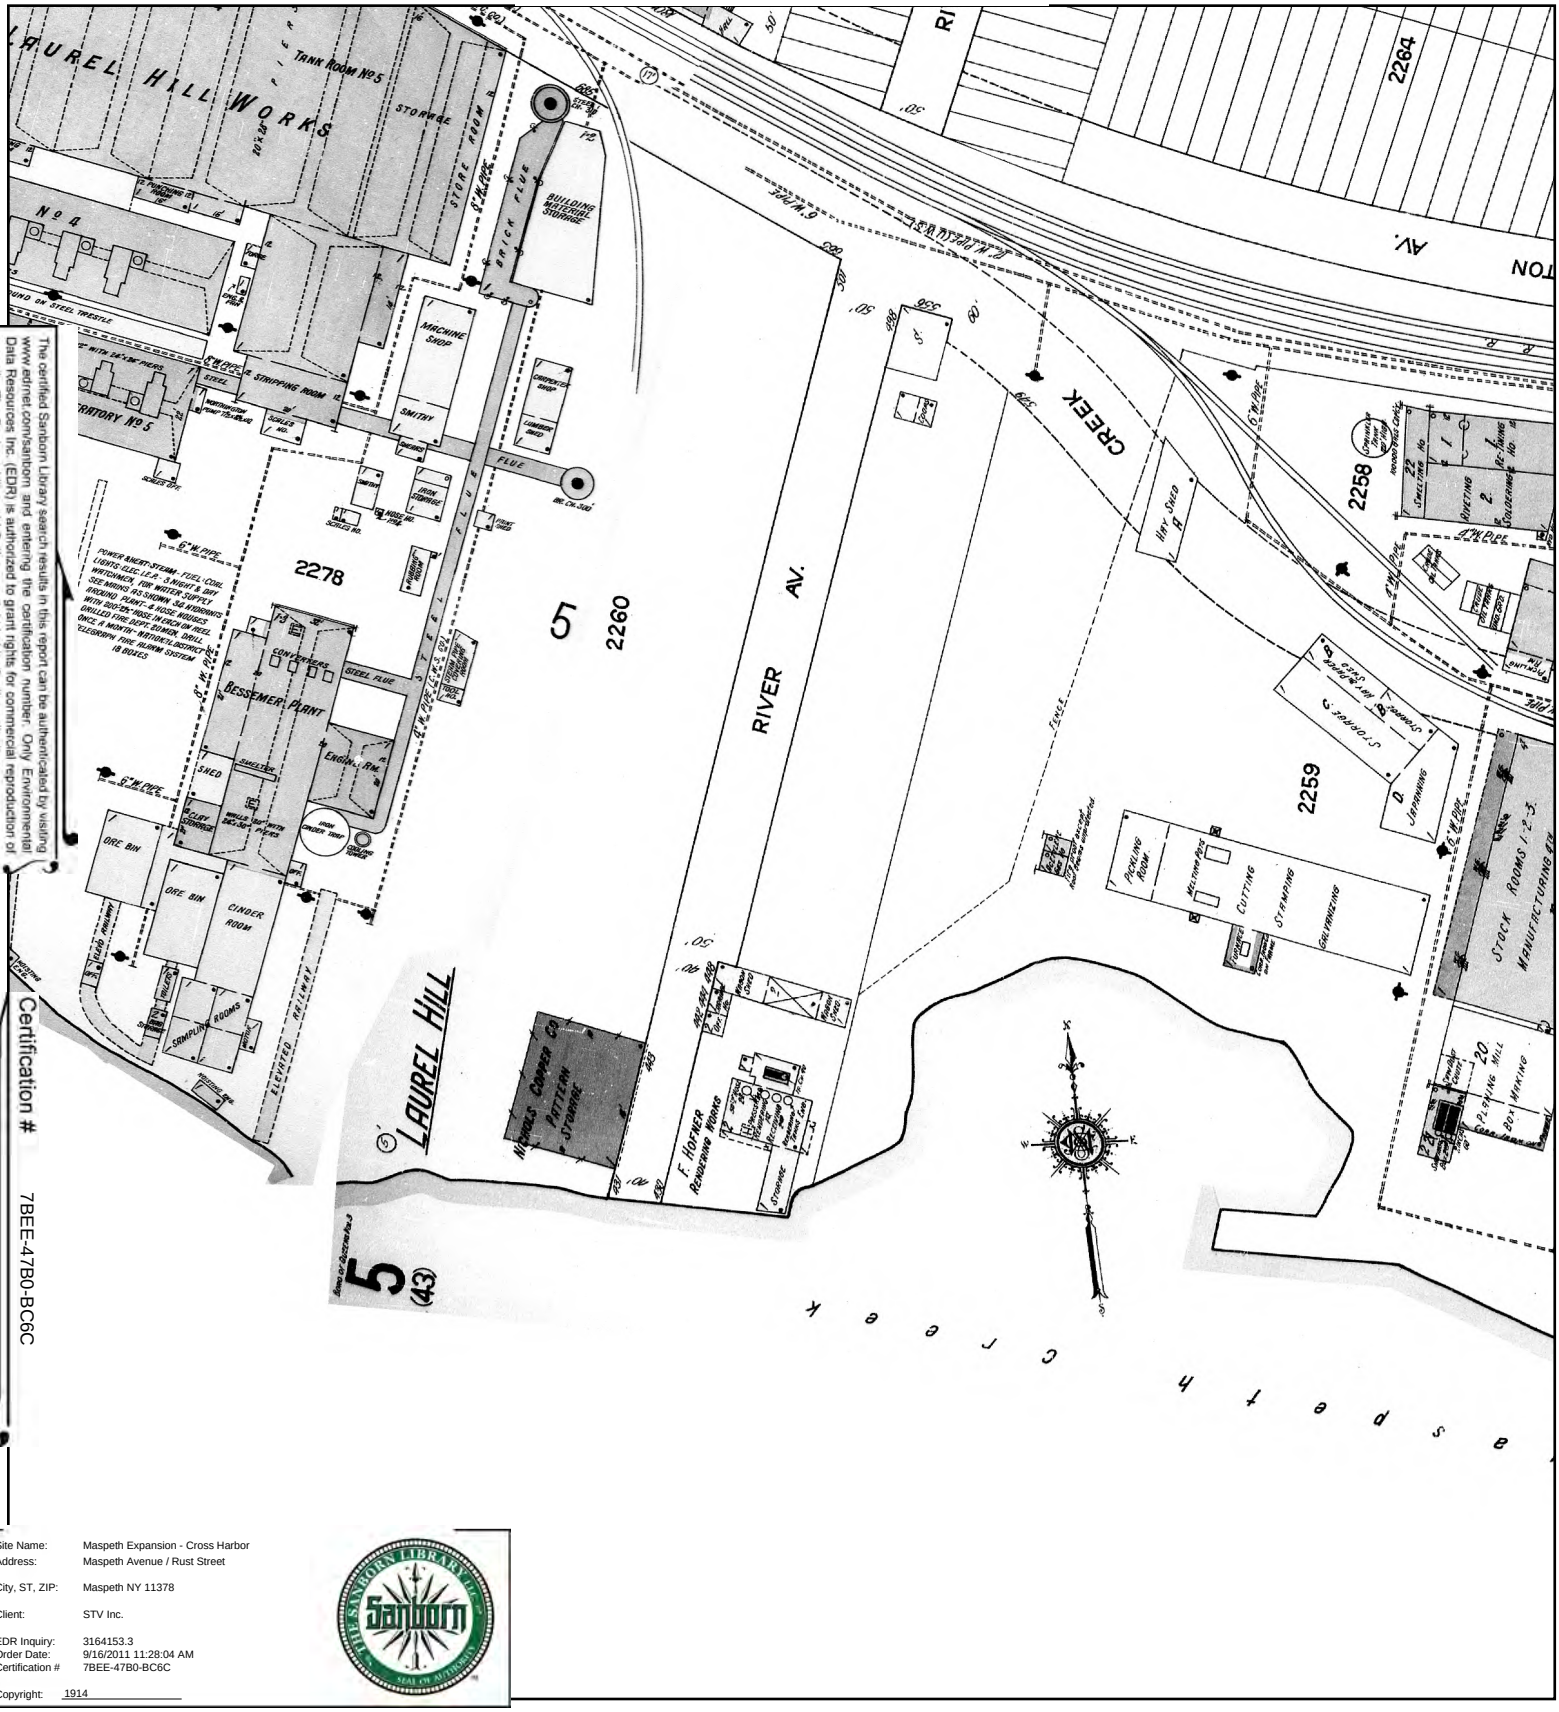

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1914

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

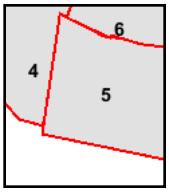

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6

0 Feet 165 330 660

N

1985 Certified Sanborn Map

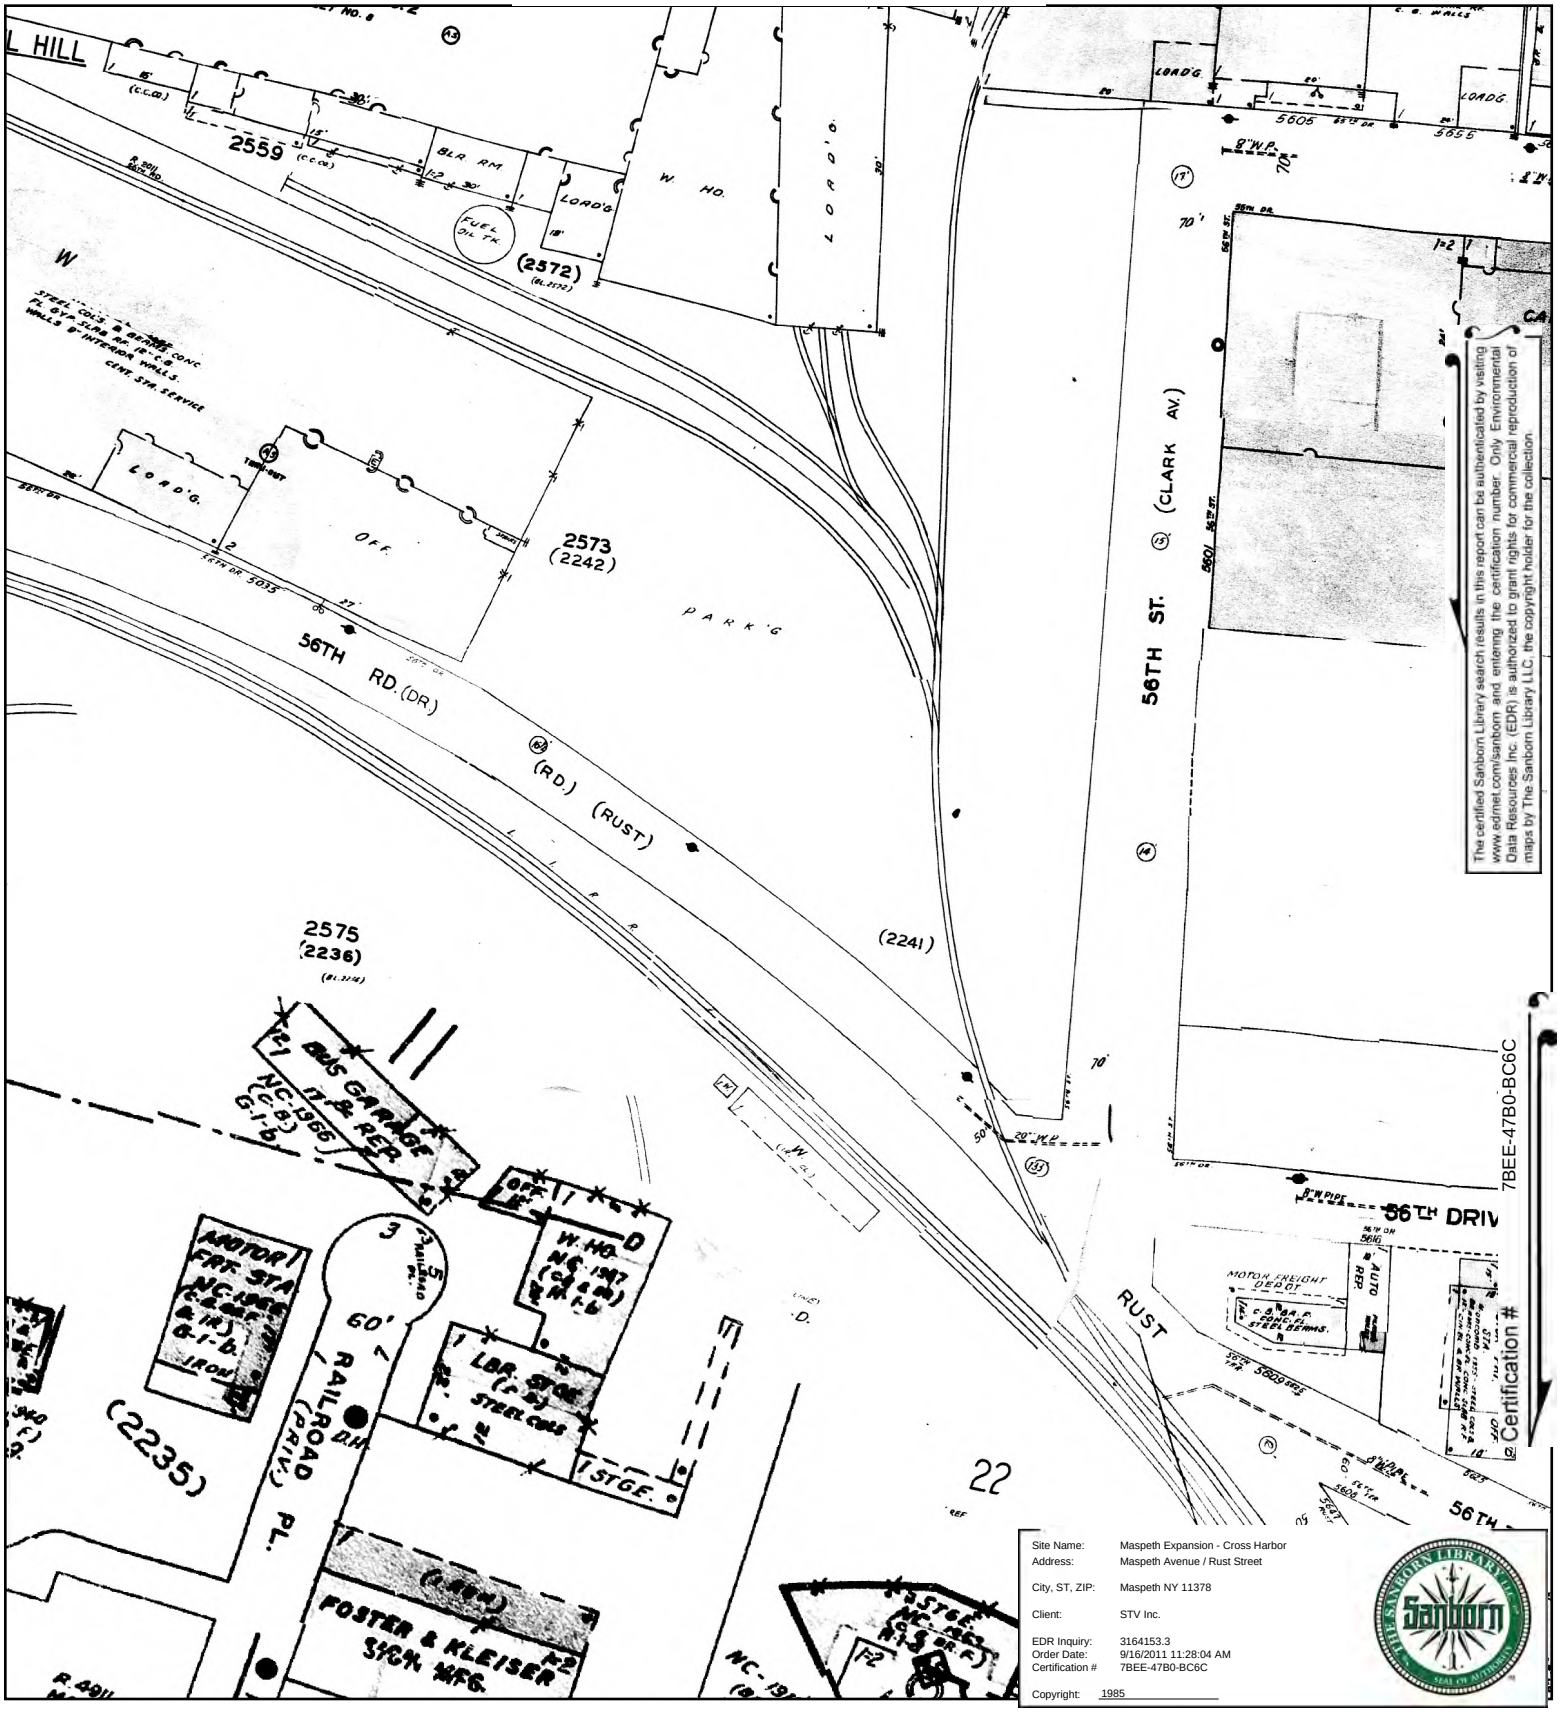

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1985

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

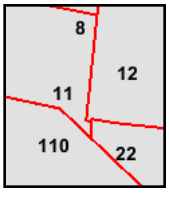

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1982 Certified Sanborn Map

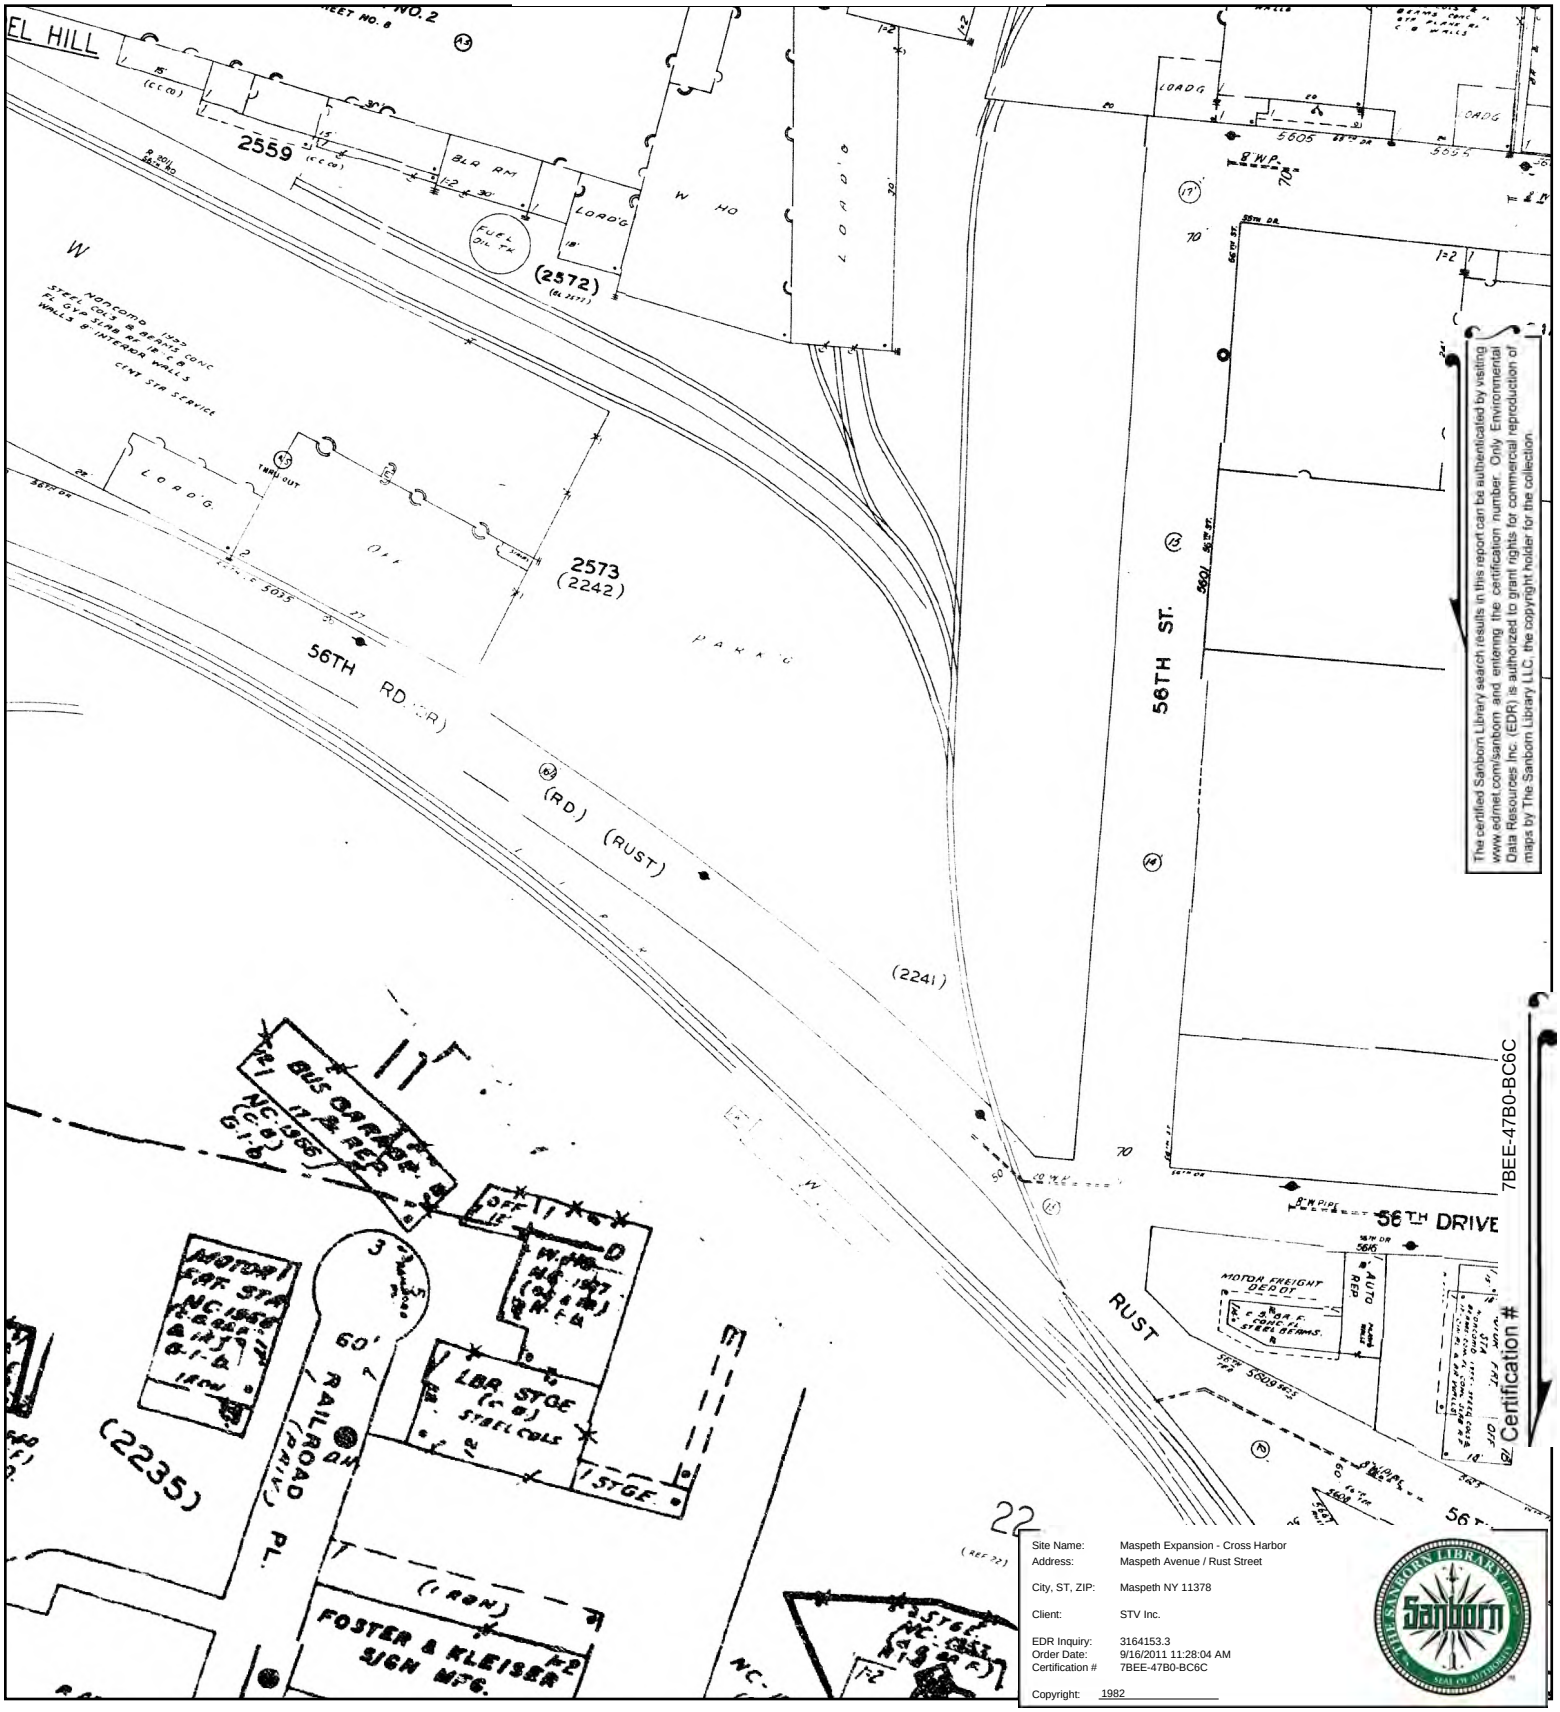

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

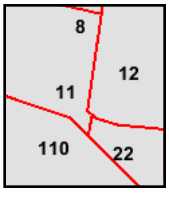

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1980 Certified Sanborn Map

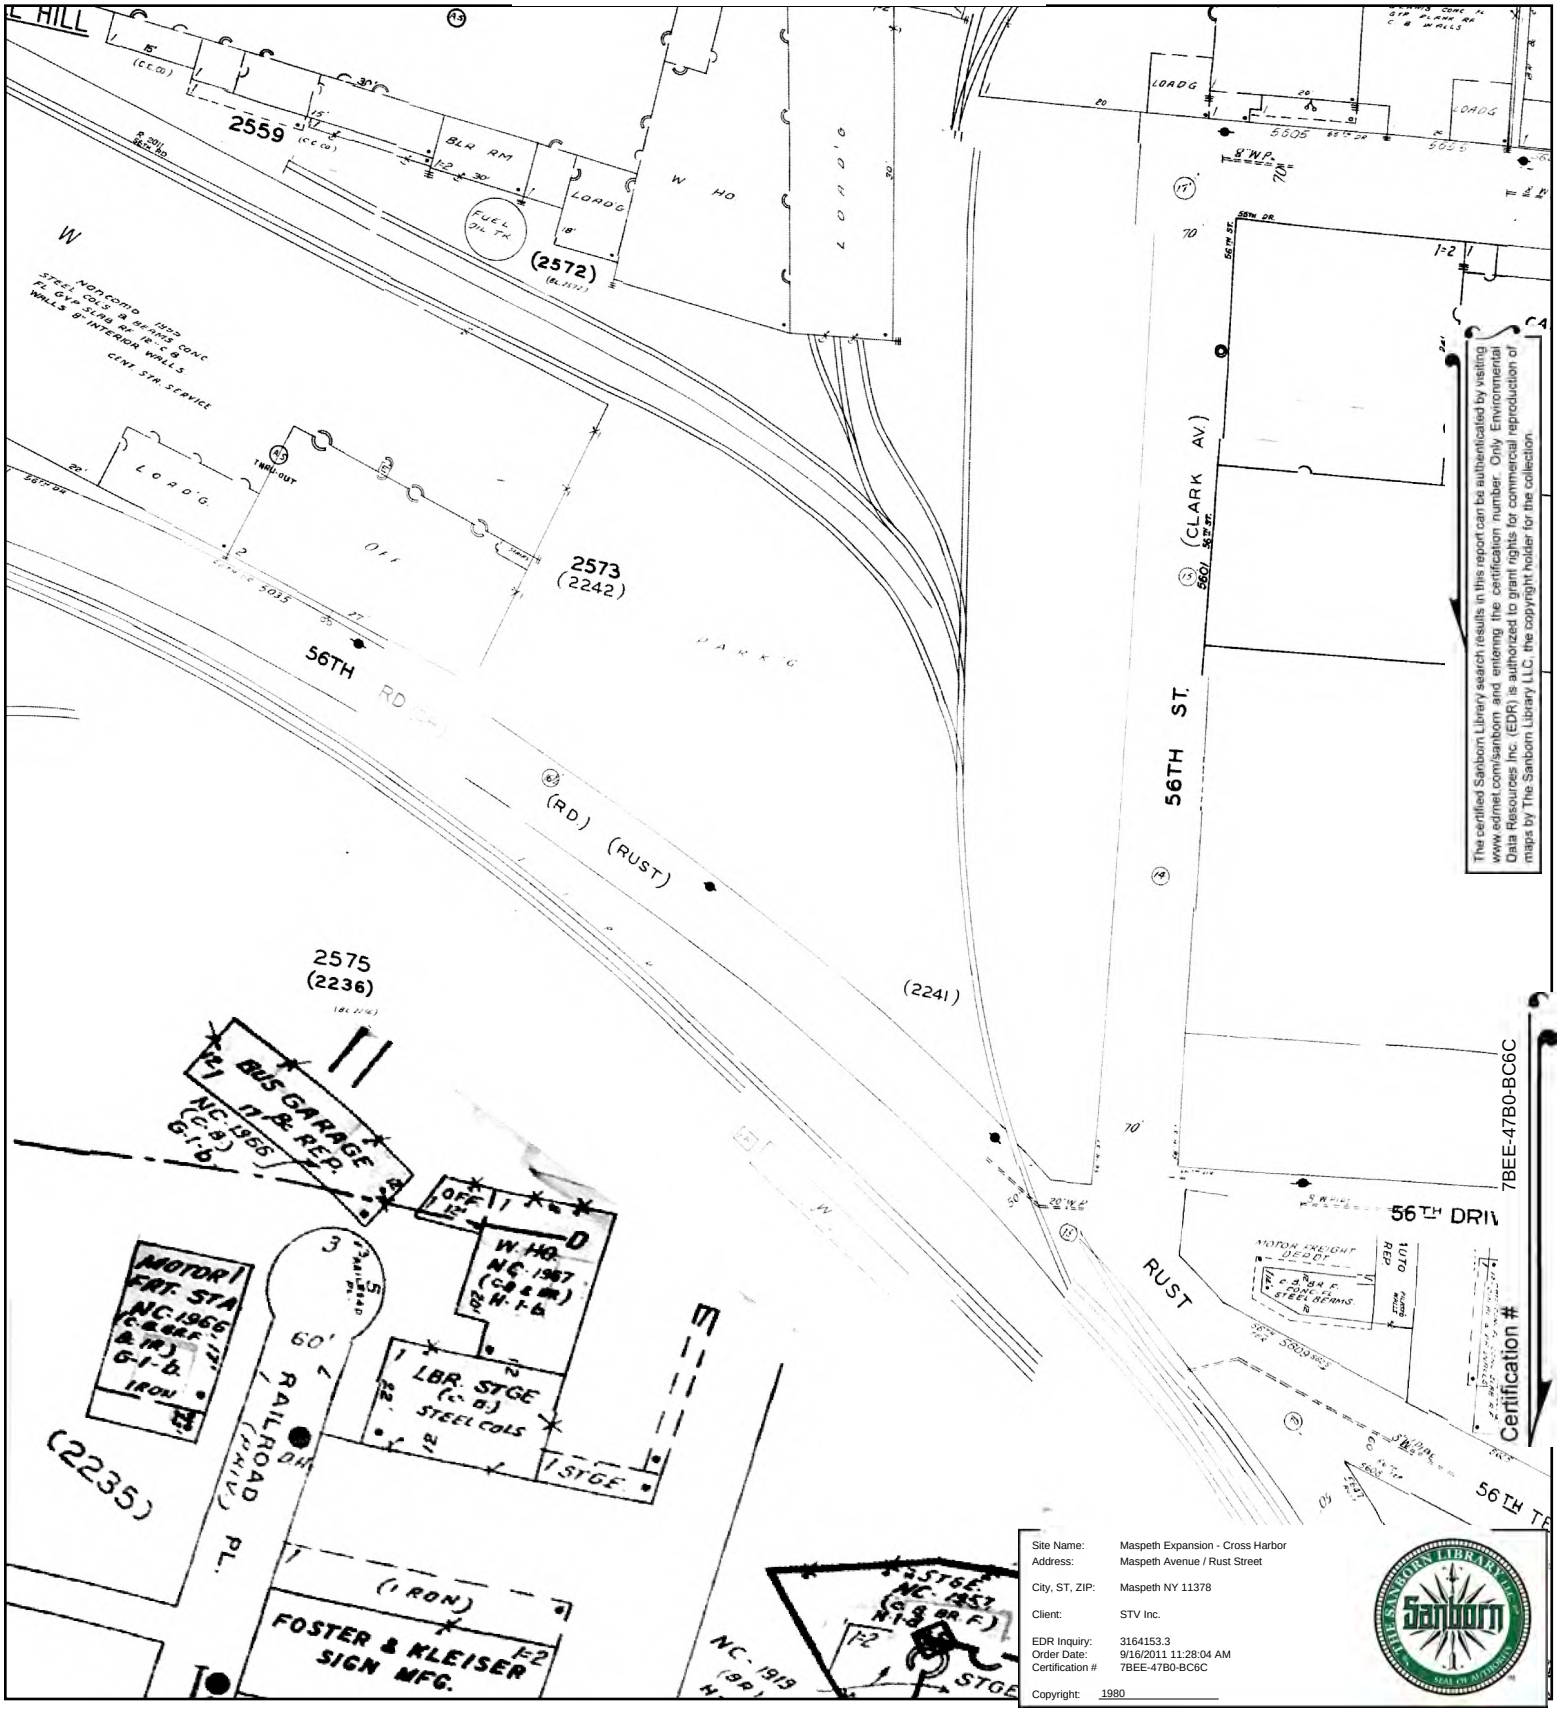

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1980

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

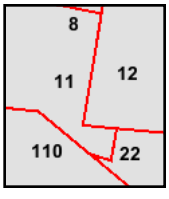

Volume 3, Sheet 110
Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22

0 Feet 165 330 660

N

1971 Certified Sanborn Map

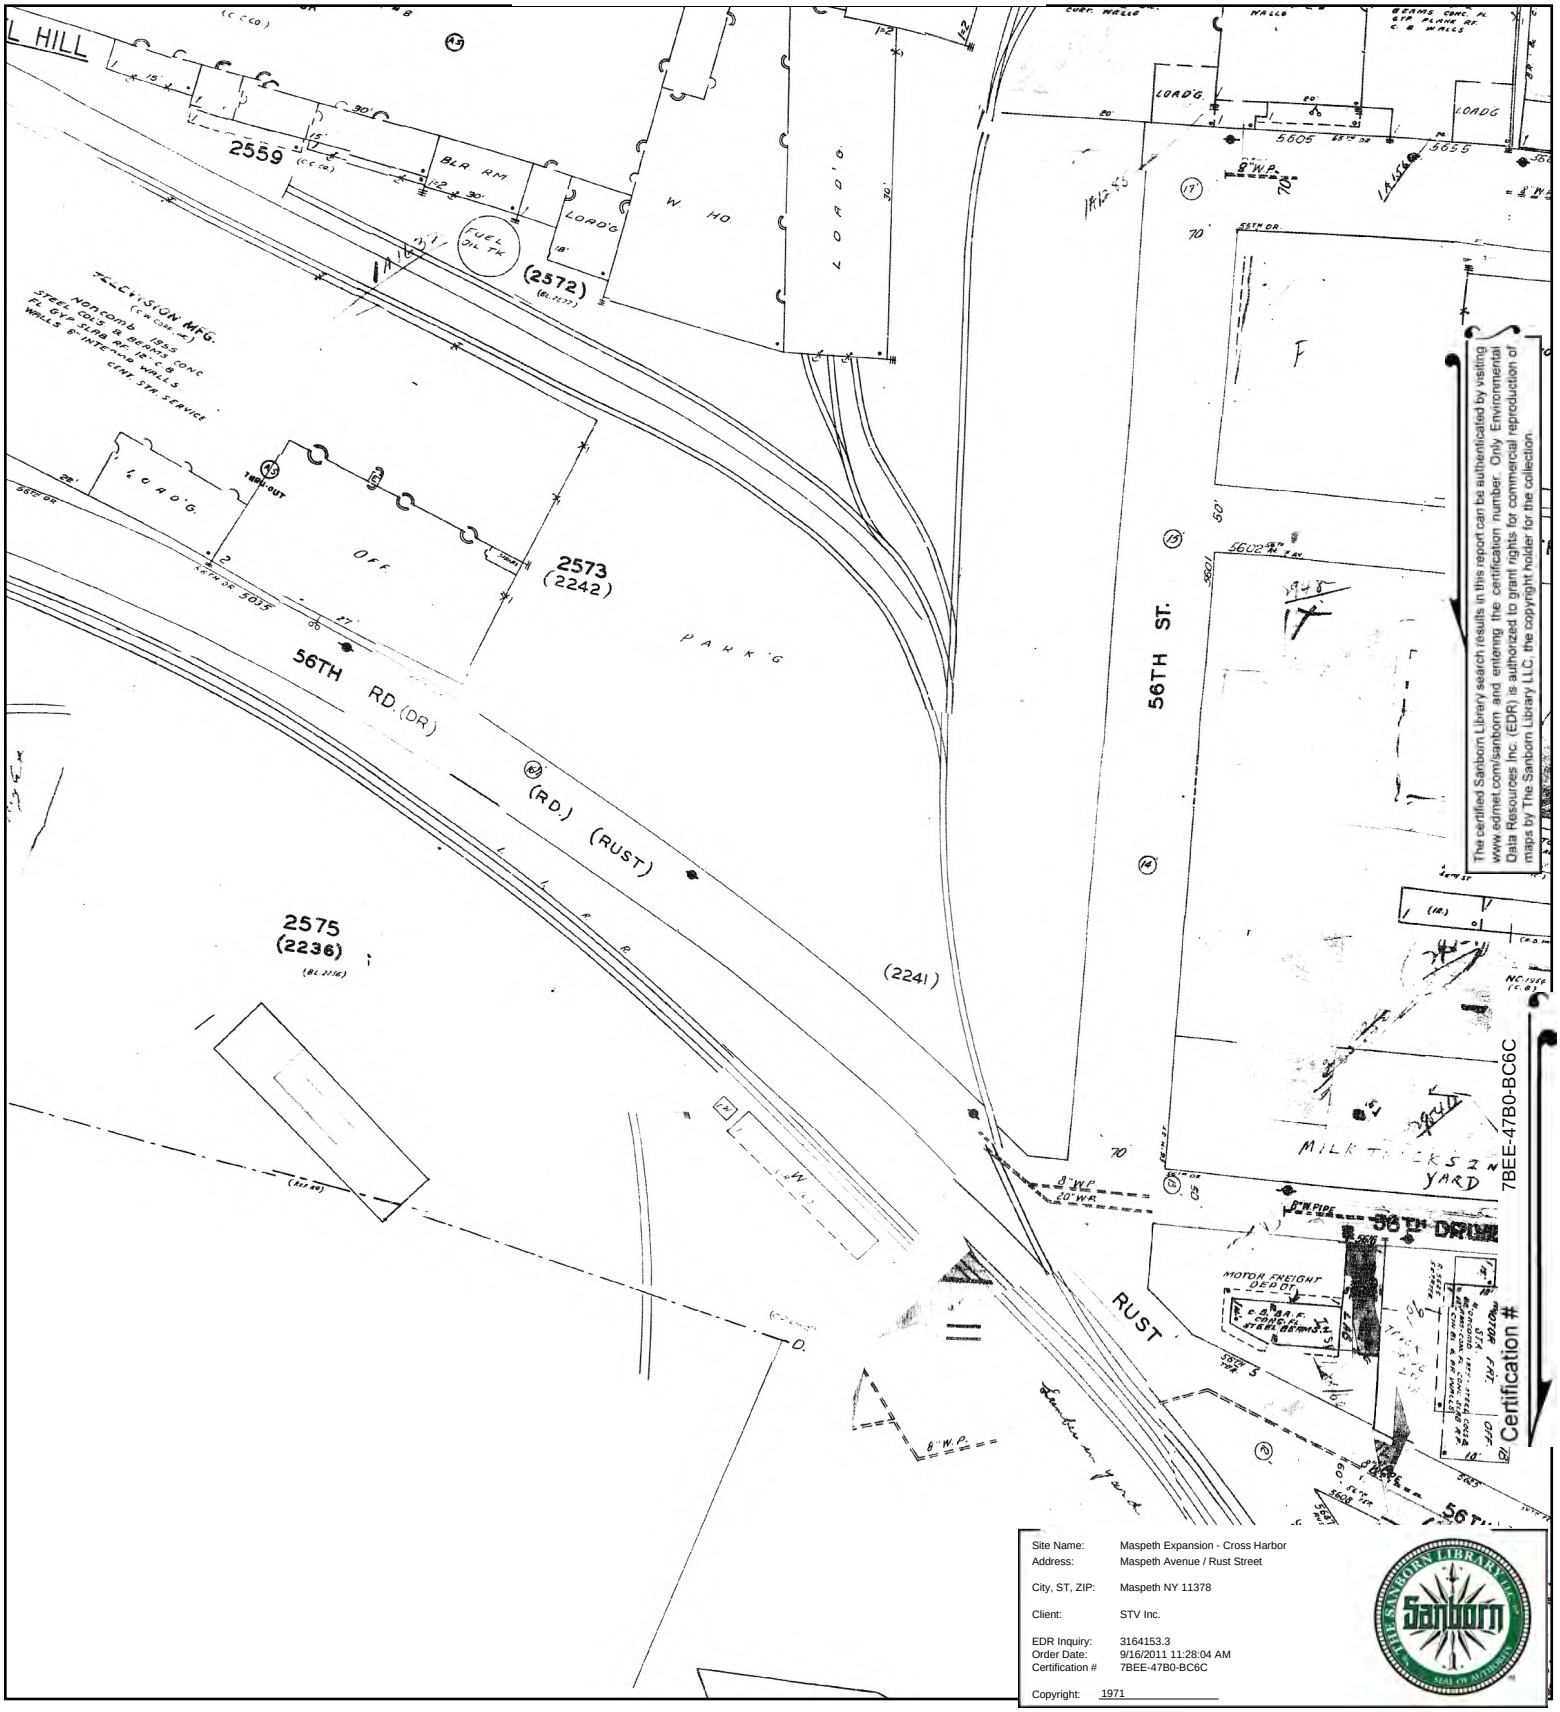

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1971

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

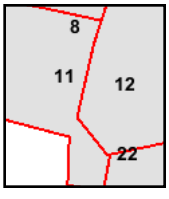

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22

N

1950 Certified Sanborn Map

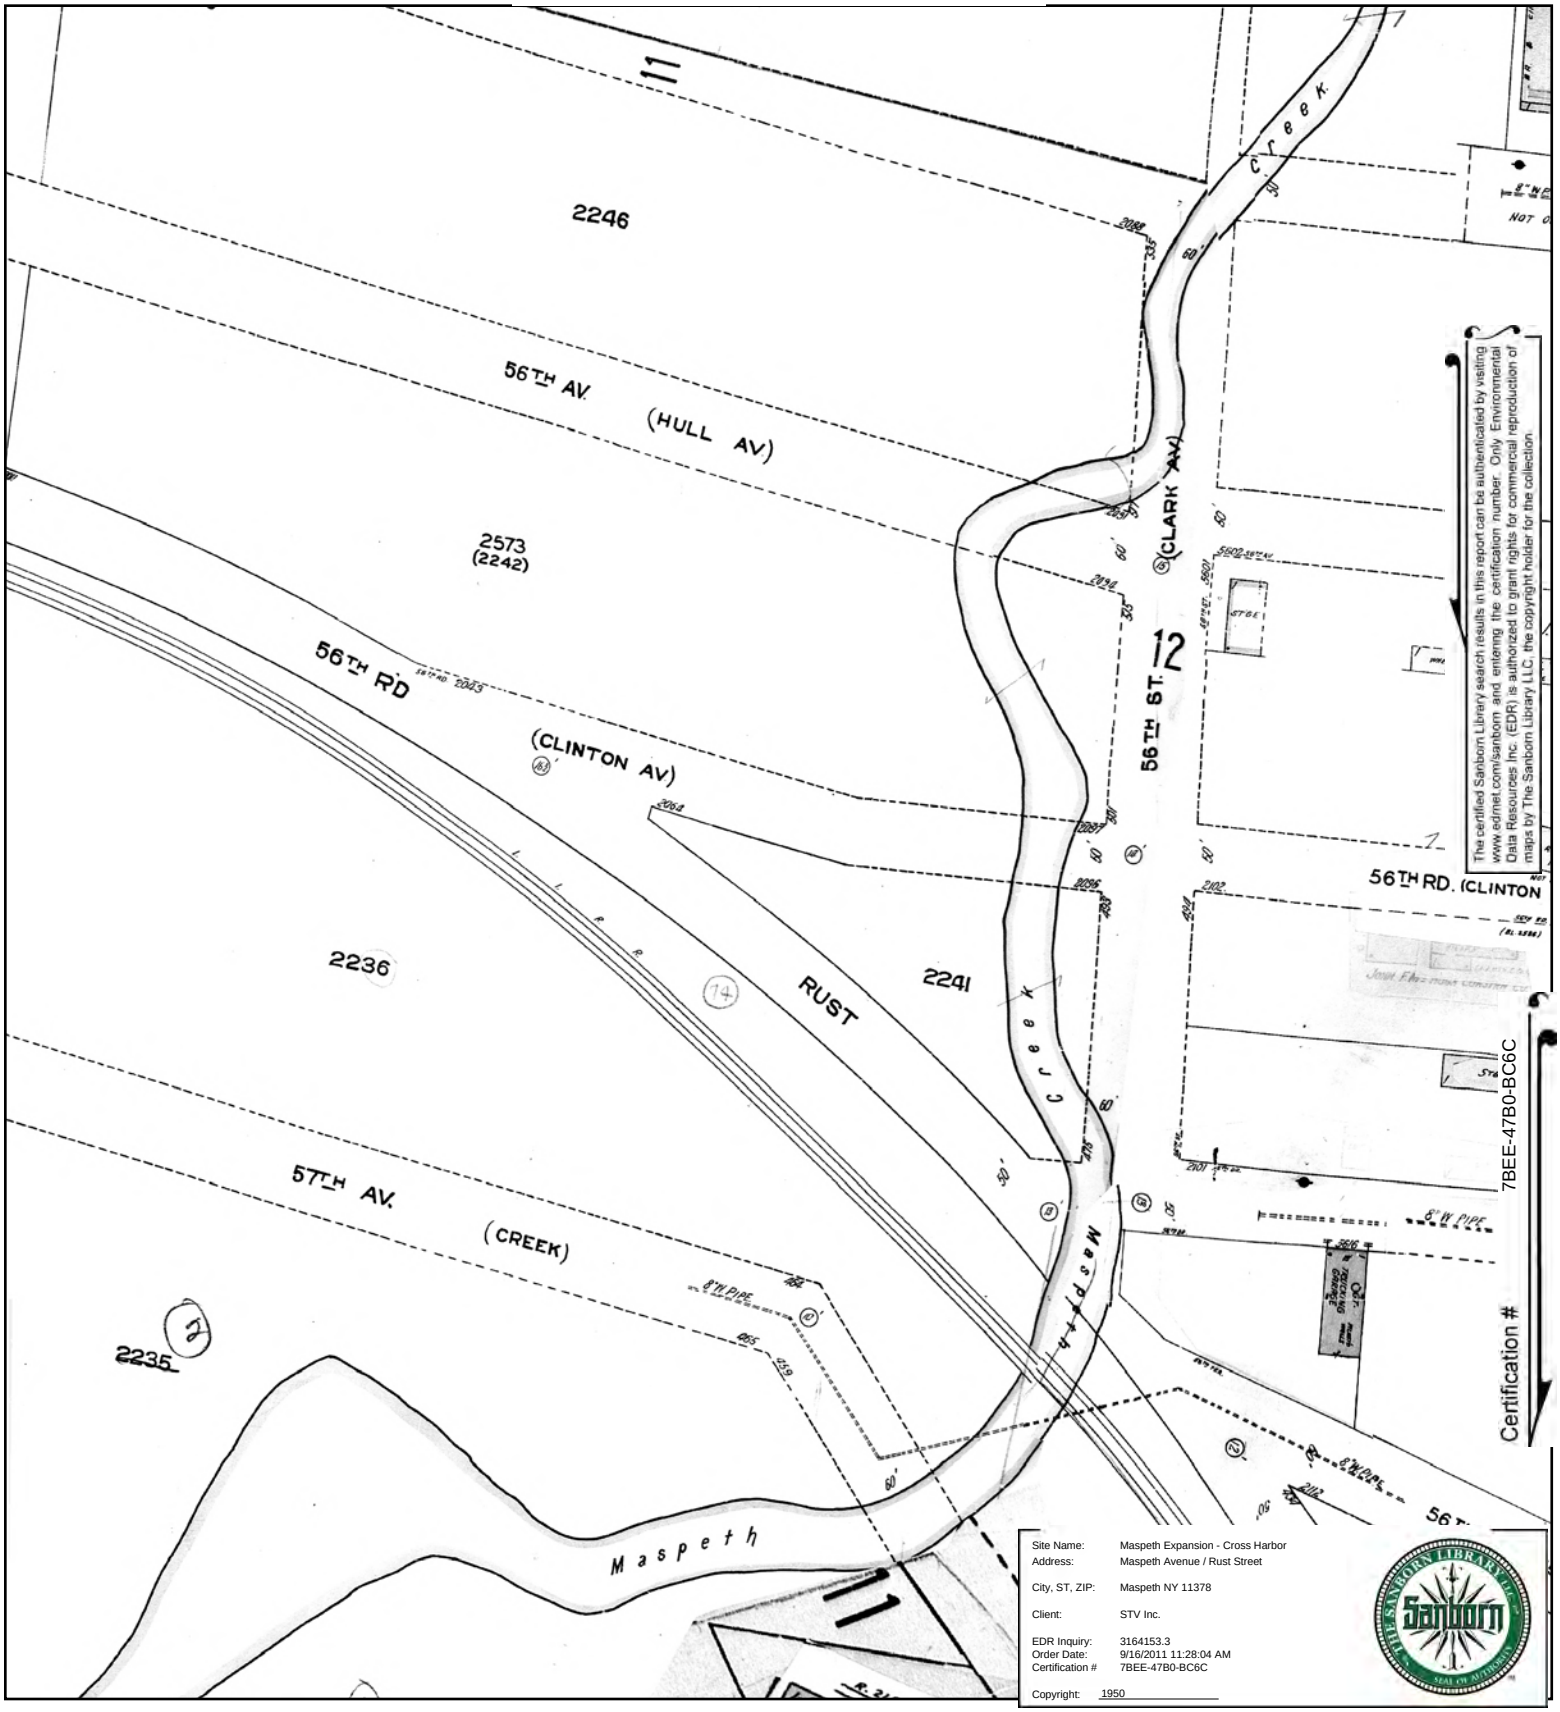

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

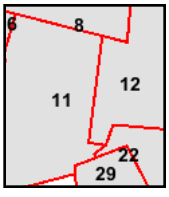

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1936 Certified Sanborn Map

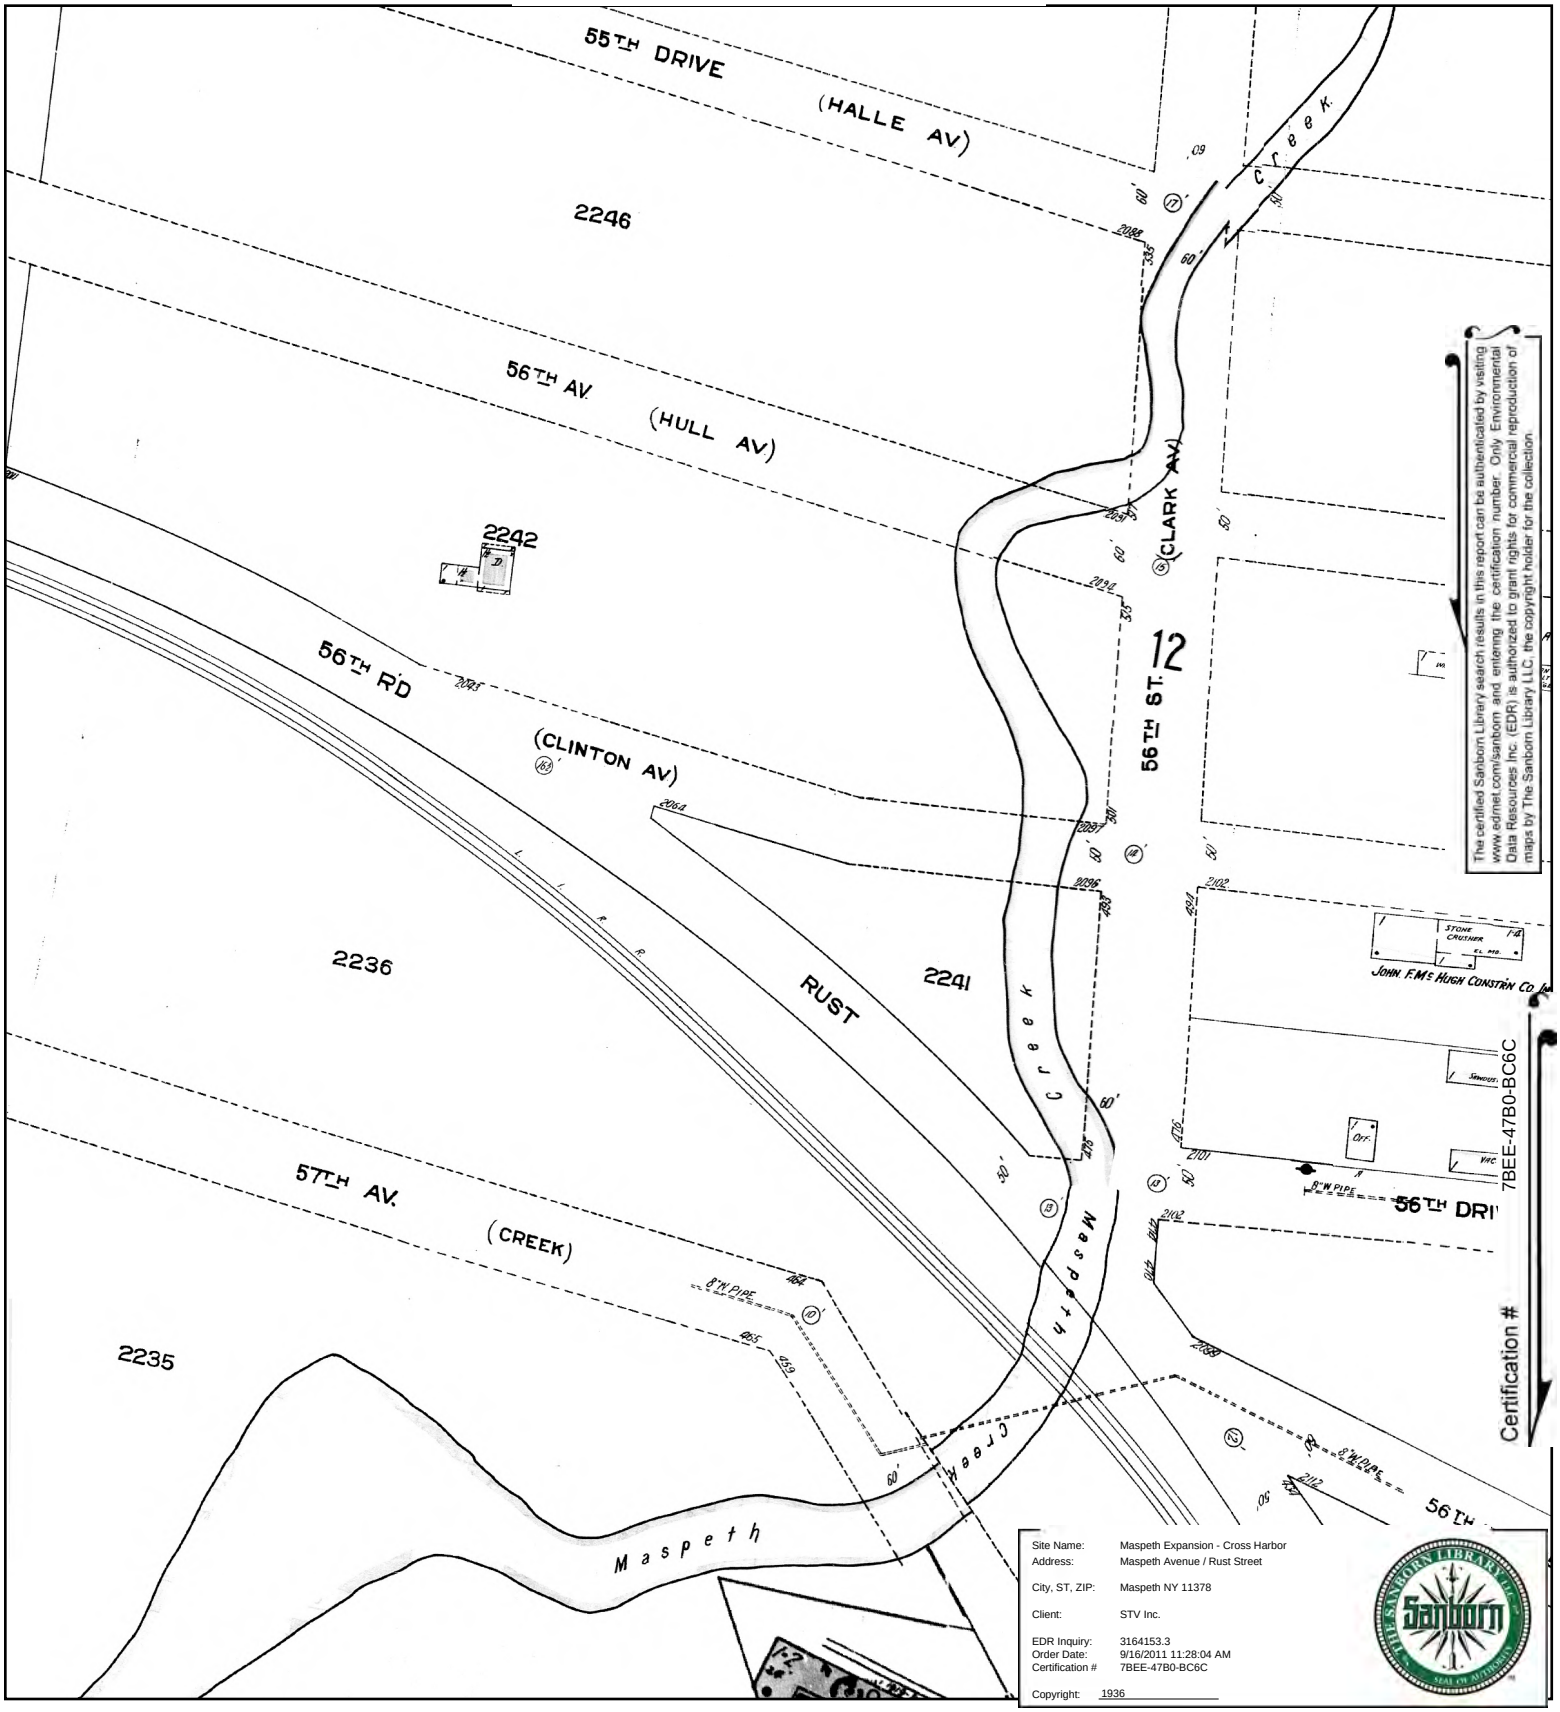

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

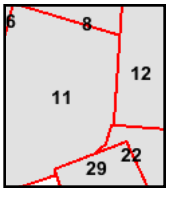

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1982 Certified Sanborn Map

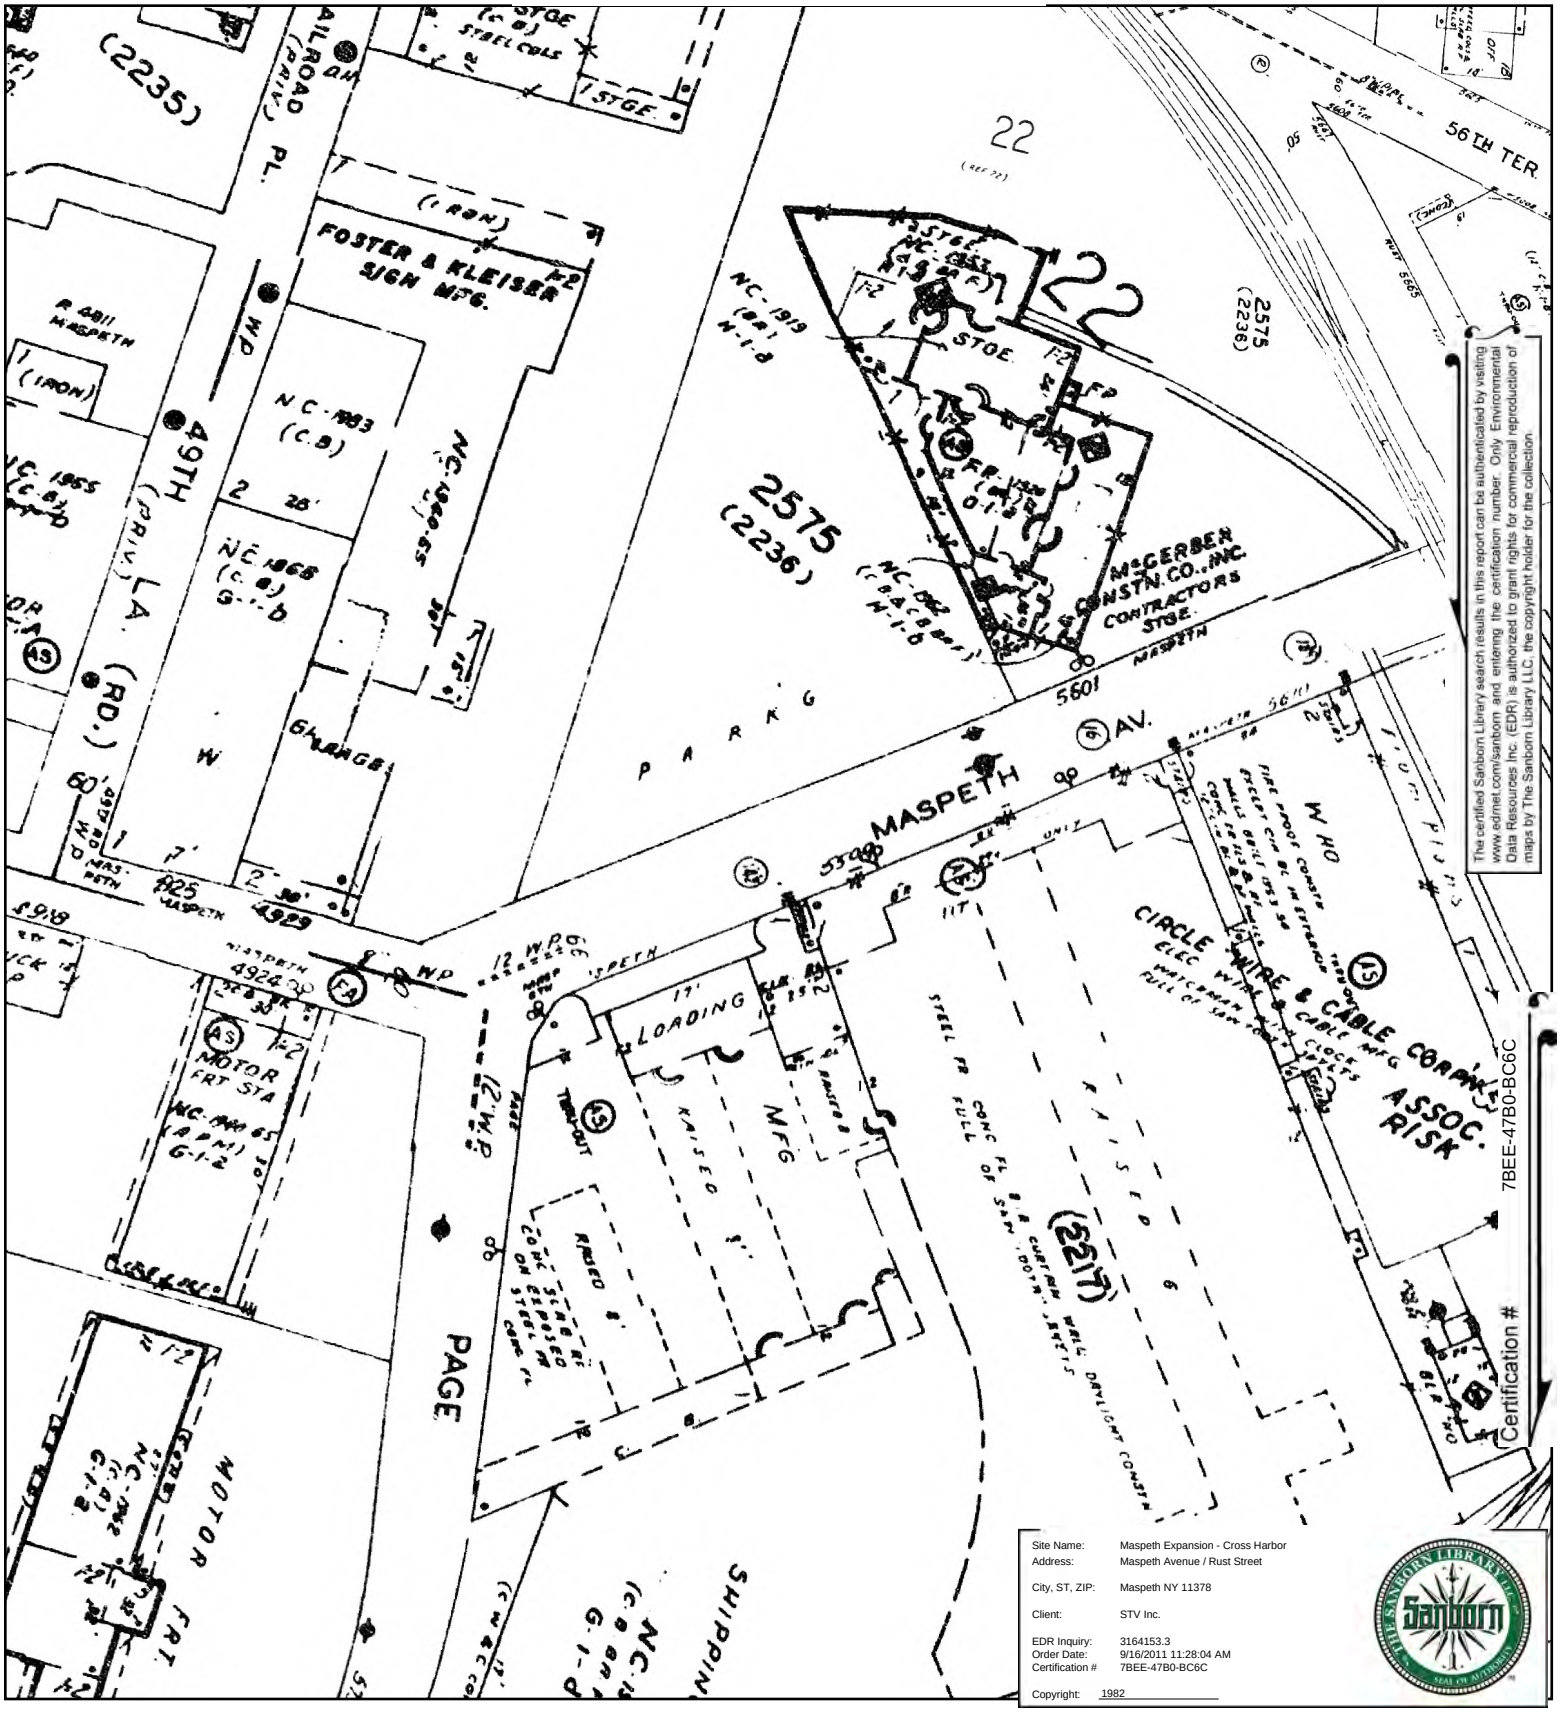

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

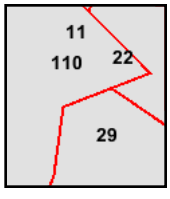

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1980 Certified Sanborn Map

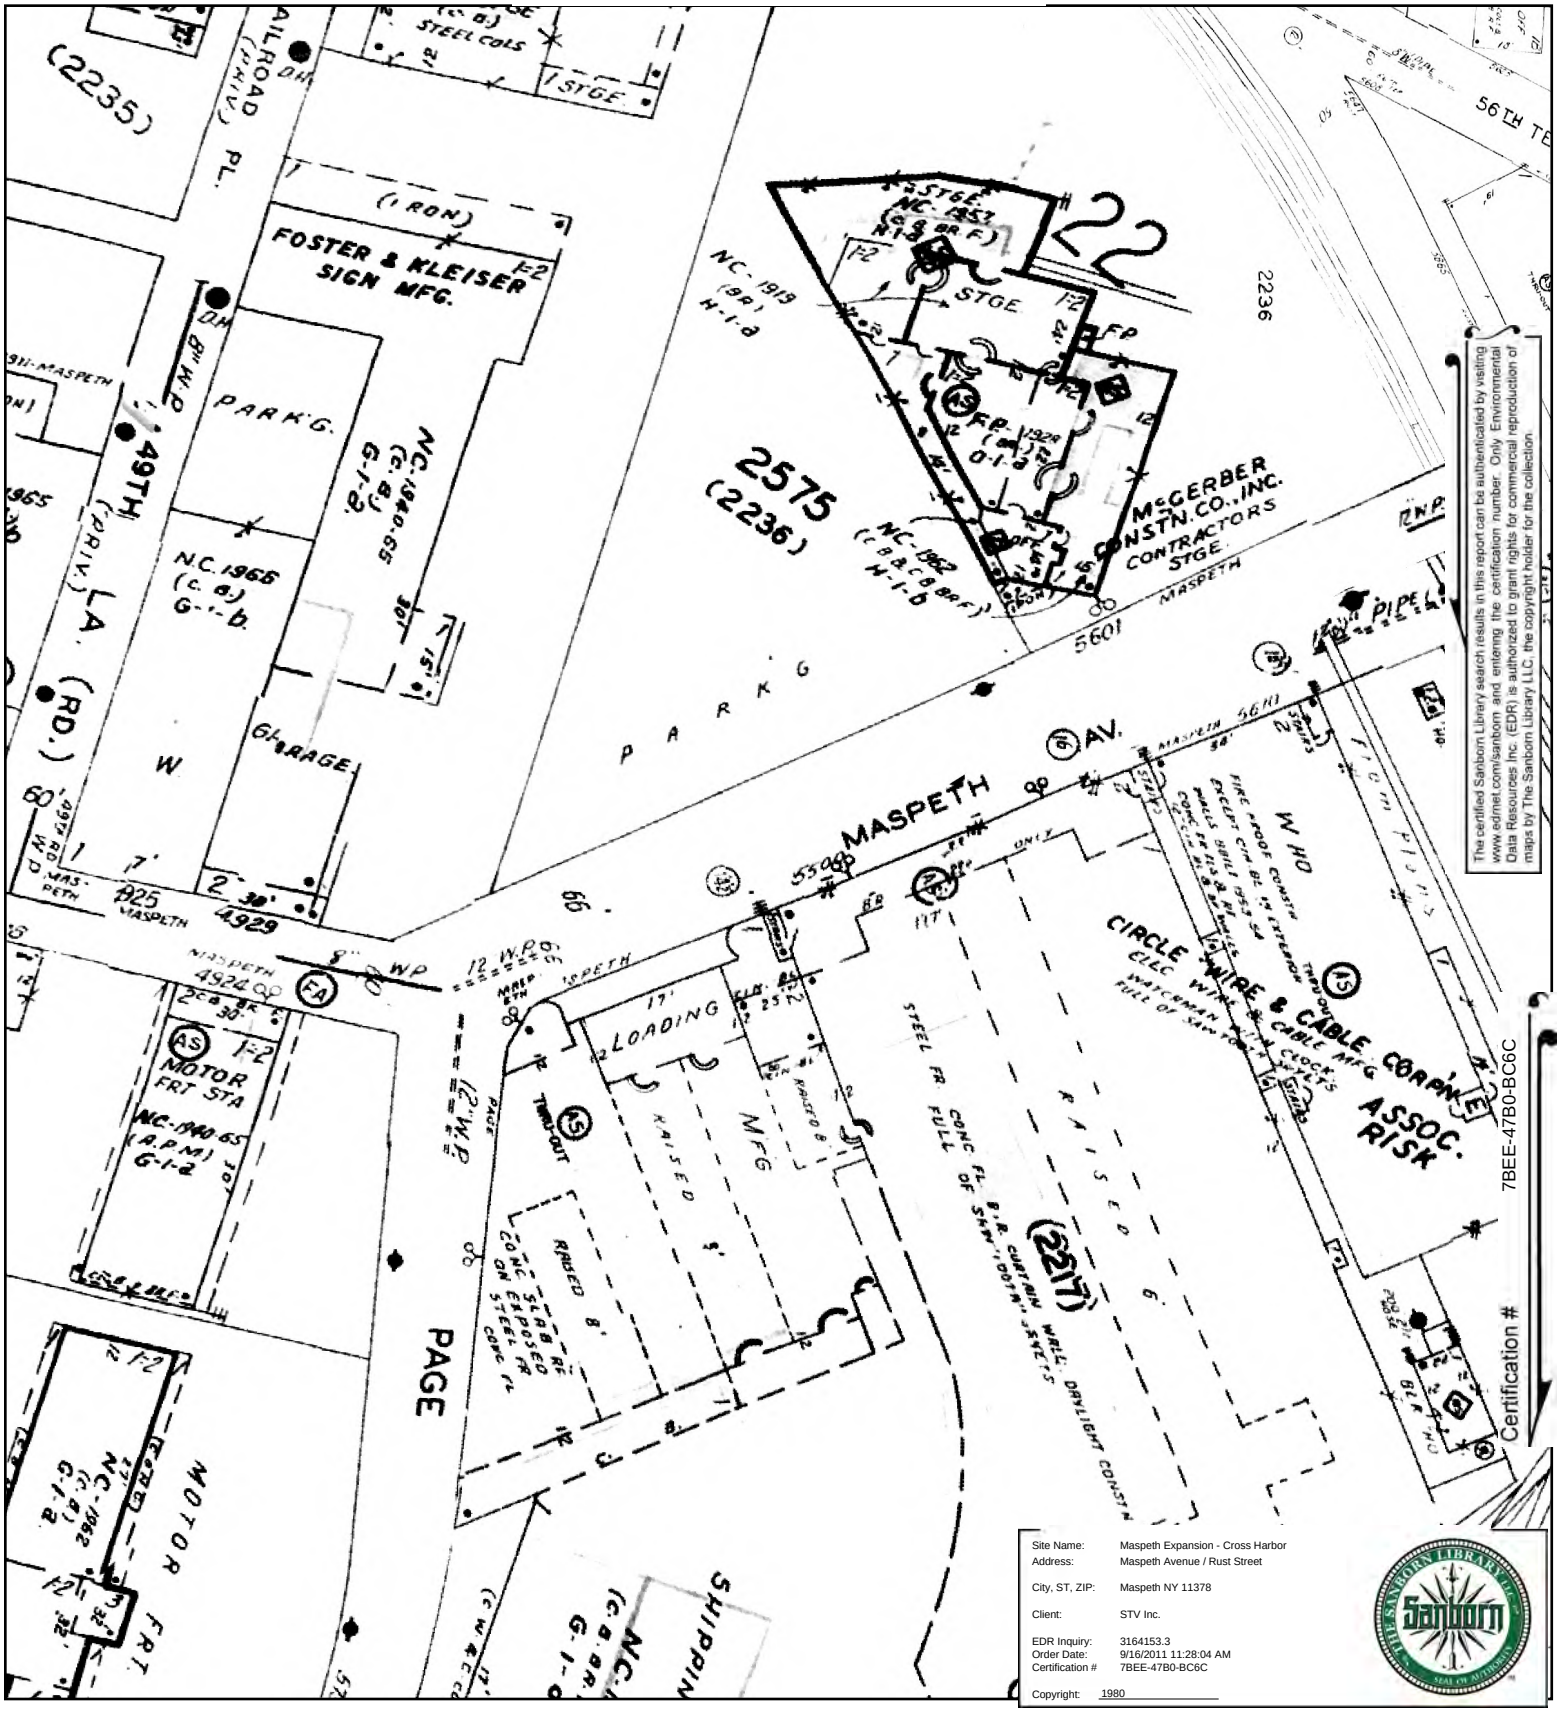

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

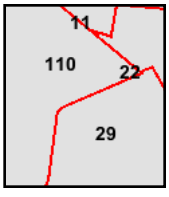

Volume 3, Sheet 110
Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1971 Certified Sanborn Map

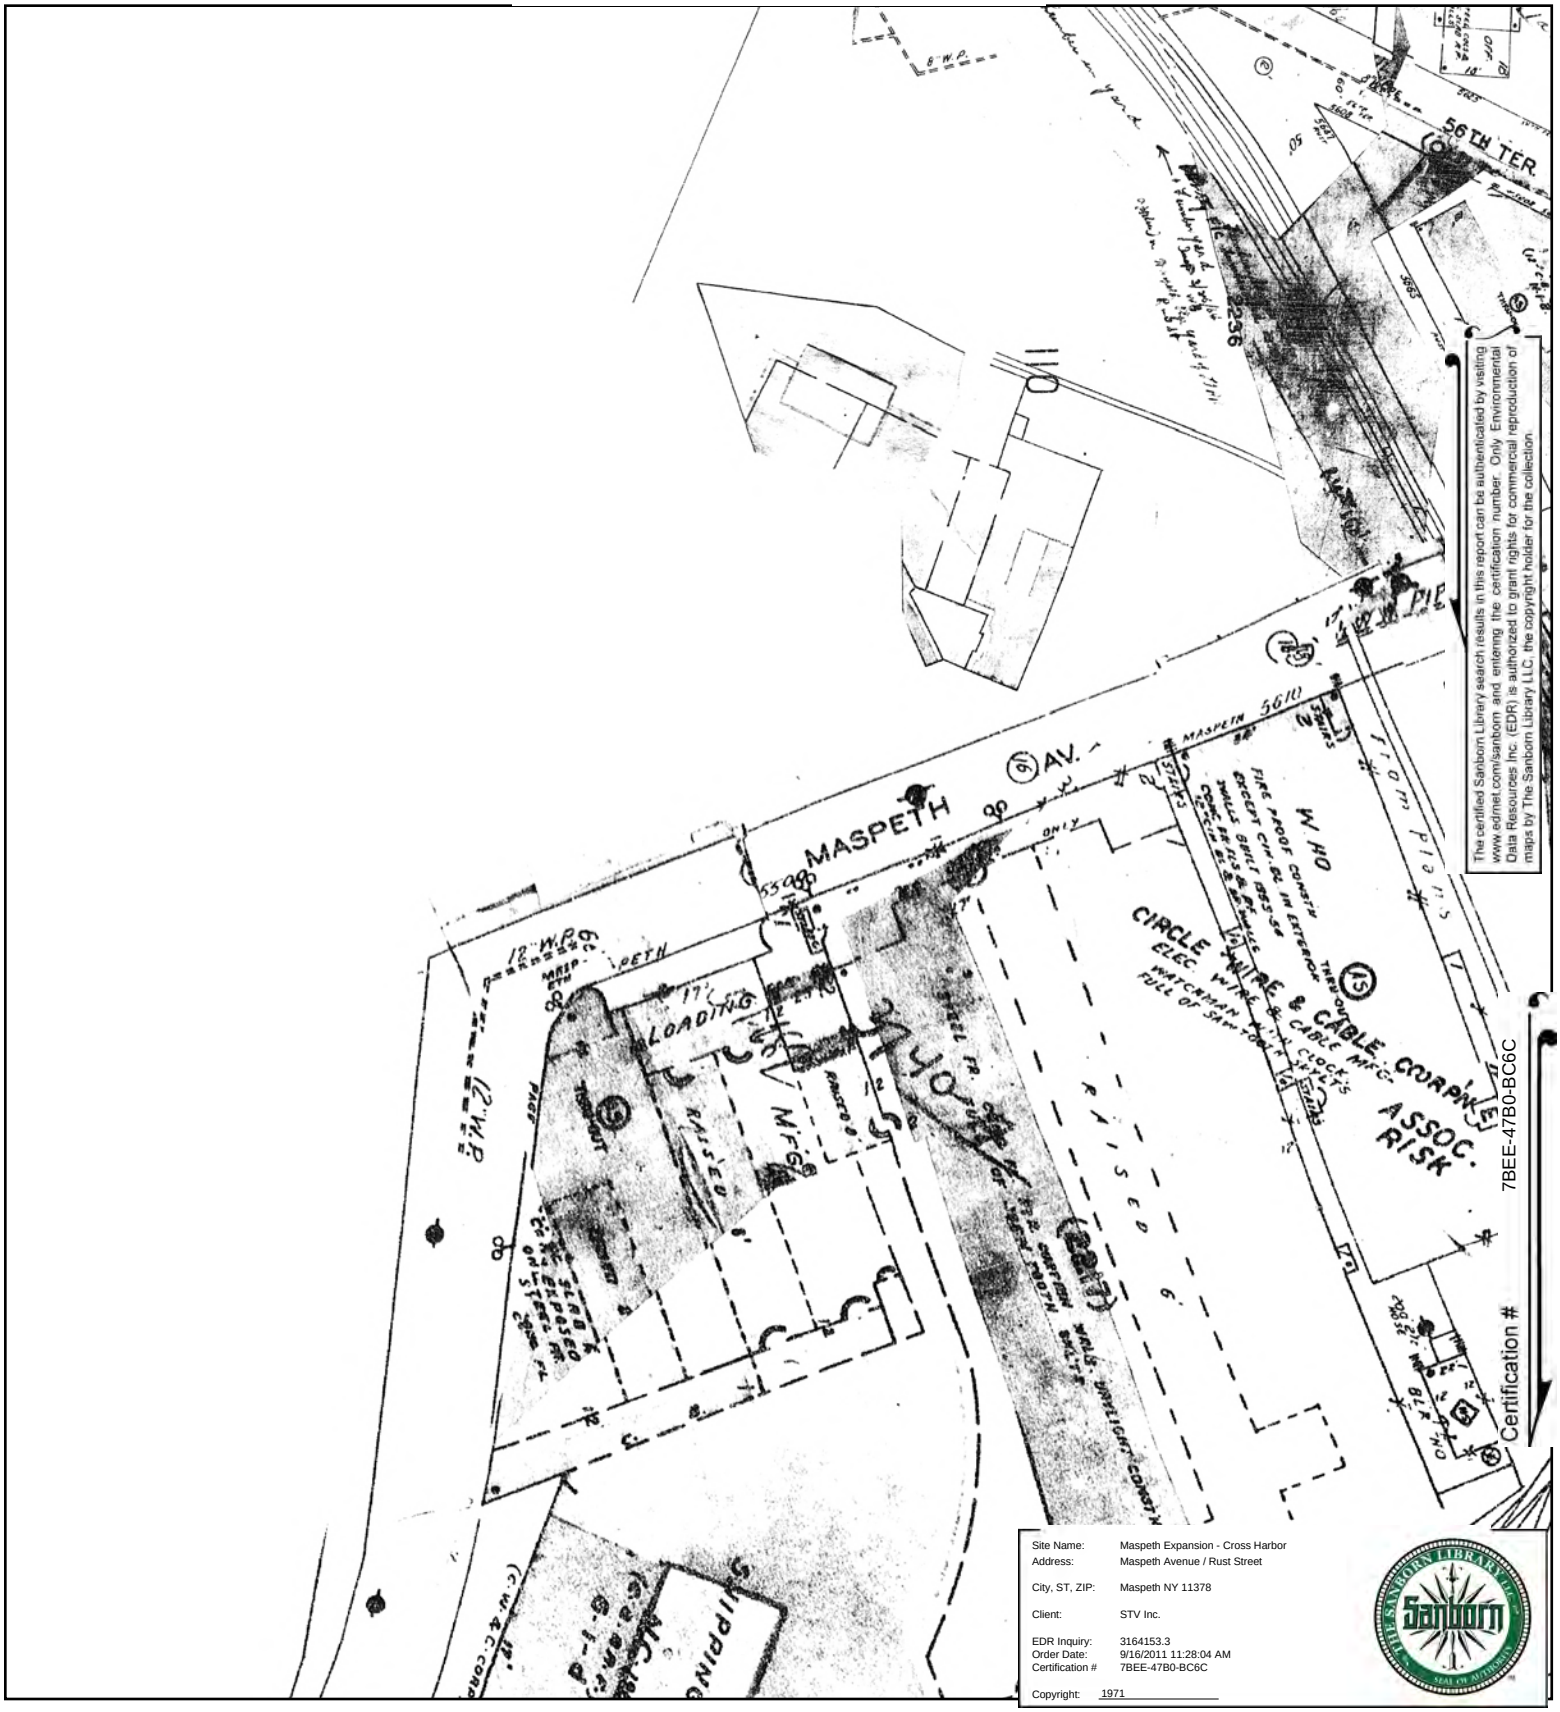

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1971

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

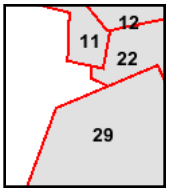

Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1990 Certified Sanborn Map

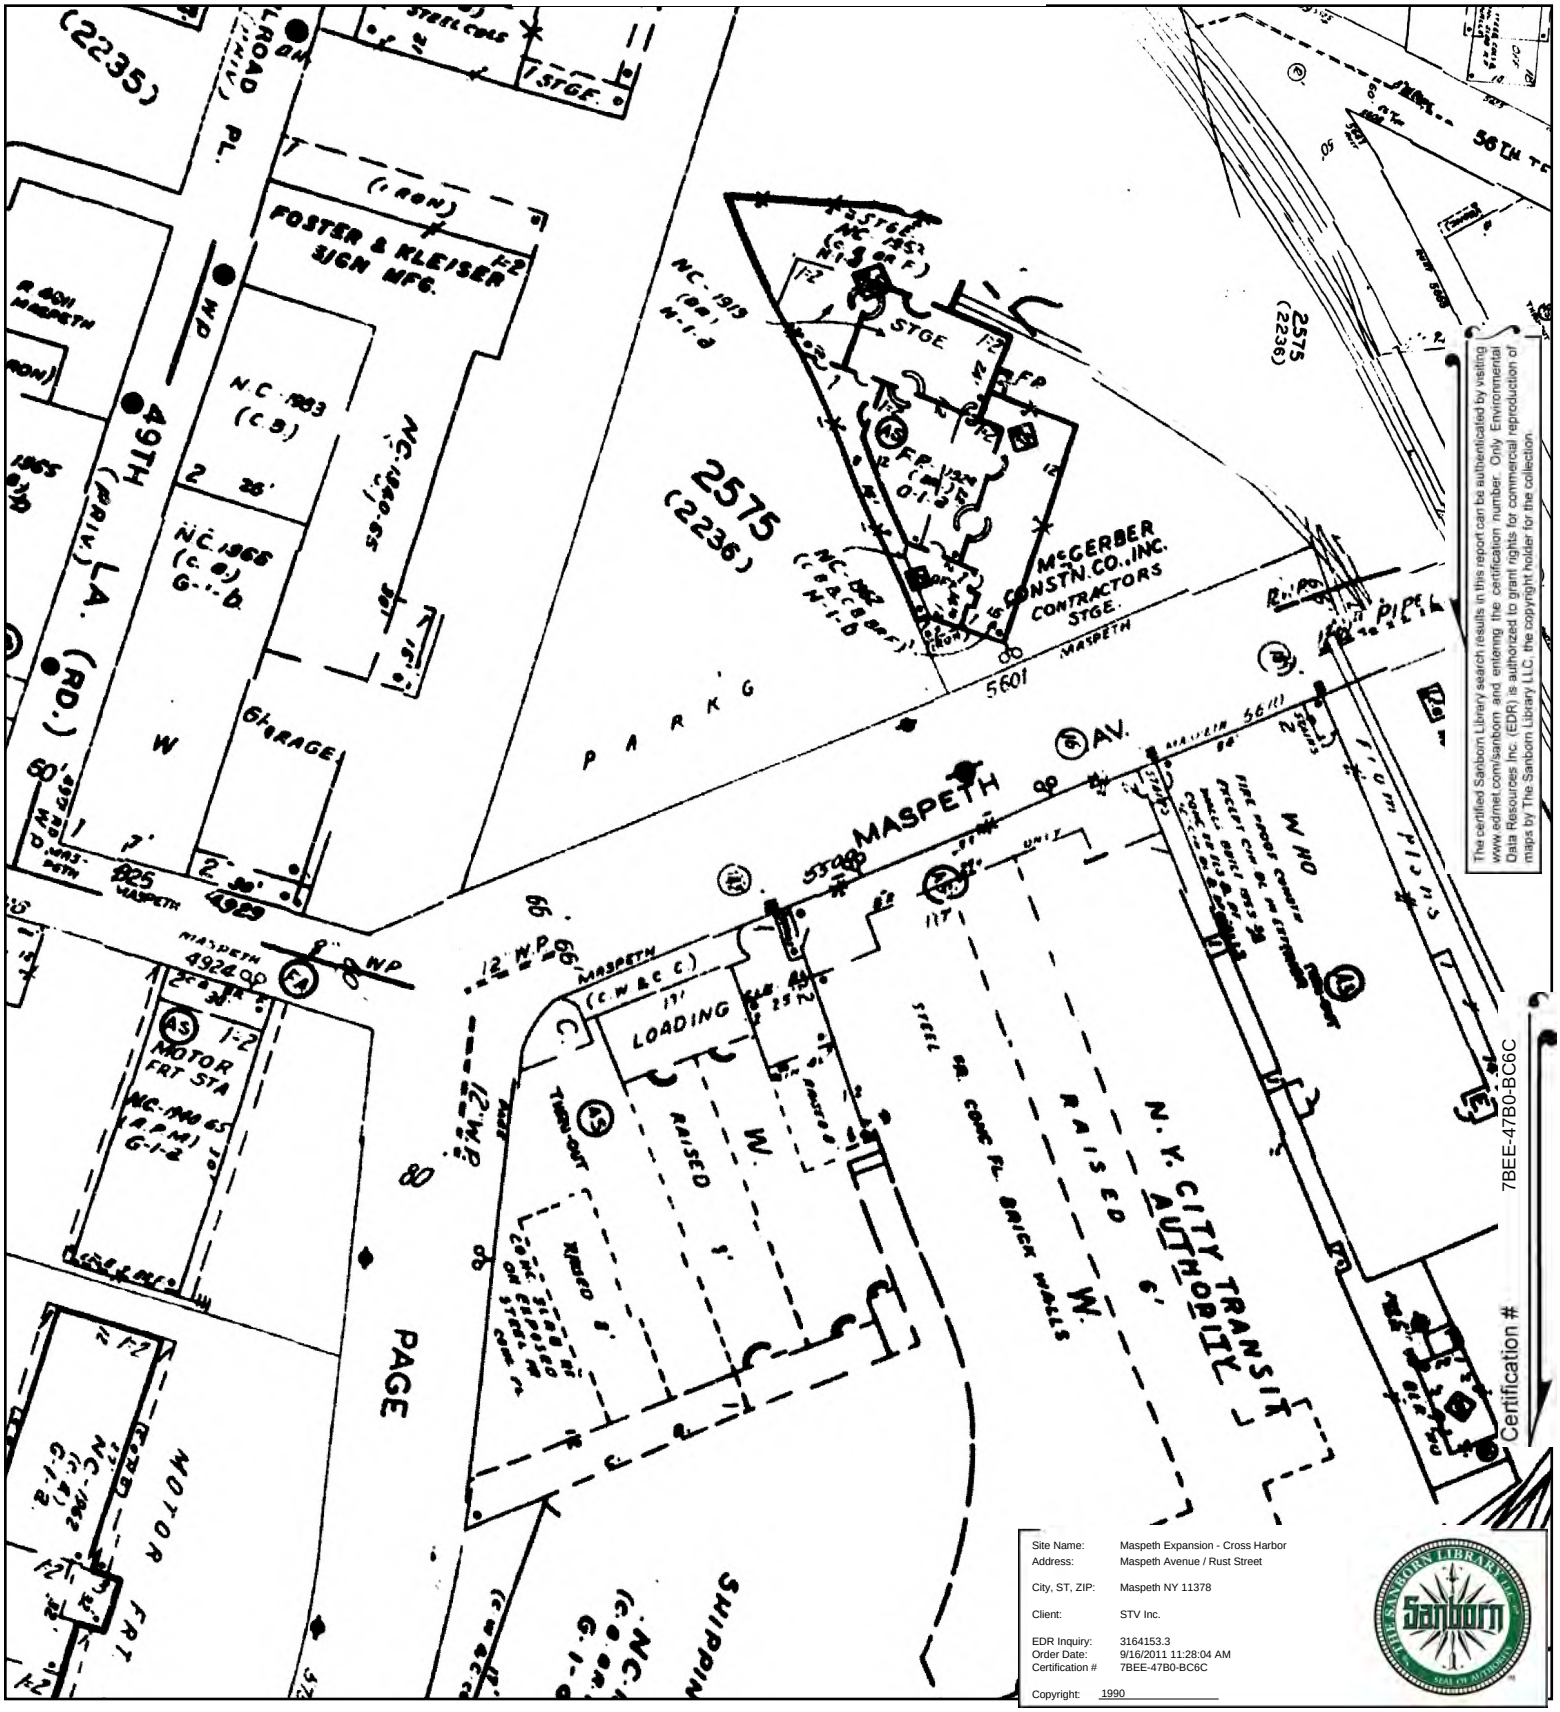

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

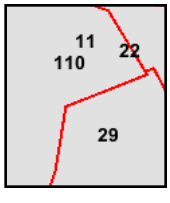

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1988 Certified Sanborn Map

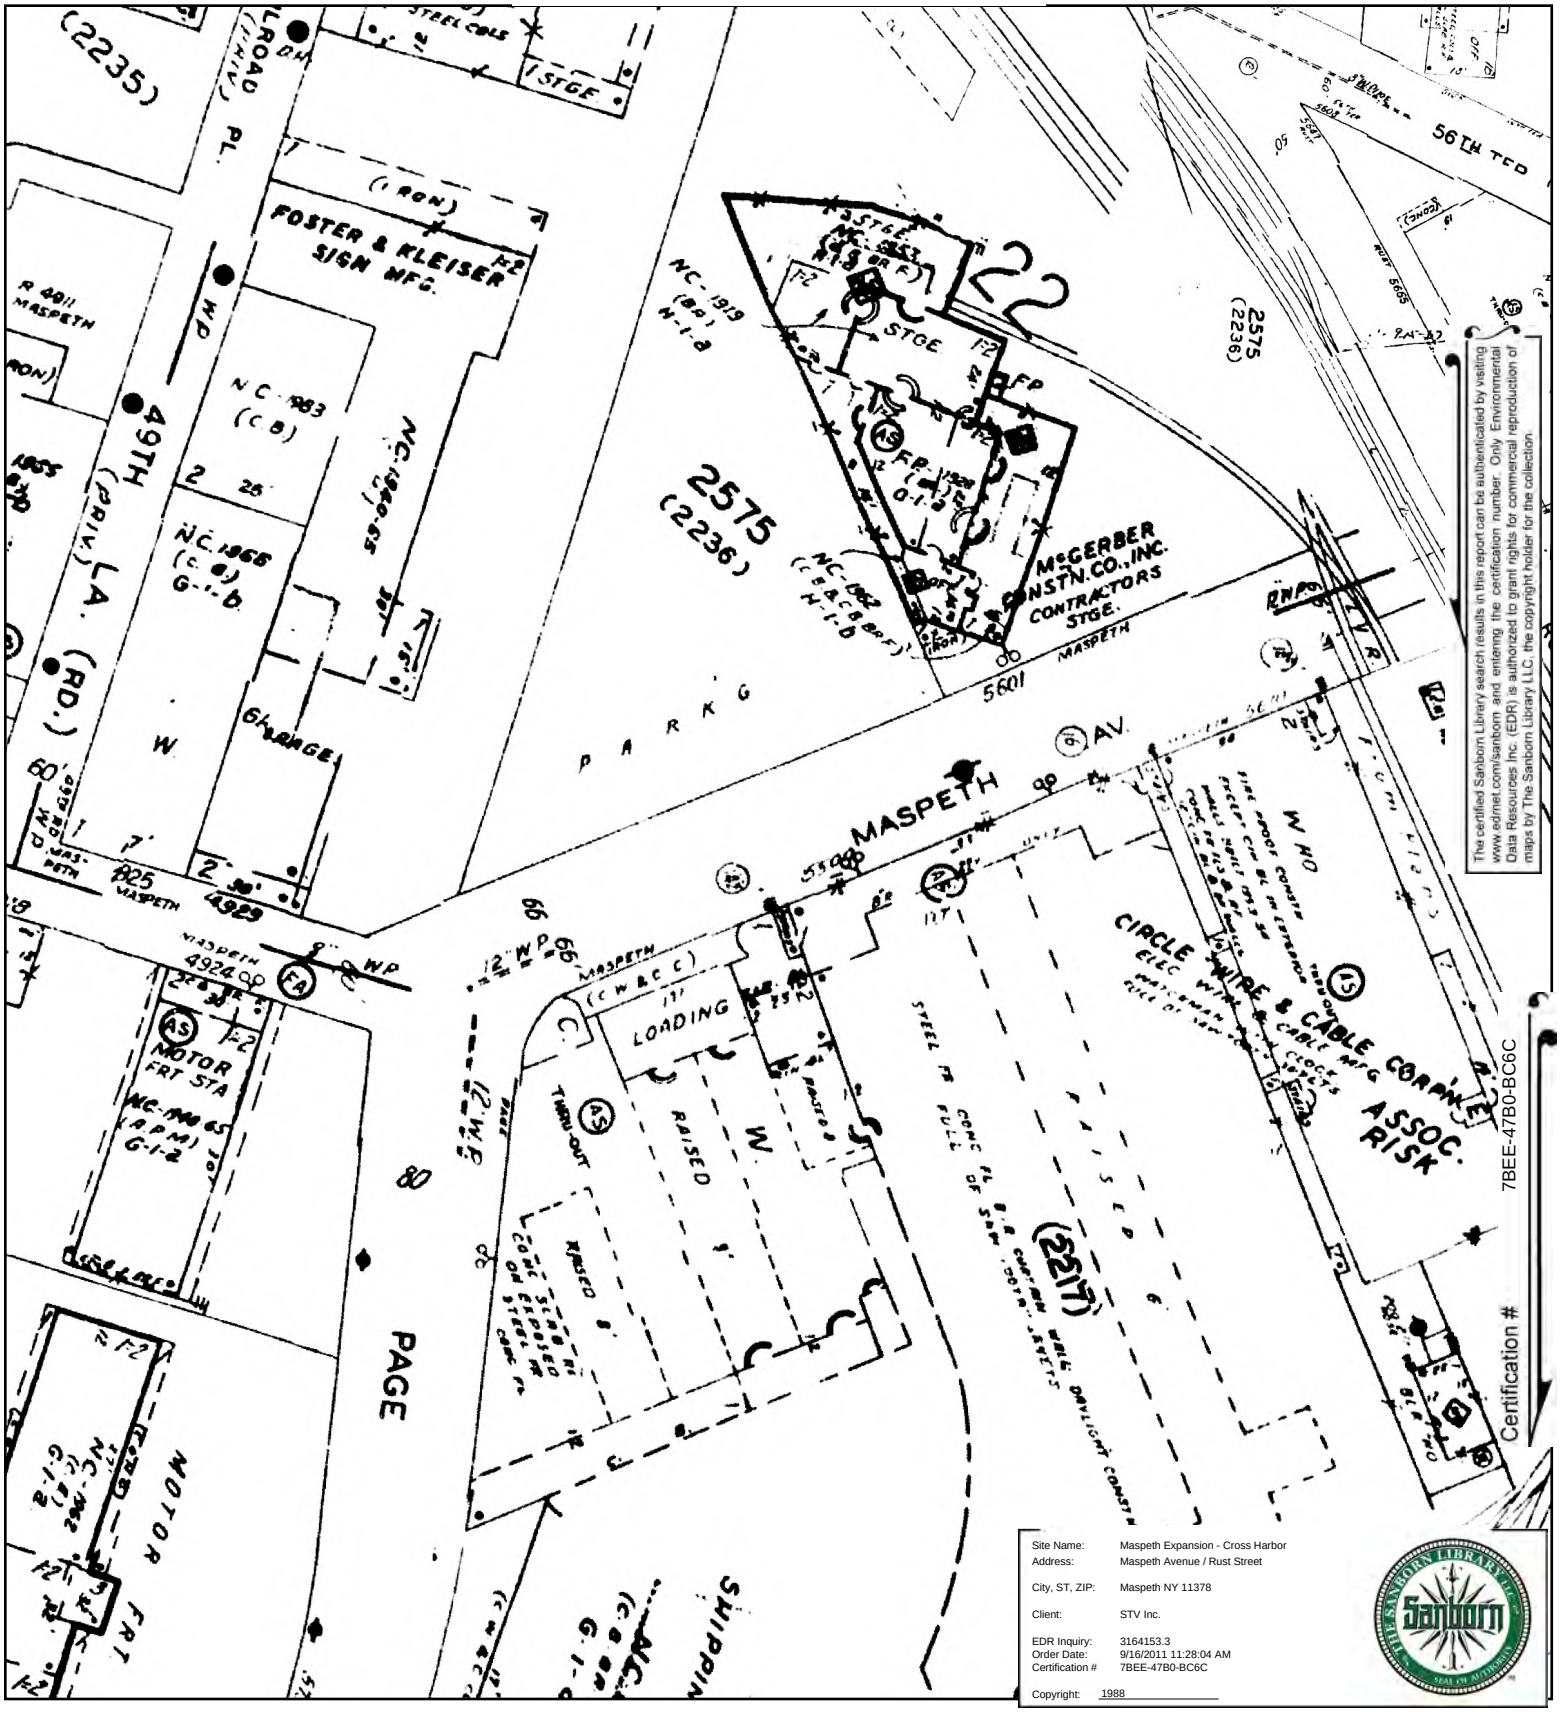

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1988

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

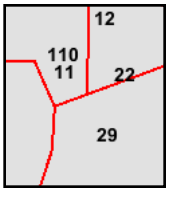

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1986 Certified Sanborn Map

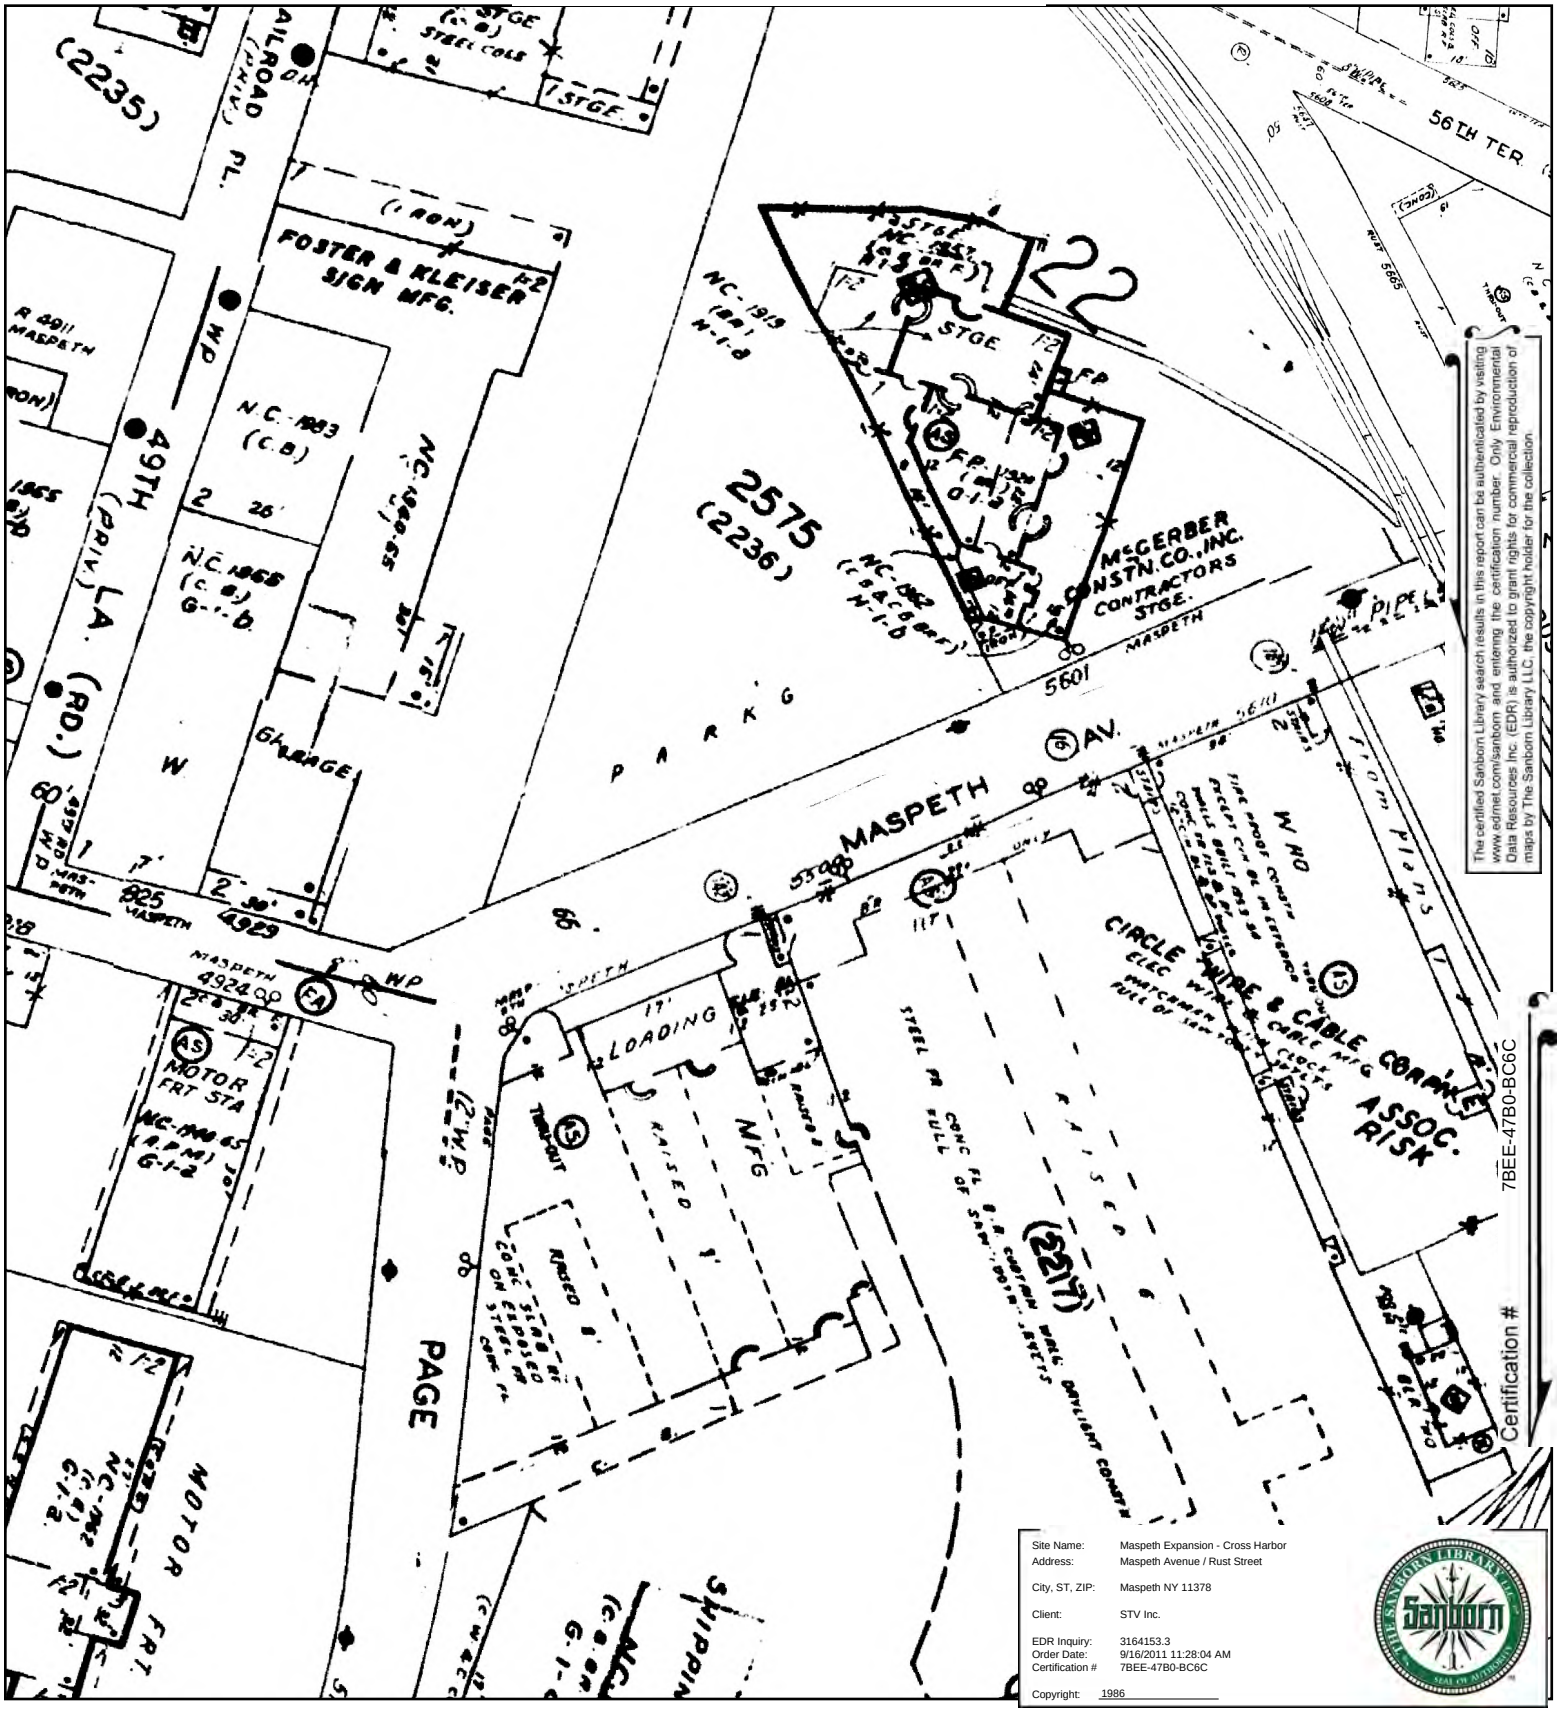

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

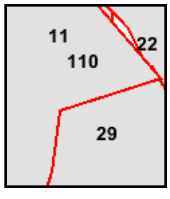

Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1985 Certified Sanborn Map

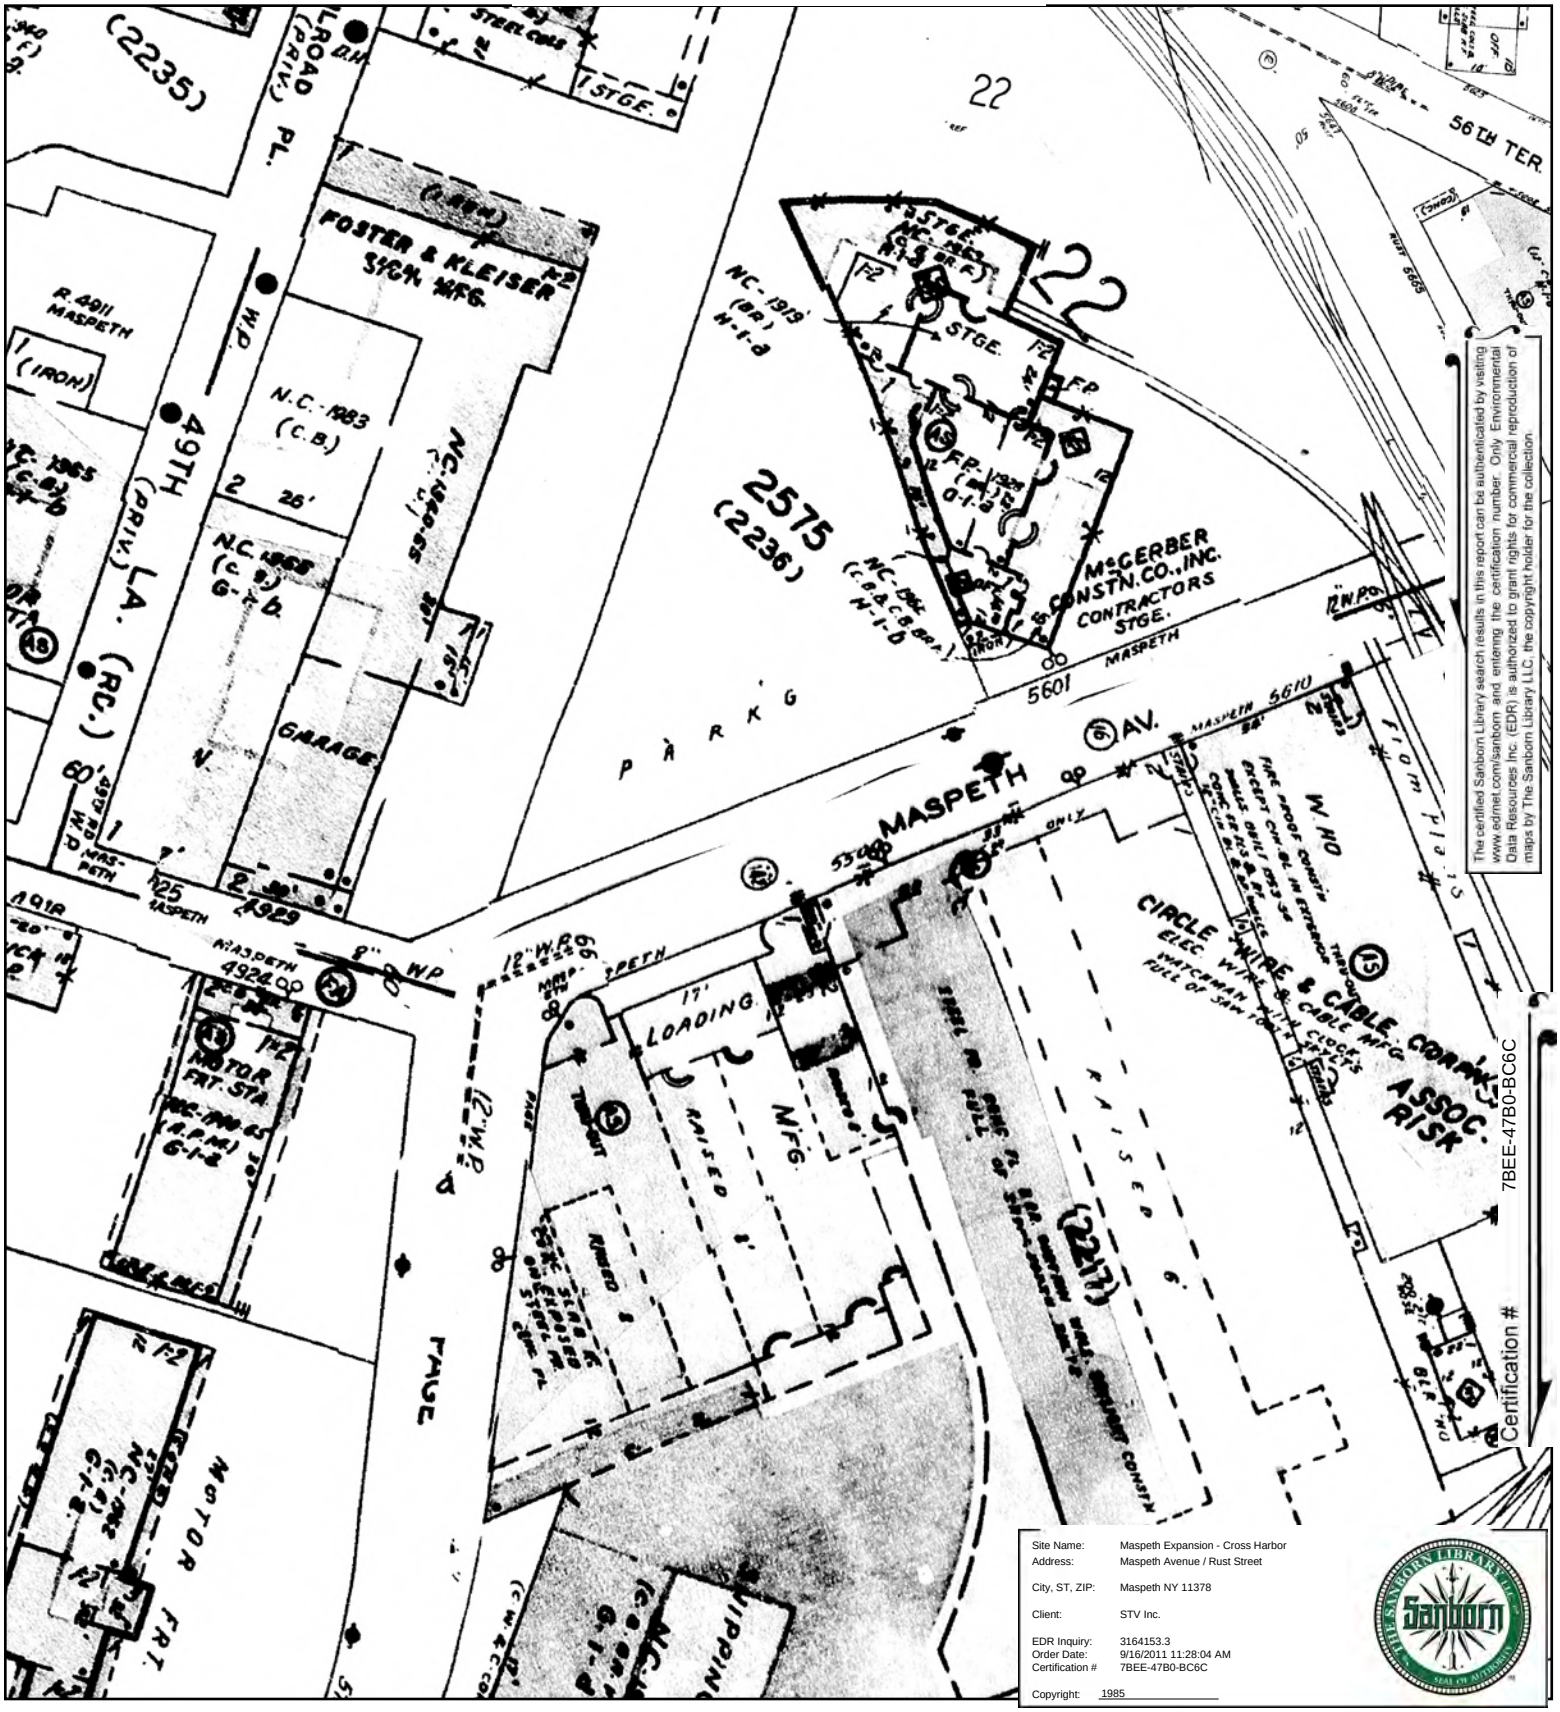

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1985

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

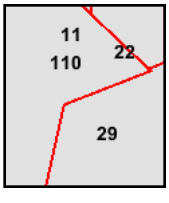

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1995 Certified Sanborn Map

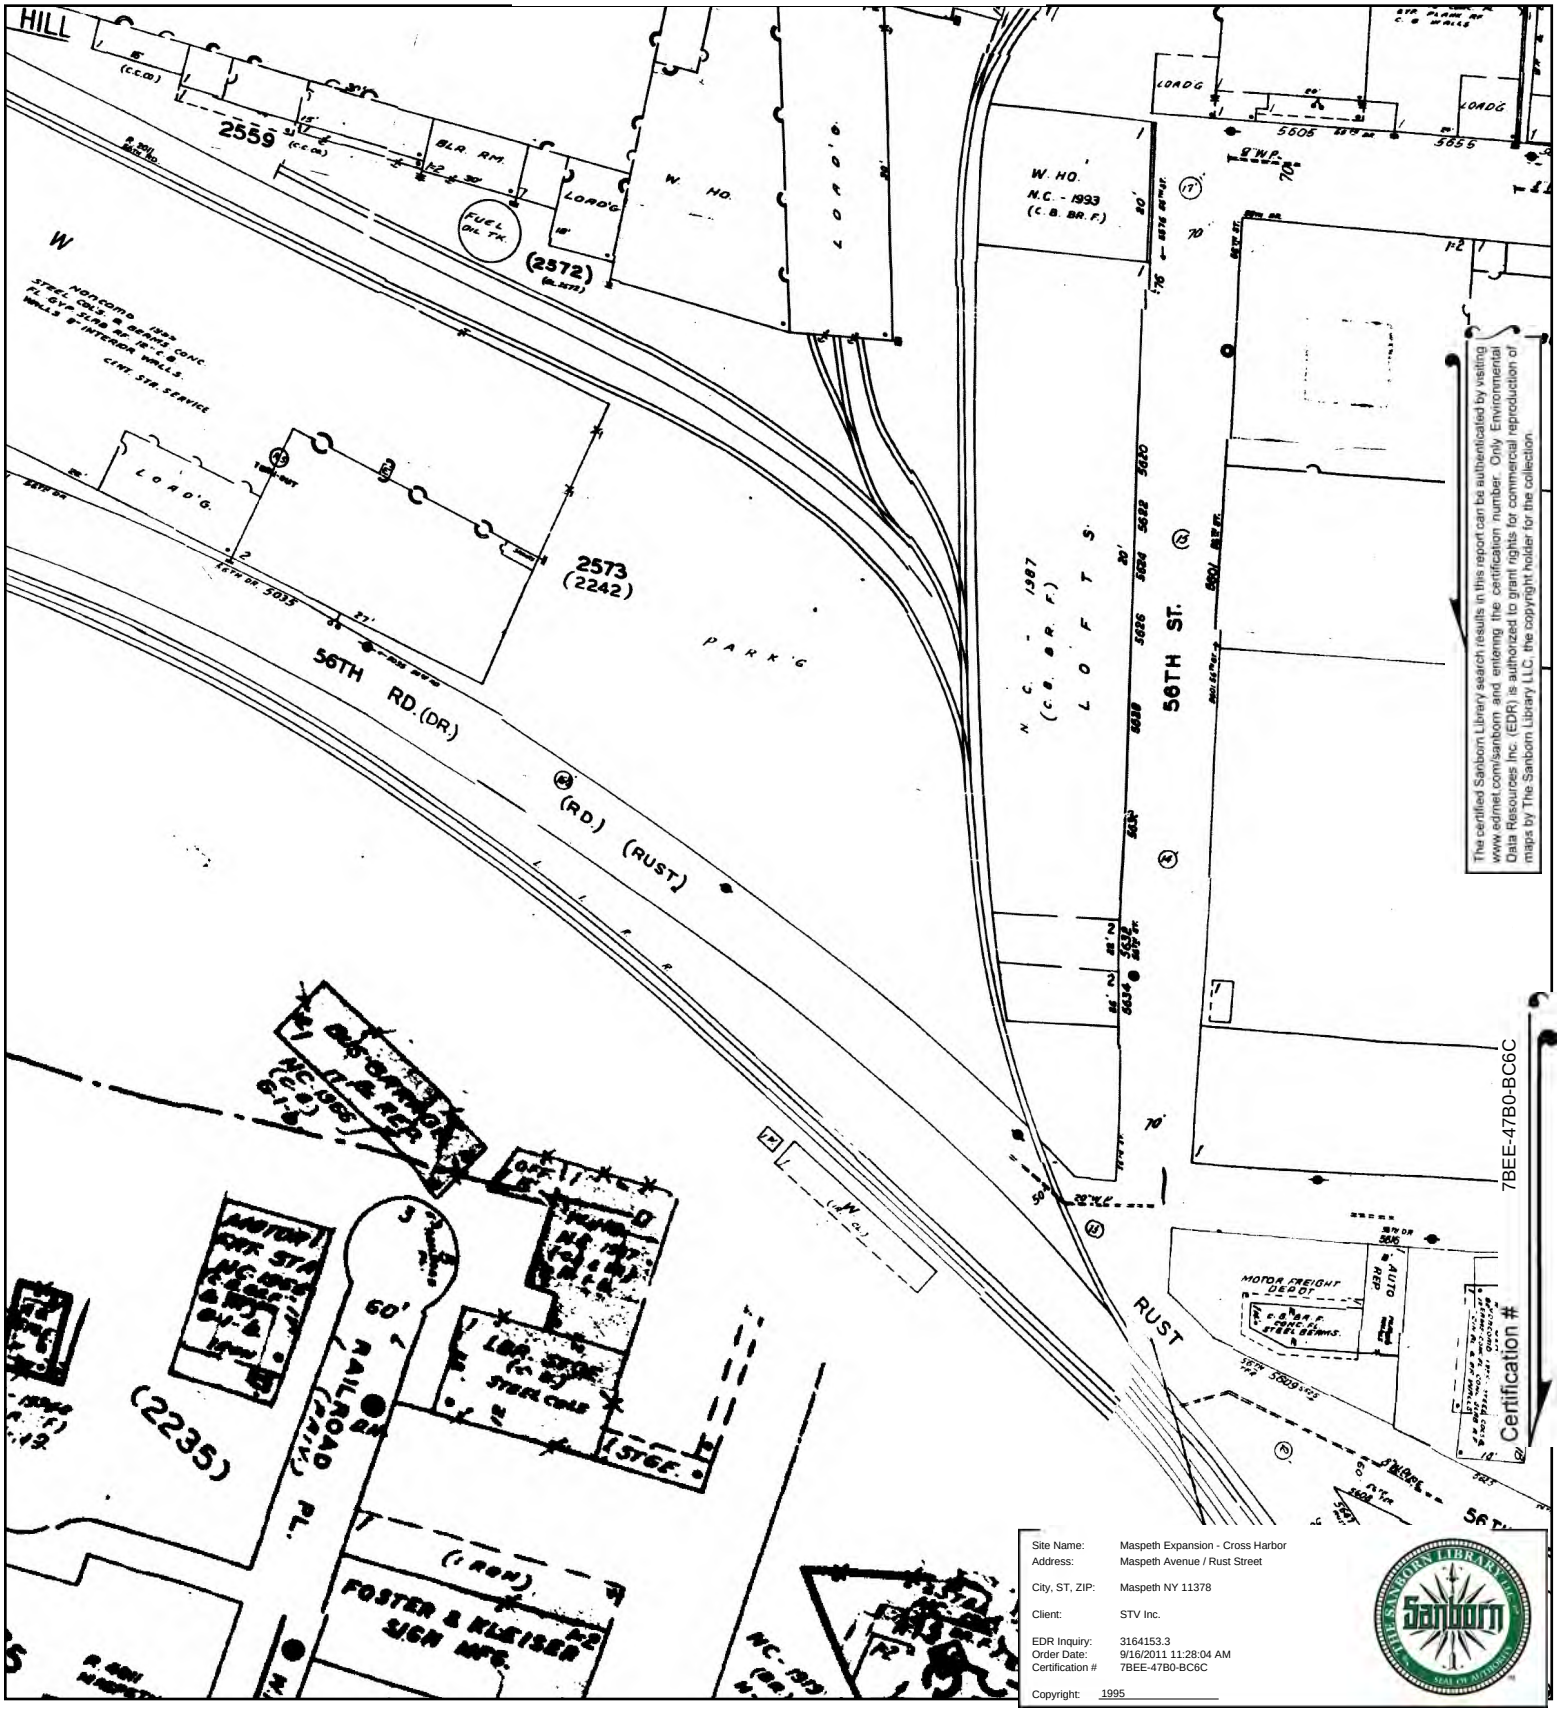

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1995

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

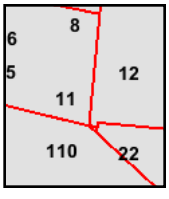

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

0 Feet 165 330 660

N

1994 Certified Sanborn Map

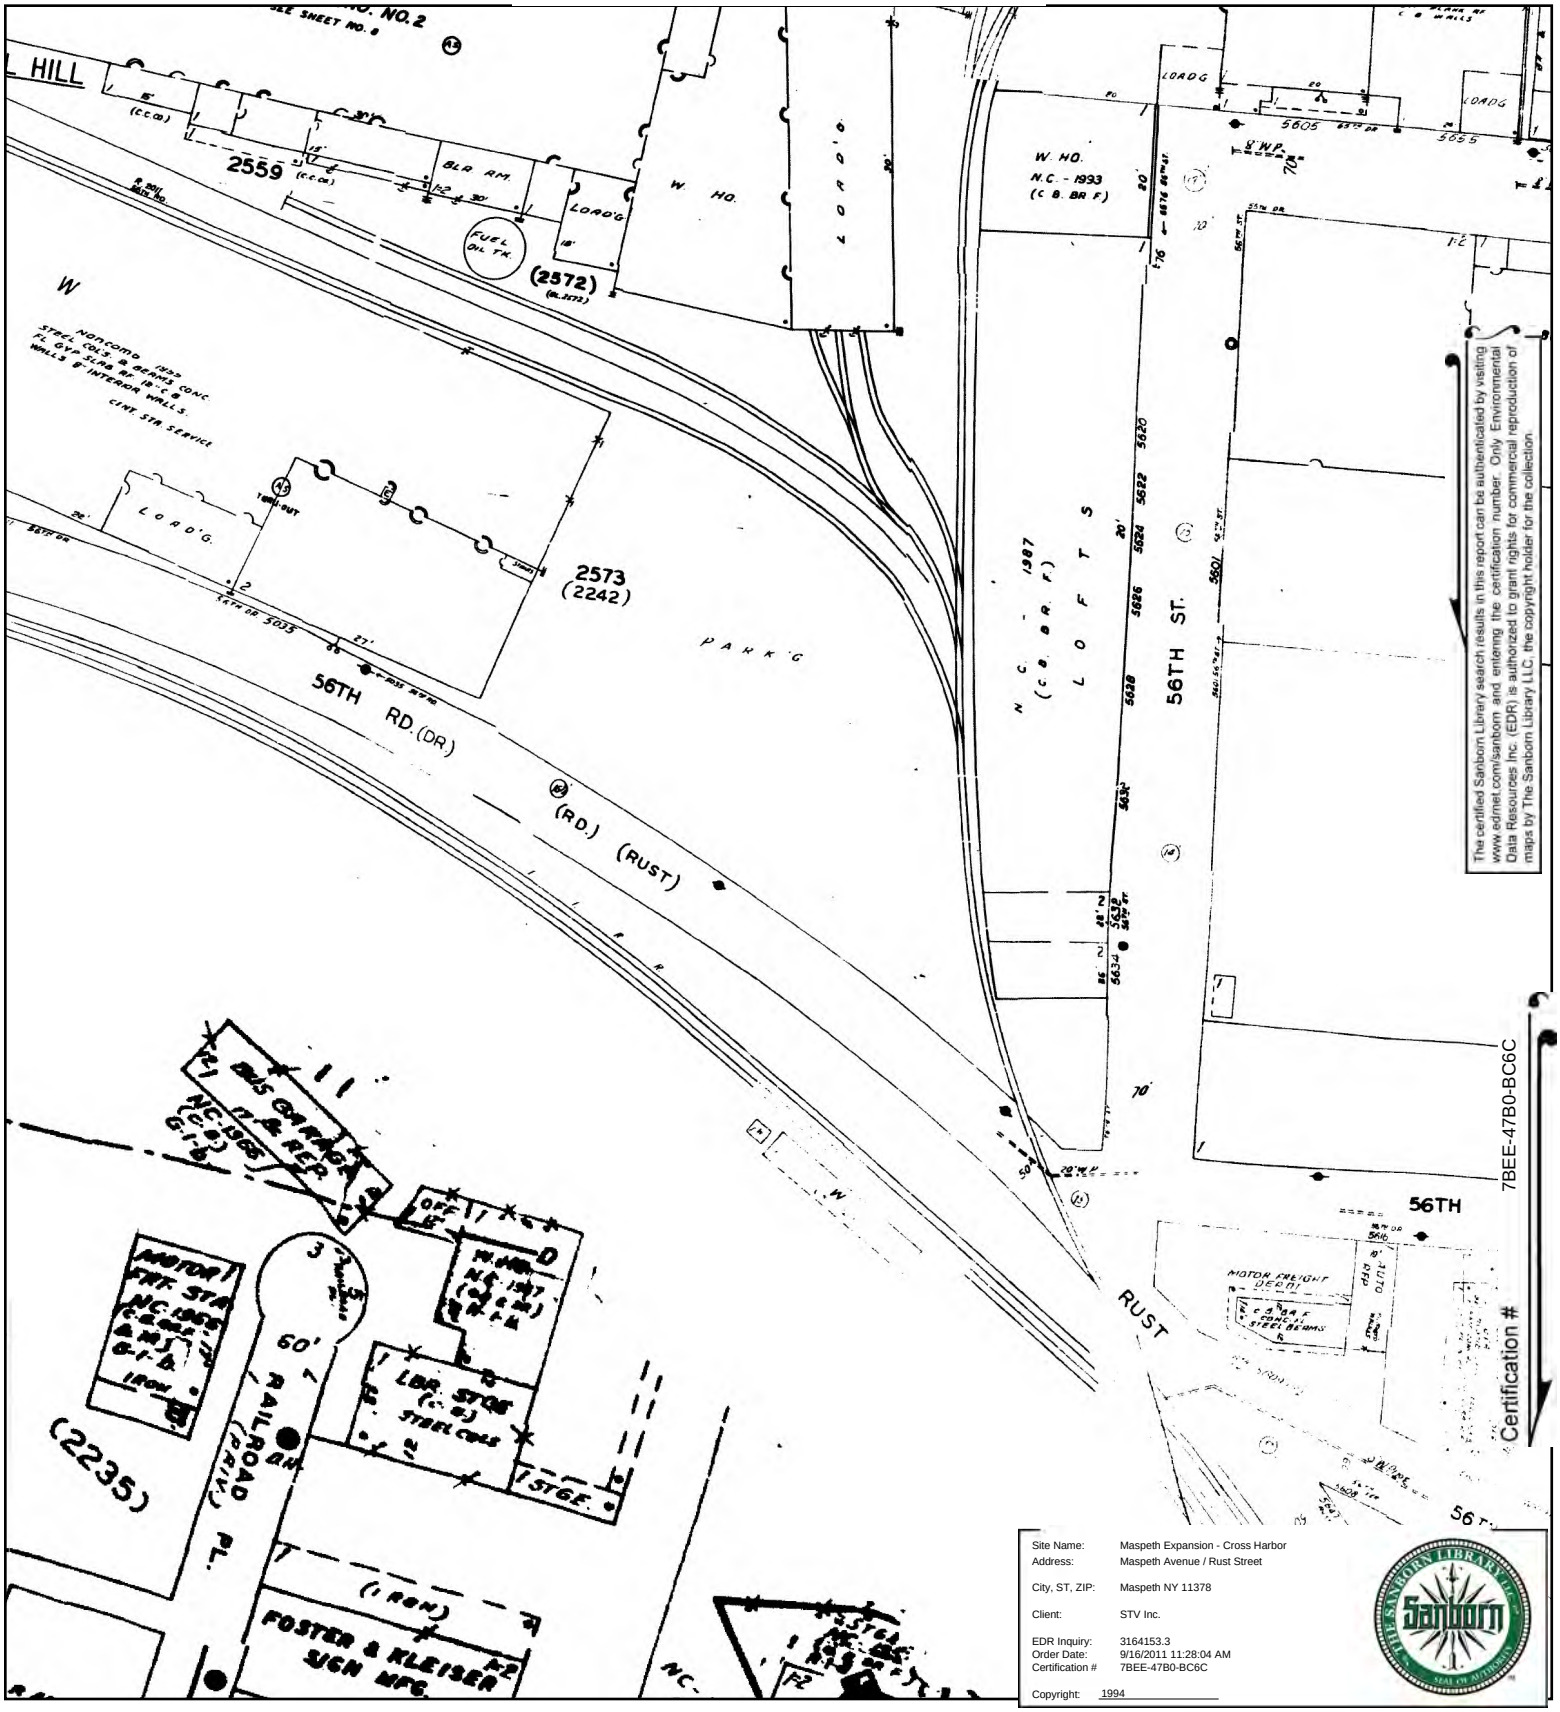

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

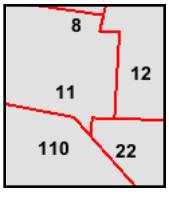

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1993 Certified Sanborn Map

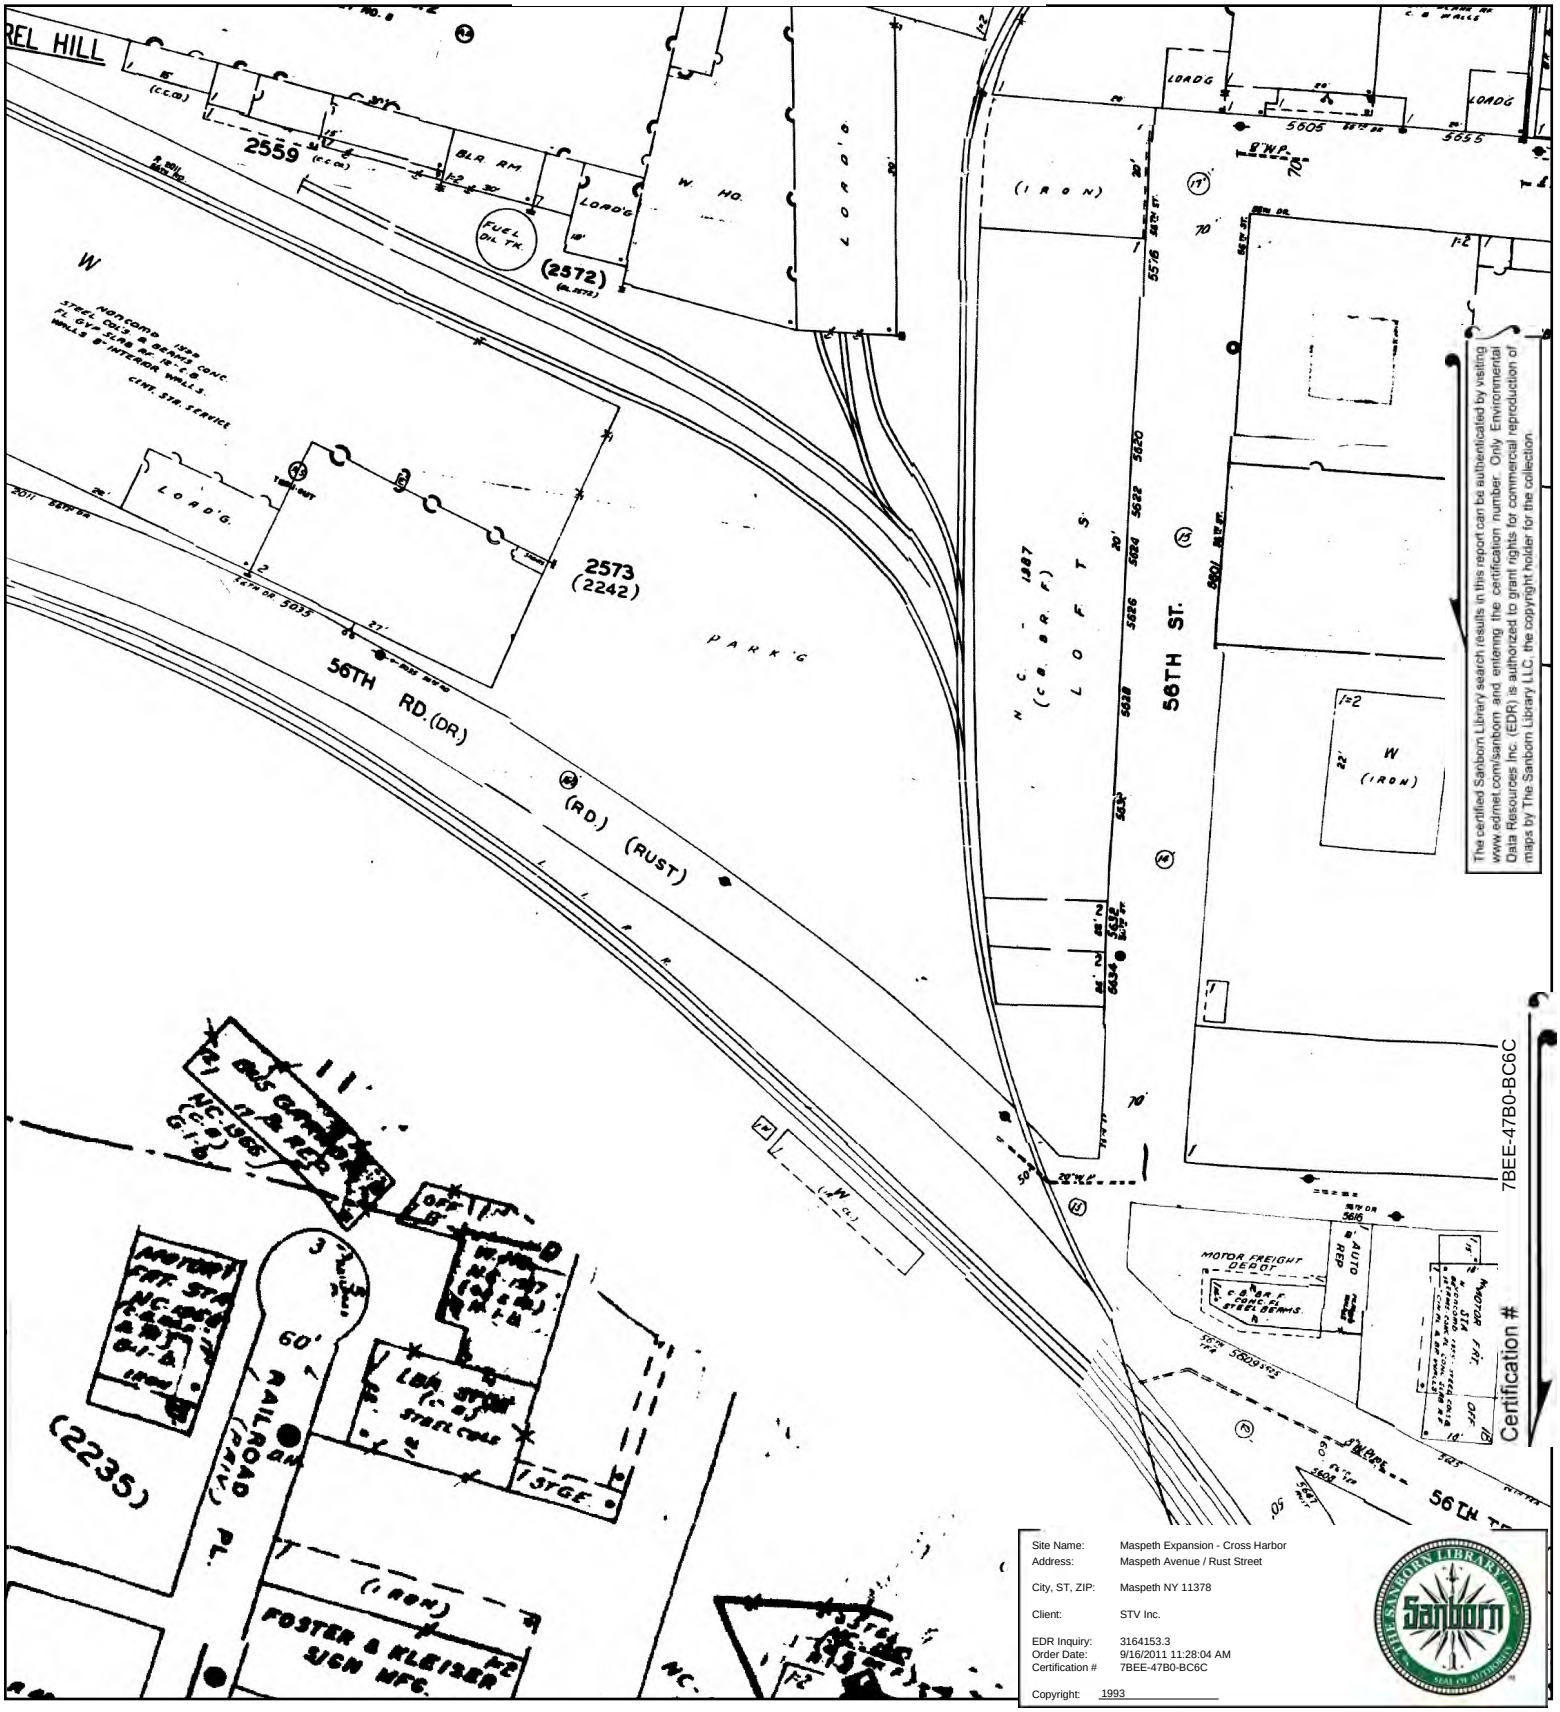

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1993

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

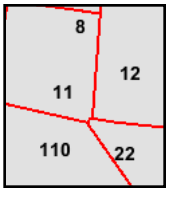

Volume 3, Sheet 110
Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22

N

1992 Certified Sanborn Map

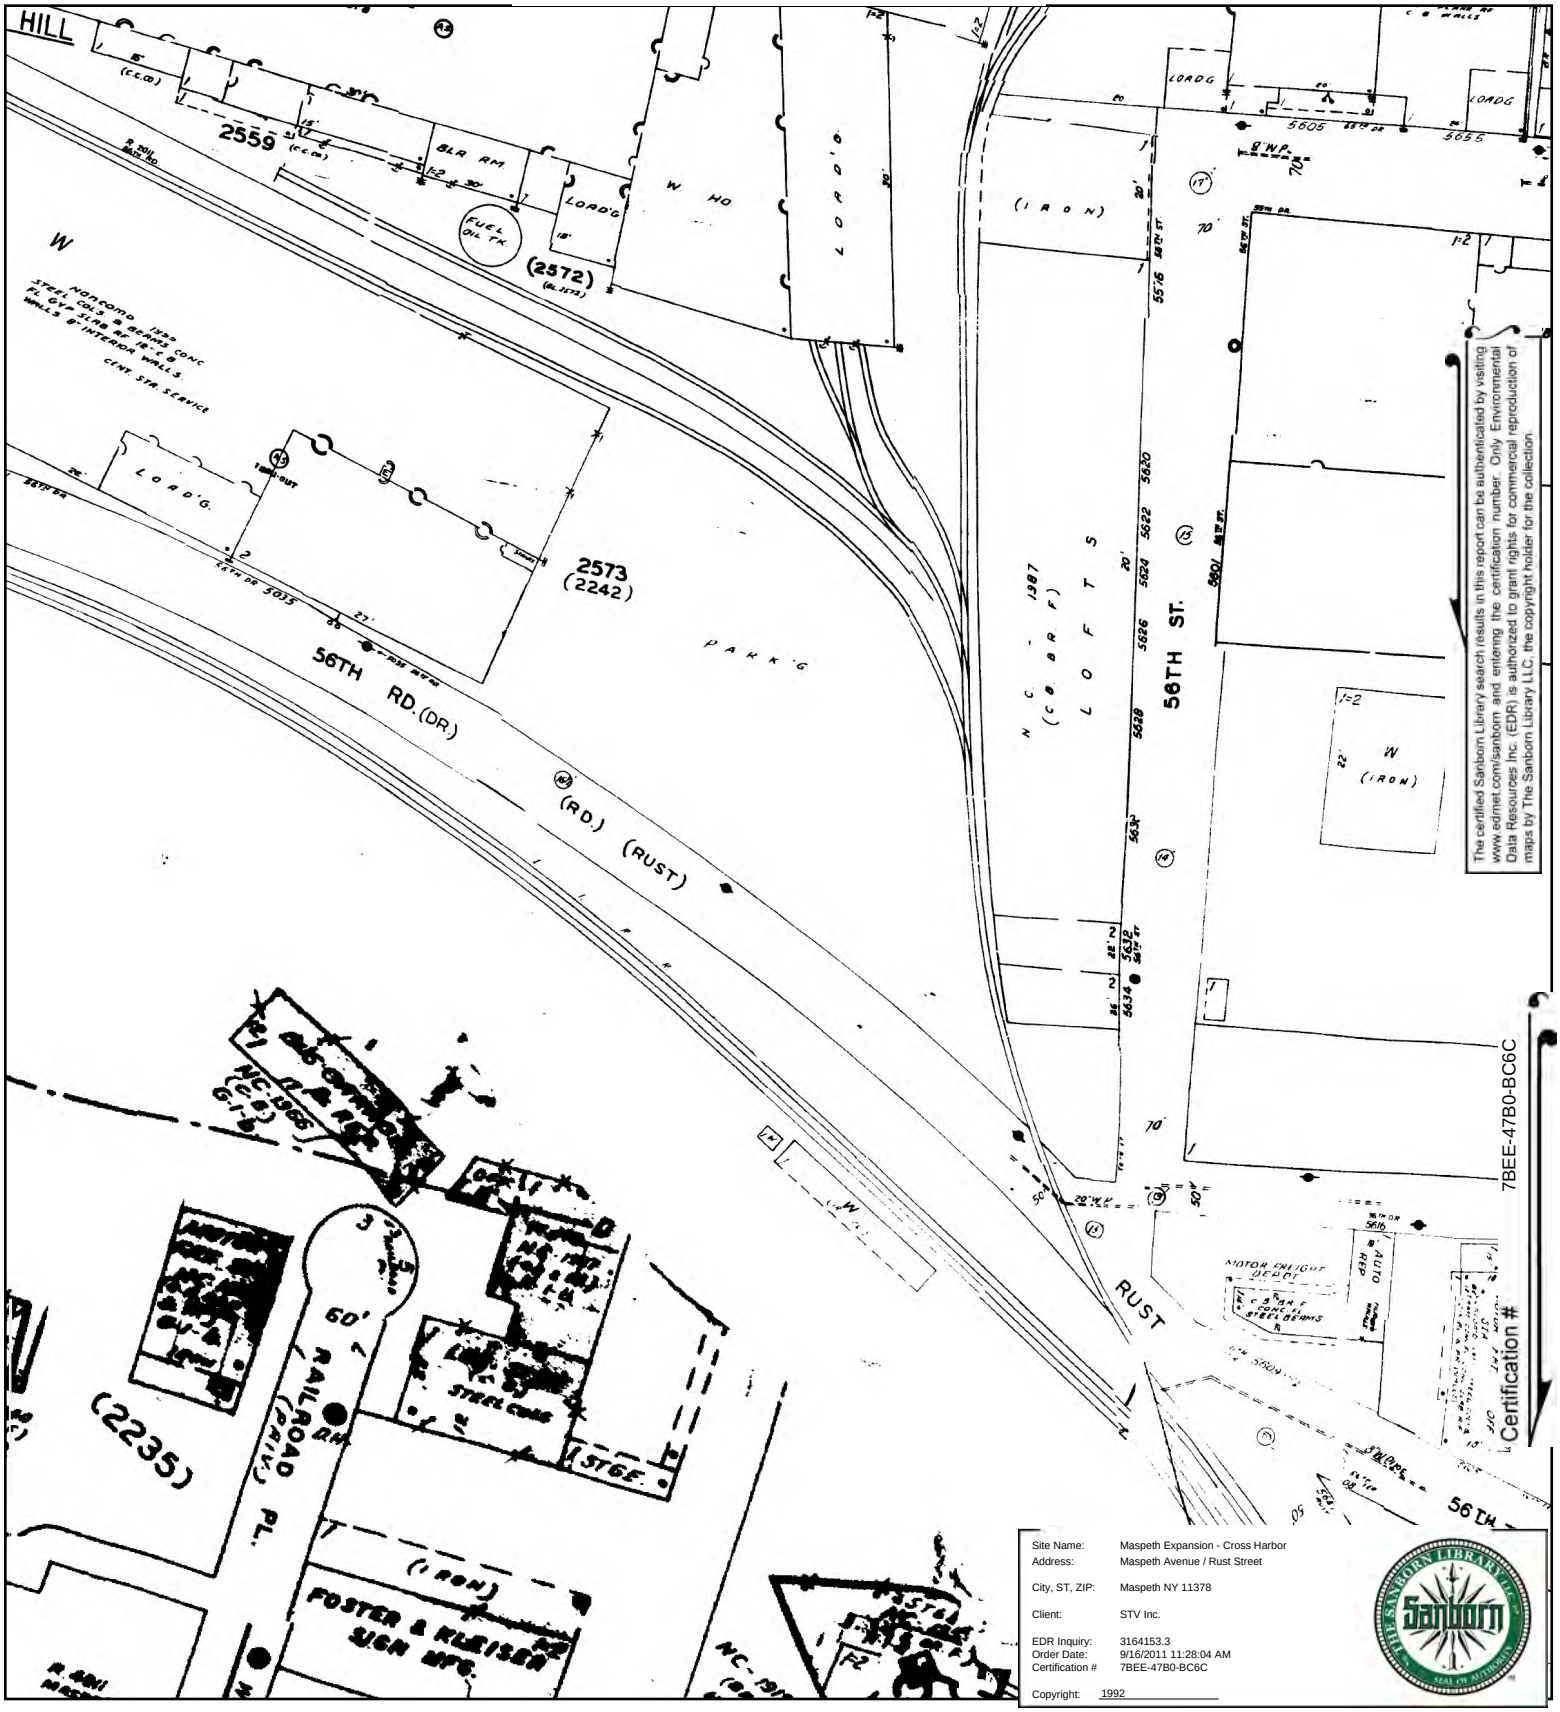

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

7BEE-47B0-BC6C Certification #

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1992

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

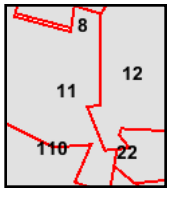

Volume 3, Sheet 110
Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22

0 Feet 165 330 660

N

1991 Certified Sanborn Map

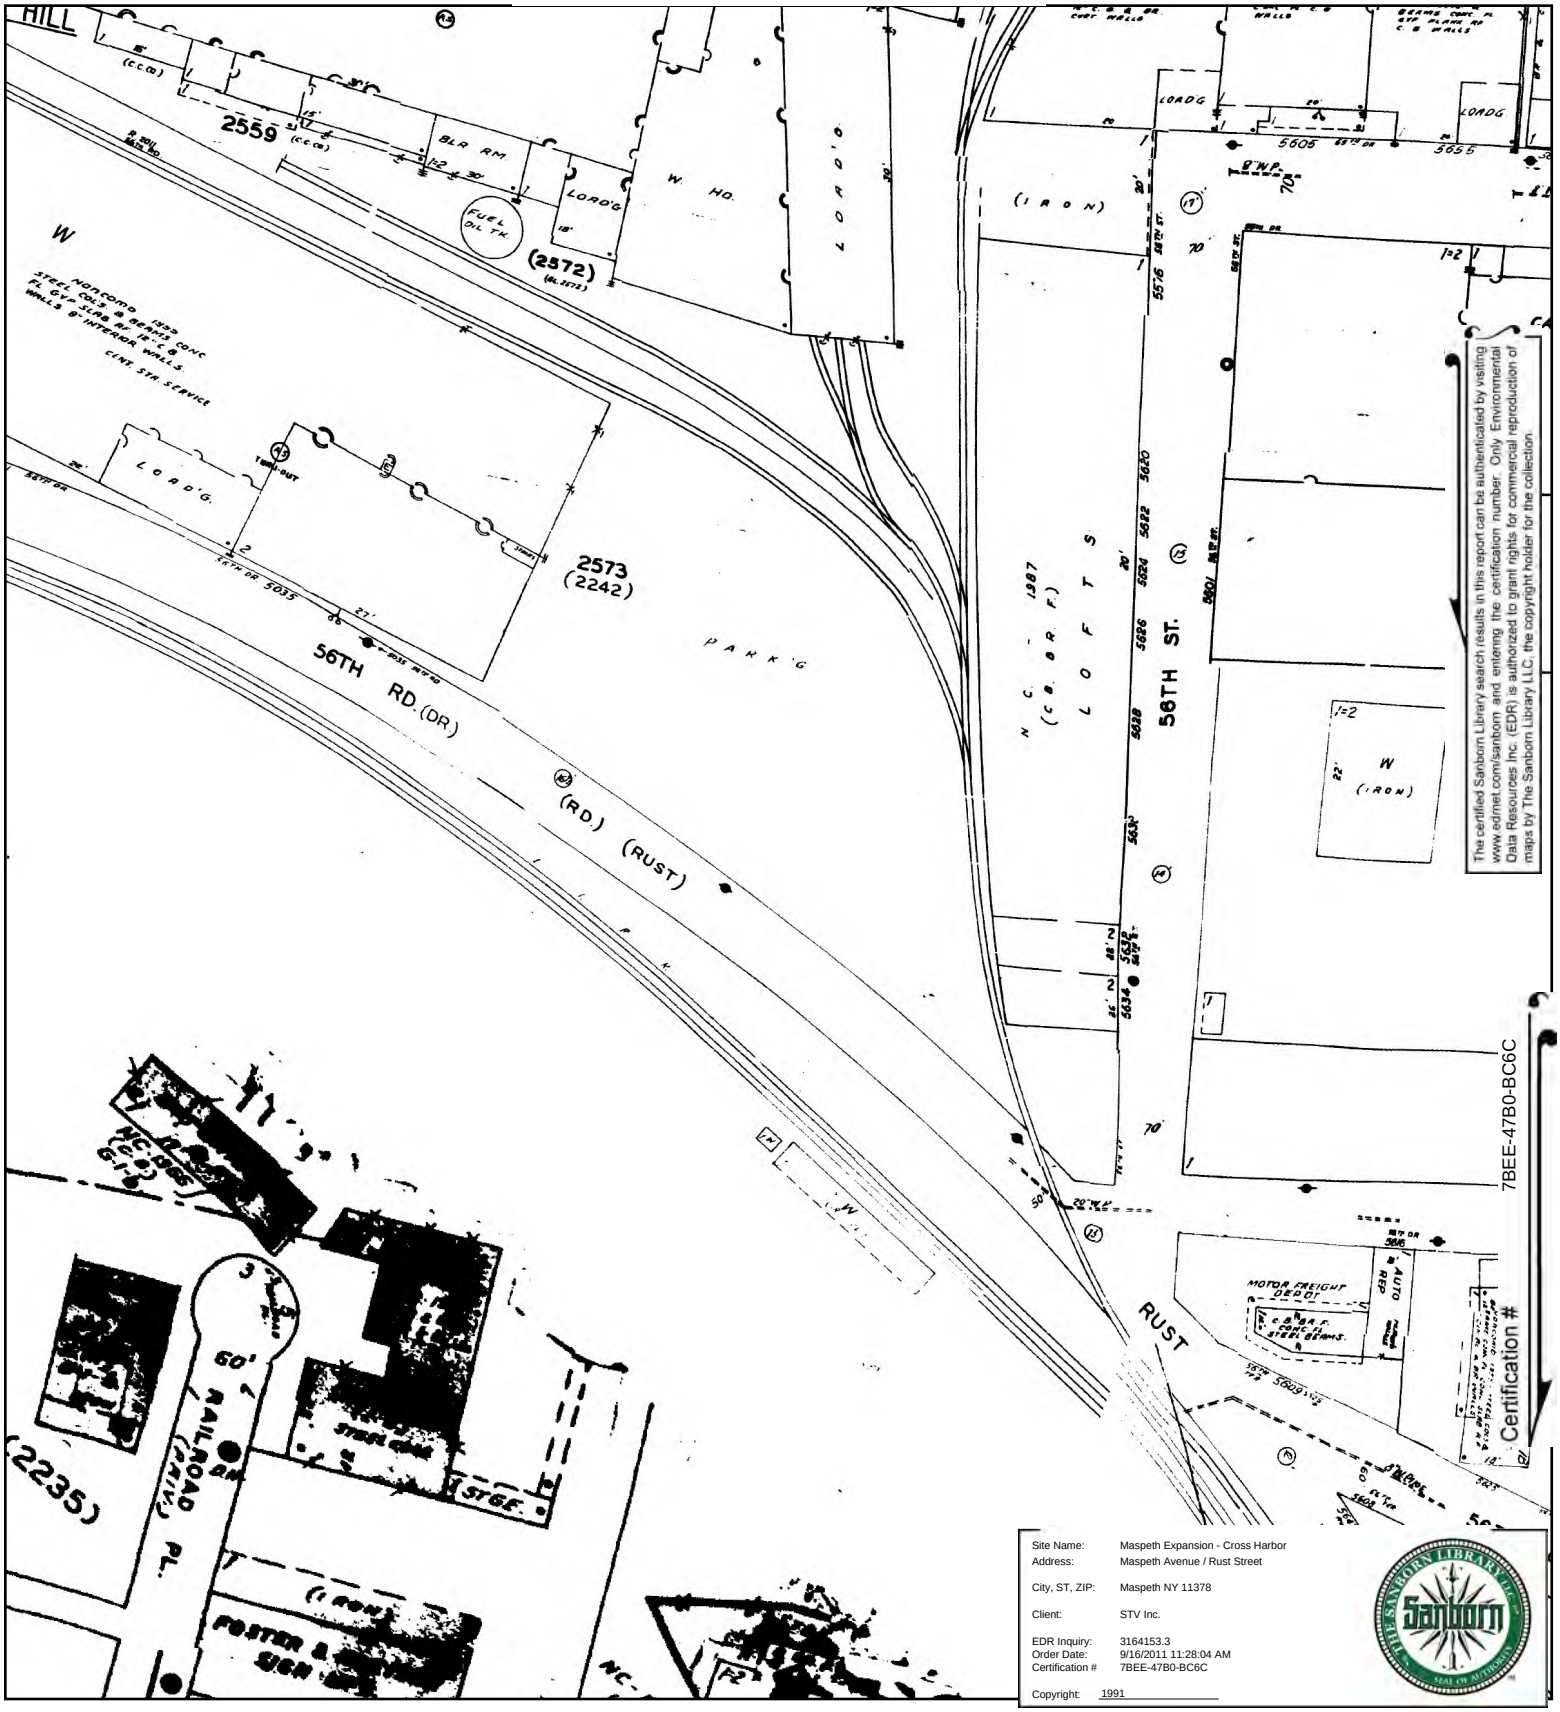

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1991

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

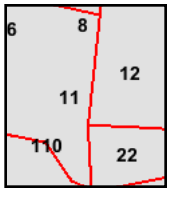

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

0 Feet 165 330 660

N

1990 Certified Sanborn Map

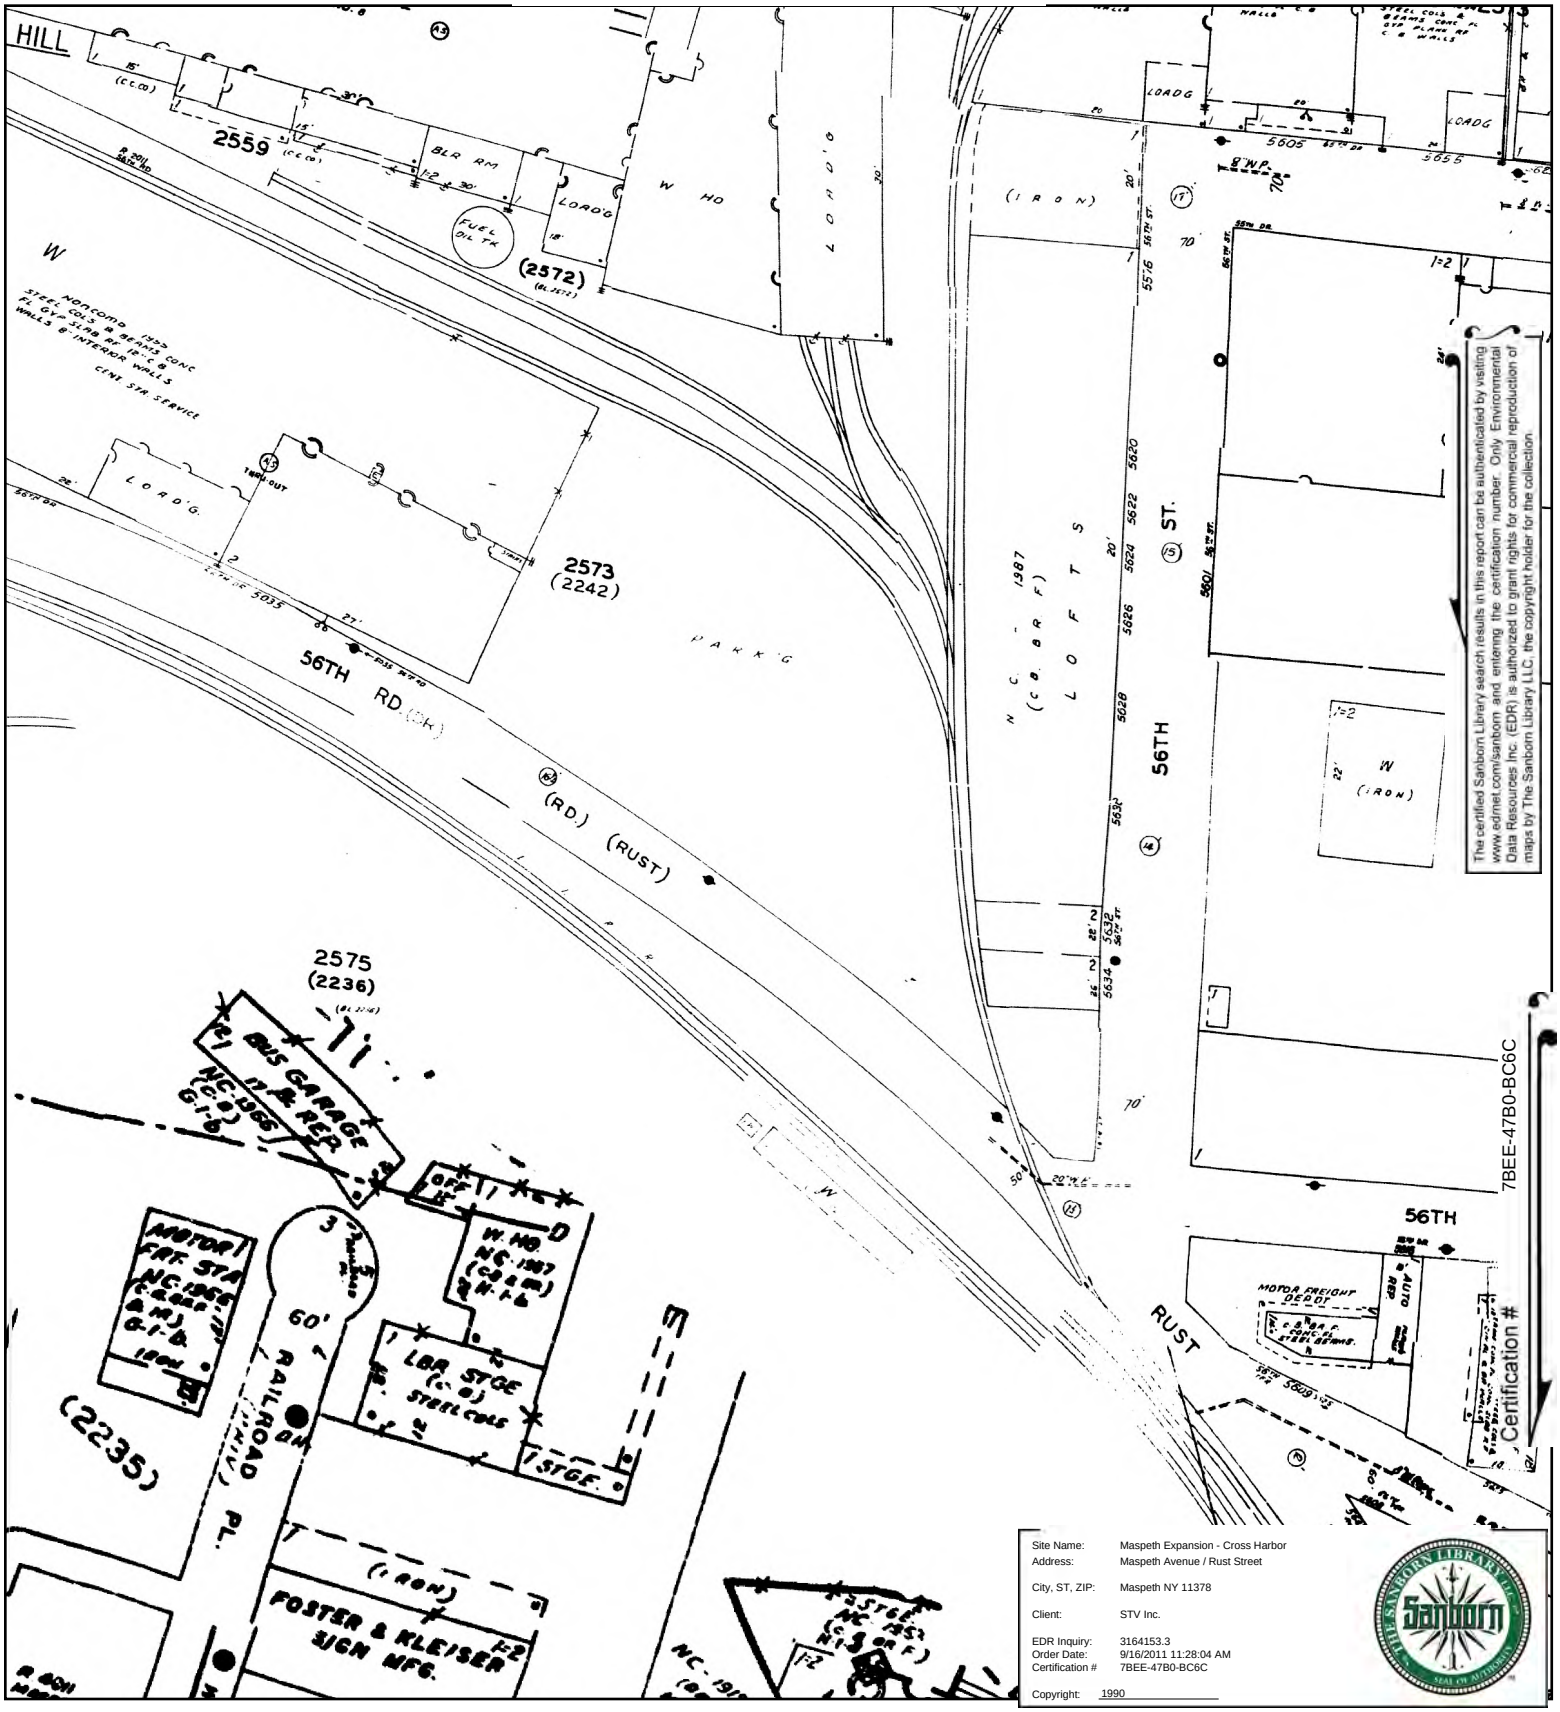

1988 Certified Sanborn Map

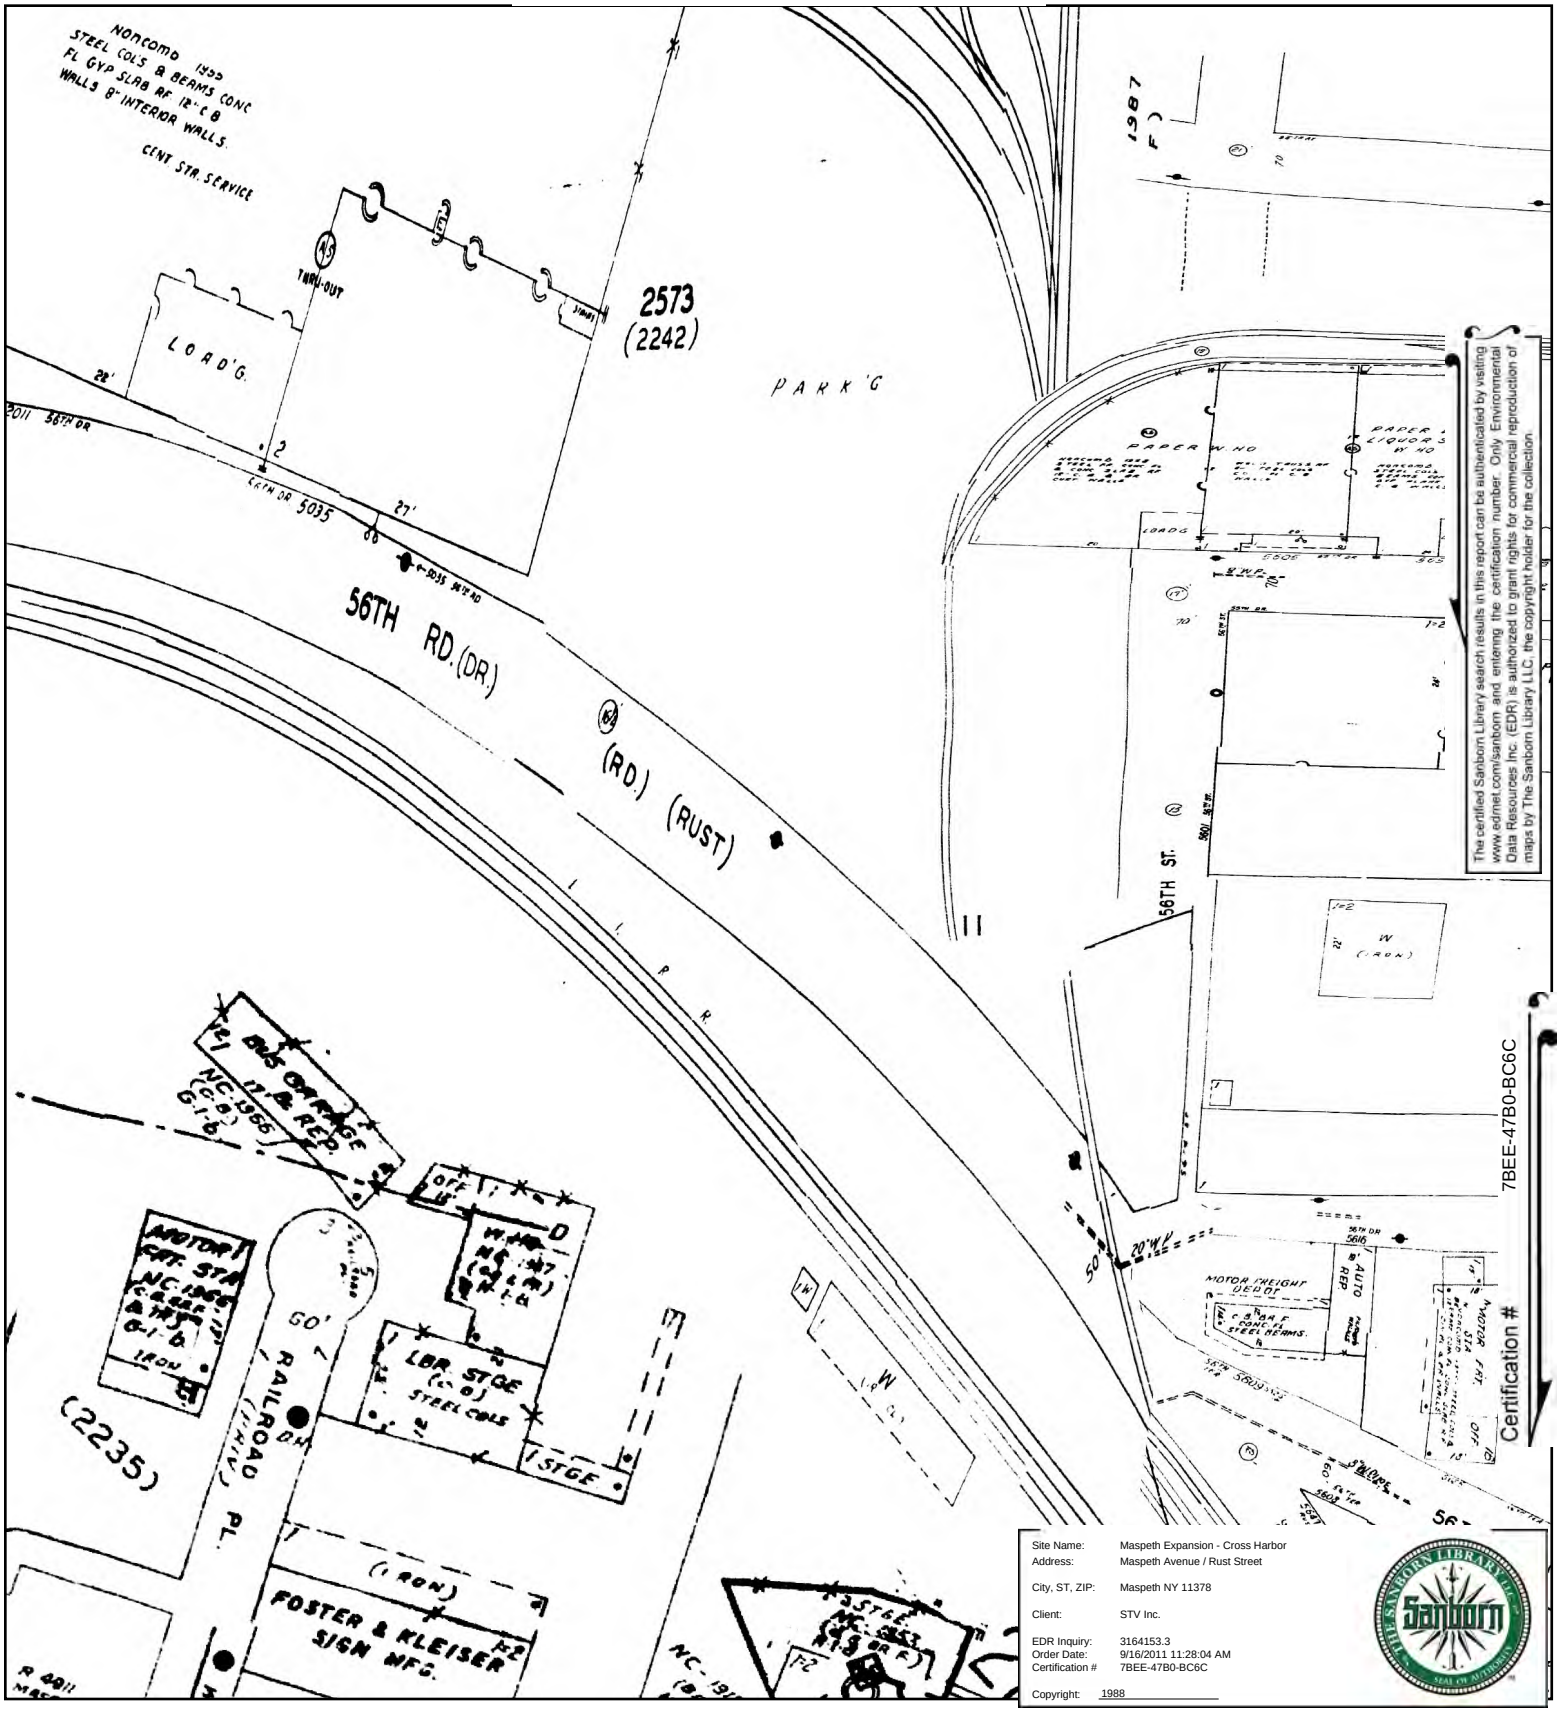

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1988

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

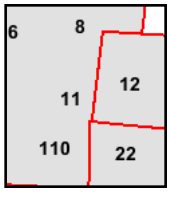

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1986 Certified Sanborn Map

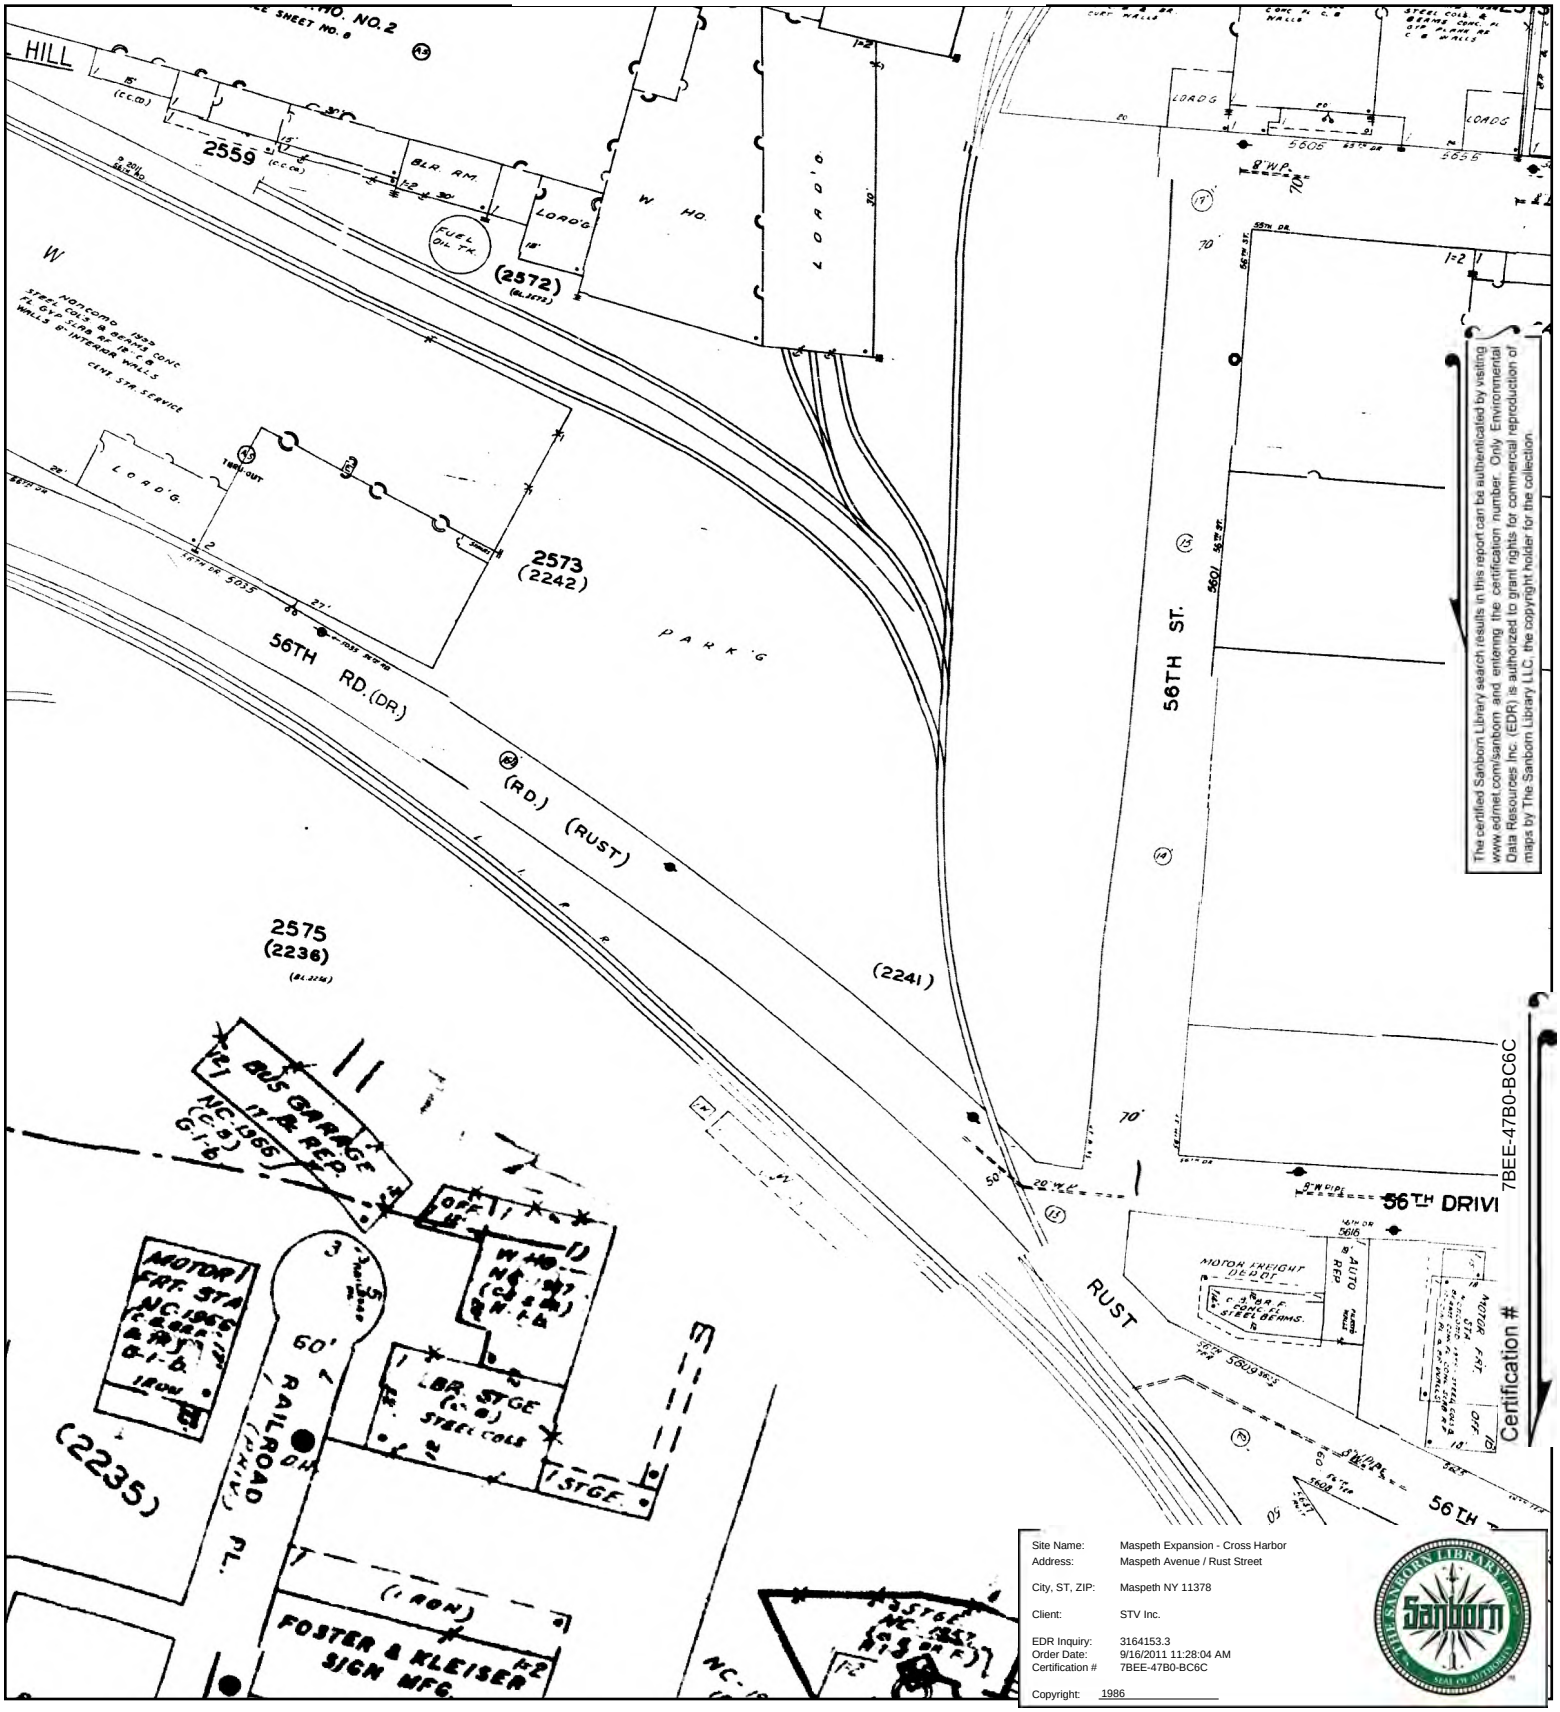

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1986

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

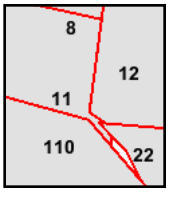

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1999 Certified Sanborn Map

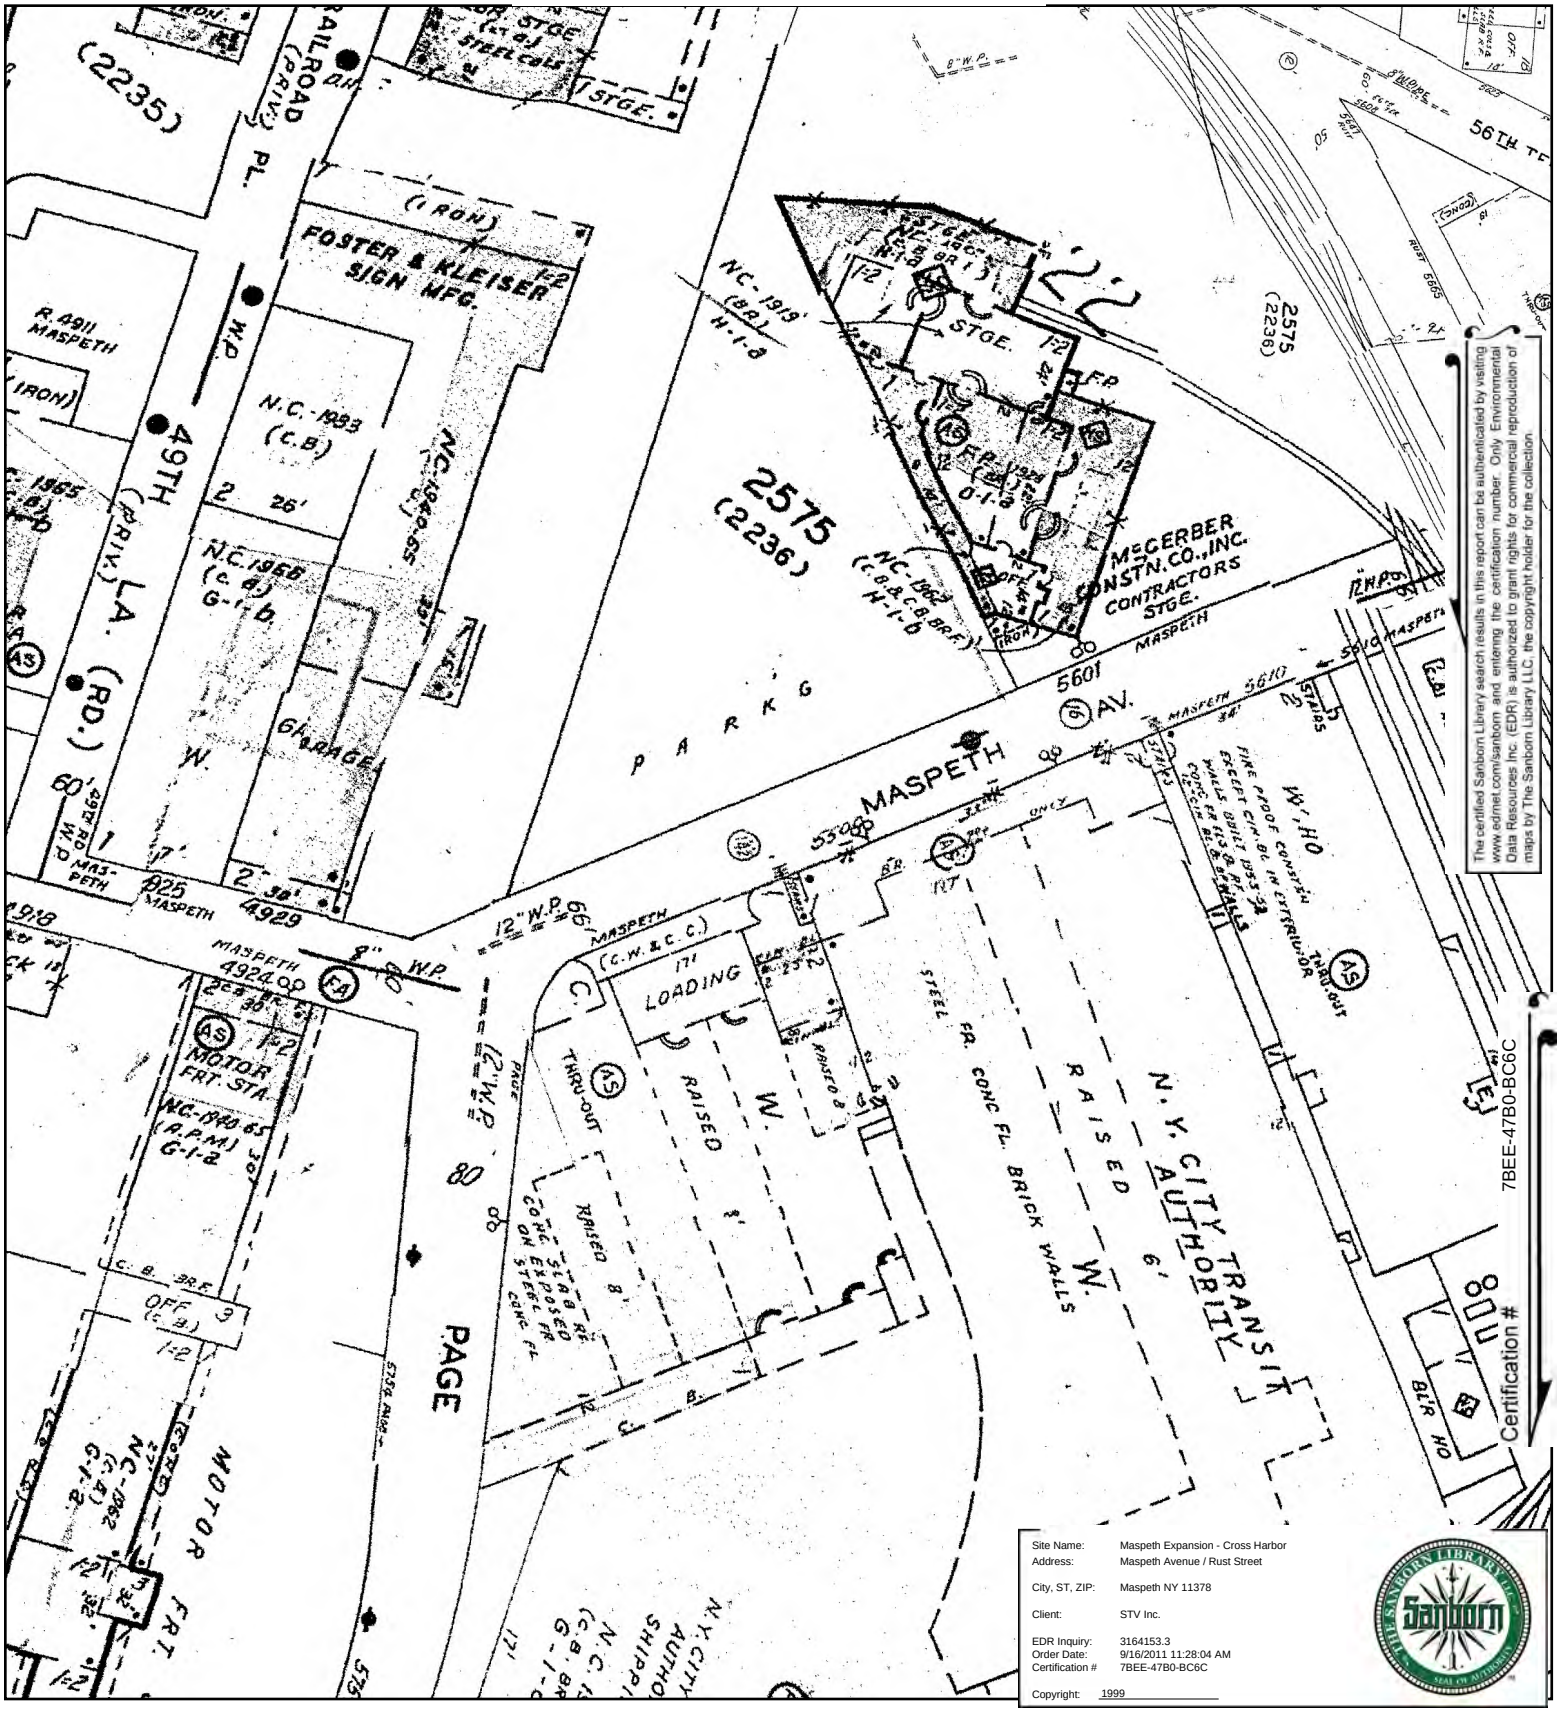

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

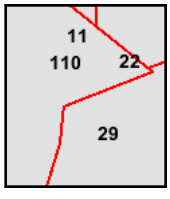

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1996 Certified Sanborn Map

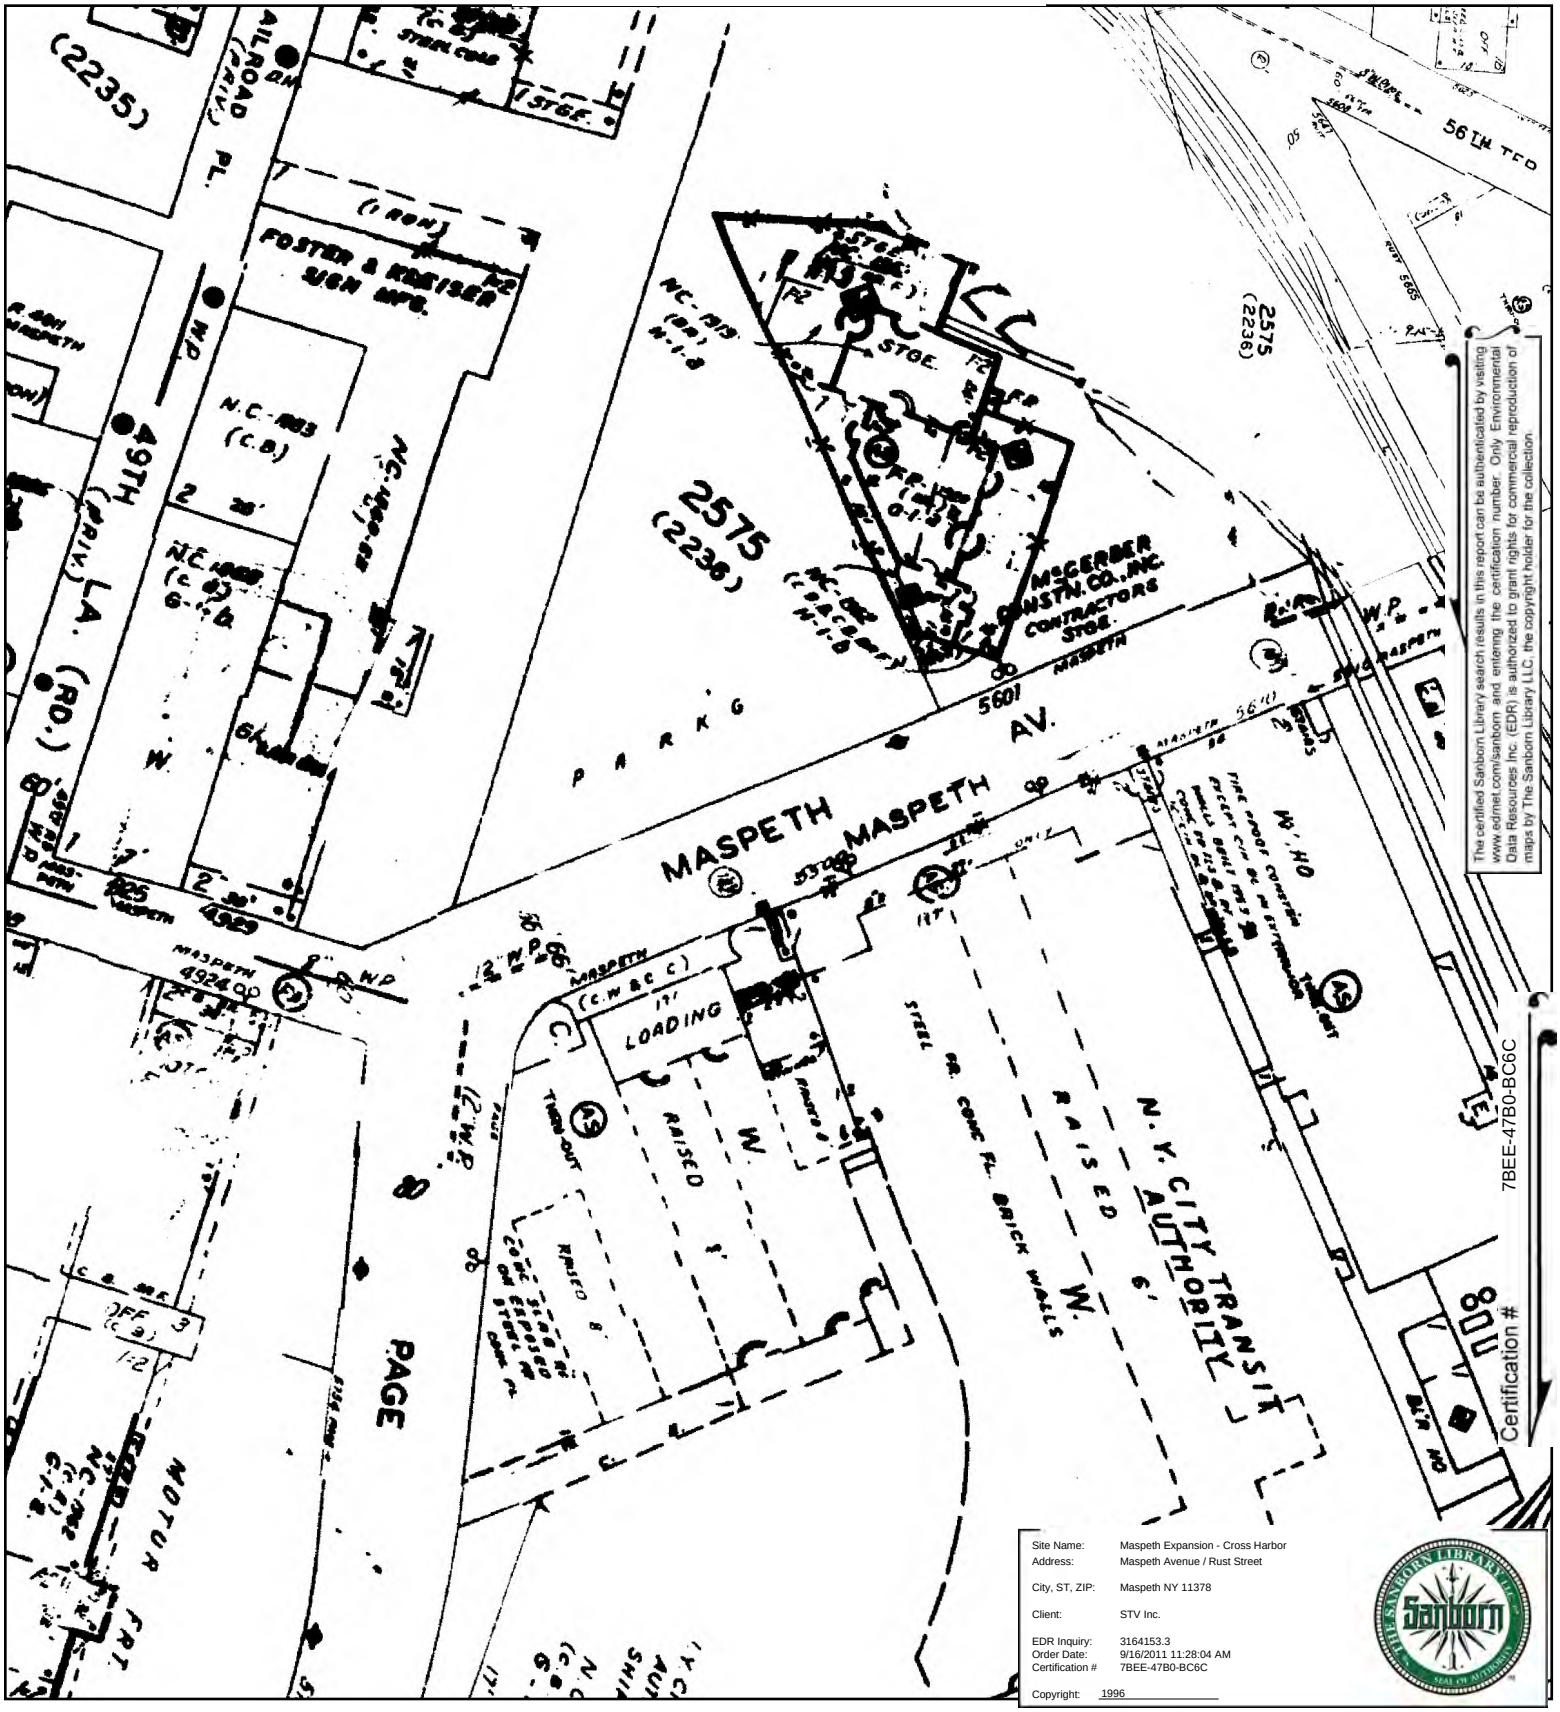

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

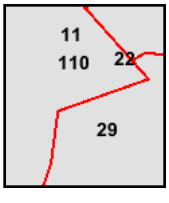

Volume 3, Sheet 110
Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1995 Certified Sanborn Map

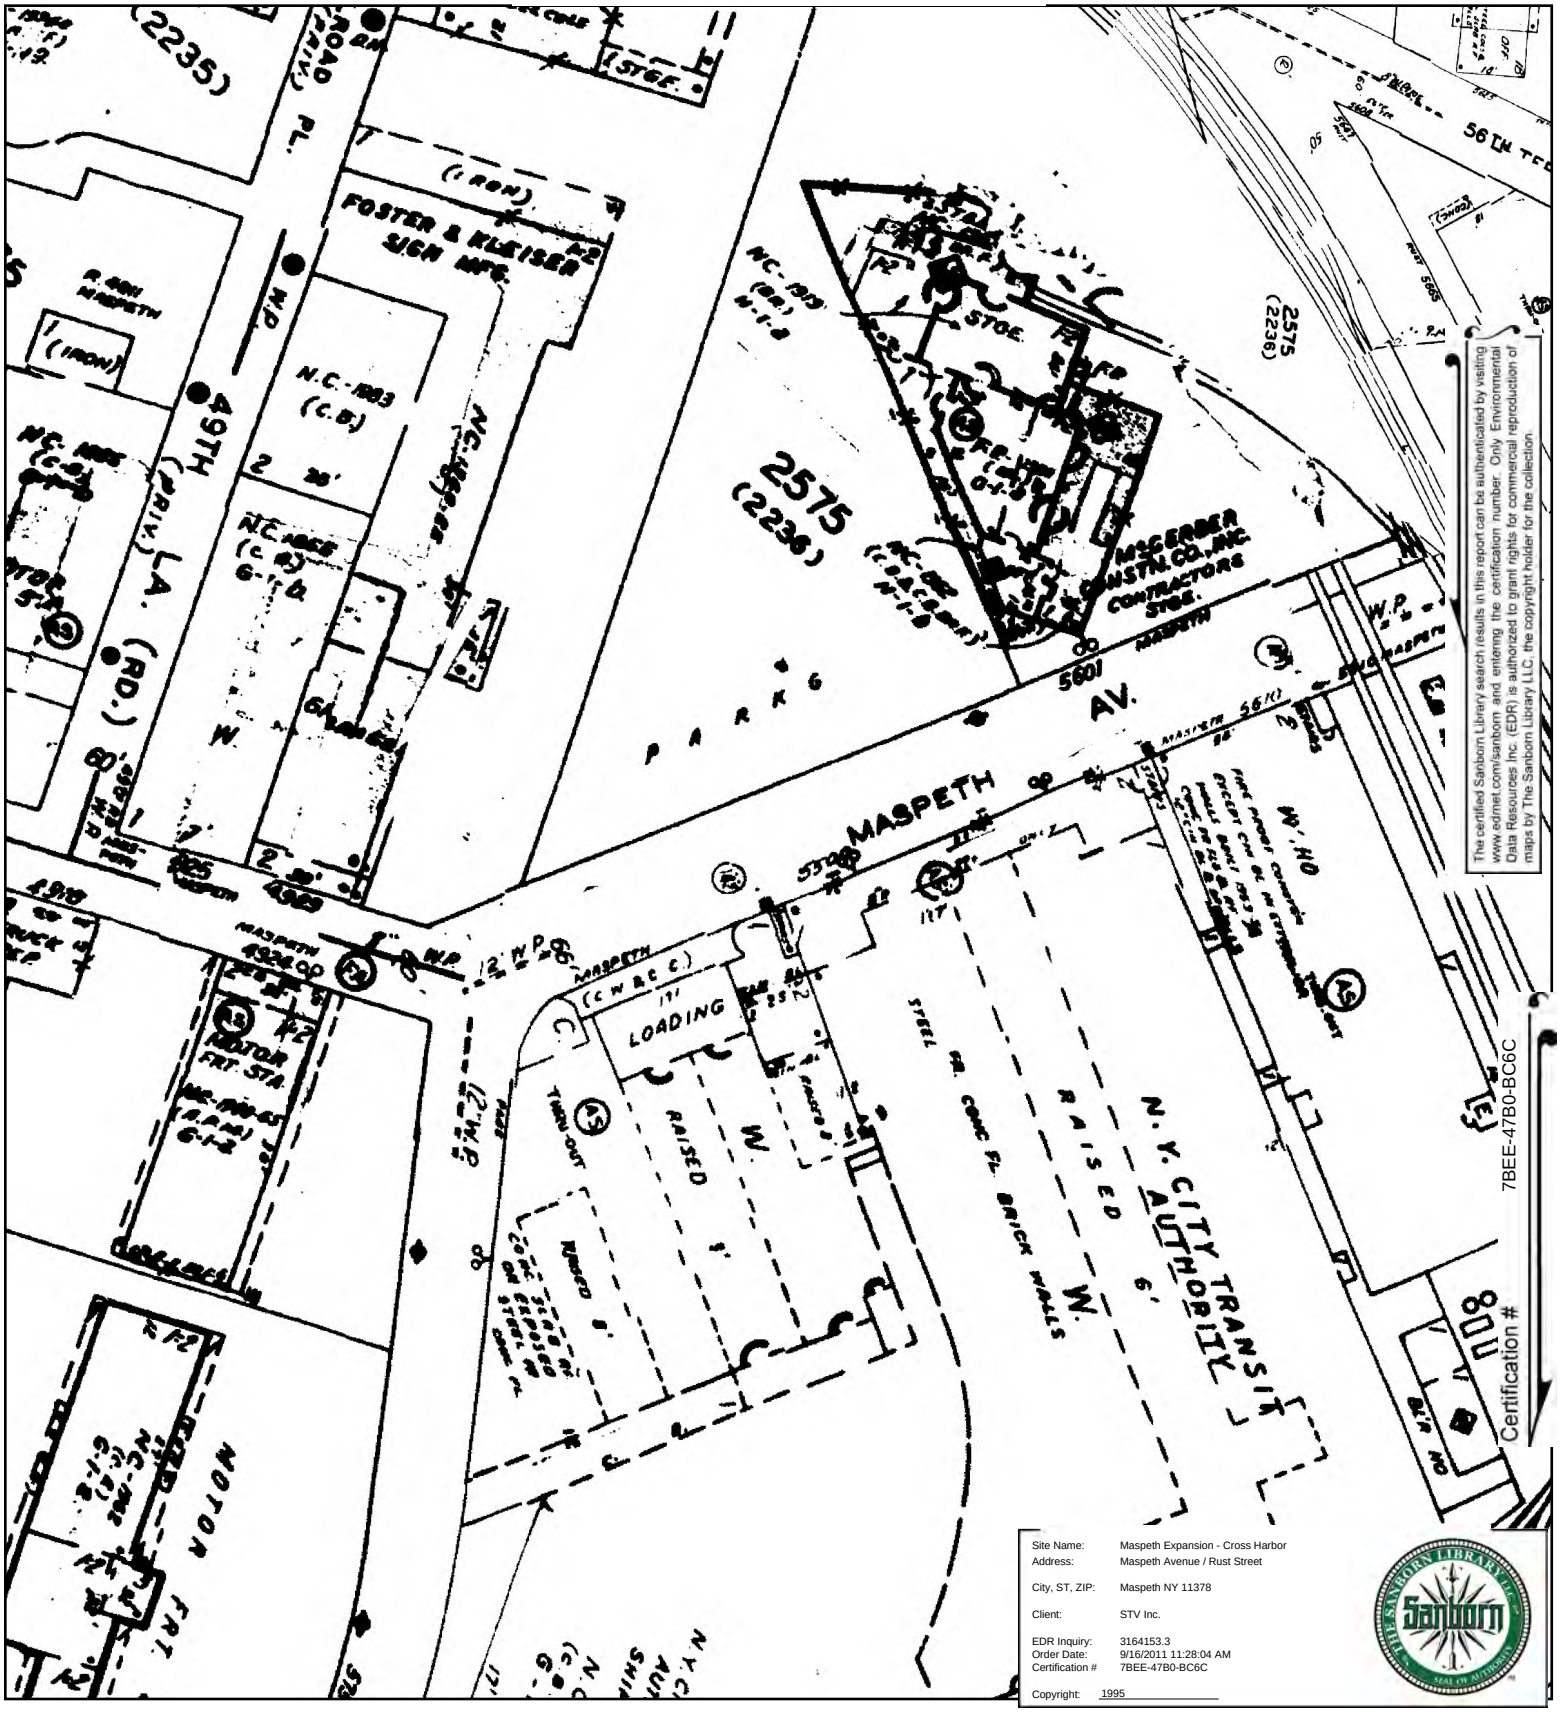

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1995

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

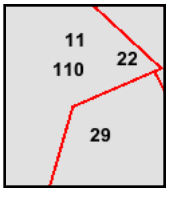

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1994 Certified Sanborn Map

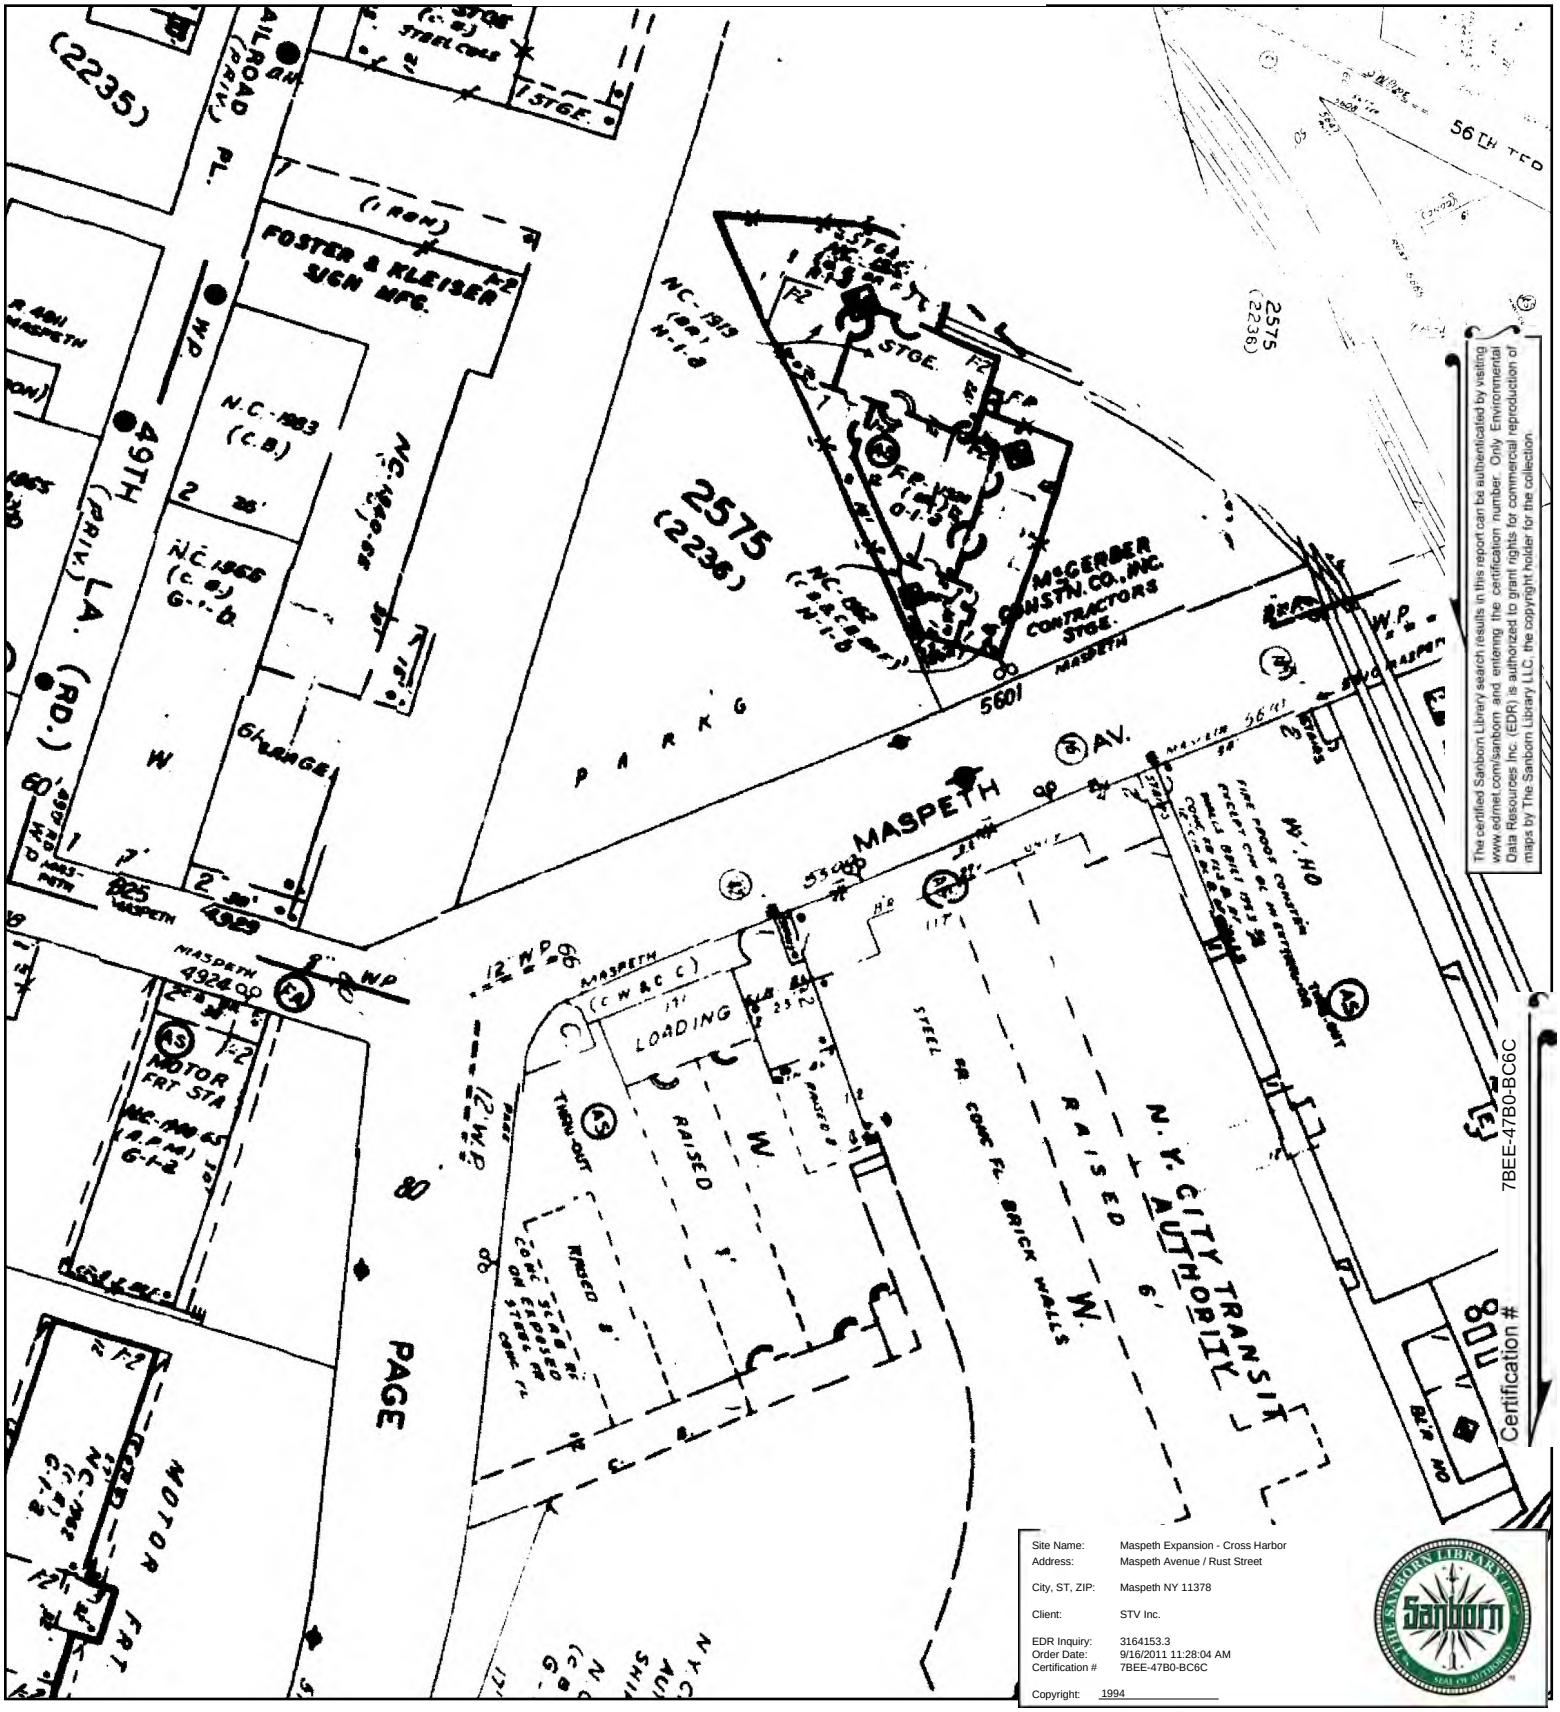

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

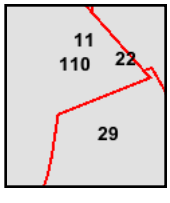

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1993 Certified Sanborn Map

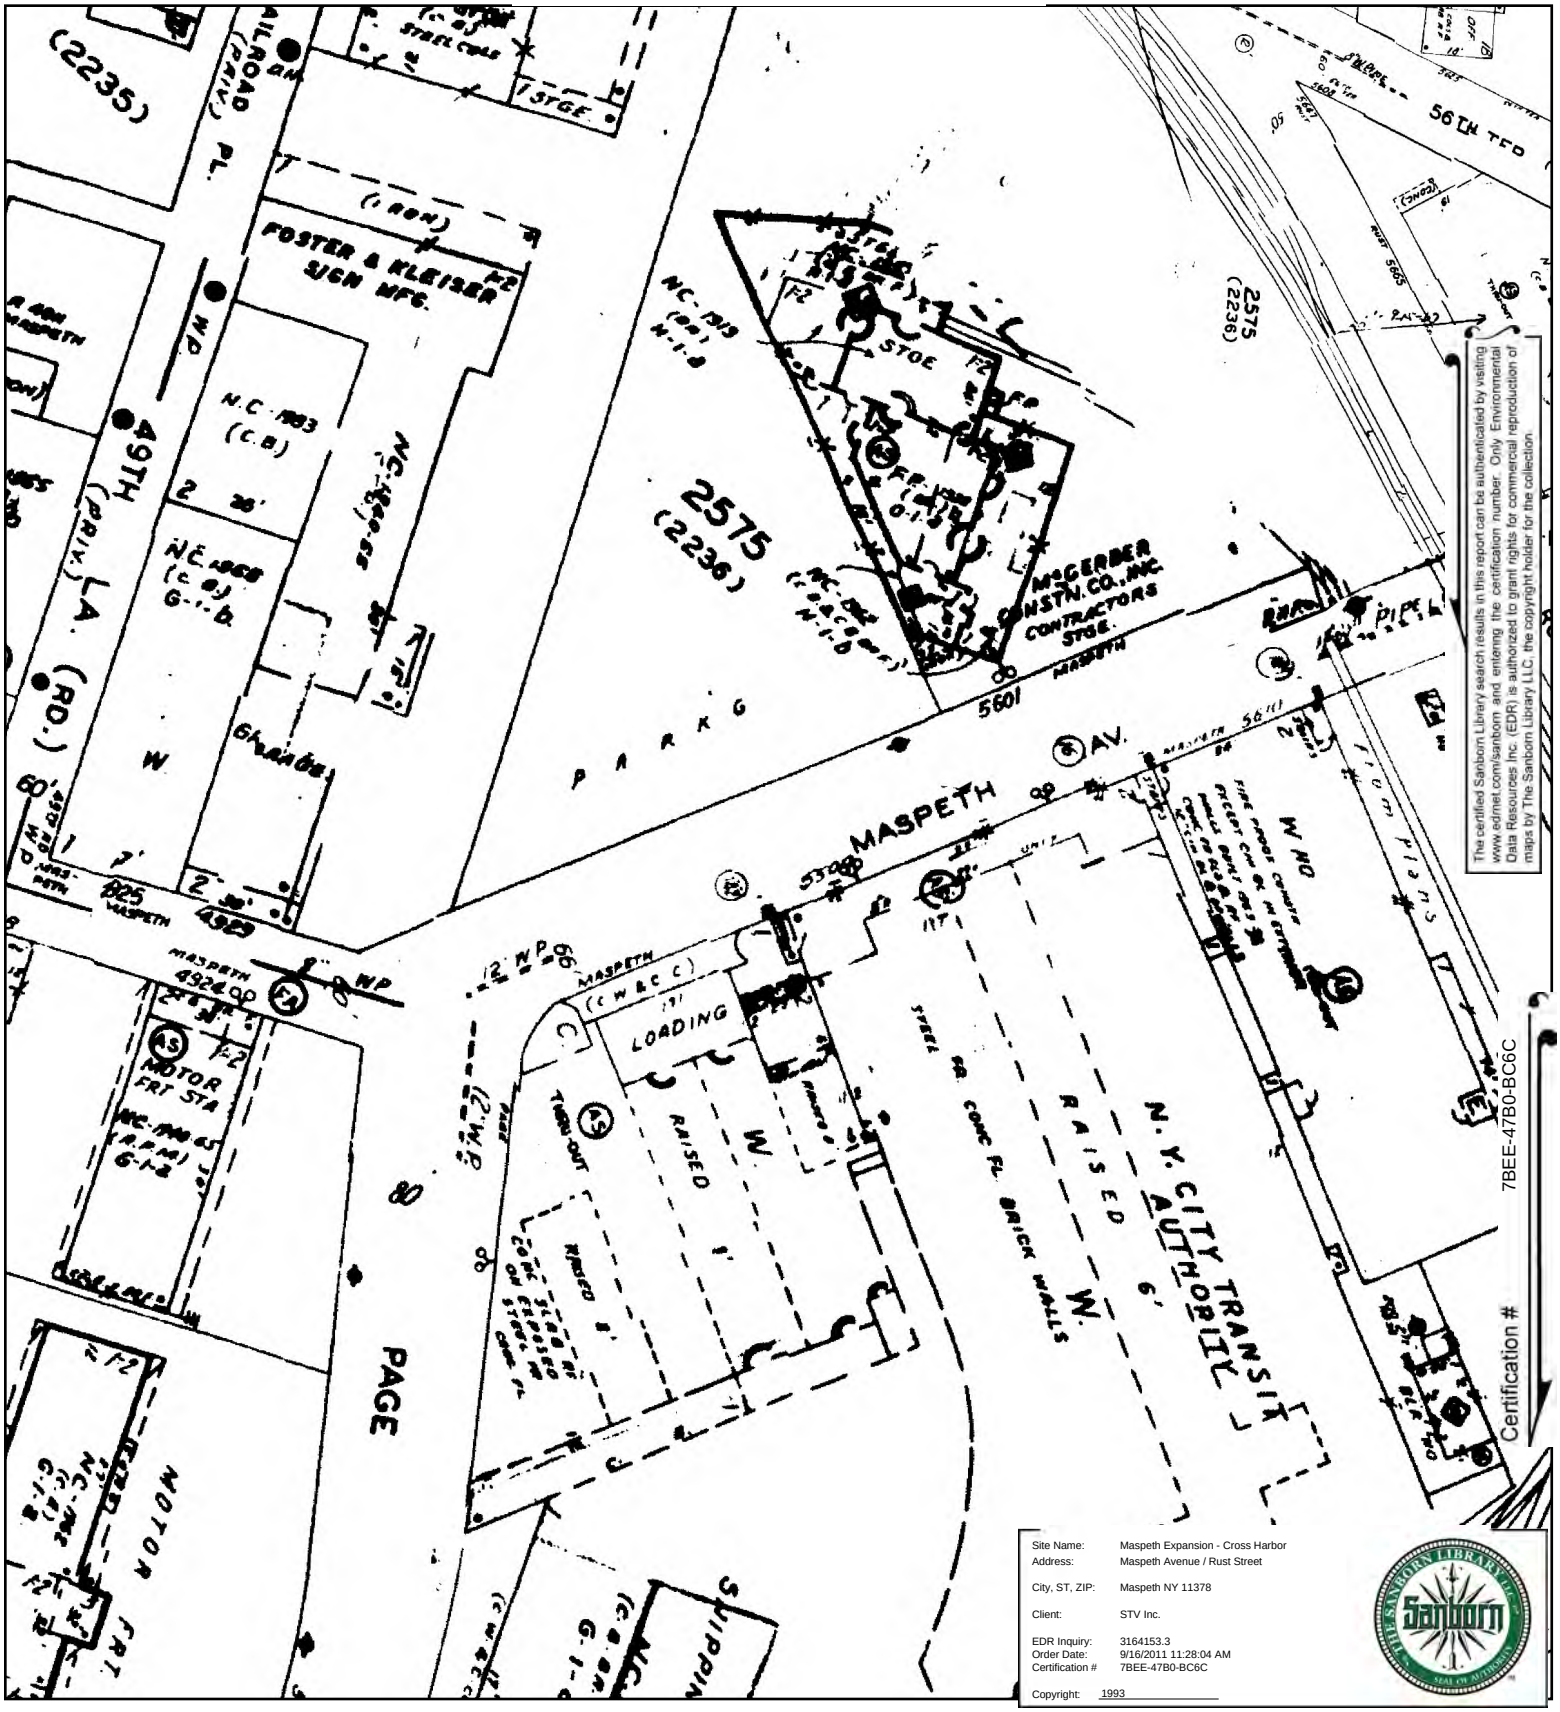

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

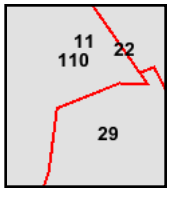

Volume 3, Sheet 110
Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1992 Certified Sanborn Map

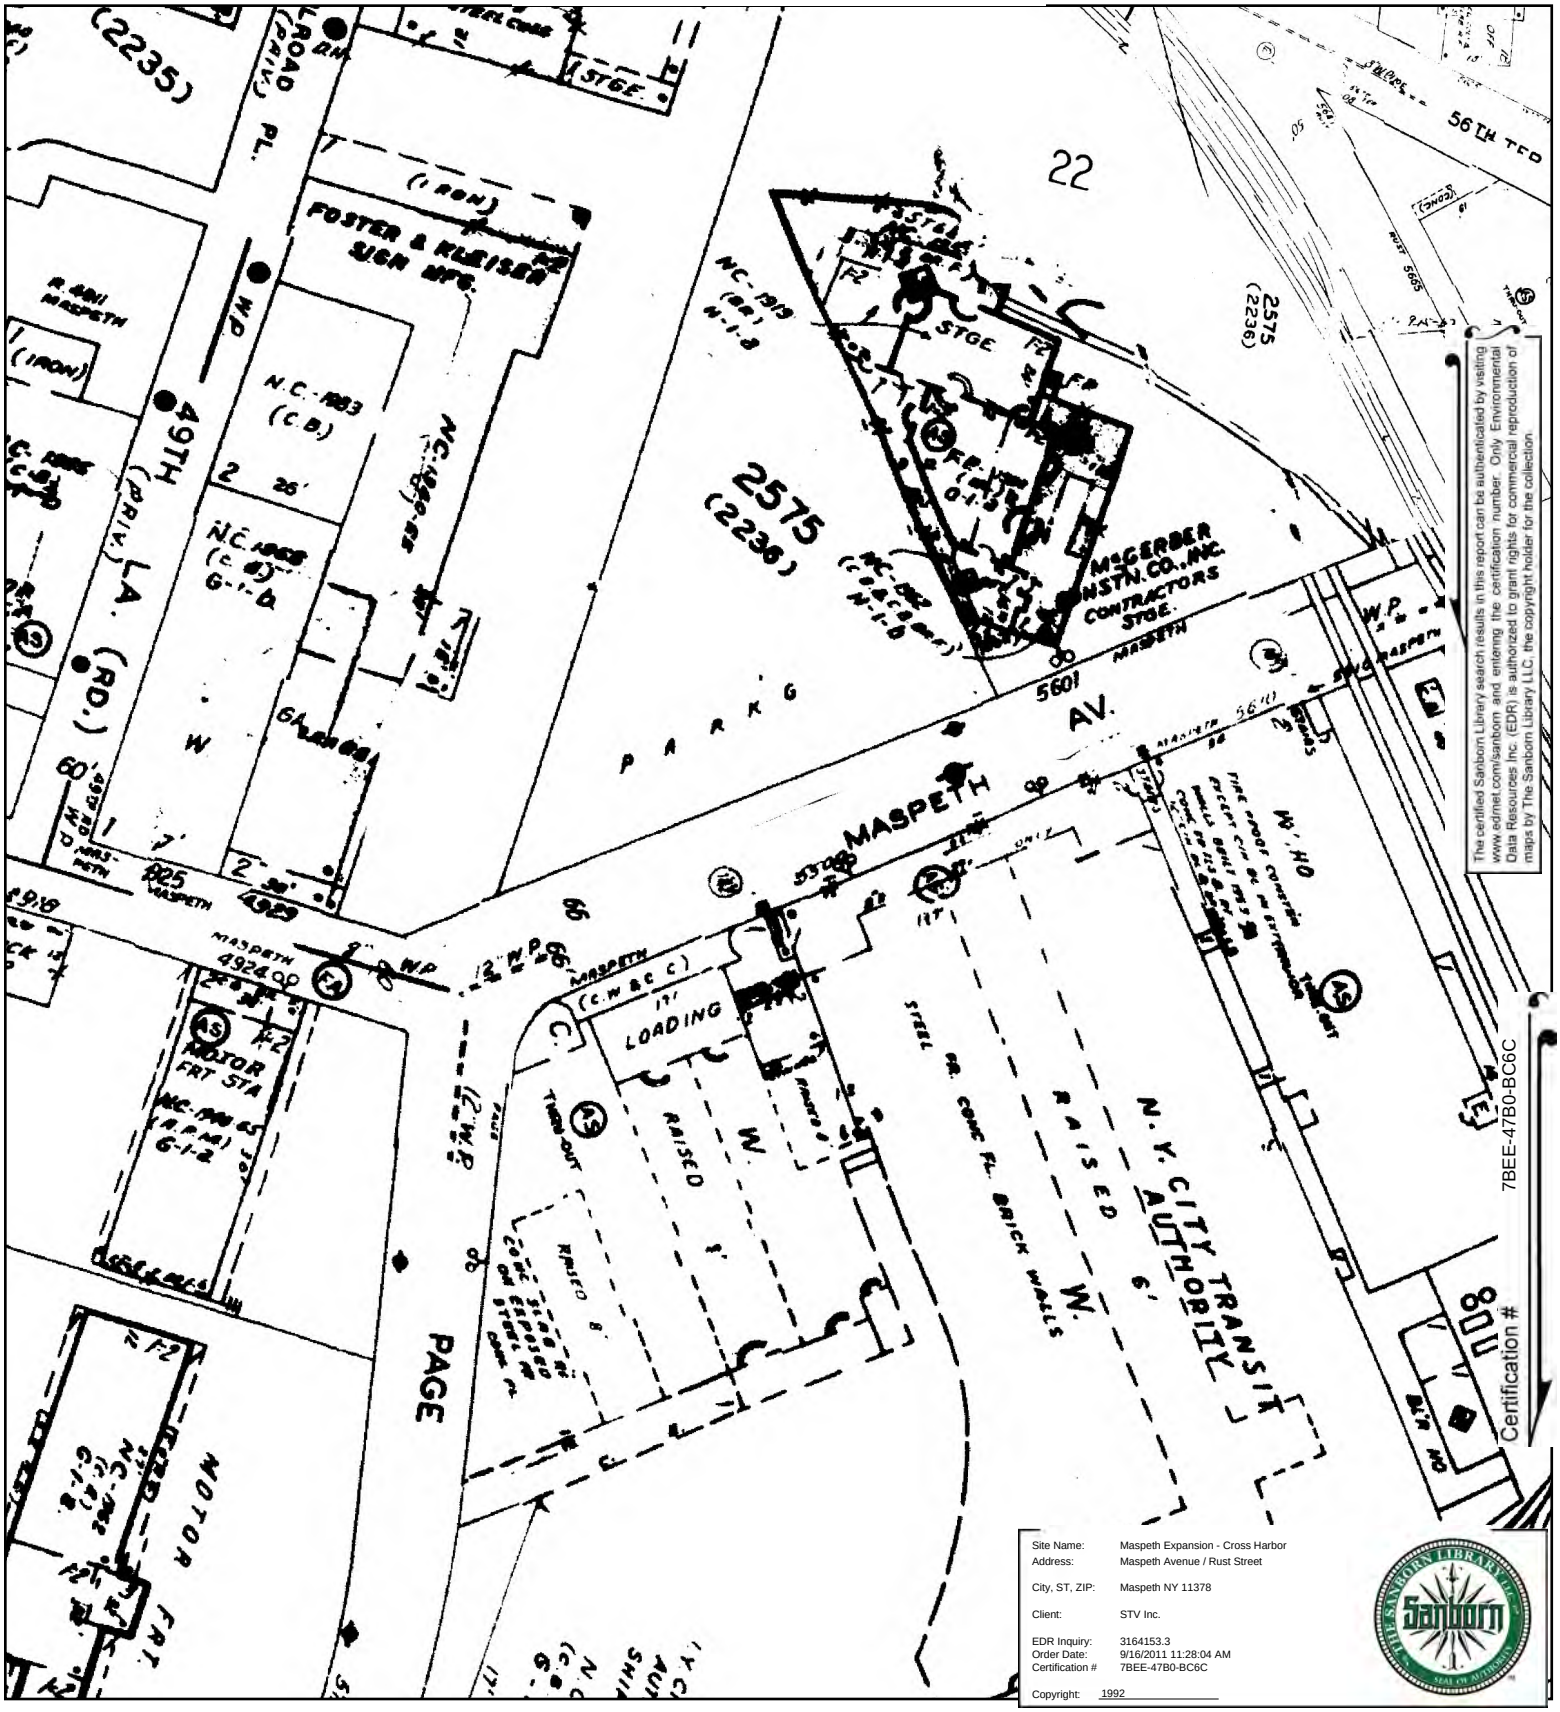

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1992

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

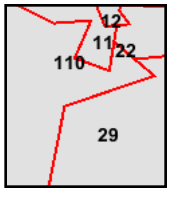

Volume 3, Sheet 110
Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29

N

1991 Certified Sanborn Map

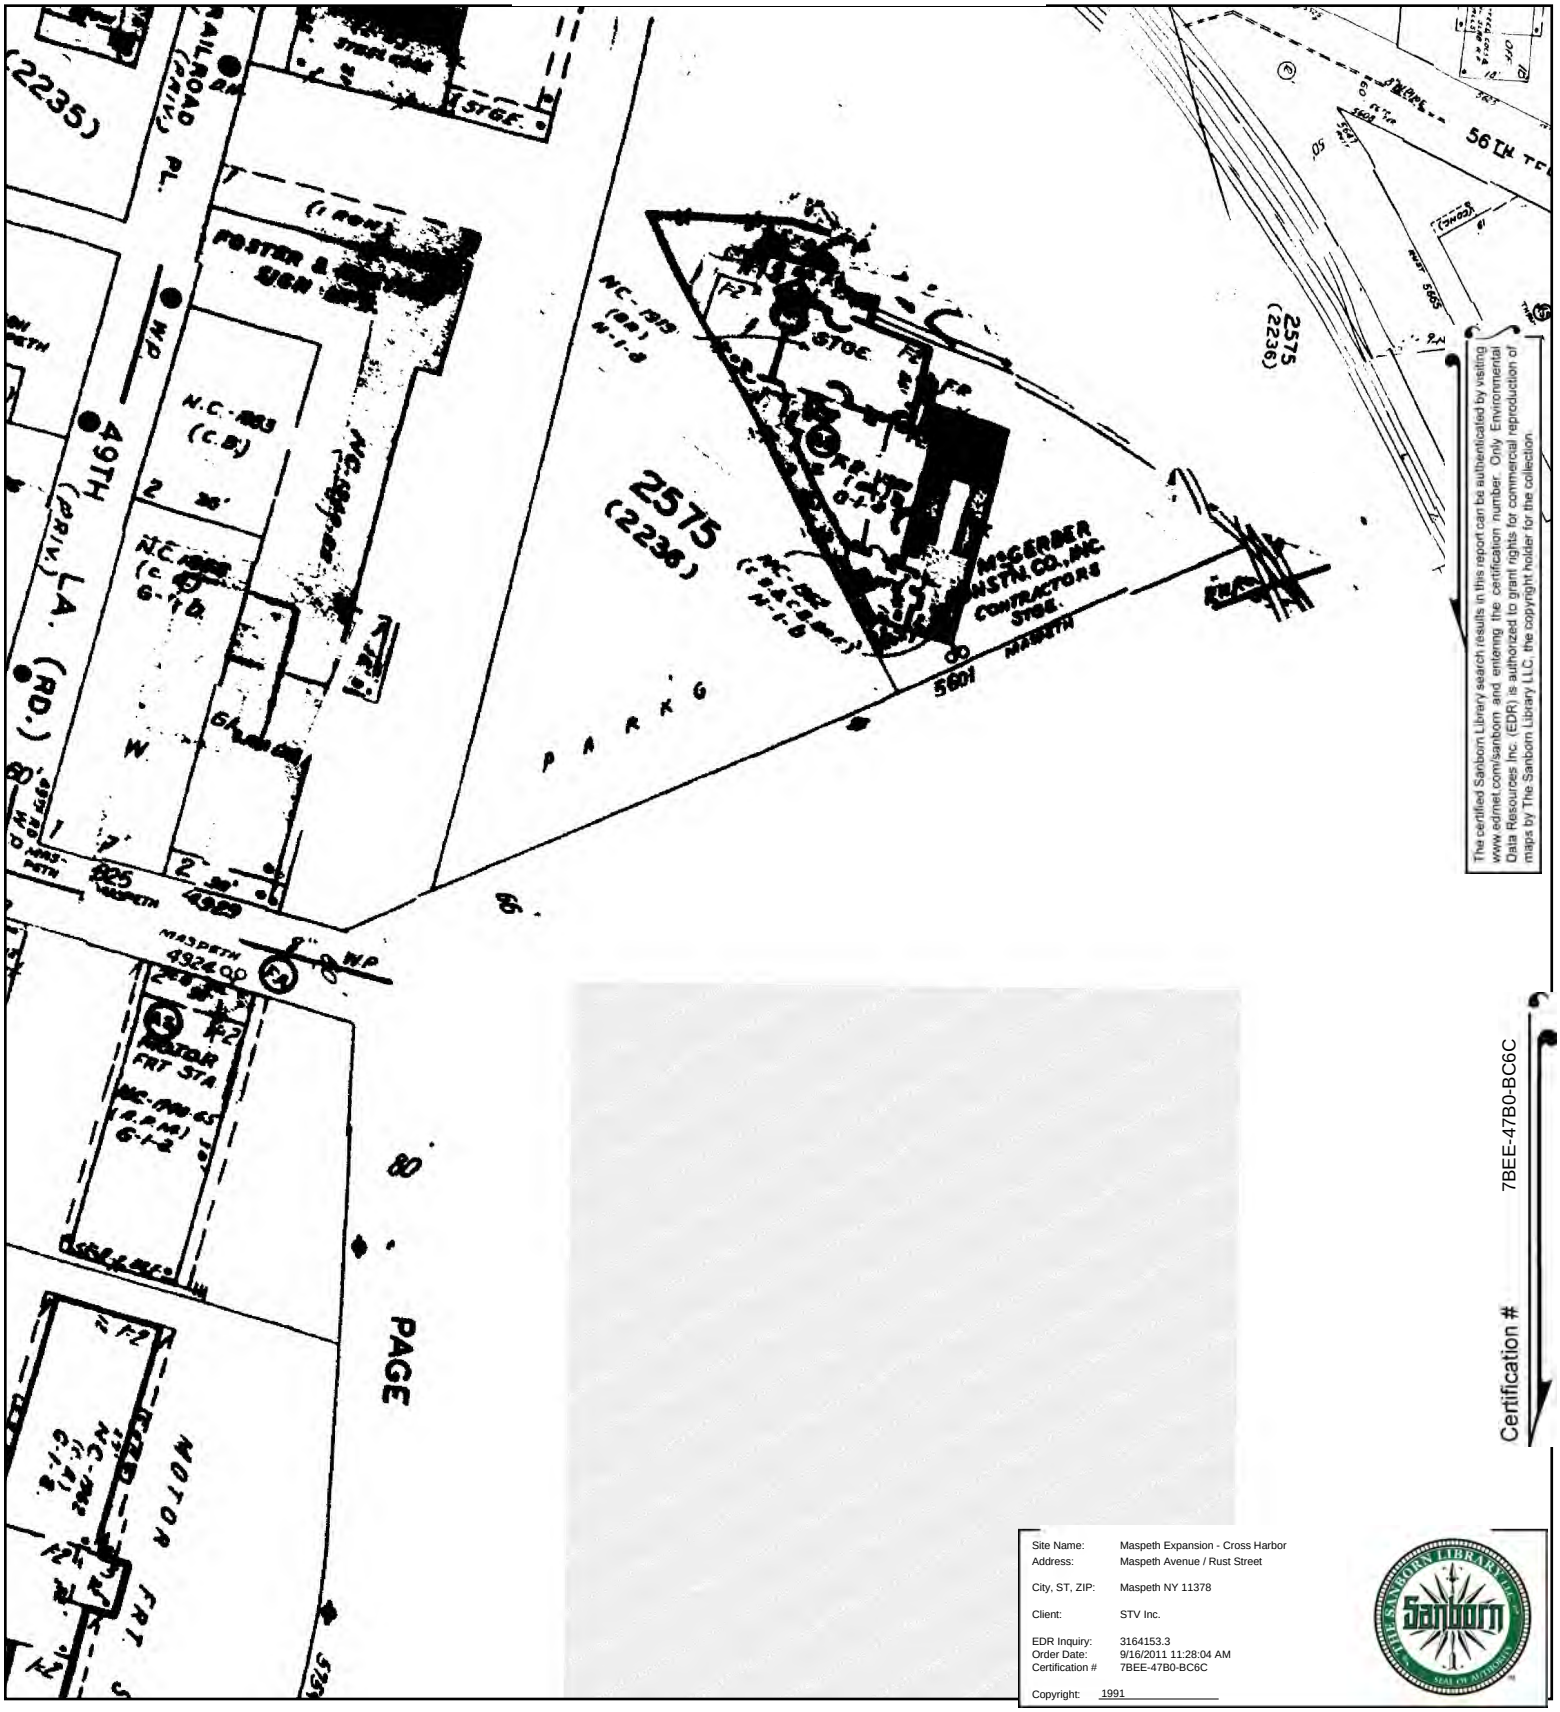
49TH
LA. (RD.)
MASPETH
PAGE
MOTOR
FRT STA
2575
(2236)
MCGERBER
INSTN. CO., INC.
CONTRACTORS
STGE.
5601
PARK
56TH
2575
(2236)
(2235)
RAILROAD
(PRIV.)
FOSTER &
STGE.
N.C.-B3
(C.B.)
N.C.-B3
(C.B.)
MASPETH
4924.00
MASPETH
4925
4925
STGE.
N.C.-R3
(C.B.)
N.C.-R3
(C.B.)
N.C.-R3
(C.B.)

Maspeth Expansion - Cross Harbor
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Inquiry Number: 3164153.3
September 16, 2011

Certified Sanborn® Map Report

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

9/16/11

Site Name:
Maspeth Expansion - Cross
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Client Name:
STV Inc.
225 Park Ave S
New York, NY 10003

EDR Inquiry # 3164153.3

Contact: Doane E. Cafferty

The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by STV Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, State, Zip: Maspeth, NY 11378
Cross Street:
P.O. # 4014403
Project: Cross Harbor-Maspeth Expansion
Certification # 7BEE-47B0-BC6C

Maps Provided:

2006	1999	1991	1980
2005	1996	1990	1971
2004	1995	1988	1950
2003	1994	1986	1936
2002	1993	1985	1914
2001	1992	1982	

Sanborn® Library search results
Certification # 7BEE-47B0-BC6C

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ✓ Library of Congress
- ✓ University Publications of America
- ✓ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

STV Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

2006 Source Sheets

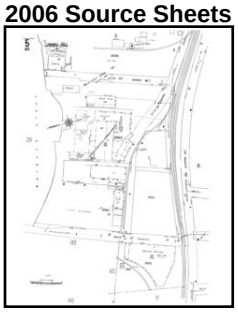
Volume 3, Sheet 5

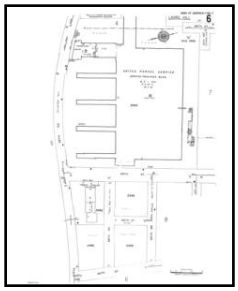
Volume 3, Sheet 6

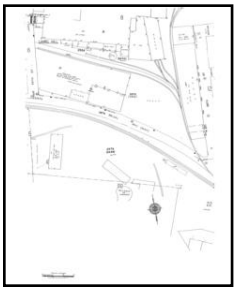
Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

2005 Source Sheets

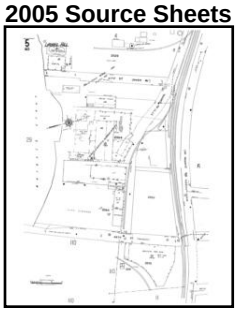
Volume 3, Sheet 5

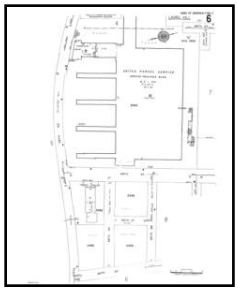
Volume 3, Sheet 6

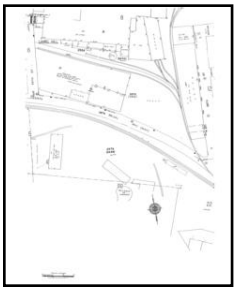
Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

2004 Source Sheets

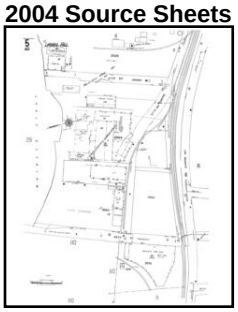
Volume 3, Sheet 5

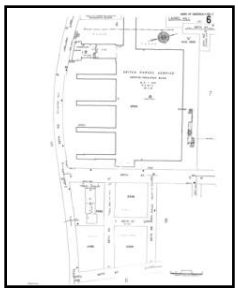
Volume 3, Sheet 6

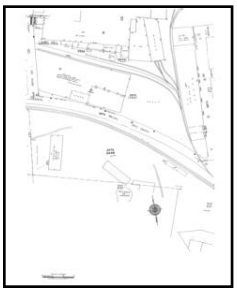
Volume 3, Sheet 11

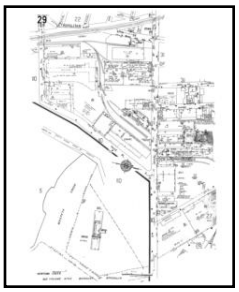
Volume 3, Sheet 29

Volume 3, Sheet 110

2003 Source Sheets

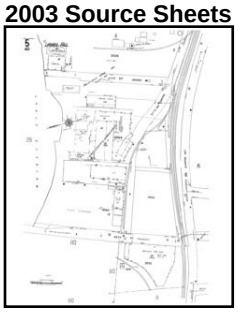
Volume 3, Sheet 5

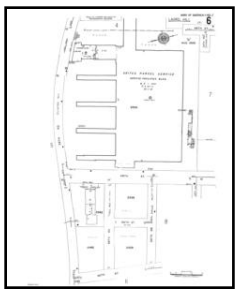
Volume 3, Sheet 6

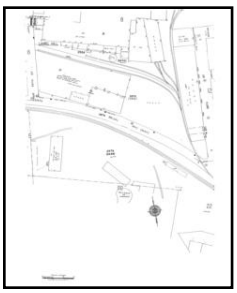
Volume 3, Sheet 11

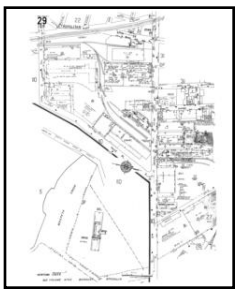
Volume 3, Sheet 29

Volume 3, Sheet 110

2002 Source Sheets

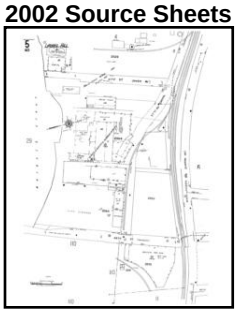

Volume 3, Sheet 5

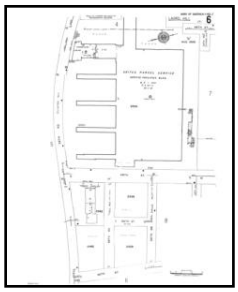

Volume 3, Sheet 6

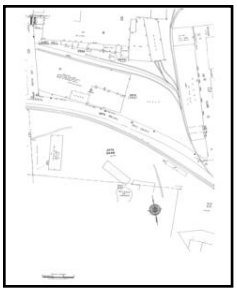

Volume 3, Sheet 11

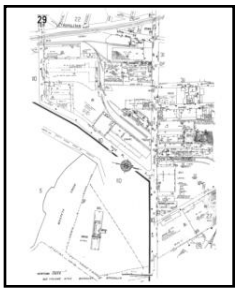

Volume 3, Sheet 29

Volume 3, Sheet 110

2001 Source Sheets

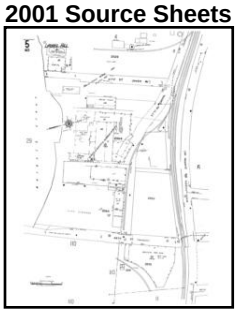

Volume 3, Sheet 5

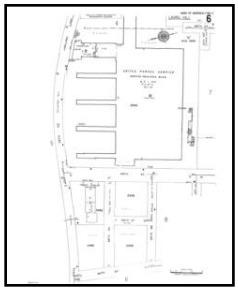

Volume 3, Sheet 6

Volume 3, Sheet 11

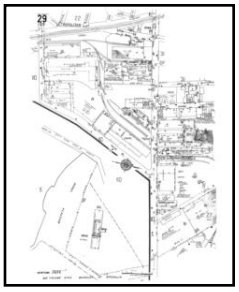

Volume 3, Sheet 29

Volume 3, Sheet 110

1999 Source Sheets

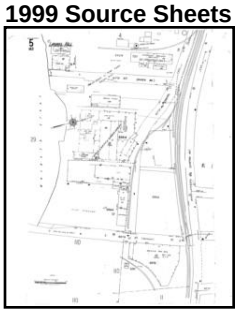

Volume 3, Sheet 5

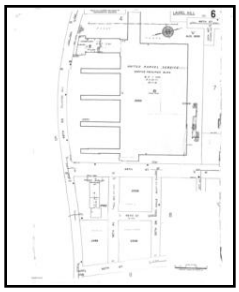

Volume 3, Sheet 6

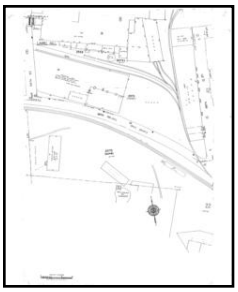

Volume 3, Sheet 11

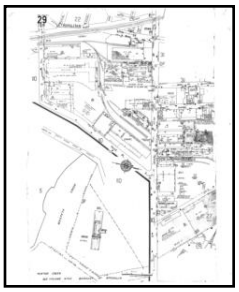

Volume 3, Sheet 29

Volume 3, Sheet 110

1996 Source Sheets

Volume 3, Sheet 110

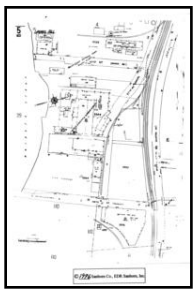

Volume 3, Sheet 5

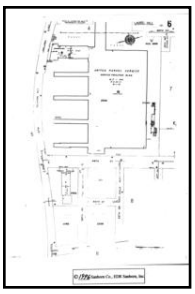

Volume 3, Sheet 6

Volume 3, Sheet 11

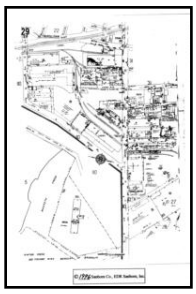

Volume 3, Sheet 29

1995 Source Sheets

Volume 3, Sheet 5

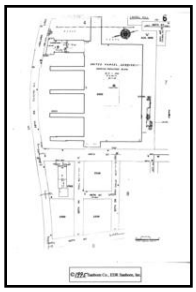

Volume 3, Sheet 6

Volume 3, Sheet 11

Volume 3, Sheet 29

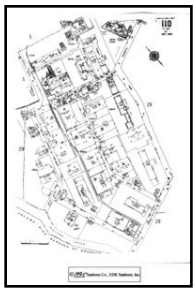

Volume 3, Sheet 110

1994 Source Sheets

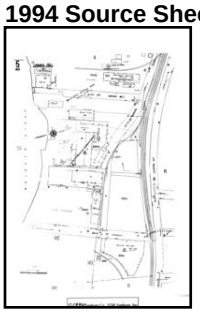

Volume 3, Sheet 5

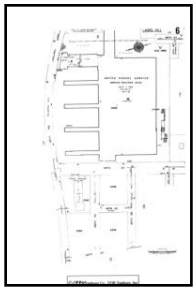

Volume 3, Sheet 6

Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

1993 Source Sheets

Volume 3, Sheet 110

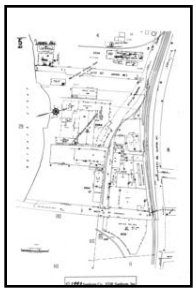

Volume 3, Sheet 5

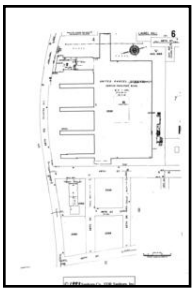

Volume 3, Sheet 6

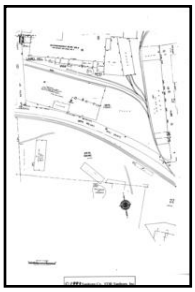

Volume 3, Sheet 11

Volume 3, Sheet 29

1992 Source Sheets

Volume 3, Sheet 110

Volume 3, Sheet 5

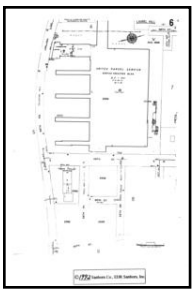

Volume 3, Sheet 6

Volume 3, Sheet 11

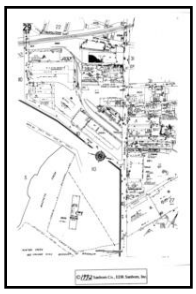

Volume 3, Sheet 29

1991 Source Sheets

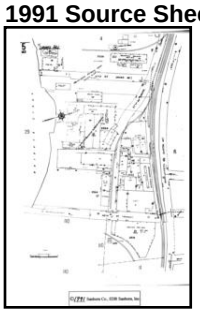

Volume 3, Sheet 5

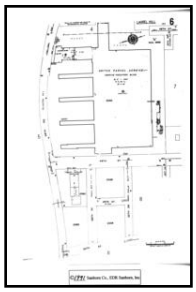

Volume 3, Sheet 6

Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

1990 Source Sheets

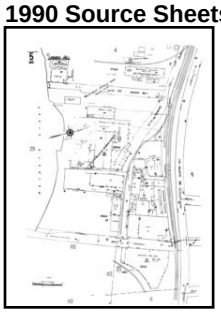

Volume 3, Sheet 5

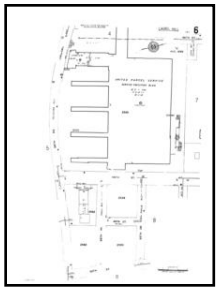

Volume 3, Sheet 6

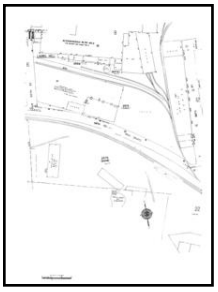

Volume 3, Sheet 11

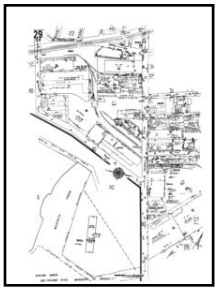

Volume 3, Sheet 29

Volume 3, Sheet 110

1988 Source Sheets

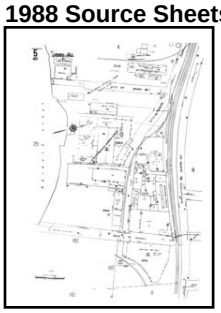

Volume 3, Sheet 5

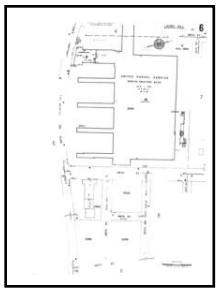

Volume 3, Sheet 6

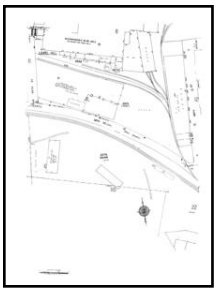

Volume 3, Sheet 11

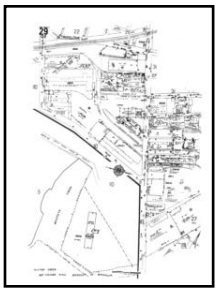

Volume 3, Sheet 29

Volume 3, Sheet 110

1986 Source Sheets

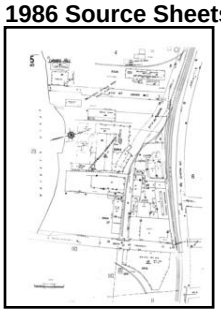

Volume 3, Sheet 5

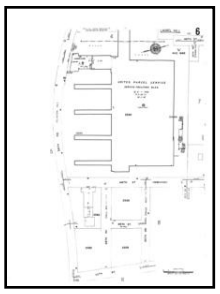

Volume 3, Sheet 6

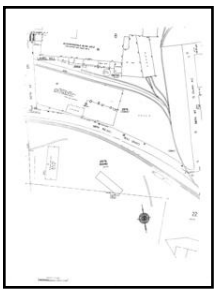

Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

1985 Source Sheets

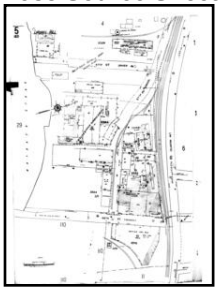

Volume 3, Sheet 5

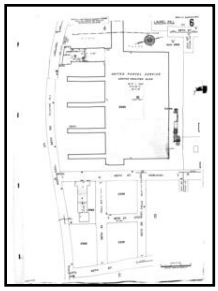

Volume 3, Sheet 6

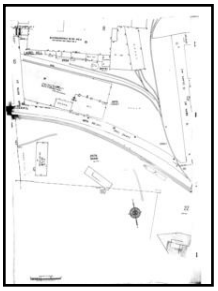

Volume 3, Sheet 11

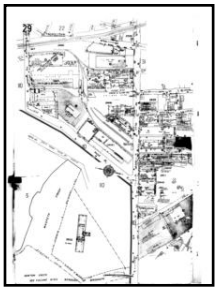

Volume 3, Sheet 29

Volume 3, Sheet 110

1982 Source Sheets

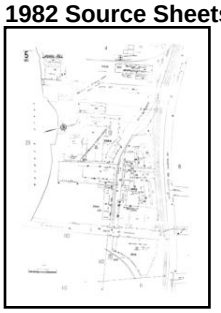

Volume 3, Sheet 5

Volume 3, Sheet 6

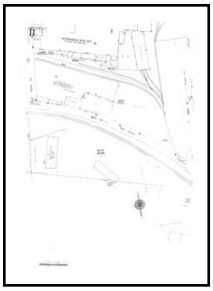

Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

1980 Source Sheets

Volume 3, Sheet 110

Volume 3, Sheet 5

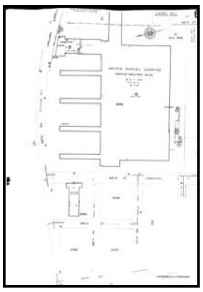

Volume 3, Sheet 6

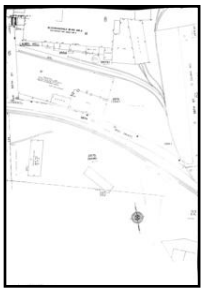

Volume 3, Sheet 11

Volume 3, Sheet 29

1971 Source Sheets

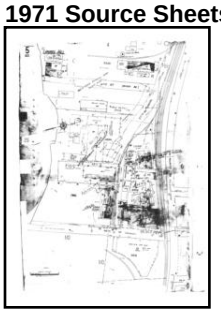

Volume 3, Sheet 5

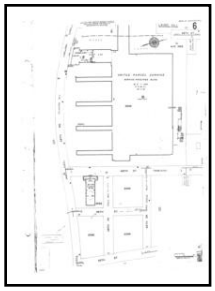

Volume 3, Sheet 6

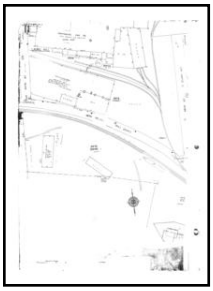

Volume 3, Sheet 11

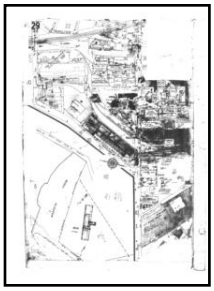

Volume 3, Sheet 29

1950 Source Sheets

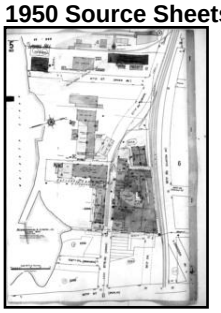

Volume 3, Sheet 5

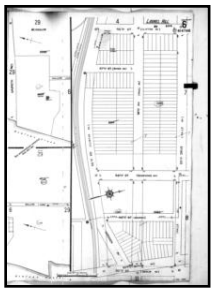

Volume 3, Sheet 6

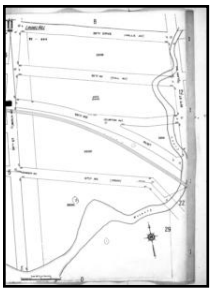

Volume 3, Sheet 11

1936 Source Sheets

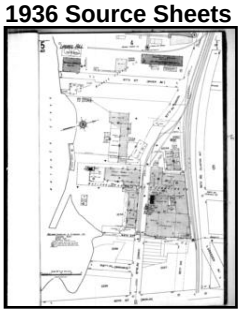

Volume 3, Sheet 5

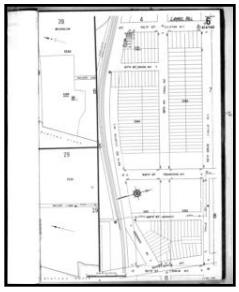

Volume 3, Sheet 6

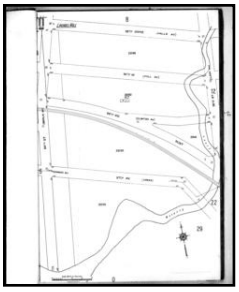

Volume 3, Sheet 11

1914 Source Sheets

Volume 3, Sheet 5

Volume 3, Sheet 6

Volume 3, Sheet 11

2006 Certified Sanborn Map

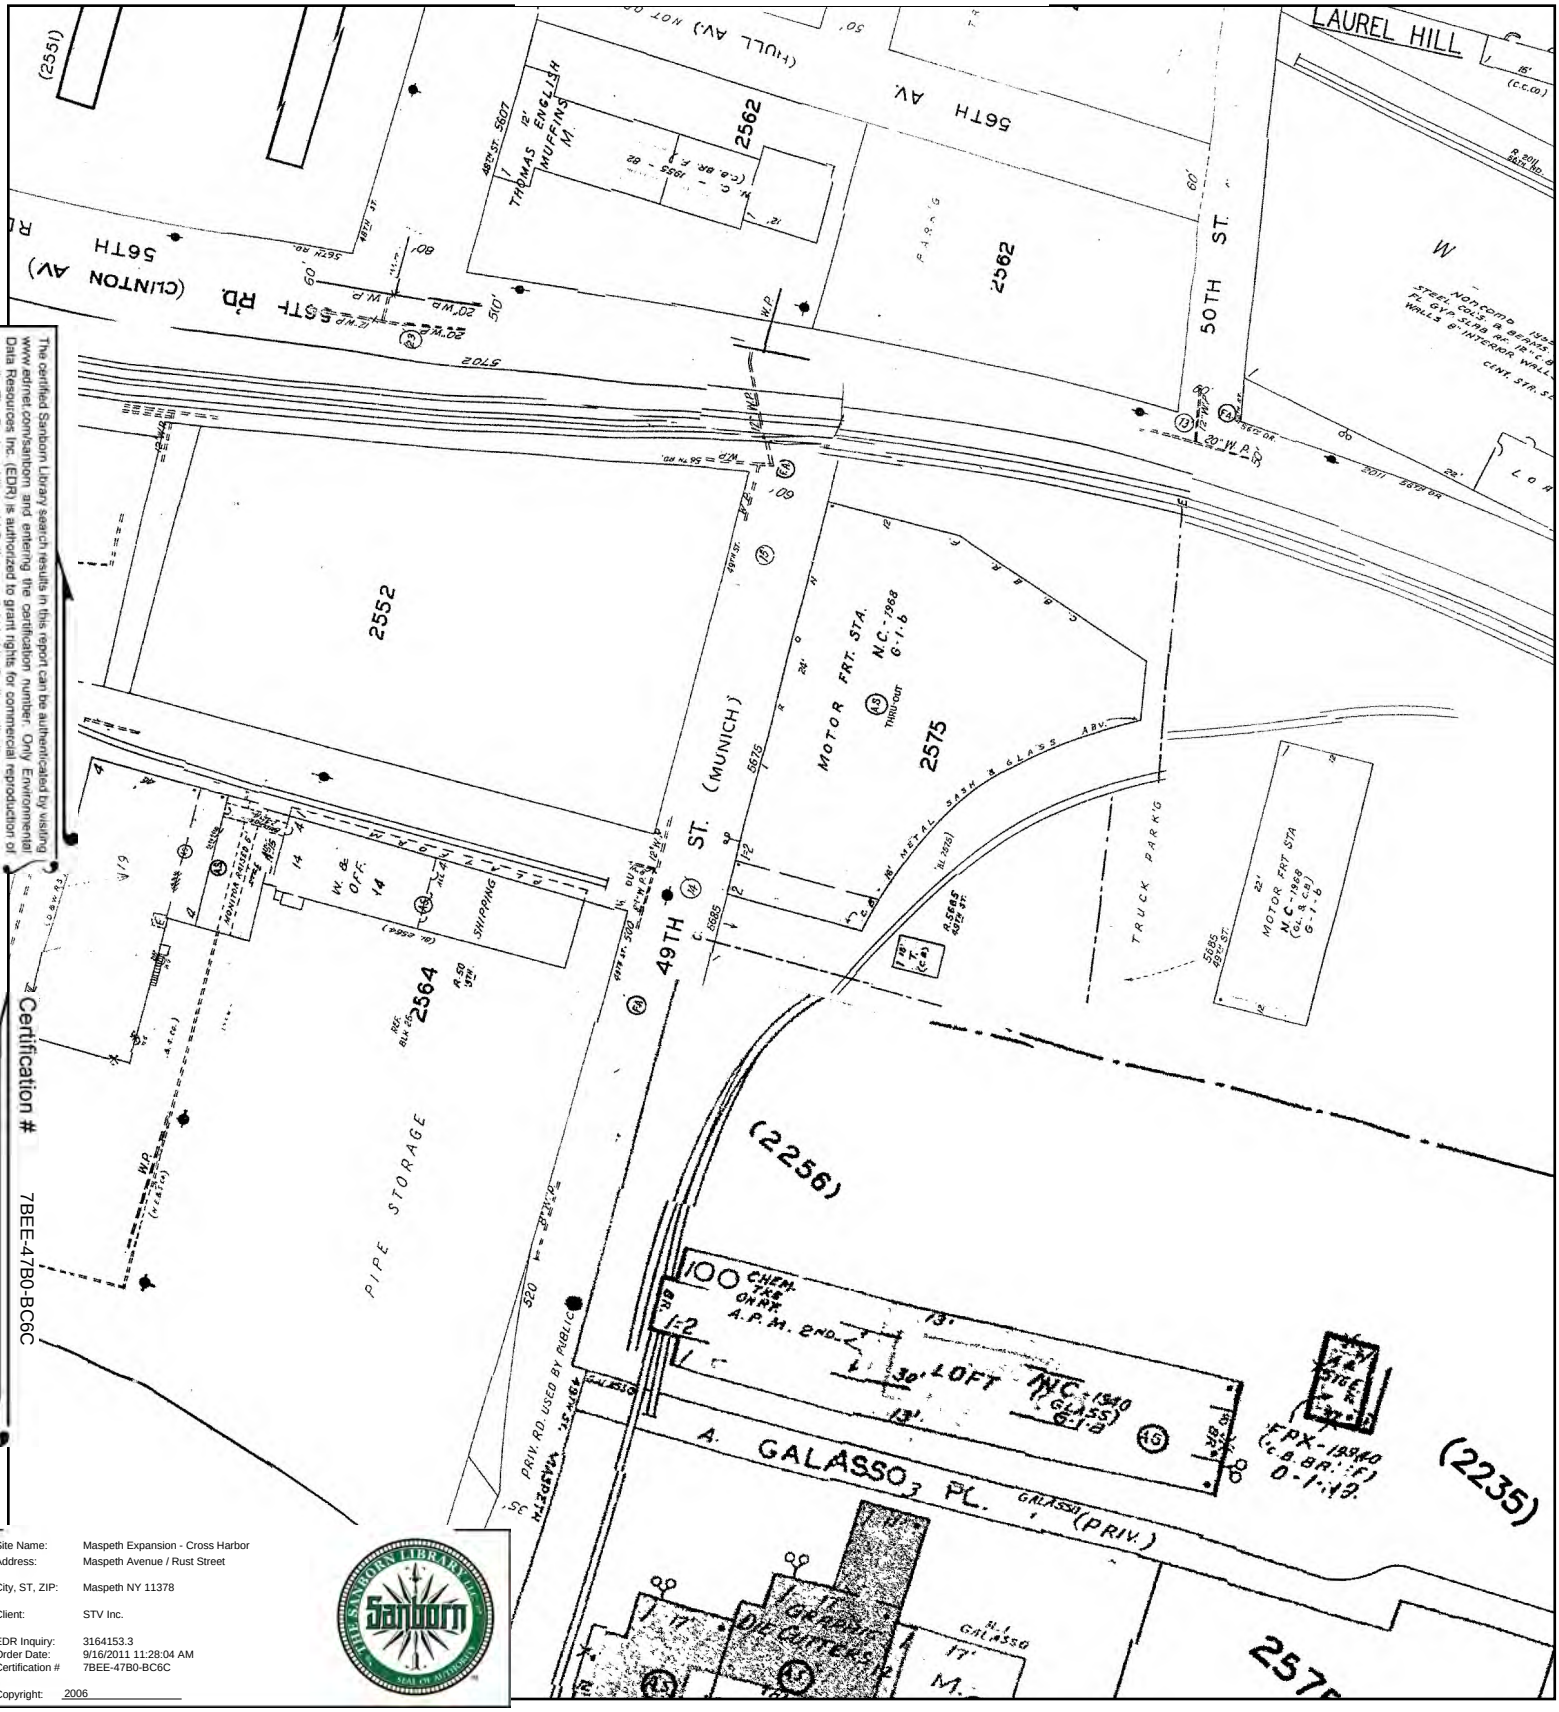

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2006

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

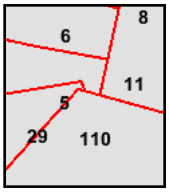

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2005 Certified Sanborn Map

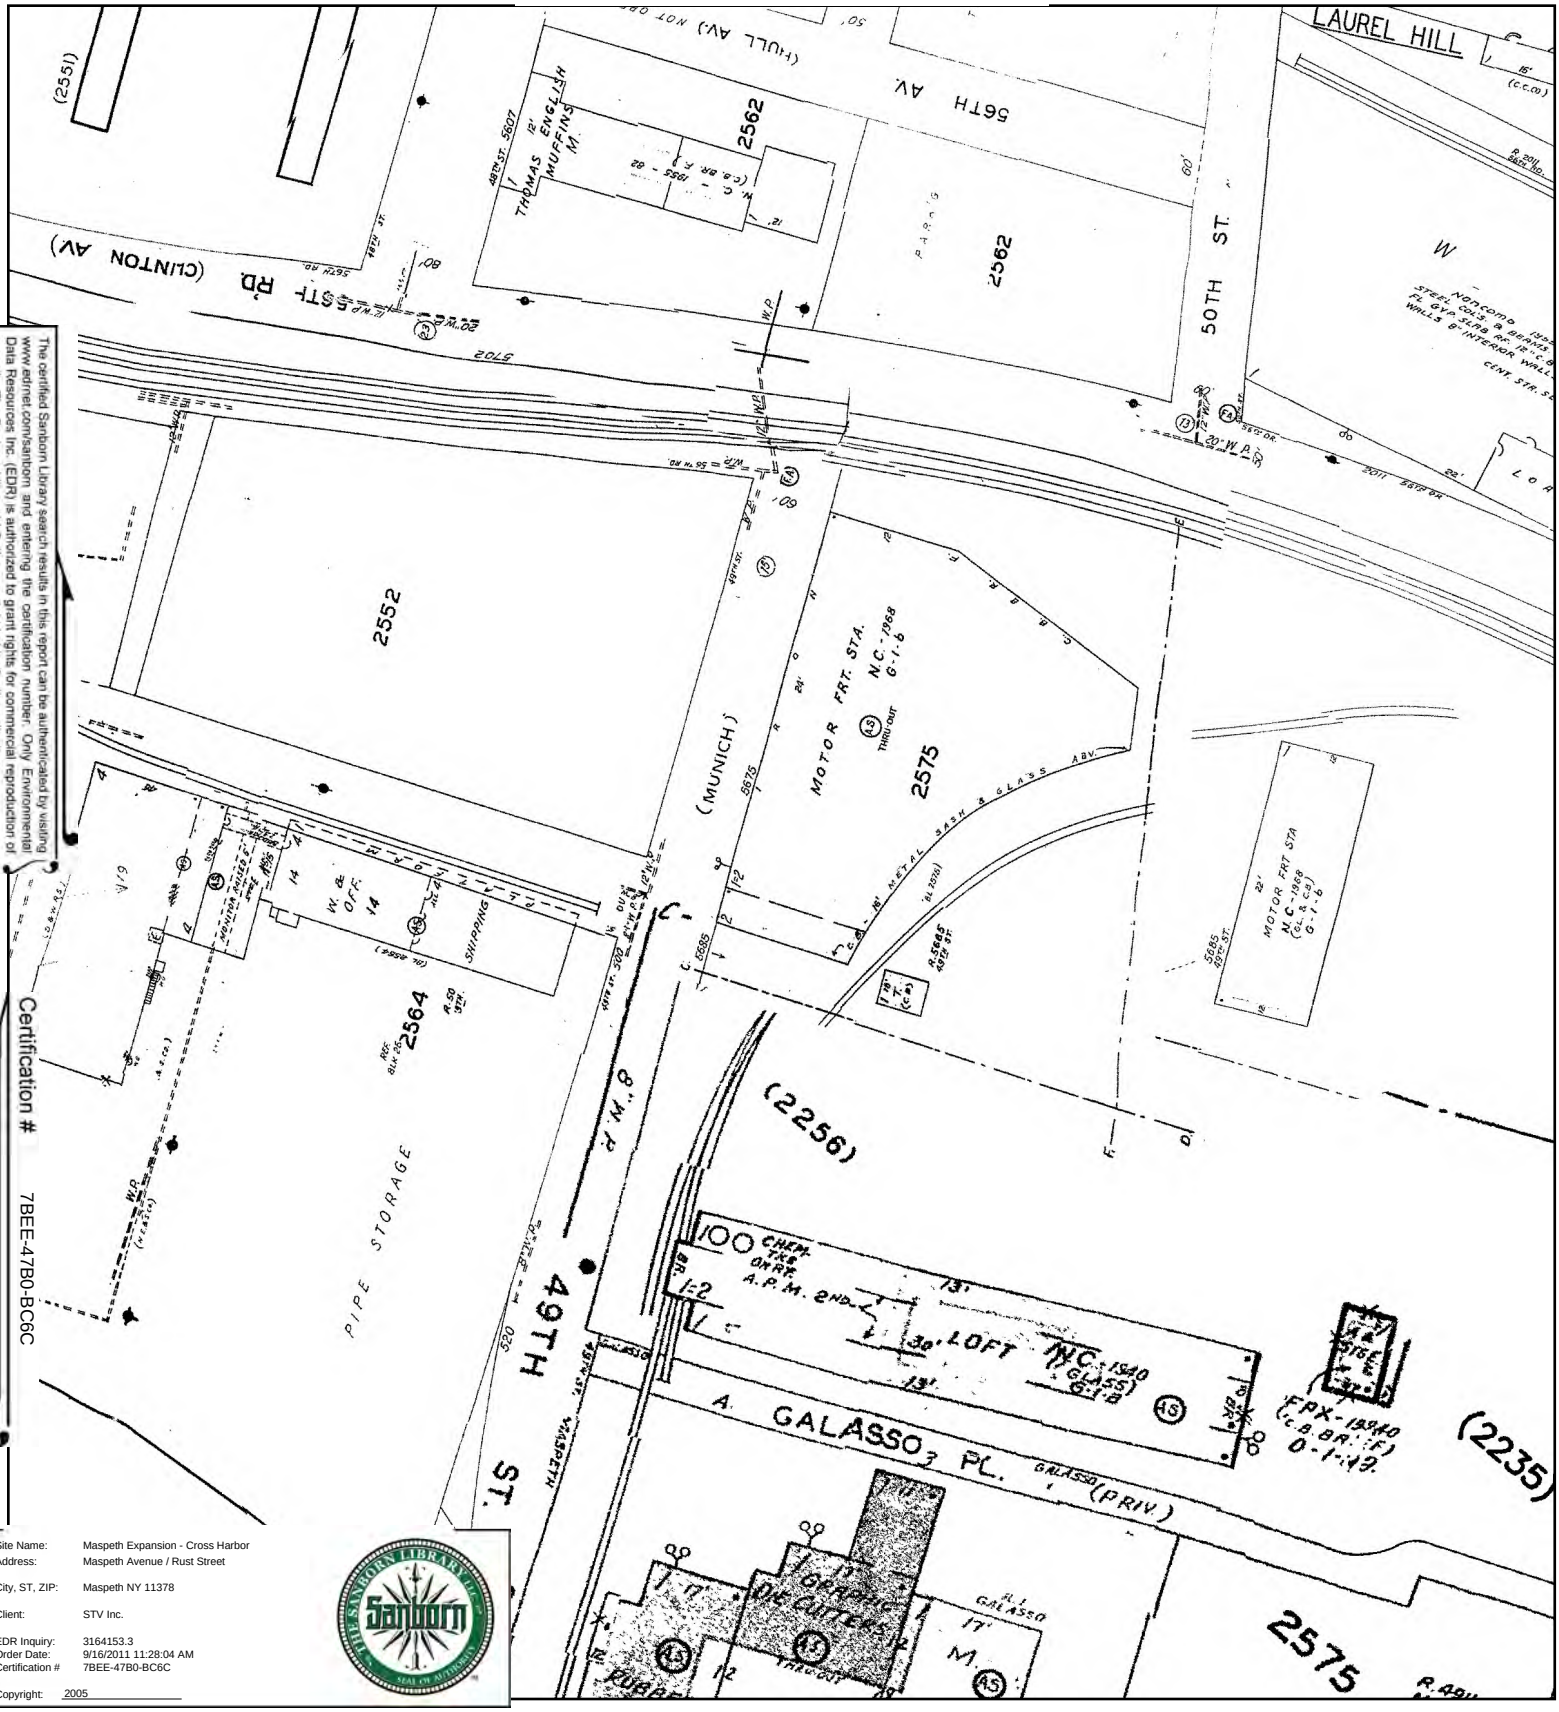

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2005

Copyright 2005

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

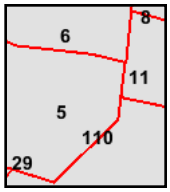

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2004 Certified Sanborn Map

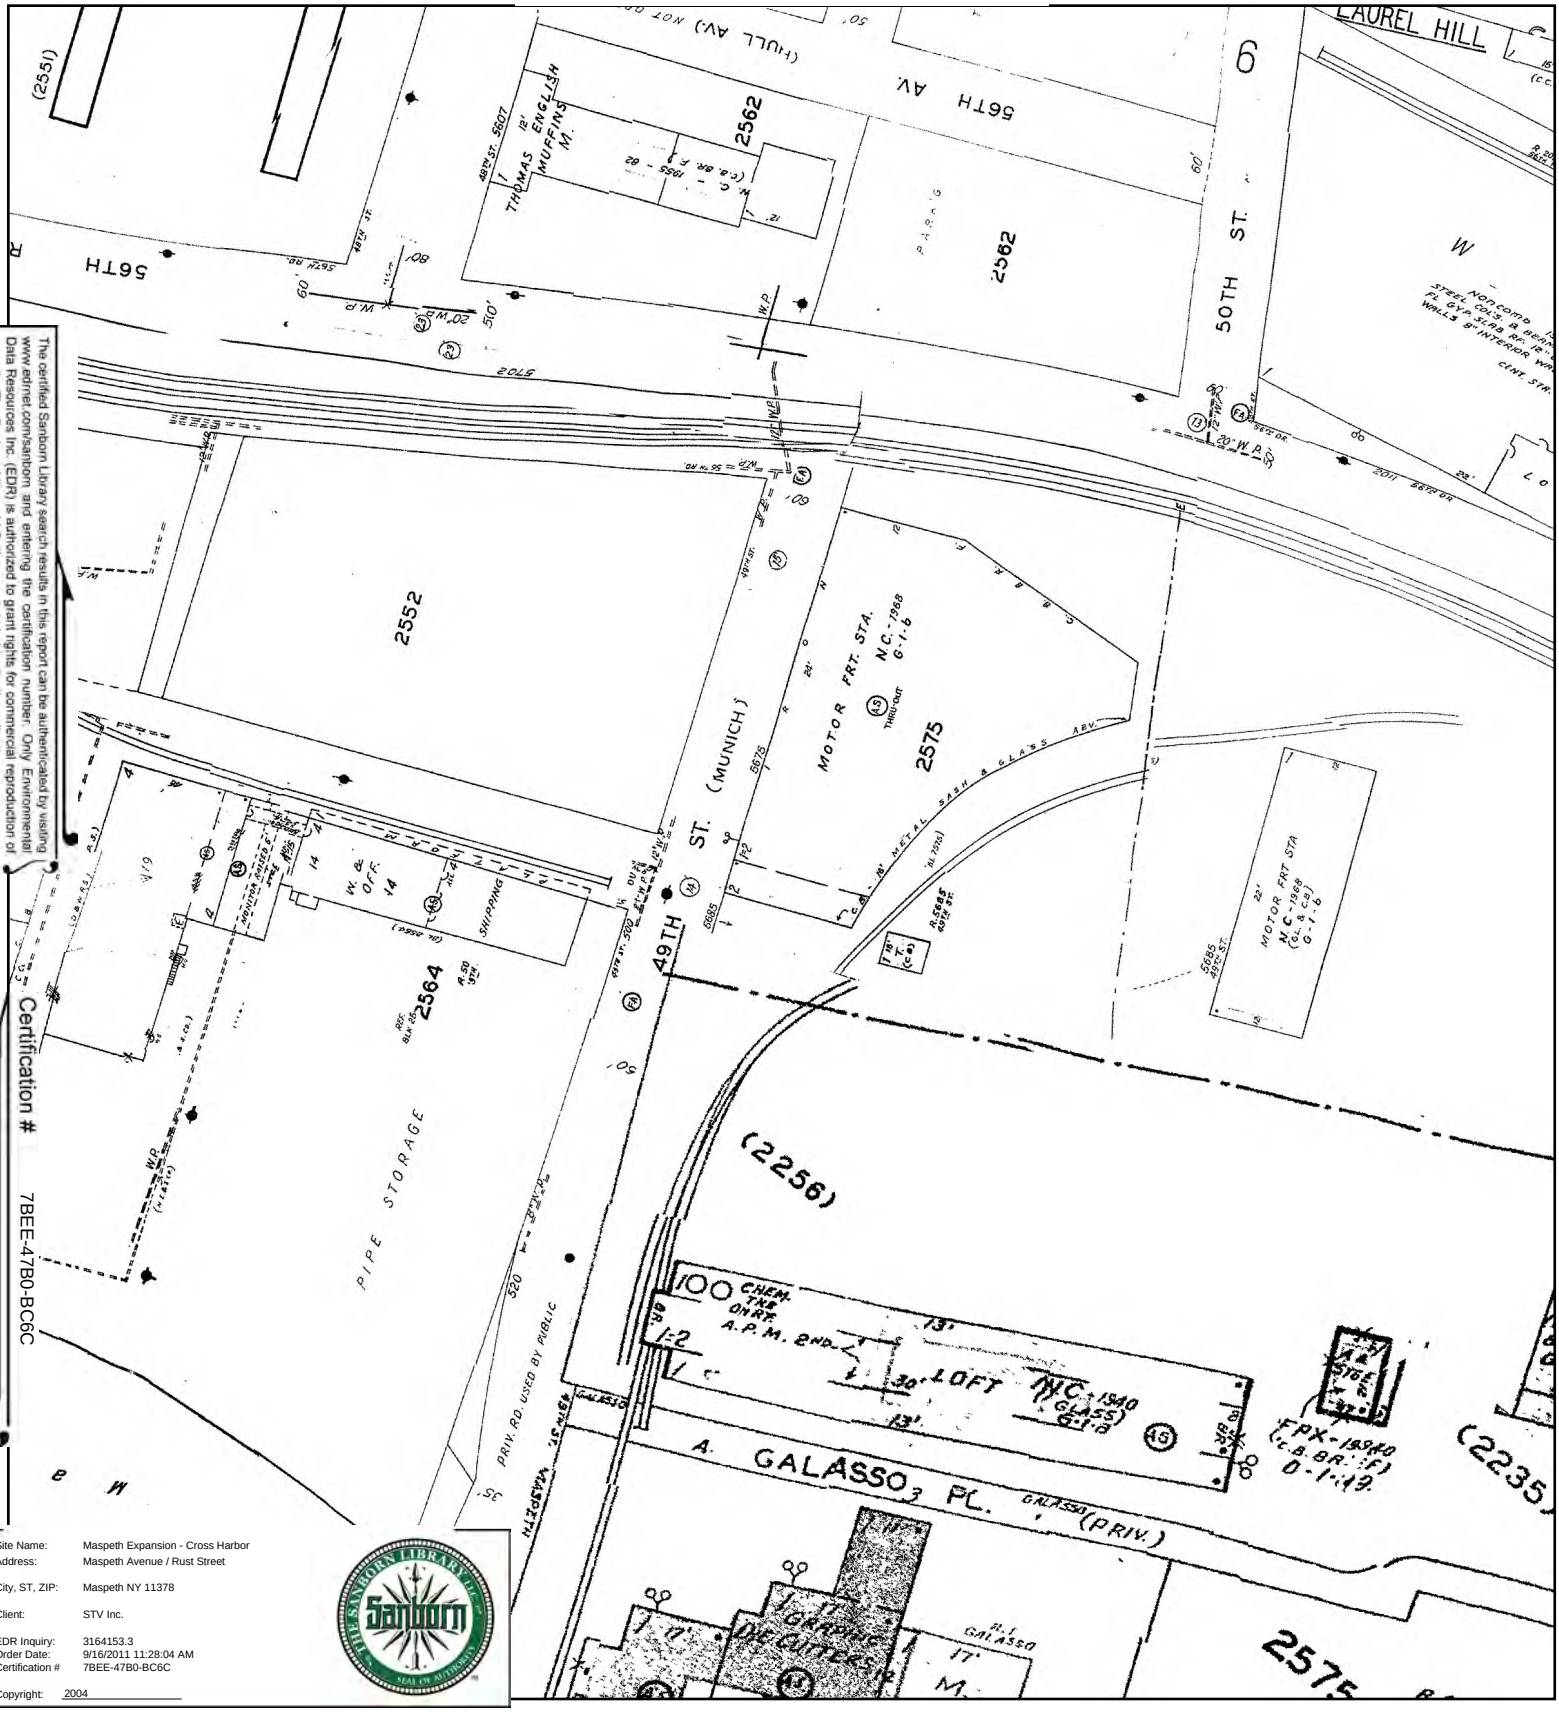

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 2004

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

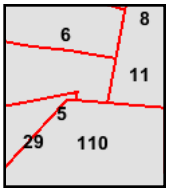

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2003 Certified Sanborn Map

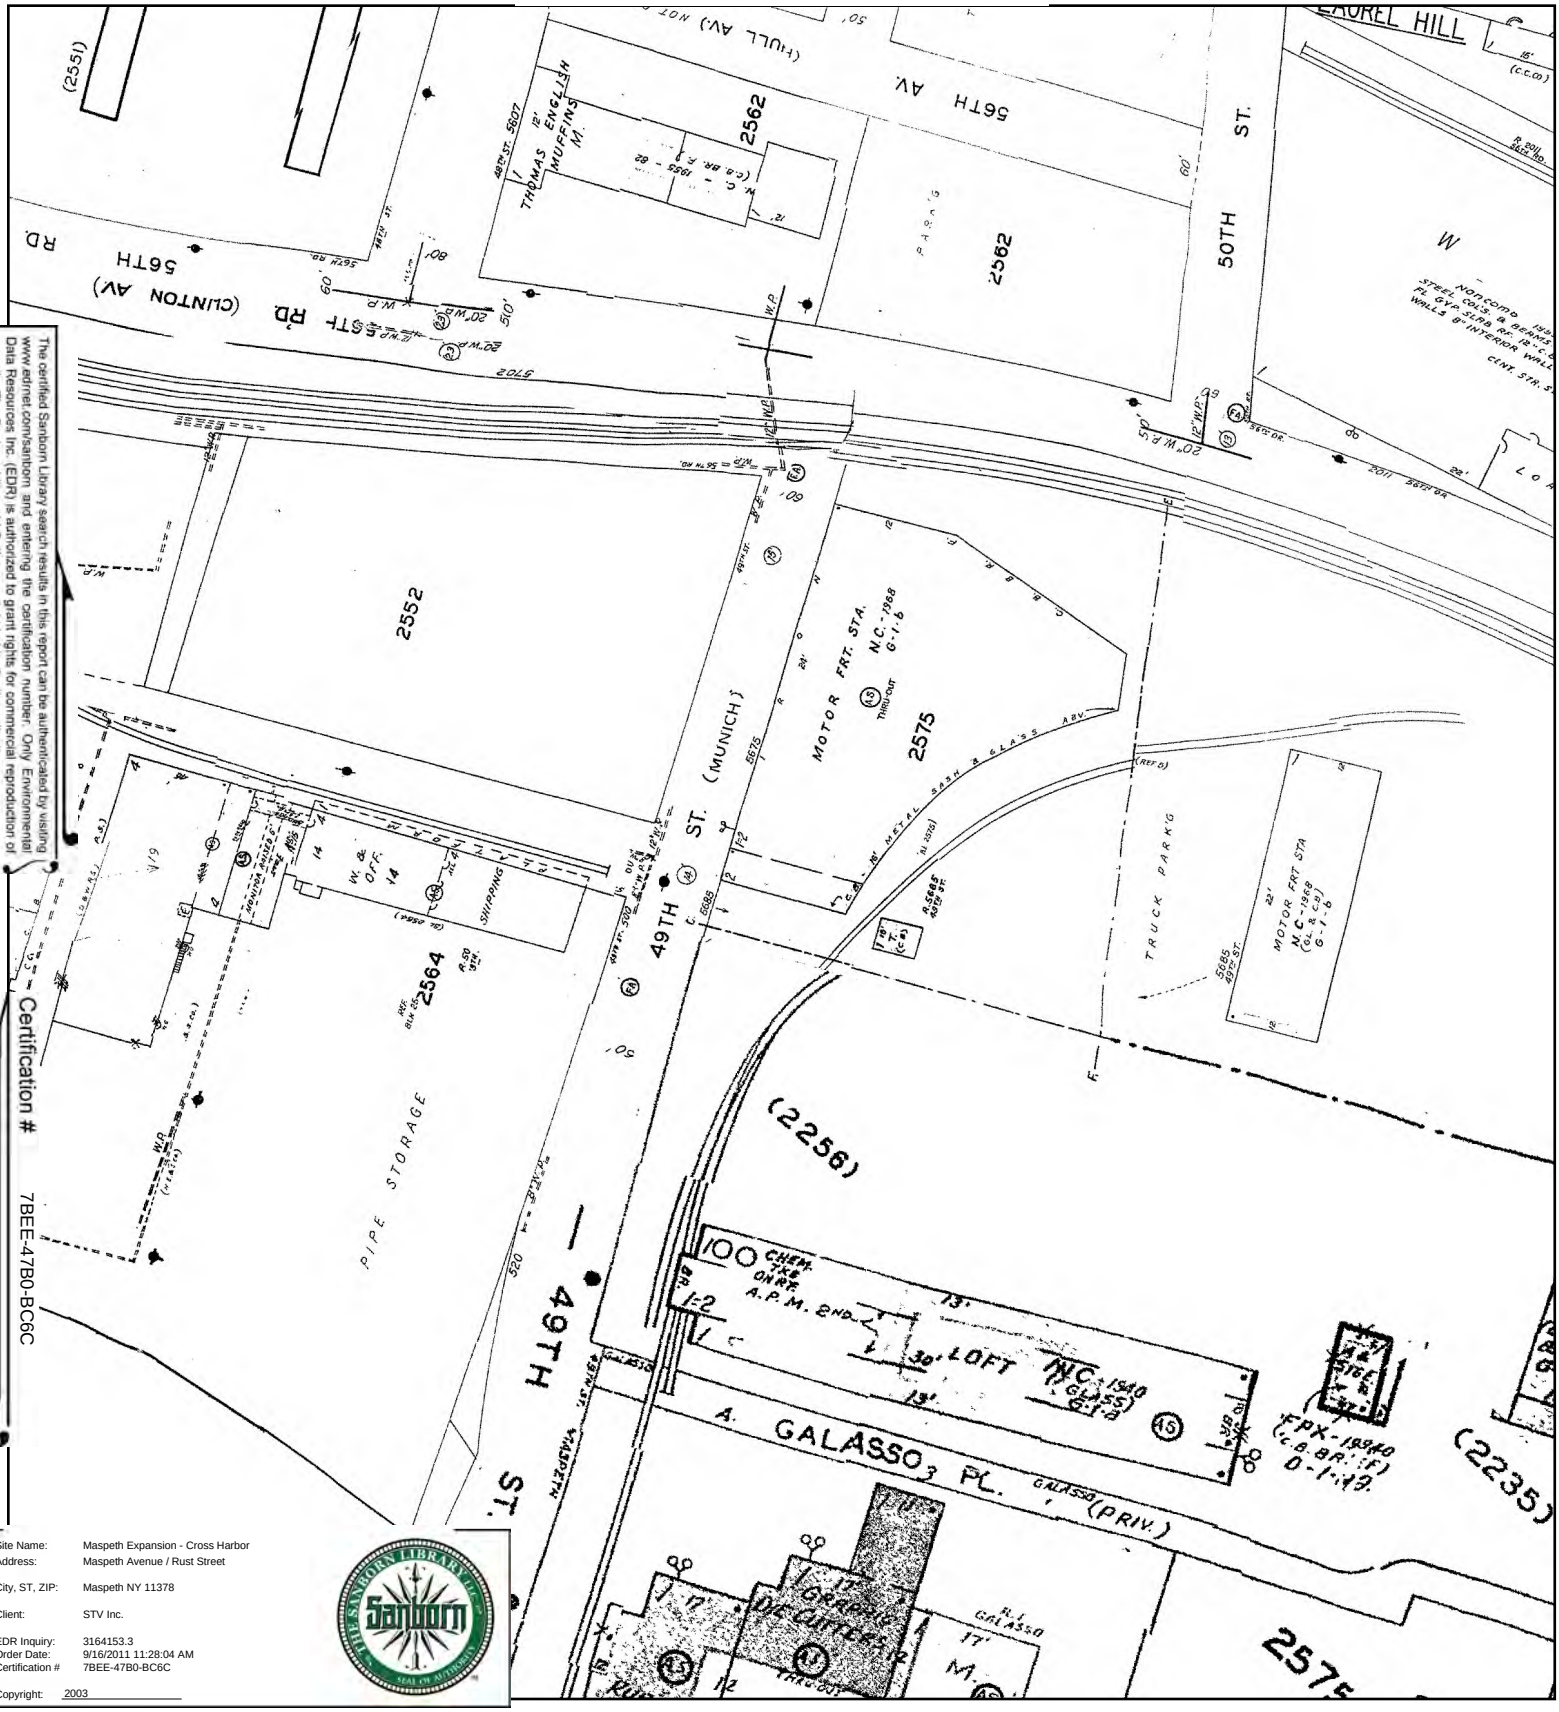

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2003

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

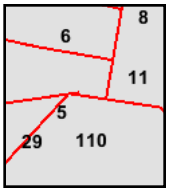

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

2002 Certified Sanborn Map

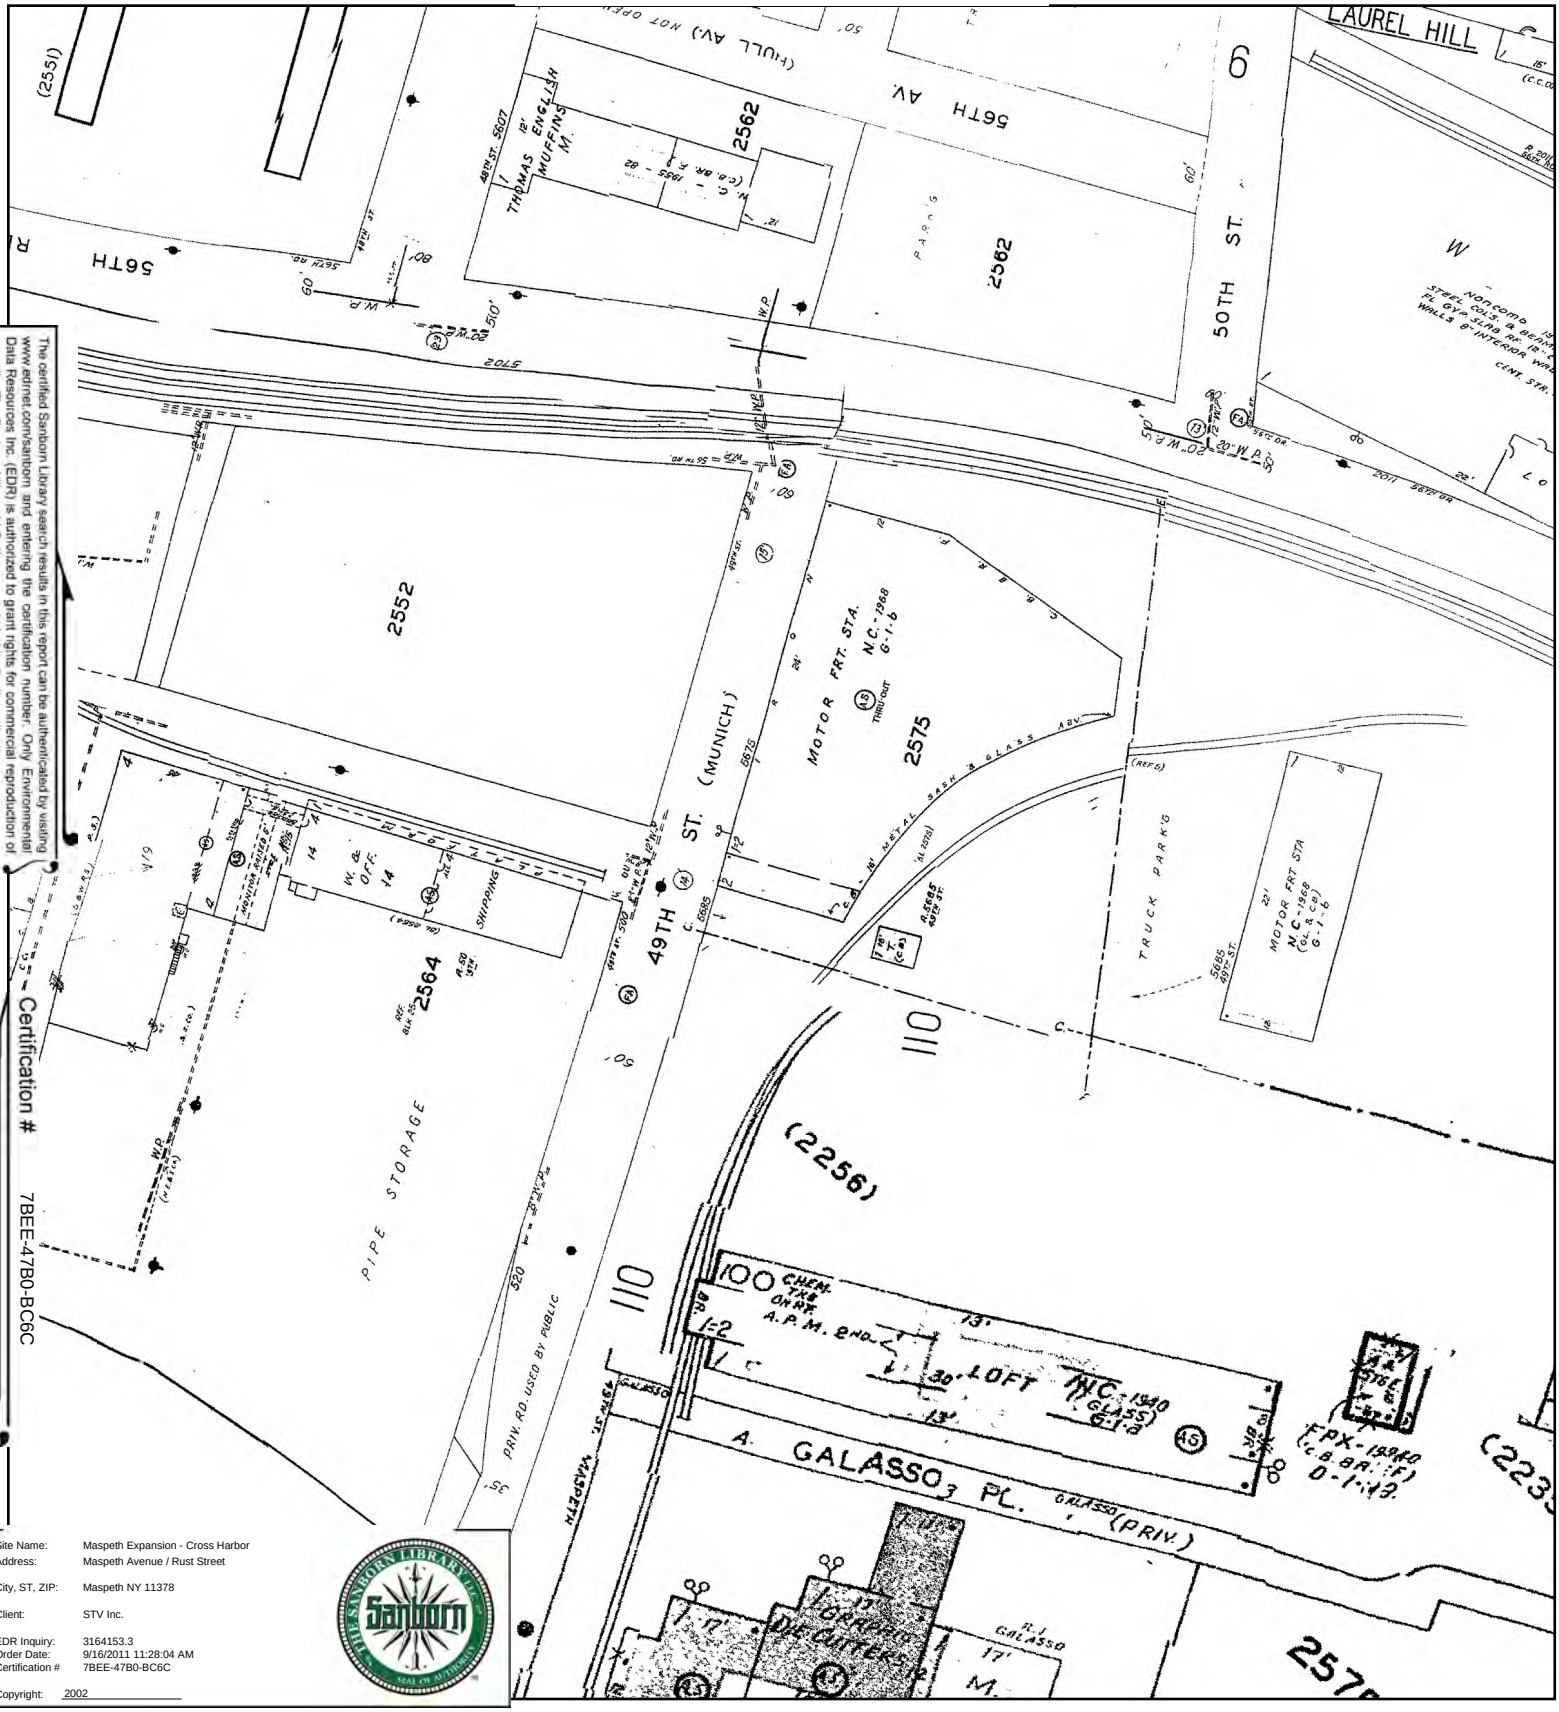

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification #: 7BEE-47B0-BC6C
Copyright: 2002

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

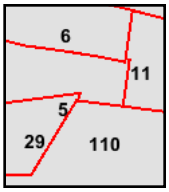

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2001 Certified Sanborn Map

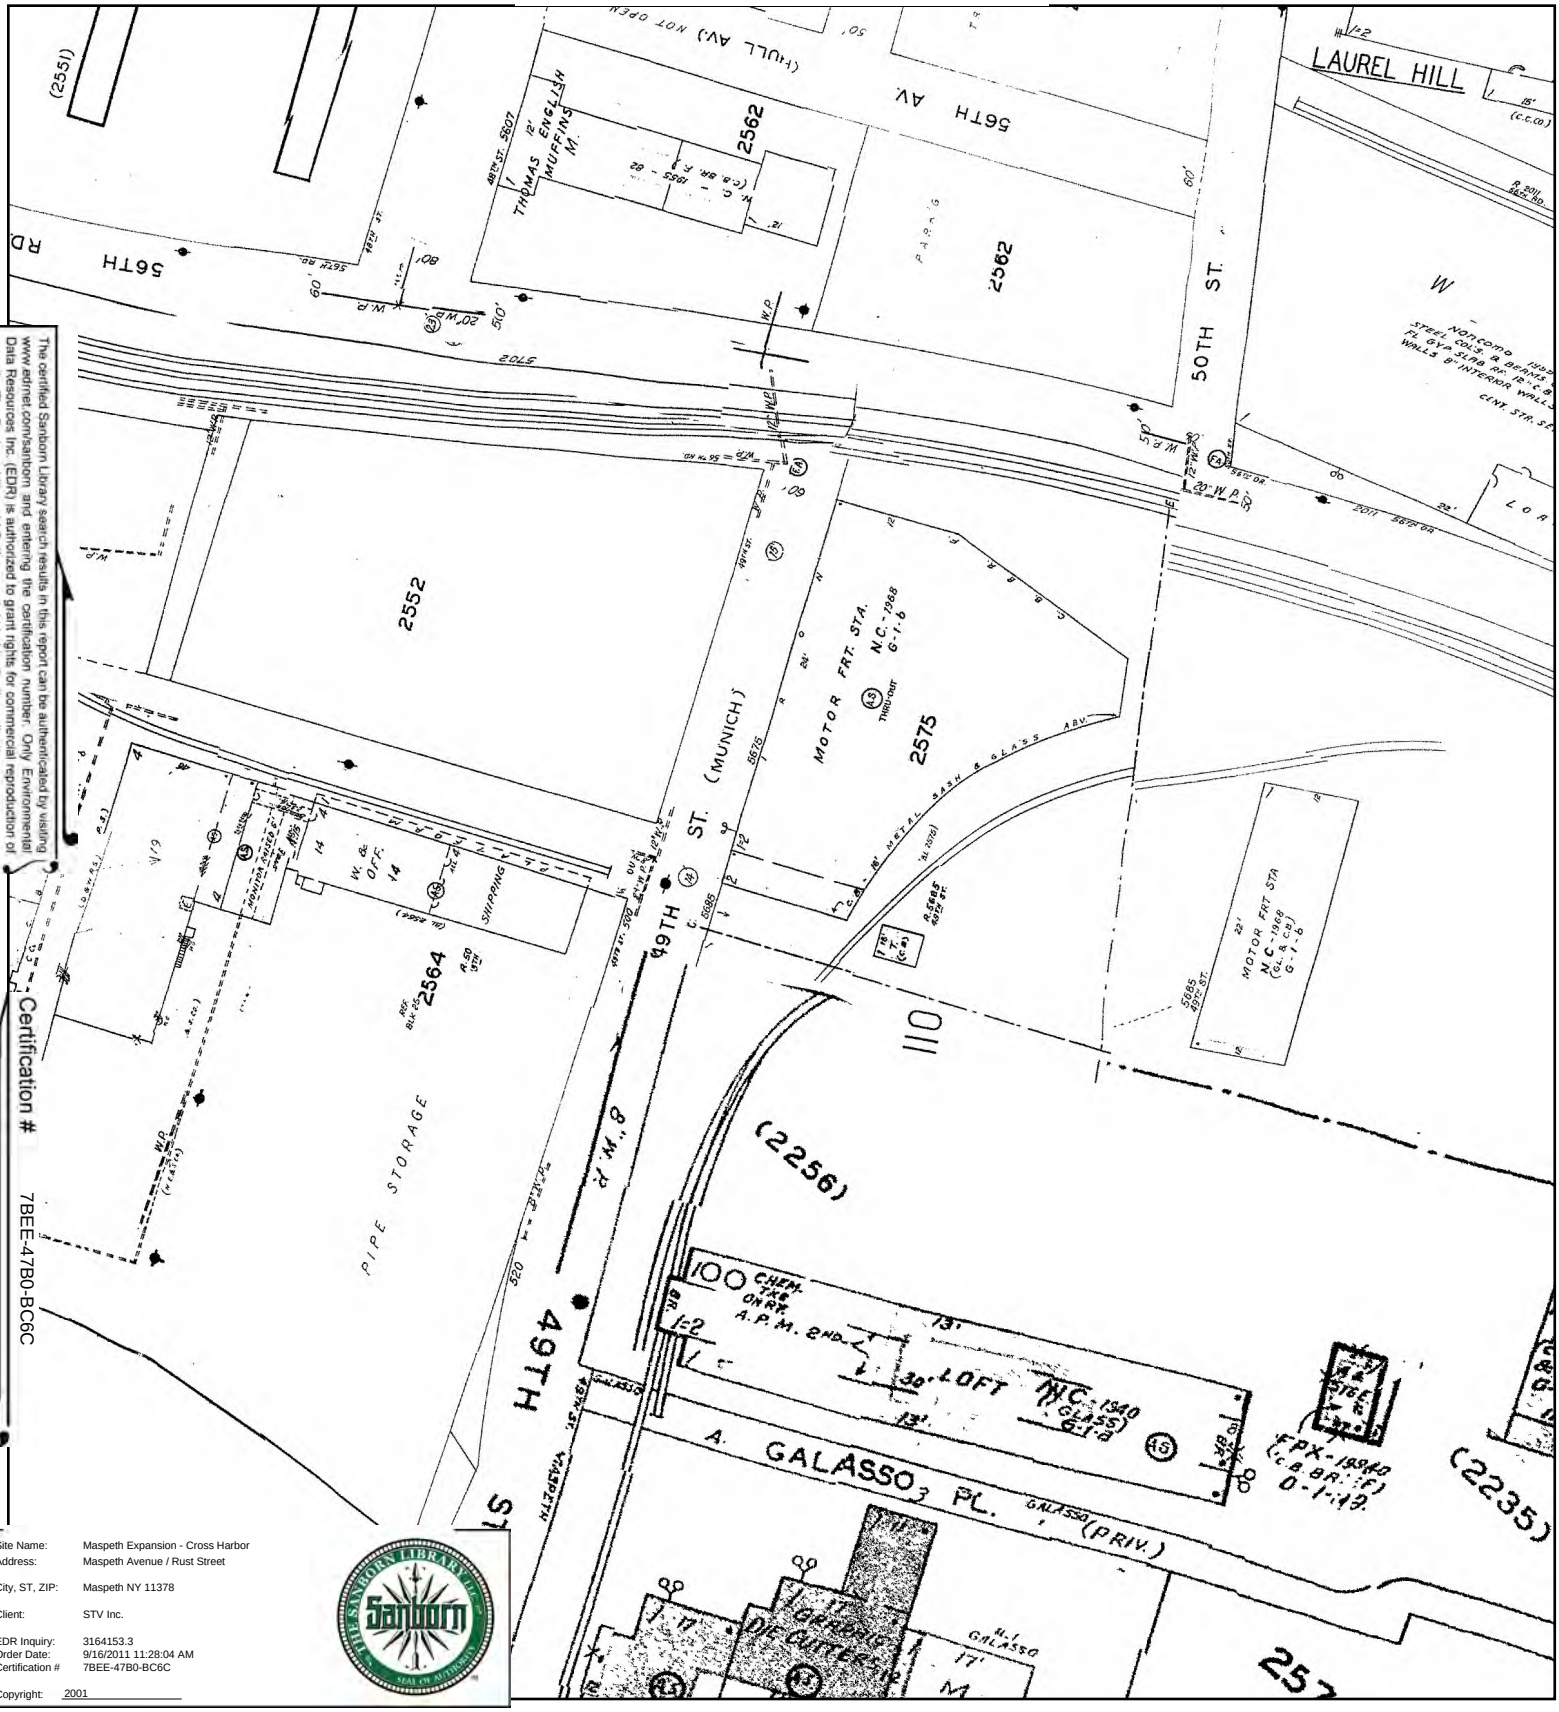

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 2001

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

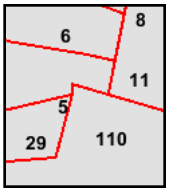

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1999 Certified Sanborn Map

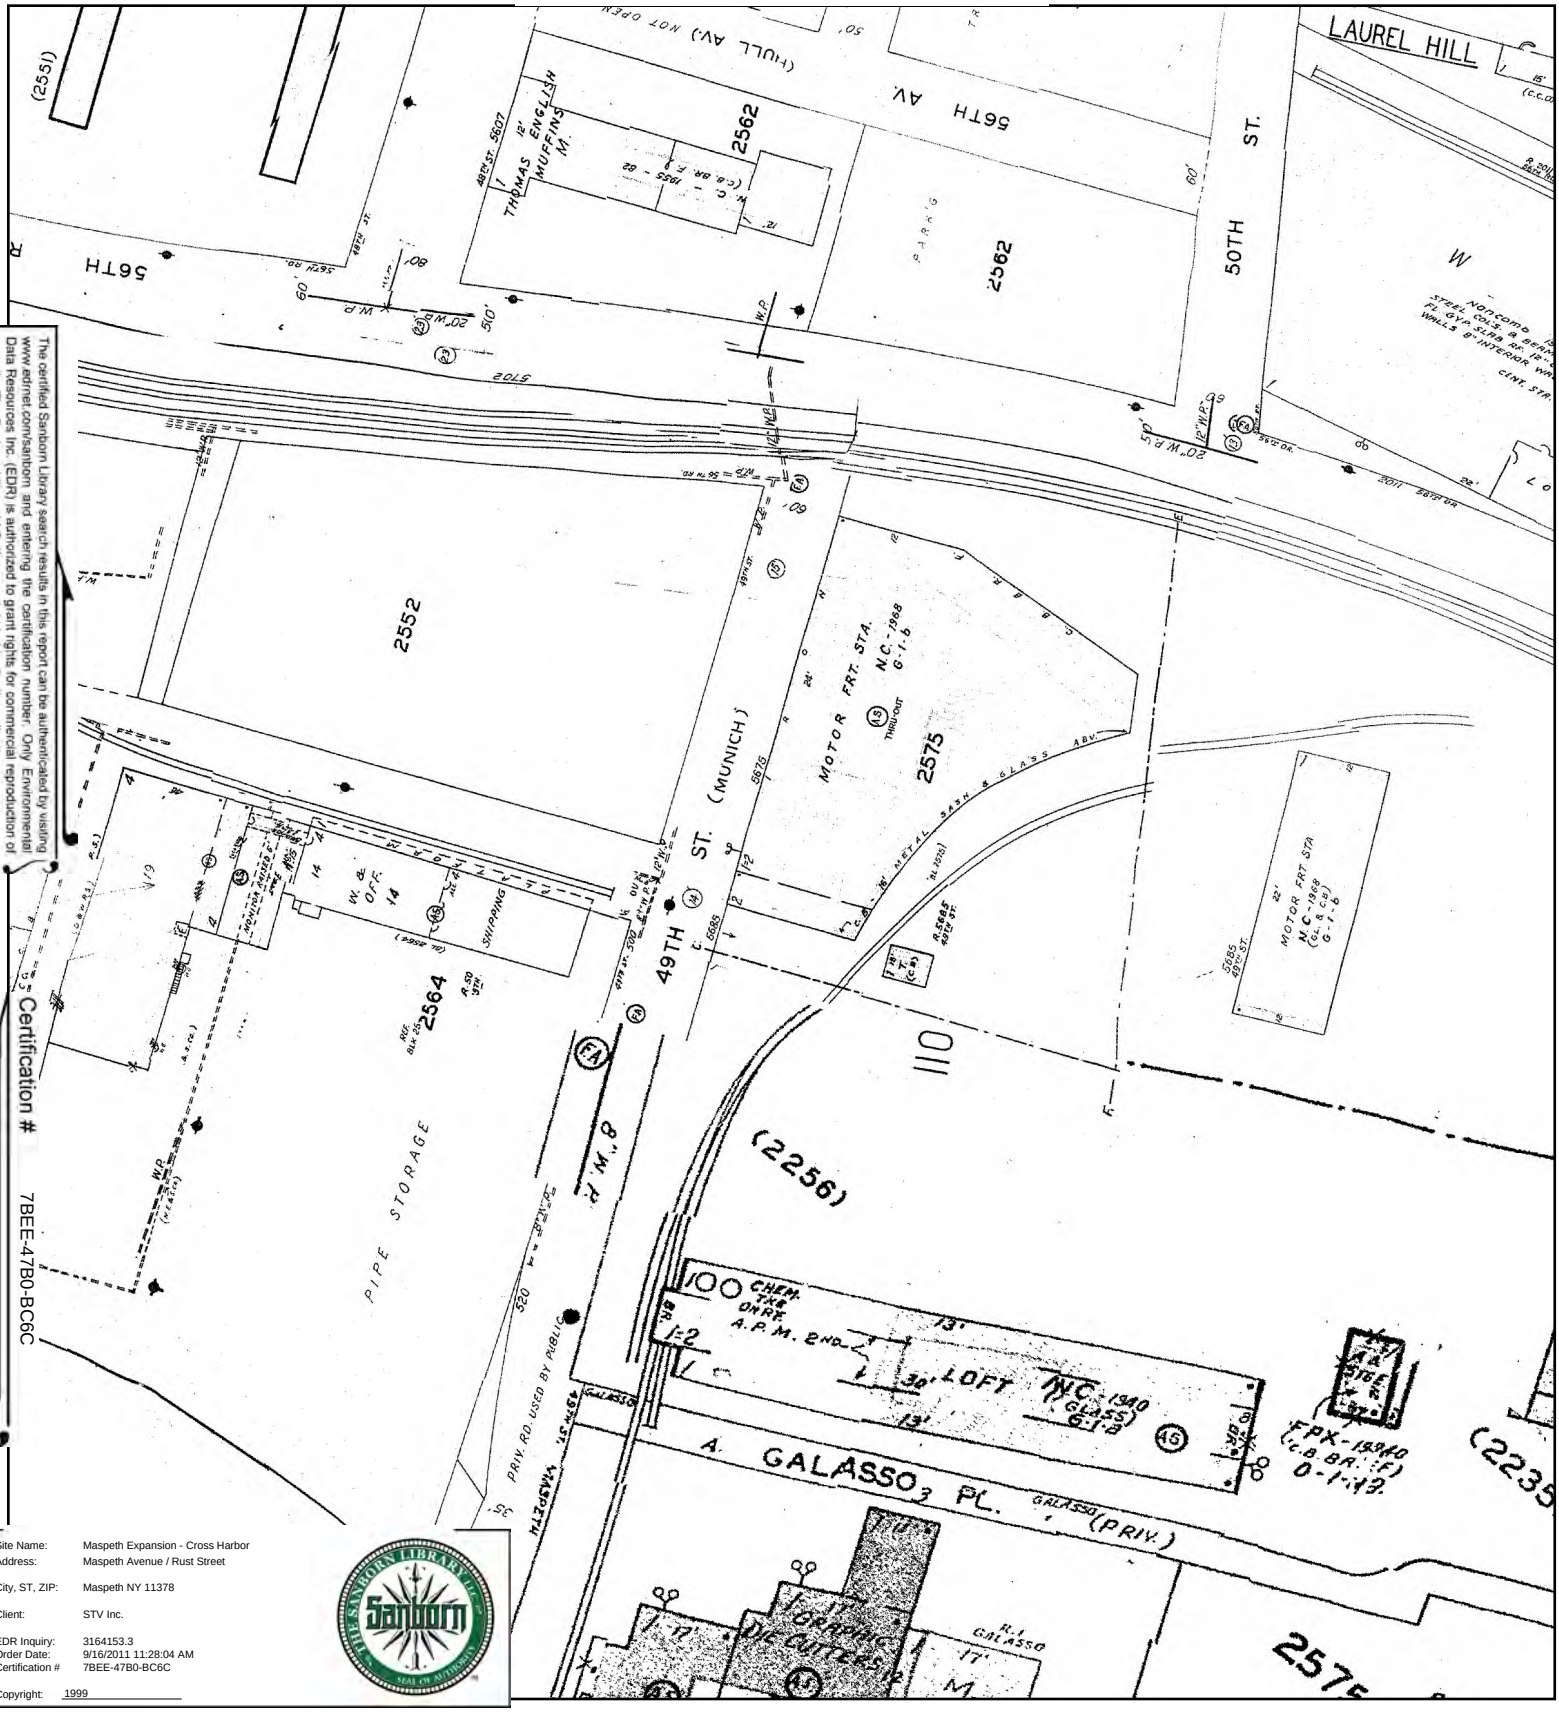

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1999

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

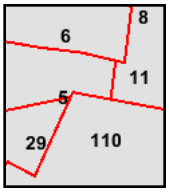

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1996 Certified Sanborn Map

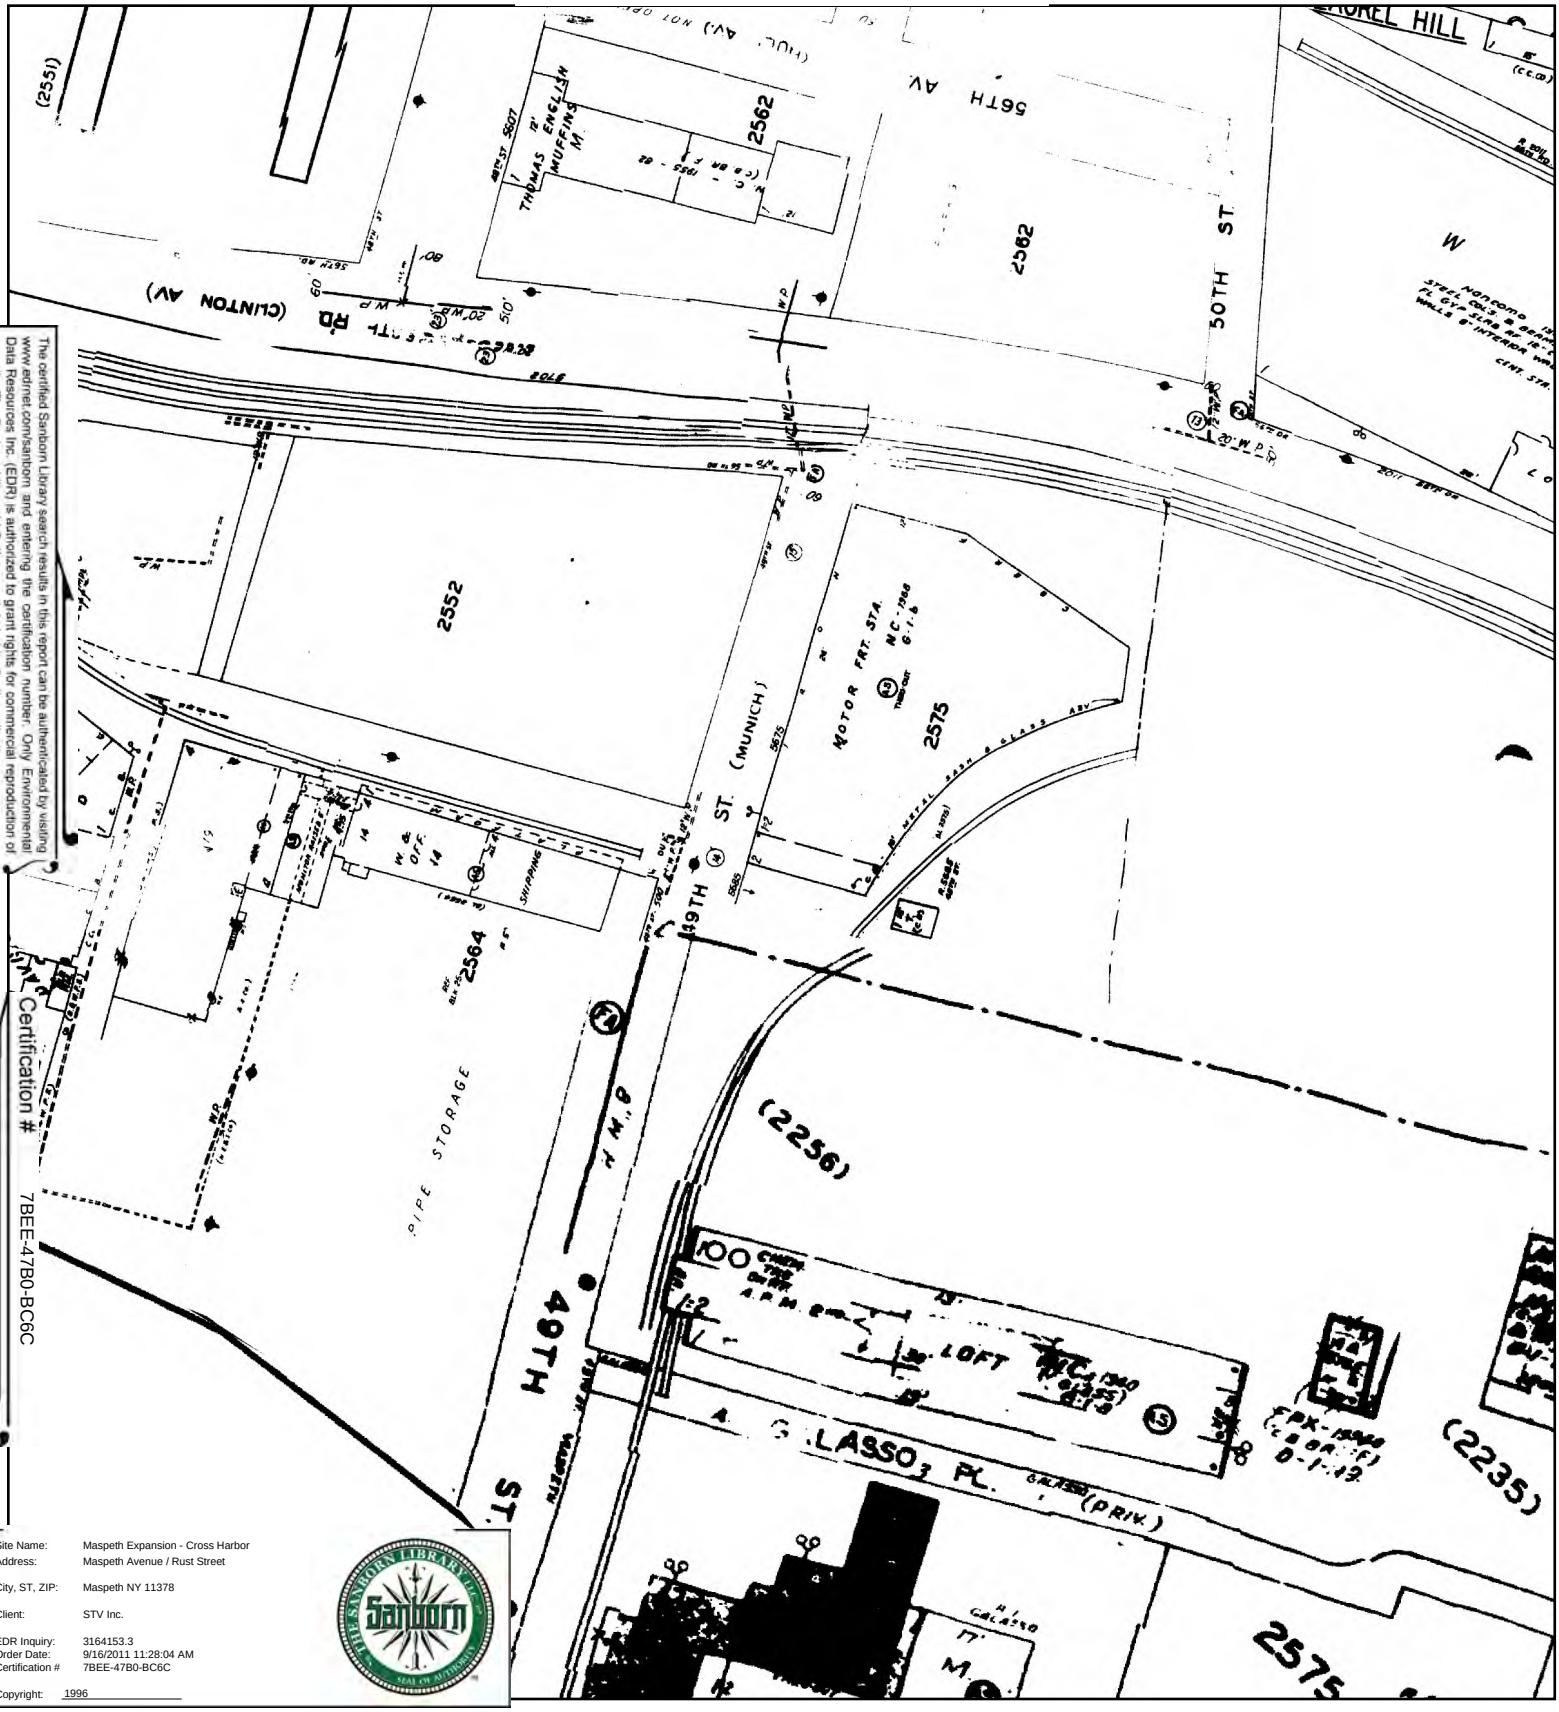

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1996

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

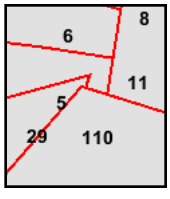

Volume 3, Sheet 110
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29

0 Feet 165 330 660

N

1995 Certified Sanborn Map

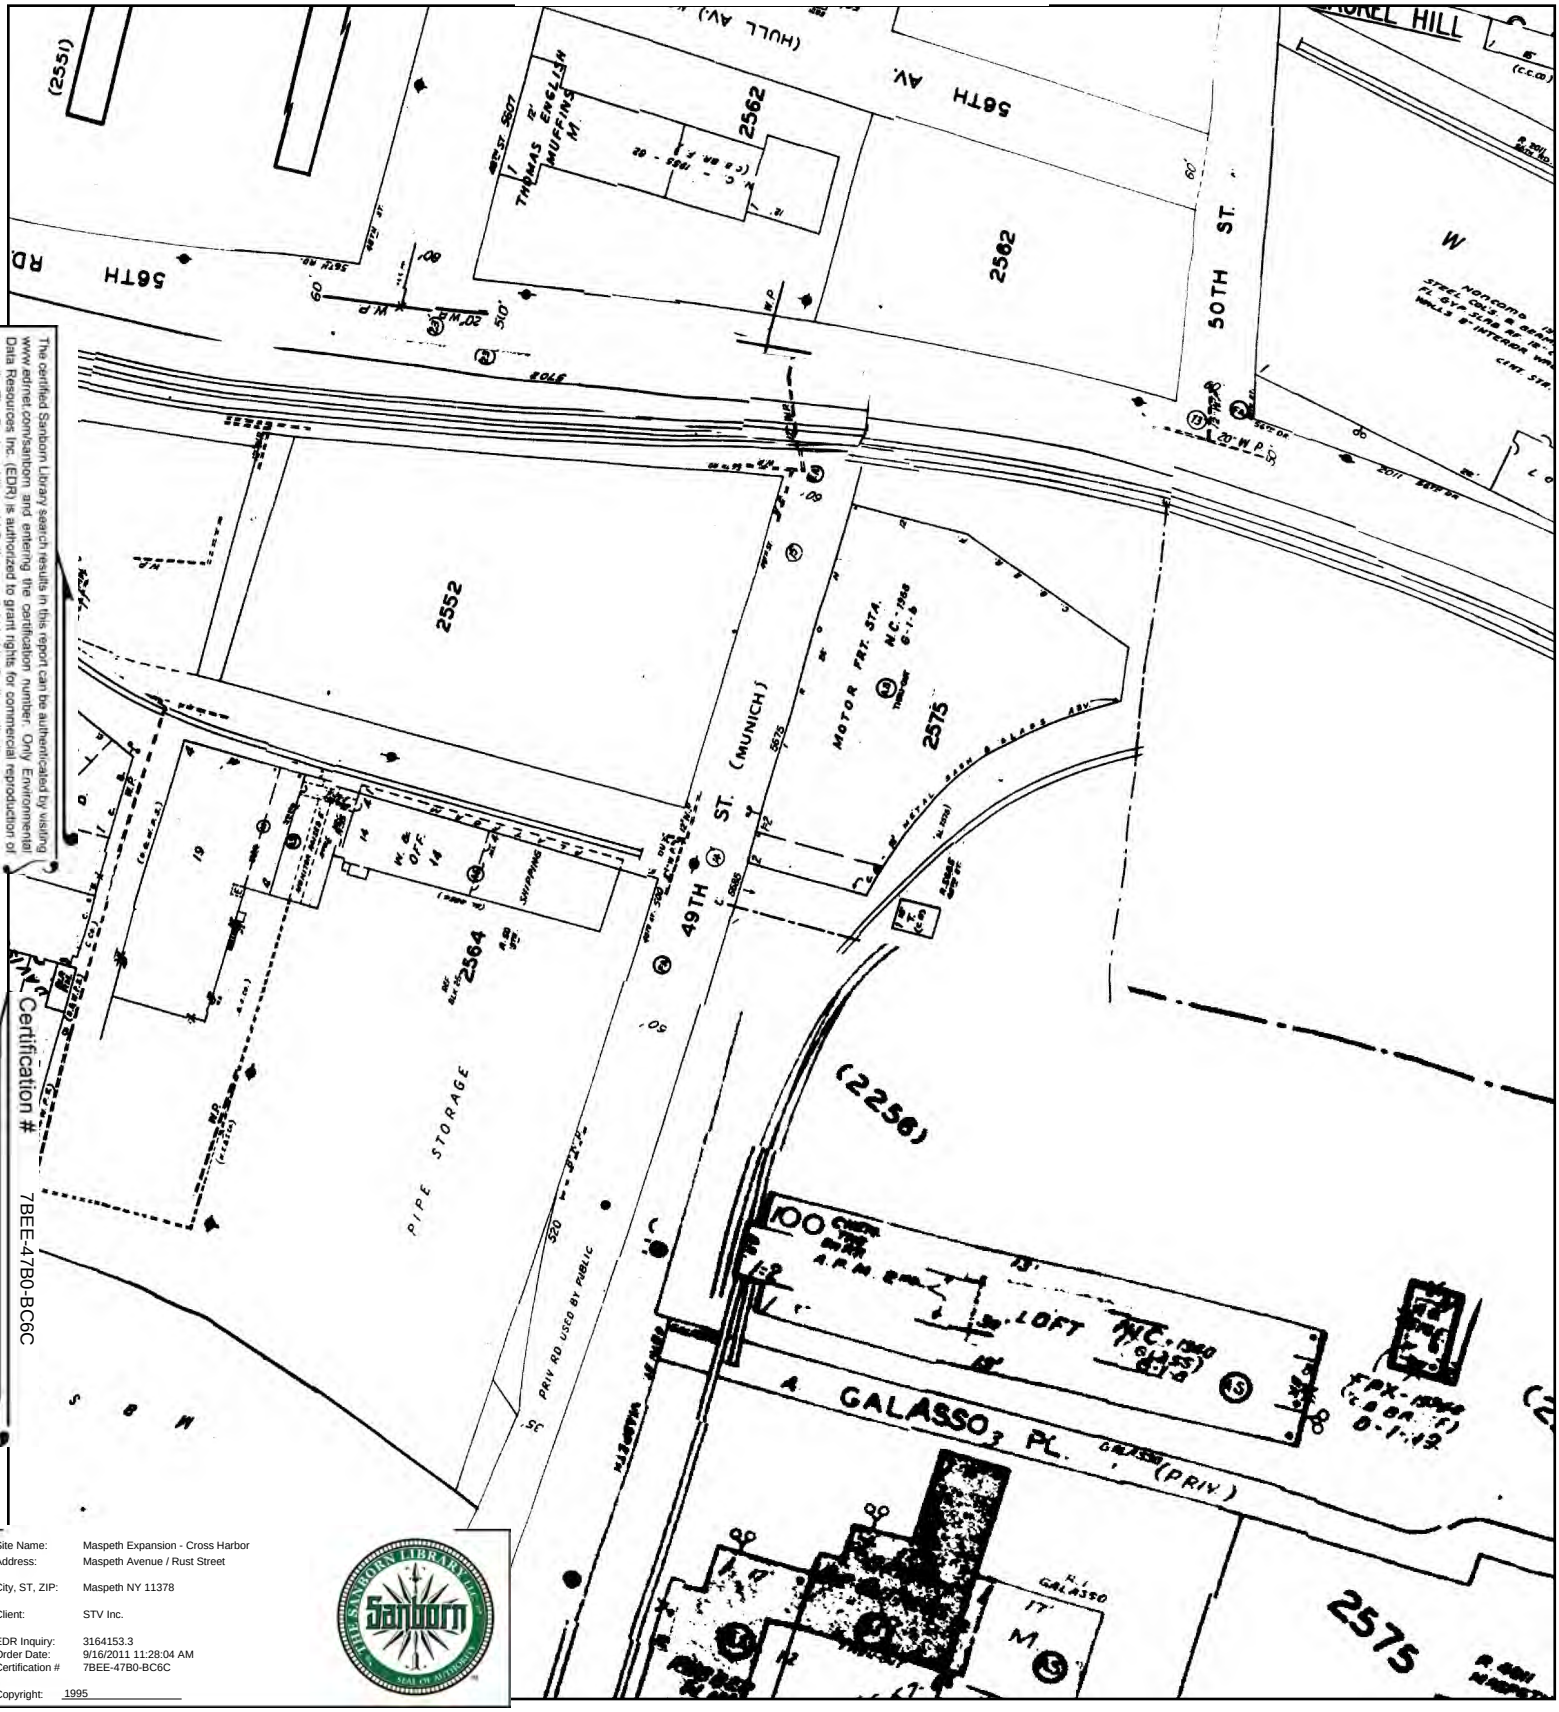

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1995

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

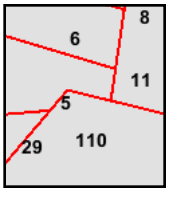

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1994 Certified Sanborn Map

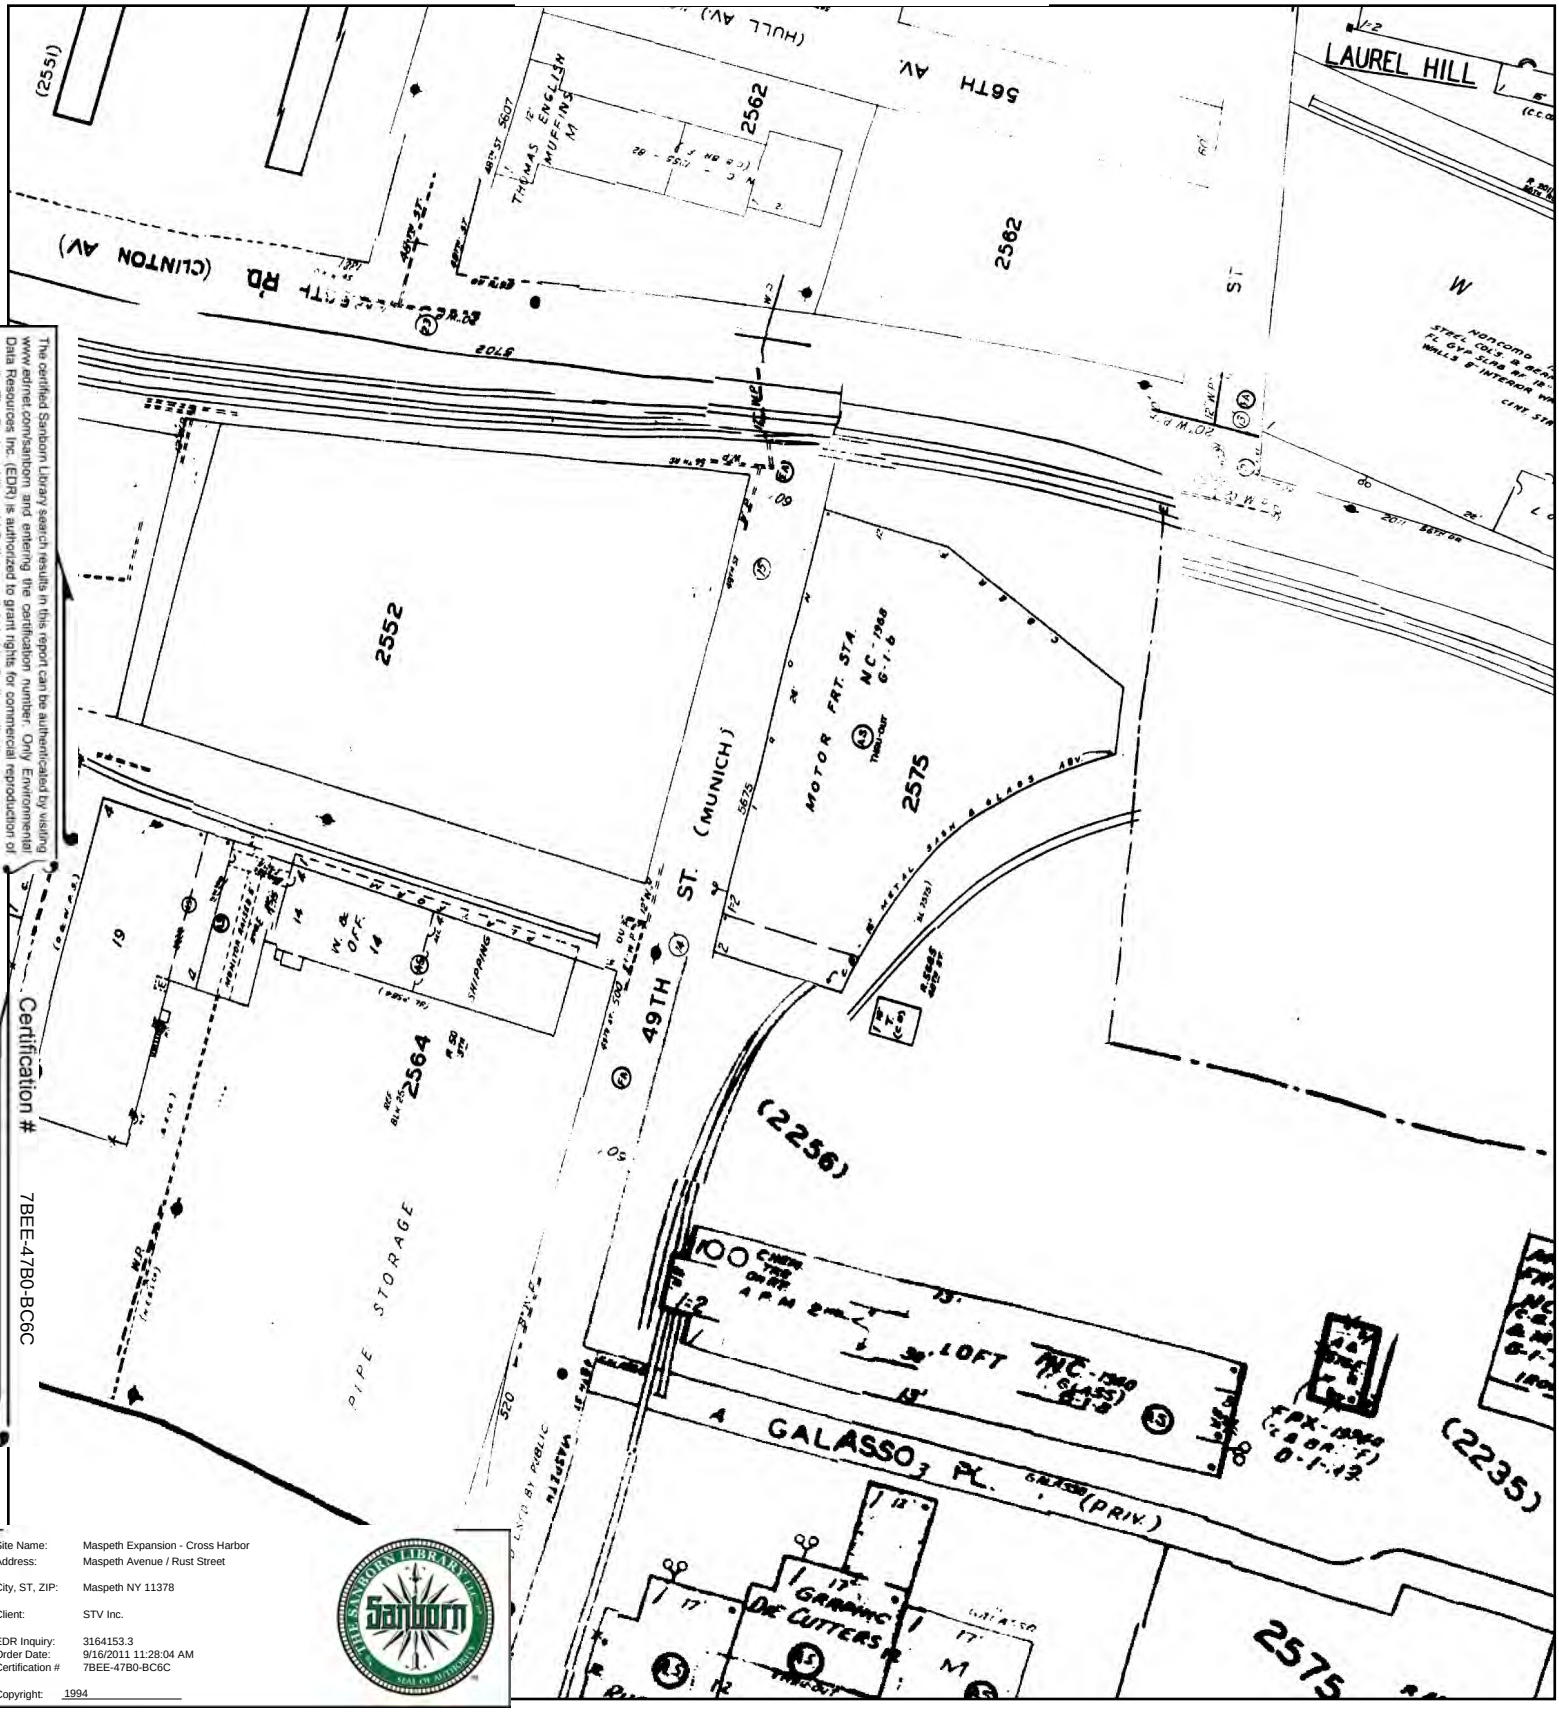

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1994

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

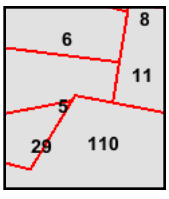

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

Maspeth Expansion - Cross Harbor
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Inquiry Number: 3164153.3
September 16, 2011

Certified Sanborn® Map Report

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

9/16/11

Site Name:
Maspeth Expansion - Cross
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Client Name:
STV Inc.
225 Park Ave S
New York, NY 10003

EDR Inquiry # 3164153.3

Contact: Doane E. Cafferty

The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by STV Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, State, Zip: Maspeth, NY 11378
Cross Street:
P.O. # 4014403
Project: Cross Harbor-Maspeth Expansion
Certification # 7BEE-47B0-BC6C

Maps Provided:

2006	1999	1991	1980
2005	1996	1990	1971
2004	1995	1988	1950
2003	1994	1986	1936
2002	1993	1985	1914
2001	1992	1982	1902

Sanborn® Library search results
Certification # 7BEE-47B0-BC6C

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ✓ Library of Congress
- ✓ University Publications of America
- ✓ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

STV Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

2006 Source Sheets

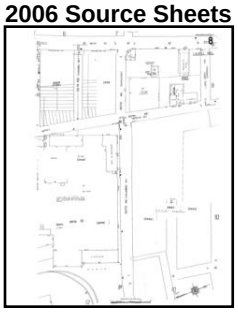
Volume 3, Sheet 8

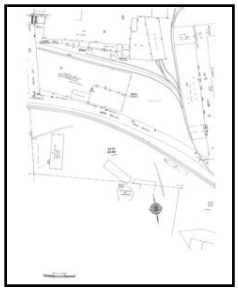
Volume 3, Sheet 11

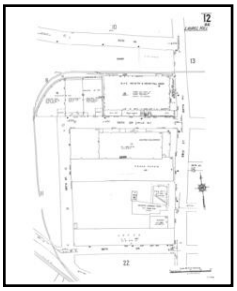
Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

2005 Source Sheets

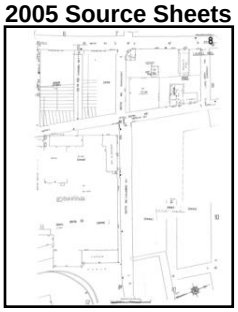
Volume 3, Sheet 8

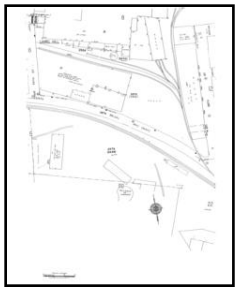
Volume 3, Sheet 11

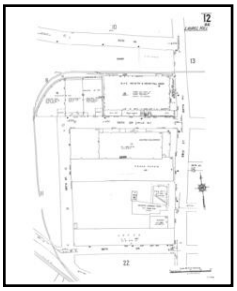
Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

2004 Source Sheets

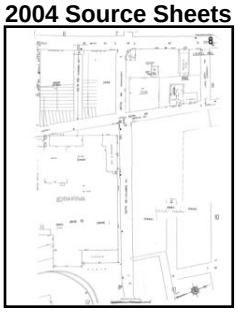
Volume 3, Sheet 8

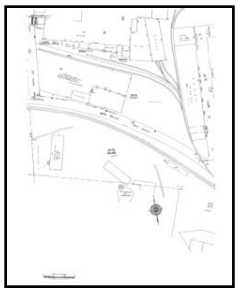
Volume 3, Sheet 11

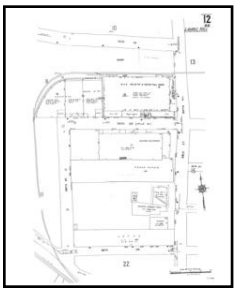
Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

2003 Source Sheets

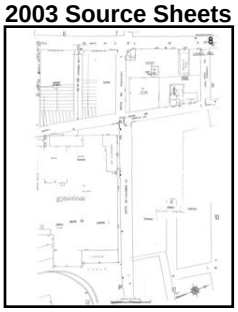
Volume 3, Sheet 8

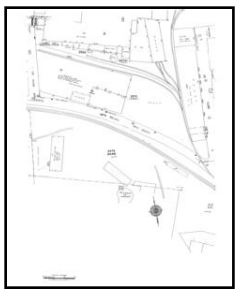
Volume 3, Sheet 11

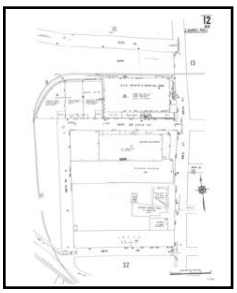
Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

2002 Source Sheets

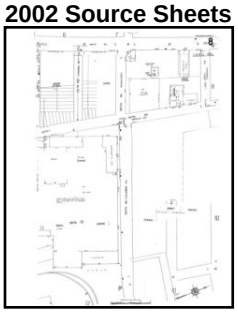

Volume 3, Sheet 8

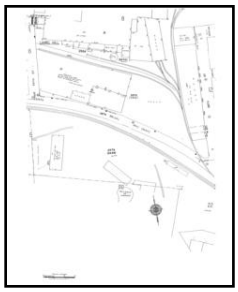

Volume 3, Sheet 11

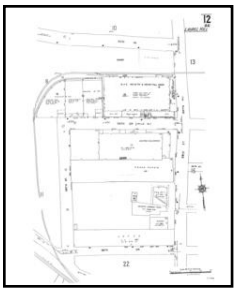

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

2001 Source Sheets

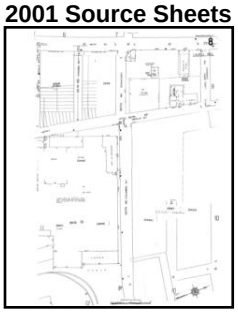

Volume 3, Sheet 8

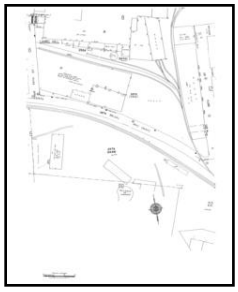

Volume 3, Sheet 11

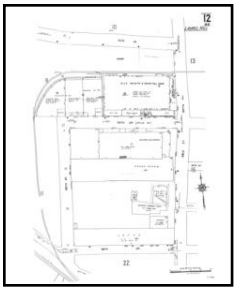

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1999 Source Sheets

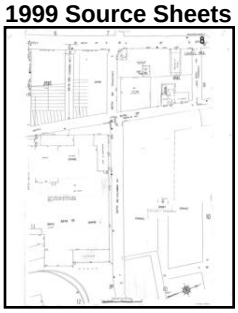

Volume 3, Sheet 8

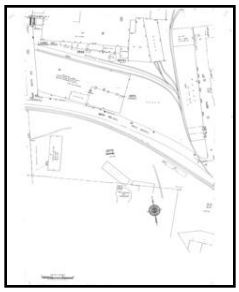

Volume 3, Sheet 11

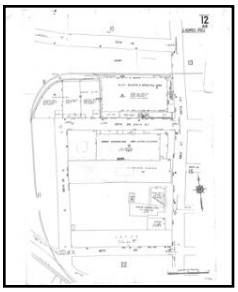

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1996 Source Sheets

Volume 3, Sheet 110

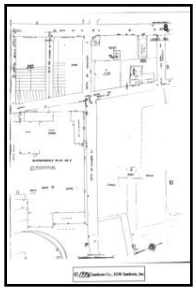

Volume 3, Sheet 8

Volume 3, Sheet 11

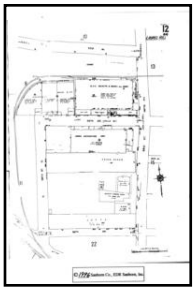

Volume 3, Sheet 12

Volume 3, Sheet 22

1995 Source Sheets

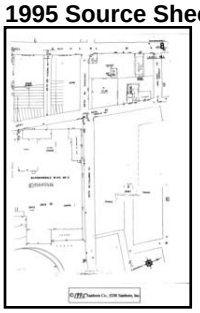

Volume 3, Sheet 8

Volume 3, Sheet 11

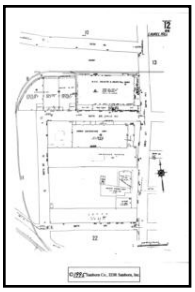

Volume 3, Sheet 12

Volume 3, Sheet 22

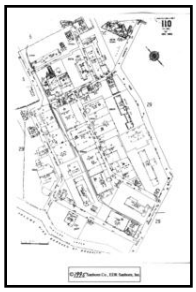

Volume 3, Sheet 110

1994 Source Sheets

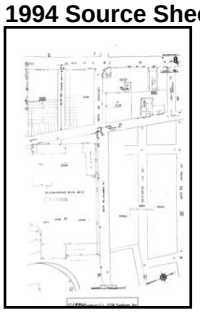

Volume 3, Sheet 8

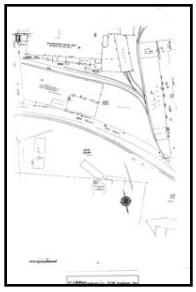

Volume 3, Sheet 11

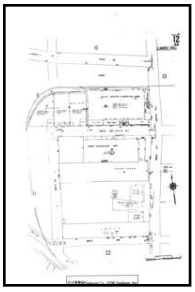

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1993 Source Sheets

Volume 3, Sheet 110

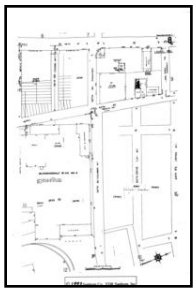

Volume 3, Sheet 8

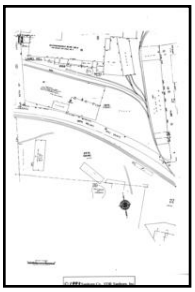

Volume 3, Sheet 11

Volume 3, Sheet 12

Volume 3, Sheet 22

1992 Source Sheets

Volume 3, Sheet 110

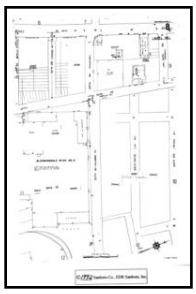

Volume 3, Sheet 8

Volume 3, Sheet 11

Volume 3, Sheet 12

Volume 3, Sheet 22

1991 Source Sheets

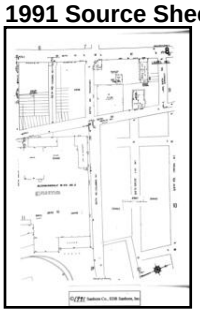

Volume 3, Sheet 8

Volume 3, Sheet 11

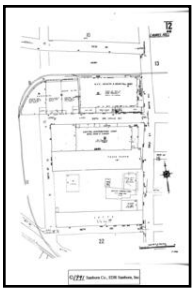

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1990 Source Sheets

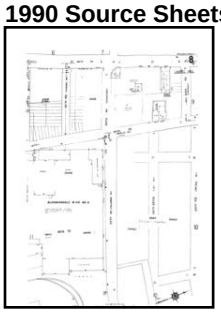

Volume 3, Sheet 8

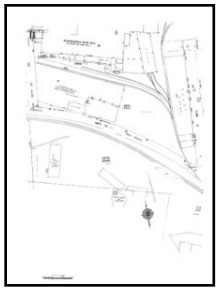

Volume 3, Sheet 11

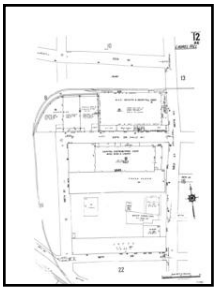

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1988 Source Sheets

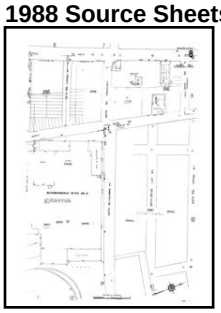

Volume 3, Sheet 8

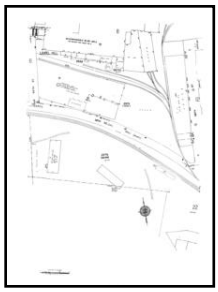

Volume 3, Sheet 11

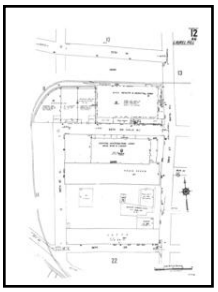

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1986 Source Sheets

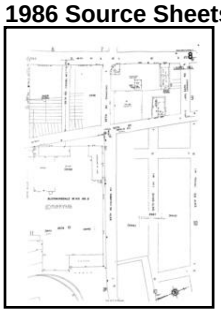

Volume 3, Sheet 8

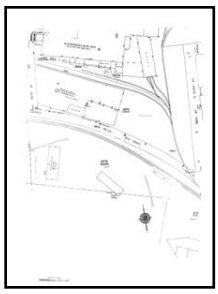

Volume 3, Sheet 11

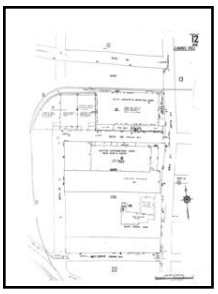

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1985 Source Sheets

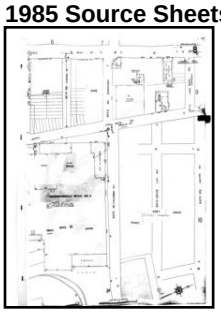

Volume 3, Sheet 8

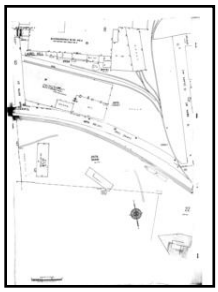

Volume 3, Sheet 11

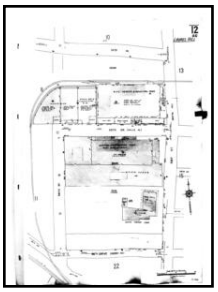

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1982 Source Sheets

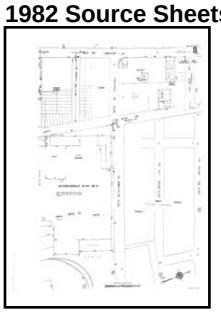

Volume 3, Sheet 8

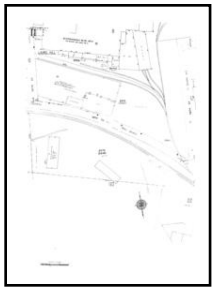

Volume 3, Sheet 11

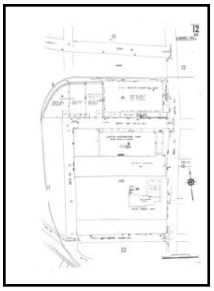

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 110

1980 Source Sheets

Volume 3, Sheet 110

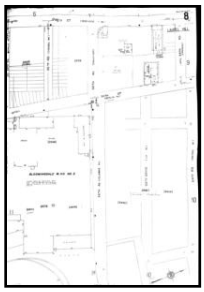

Volume 3, Sheet 8

Volume 3, Sheet 11

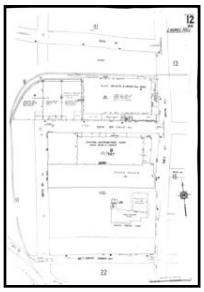

Volume 3, Sheet 12

Volume 3, Sheet 22

1971 Source Sheets

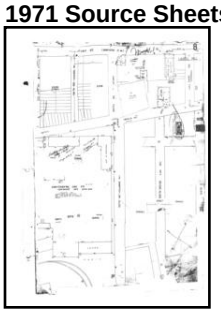

Volume 3, Sheet 8

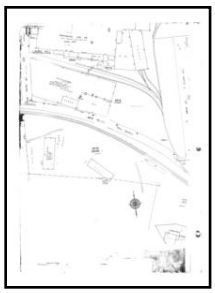

Volume 3, Sheet 11

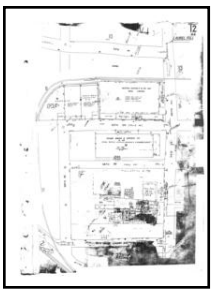

Volume 3, Sheet 12

Volume 3, Sheet 22

1950 Source Sheets

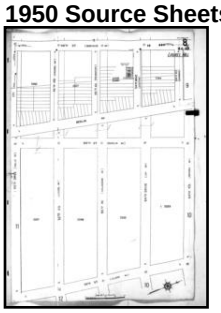

Volume 3, Sheet 8

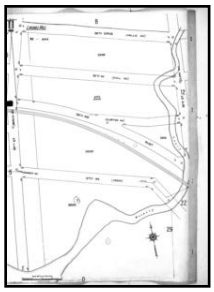

Volume 3, Sheet 11

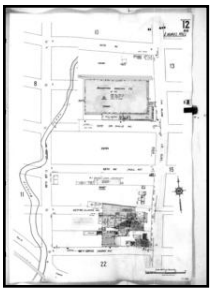

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 29

1936 Source Sheets

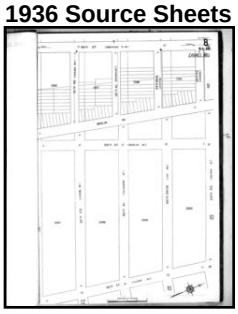

Volume 3, Sheet 8

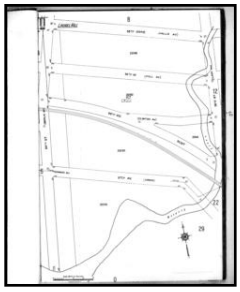

Volume 3, Sheet 11

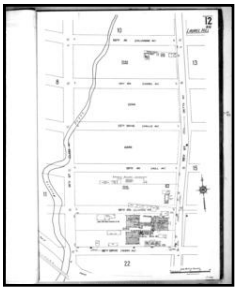

Volume 3, Sheet 12

Volume 3, Sheet 22

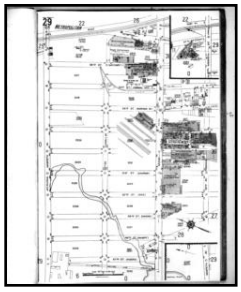

Volume 3, Sheet 29

1914 Source Sheets

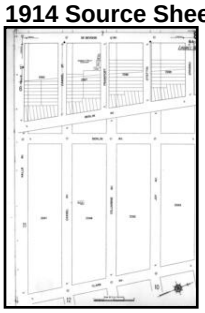

Volume 3, Sheet 8

Volume 3, Sheet 11

Volume 3, Sheet 12

Volume 3, Sheet 22

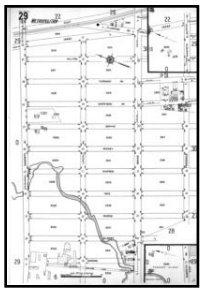

Volume 3, Sheet 29

1902 Source Sheets

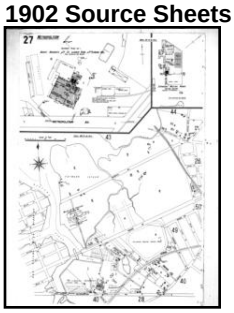

Volume 3, Sheet 27

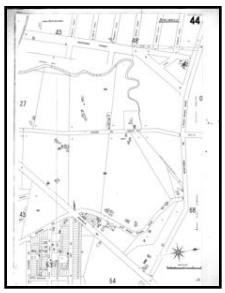

Volume 3, Sheet 44

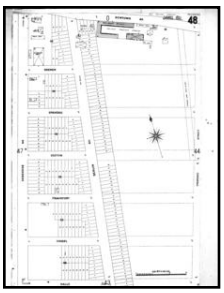

Volume 3, Sheet 48

2006 Certified Sanborn Map

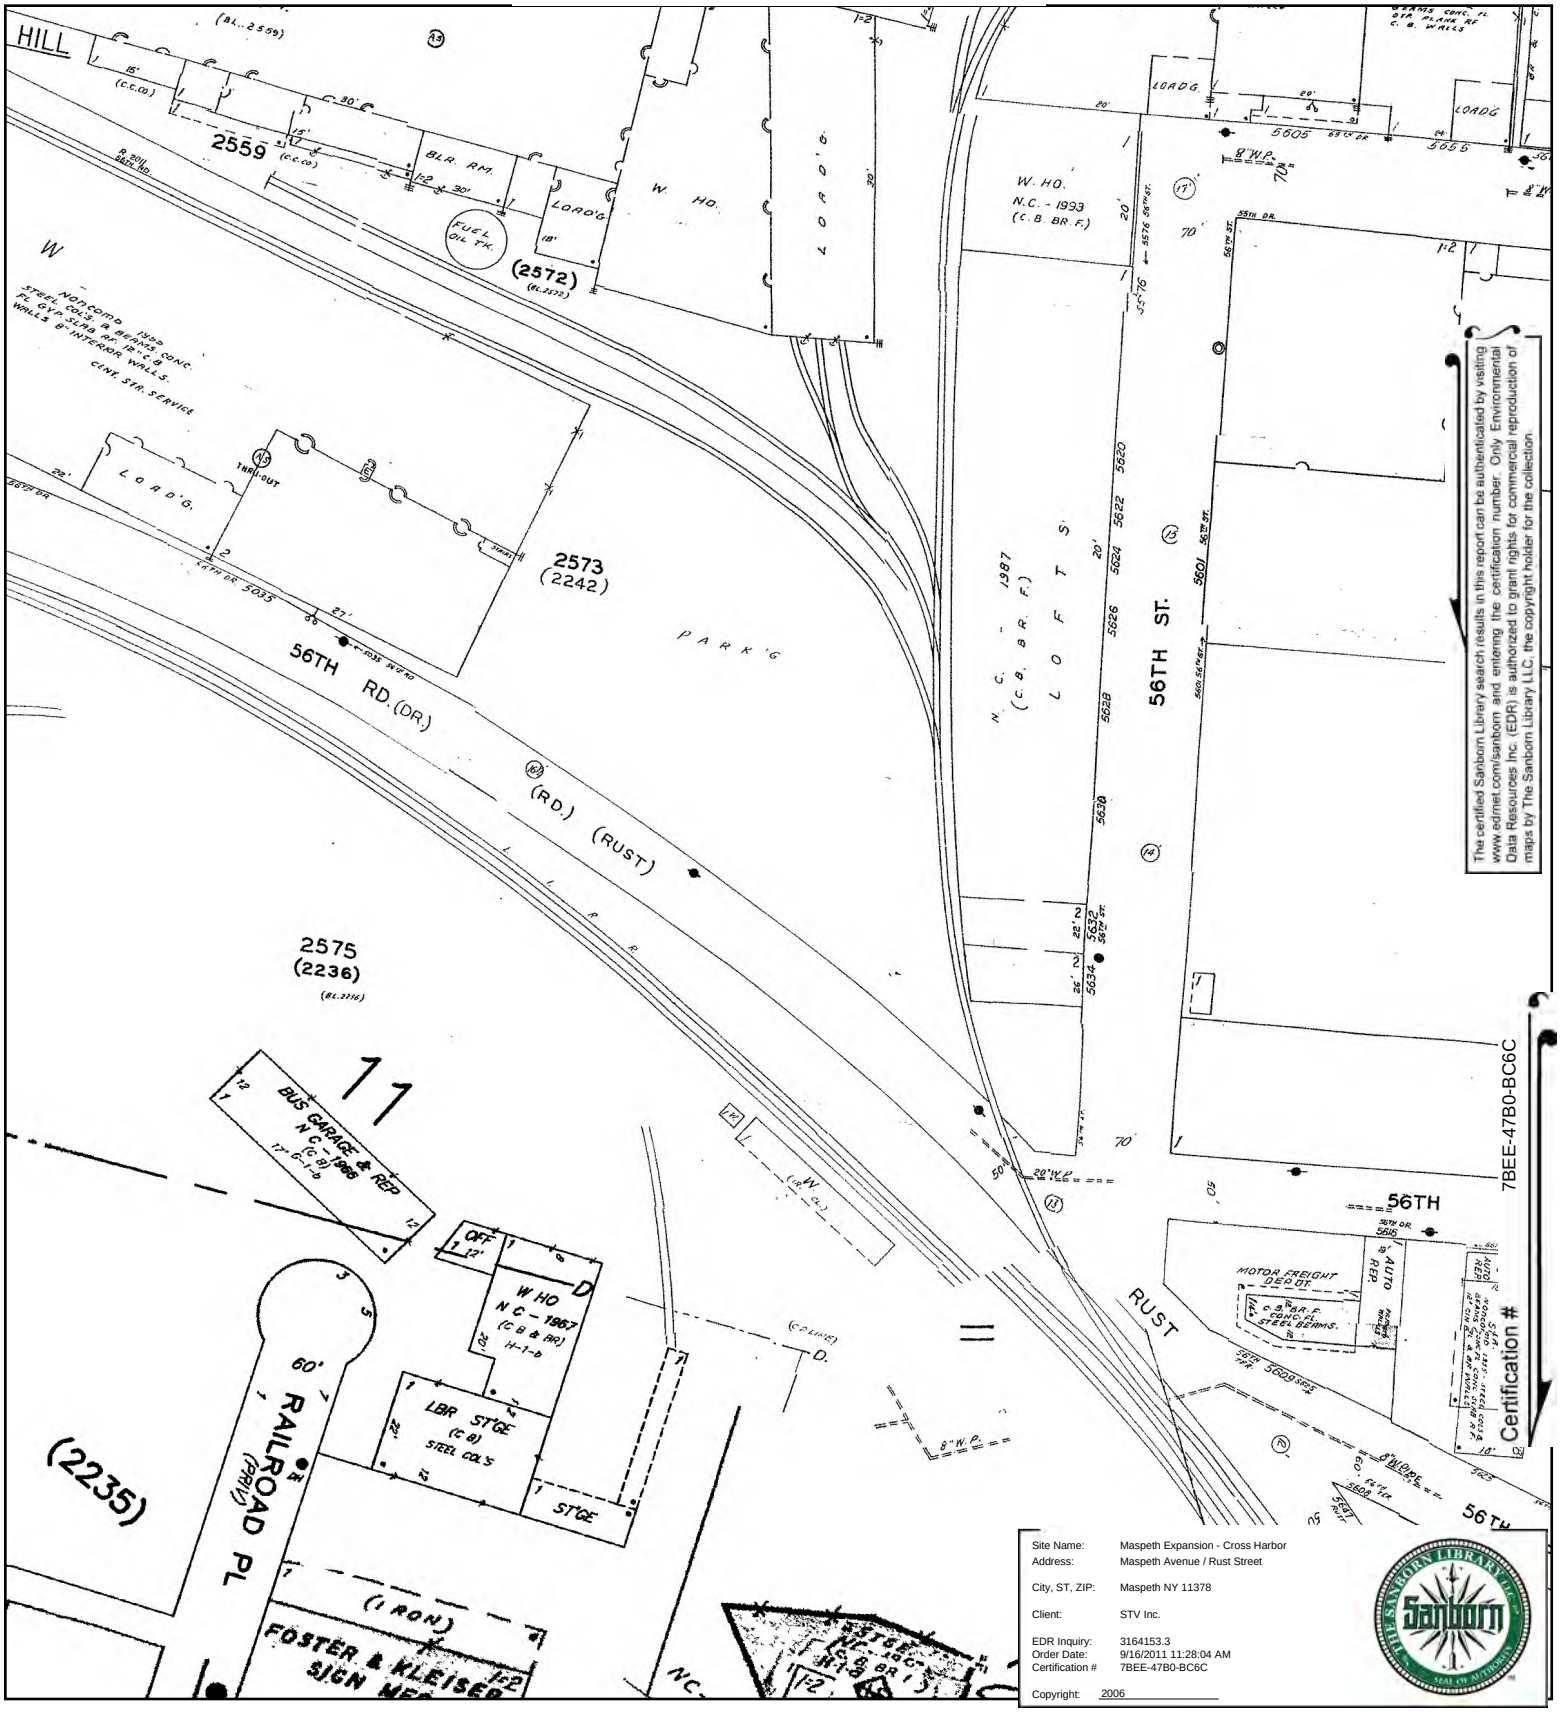

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2006

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

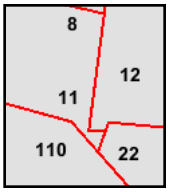

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

2005 Certified Sanborn Map

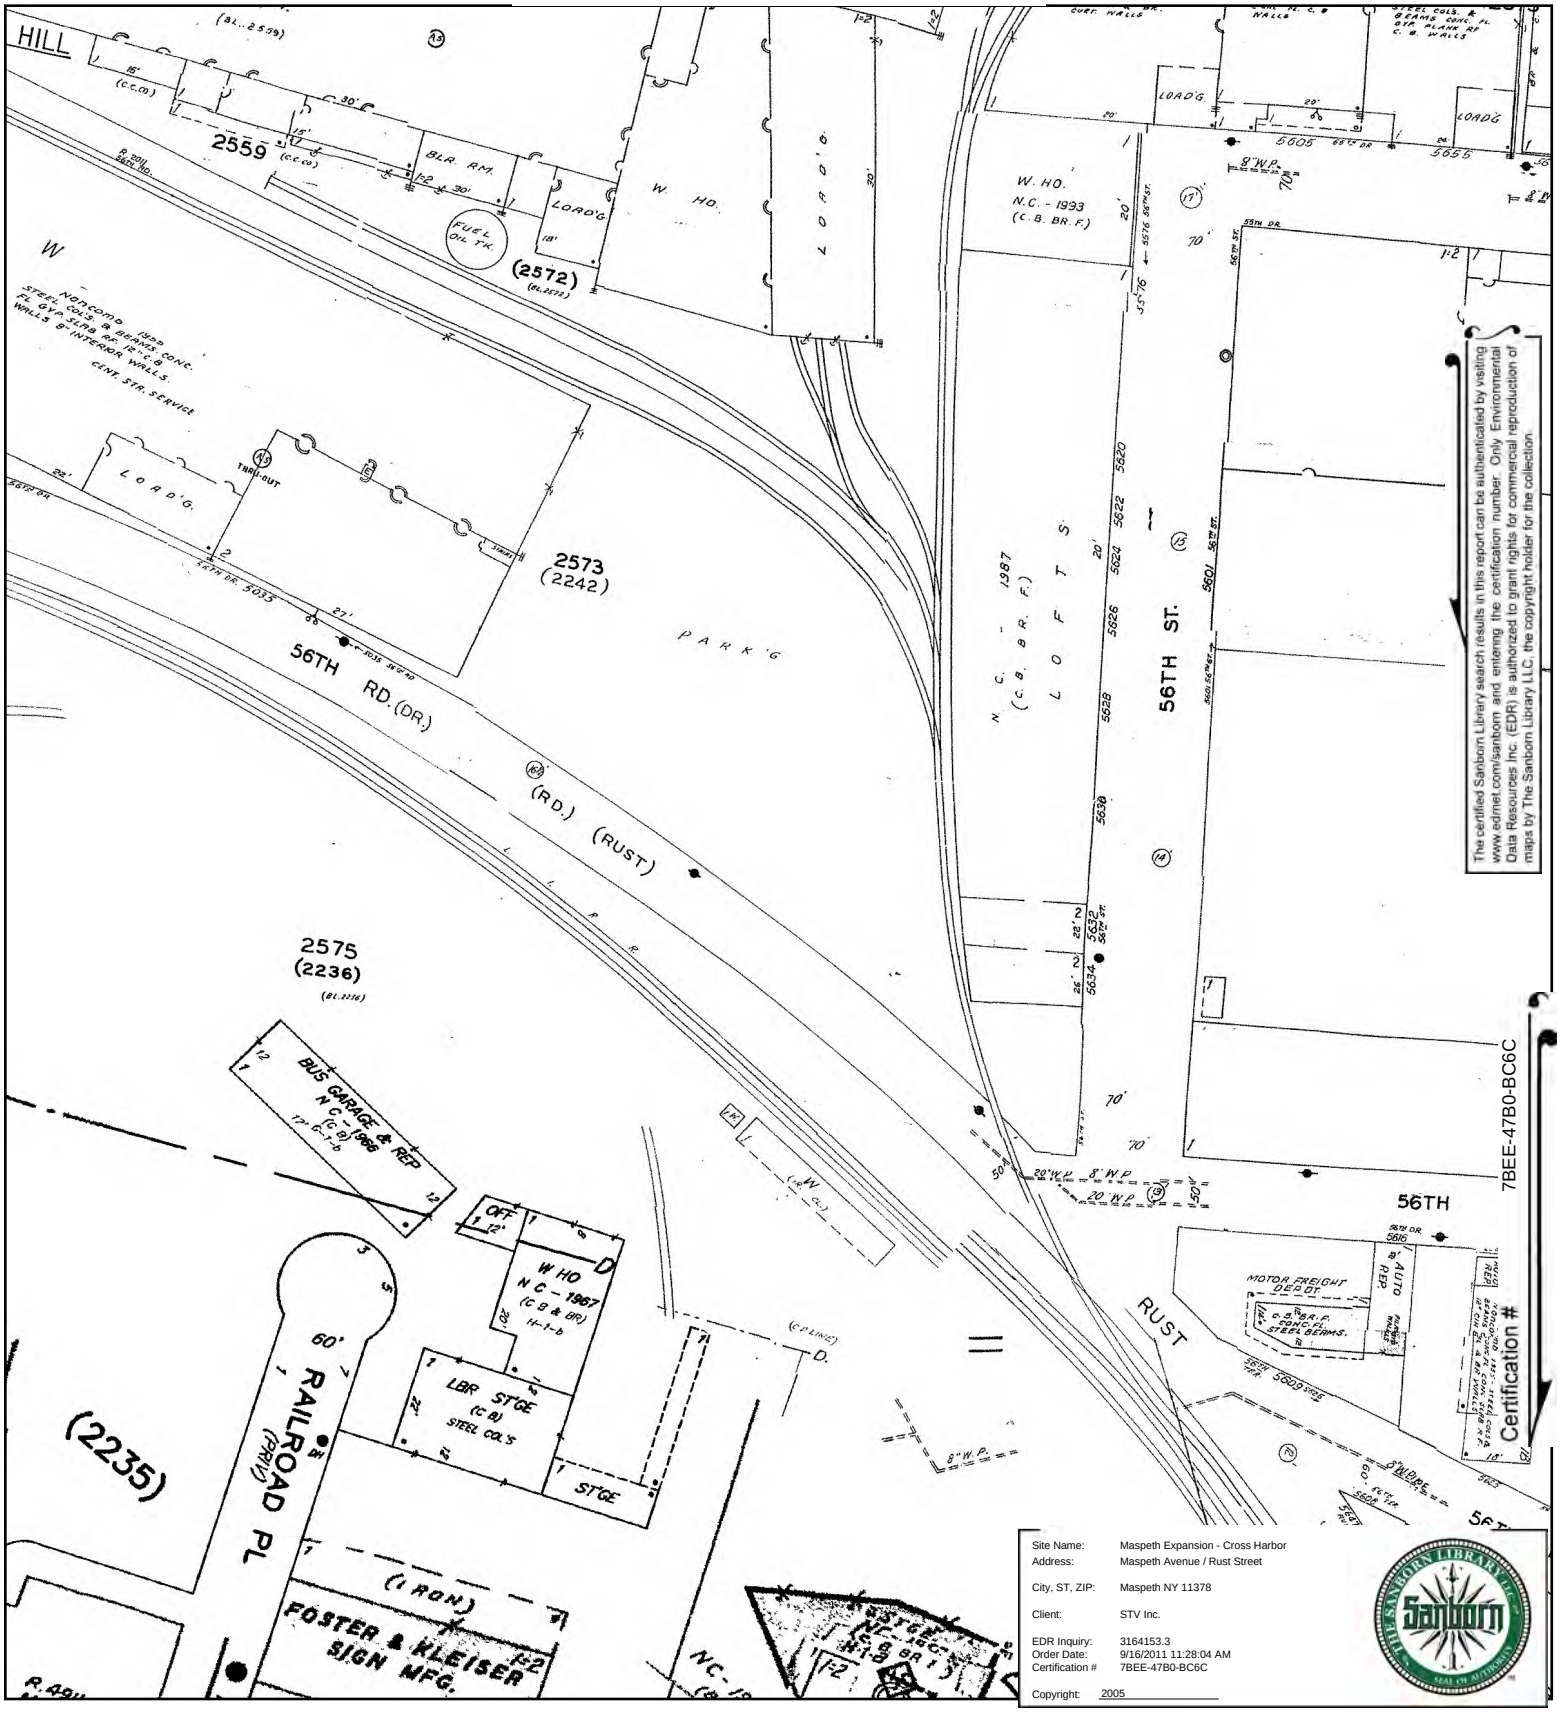

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2005

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

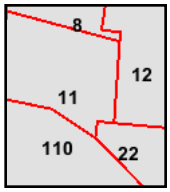

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

2004 Certified Sanborn Map

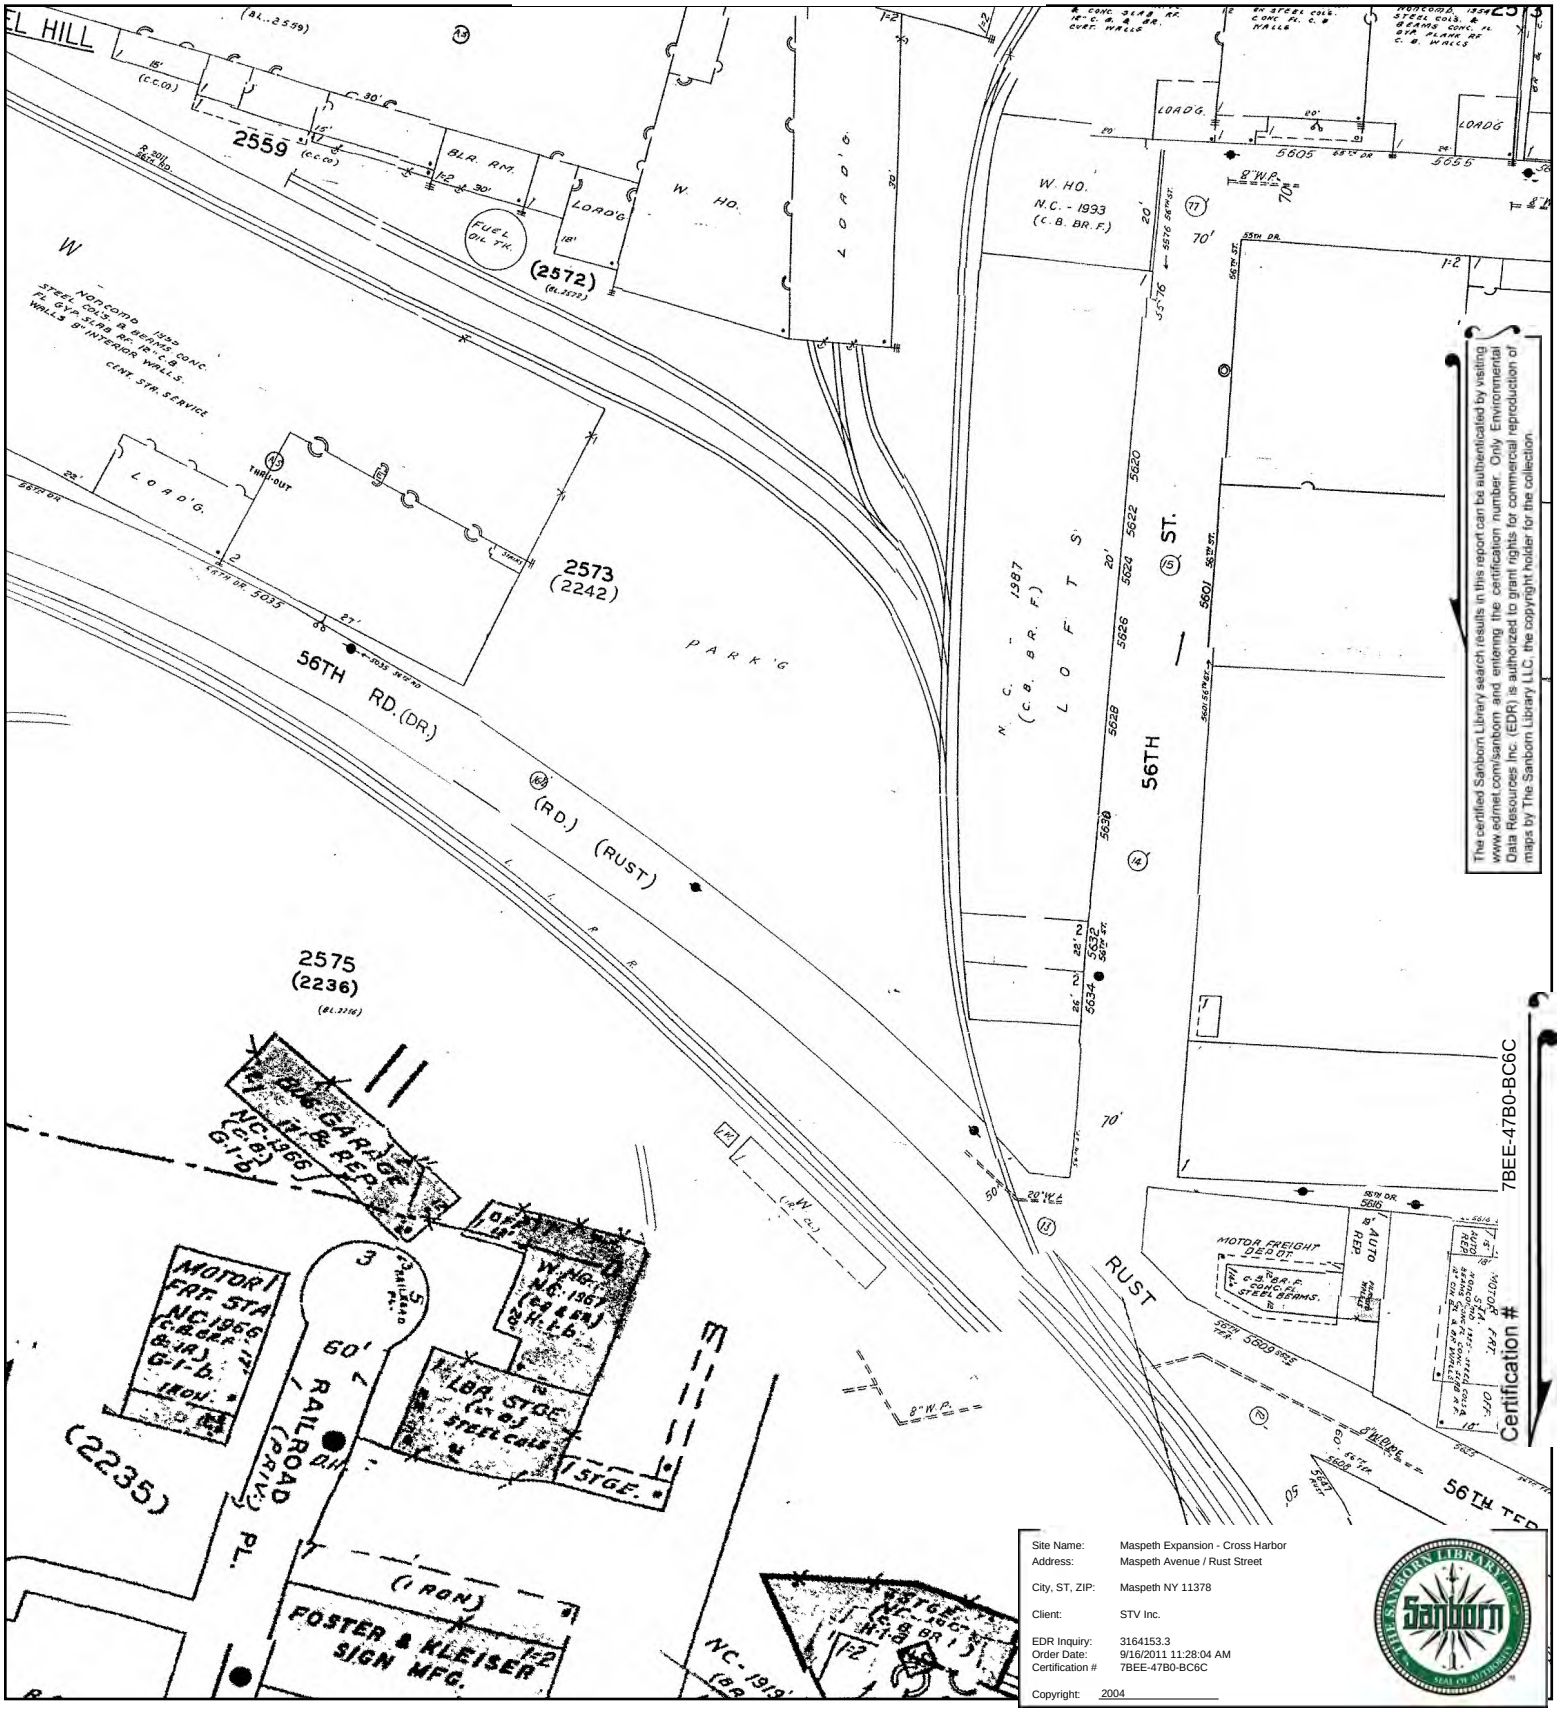

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2004

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

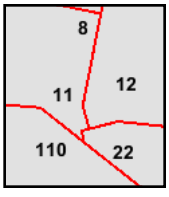

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

2003 Certified Sanborn Map

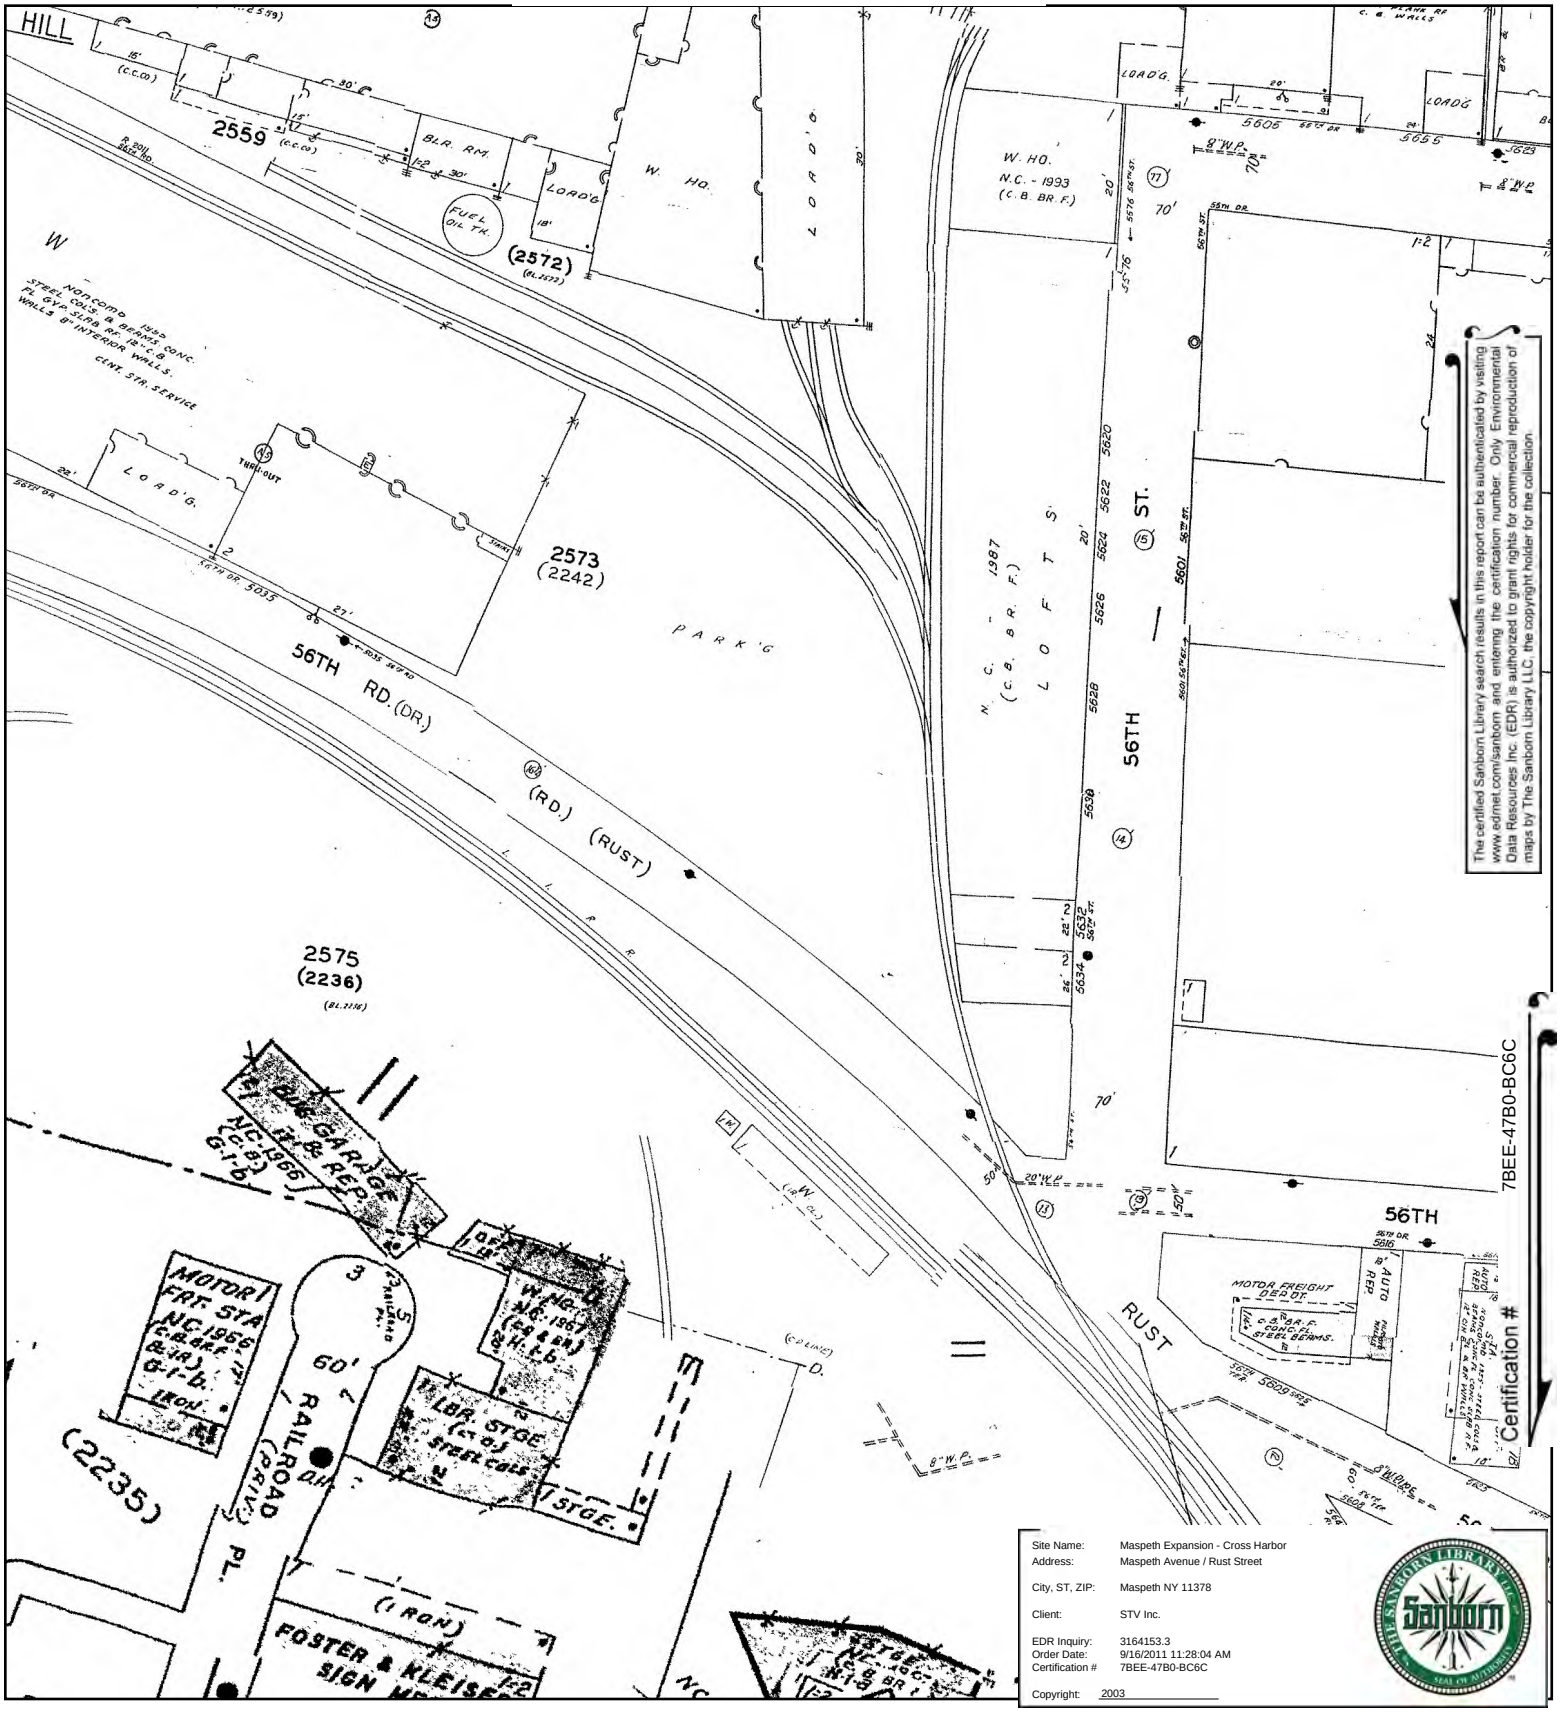

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

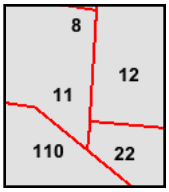

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

0 Feet 165 330 660

N

2002 Certified Sanborn Map

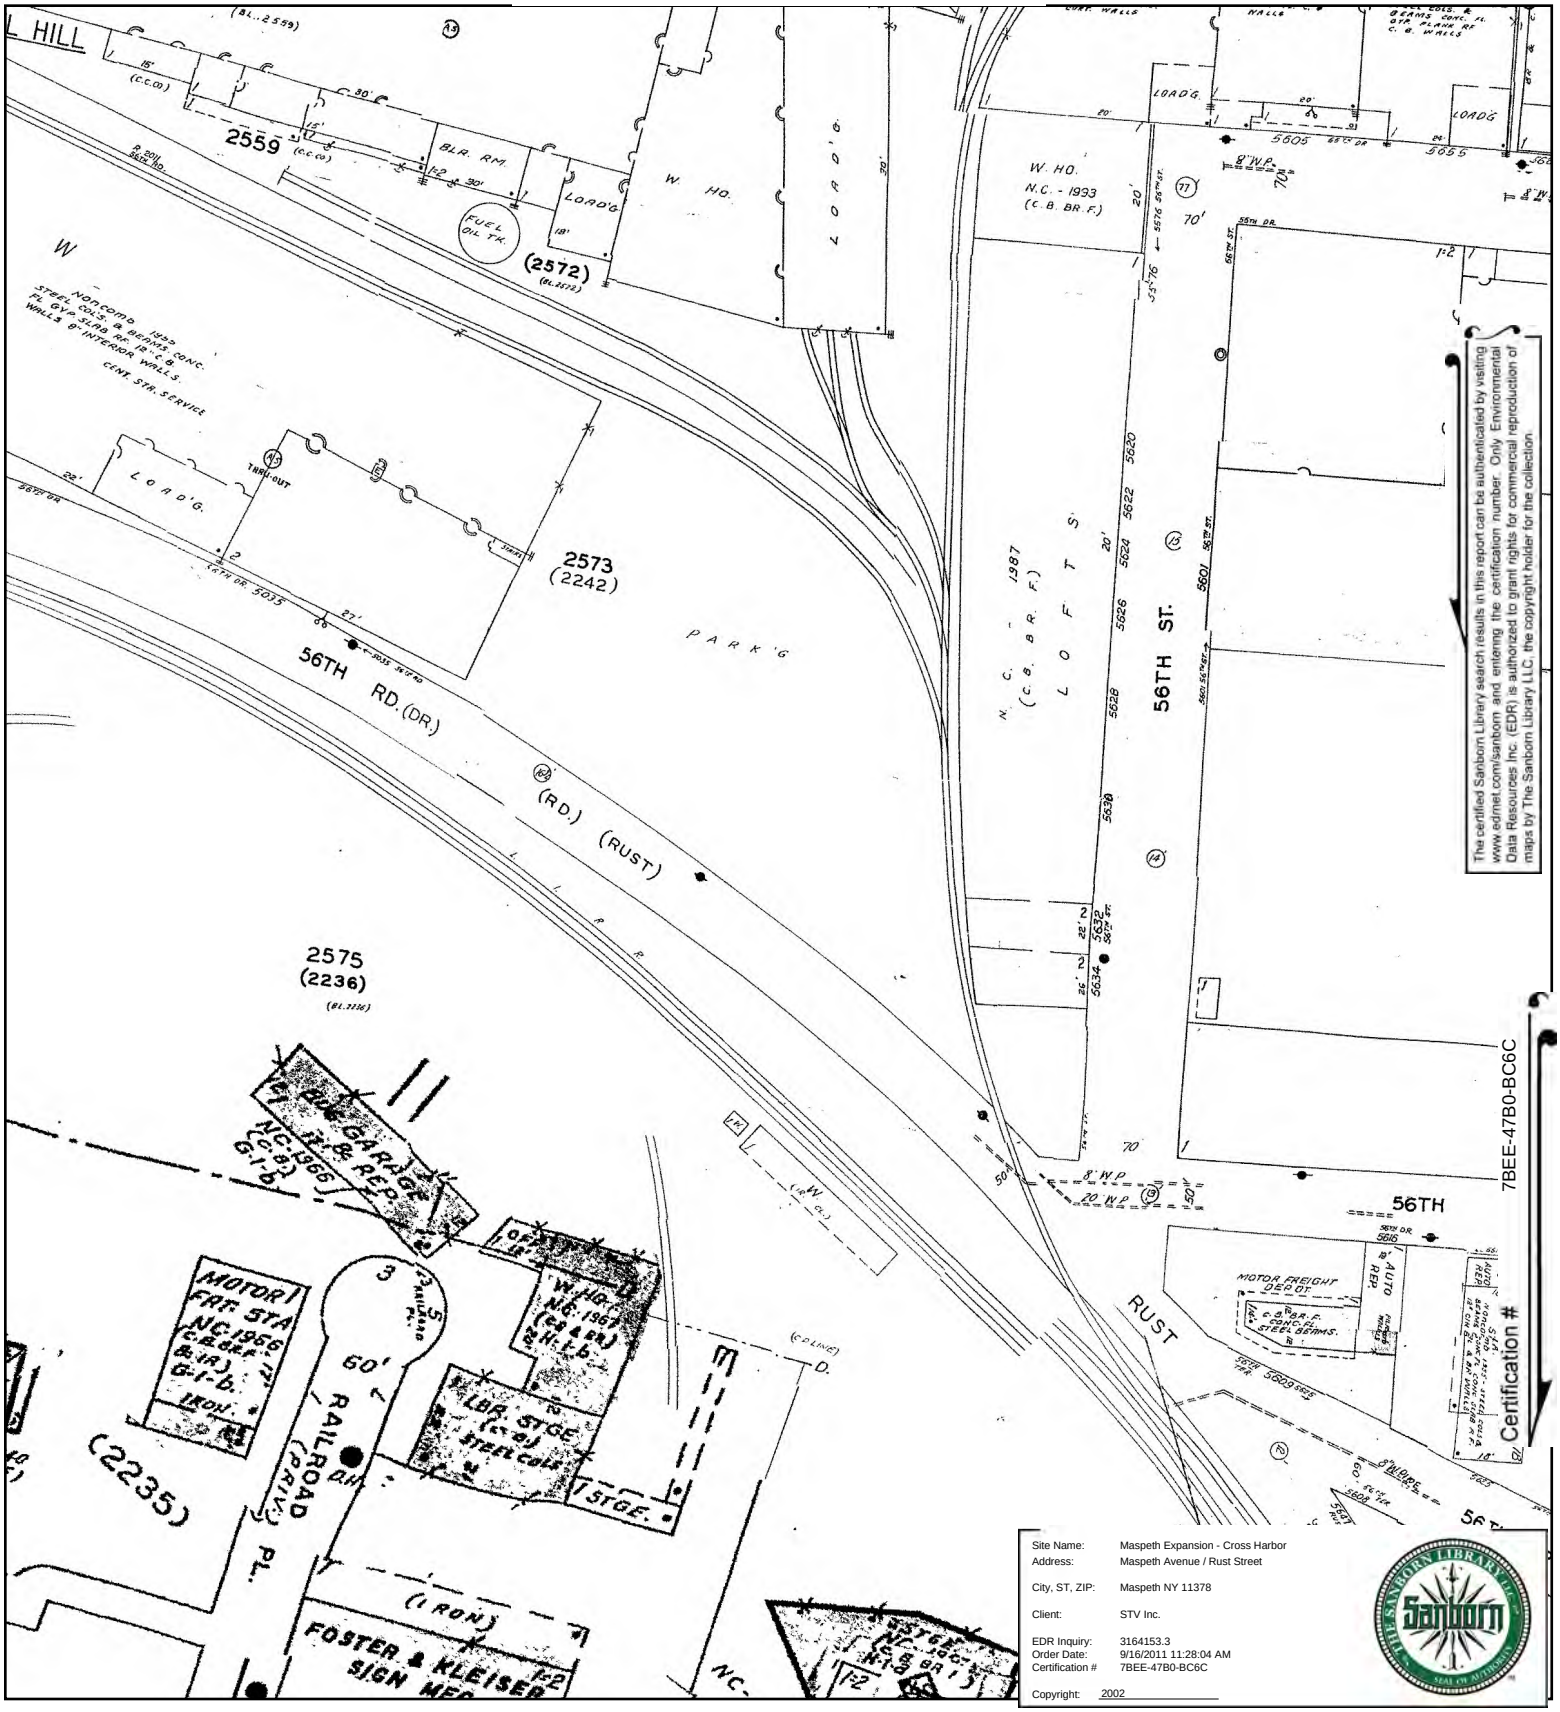

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2002

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

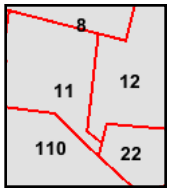

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

2001 Certified Sanborn Map

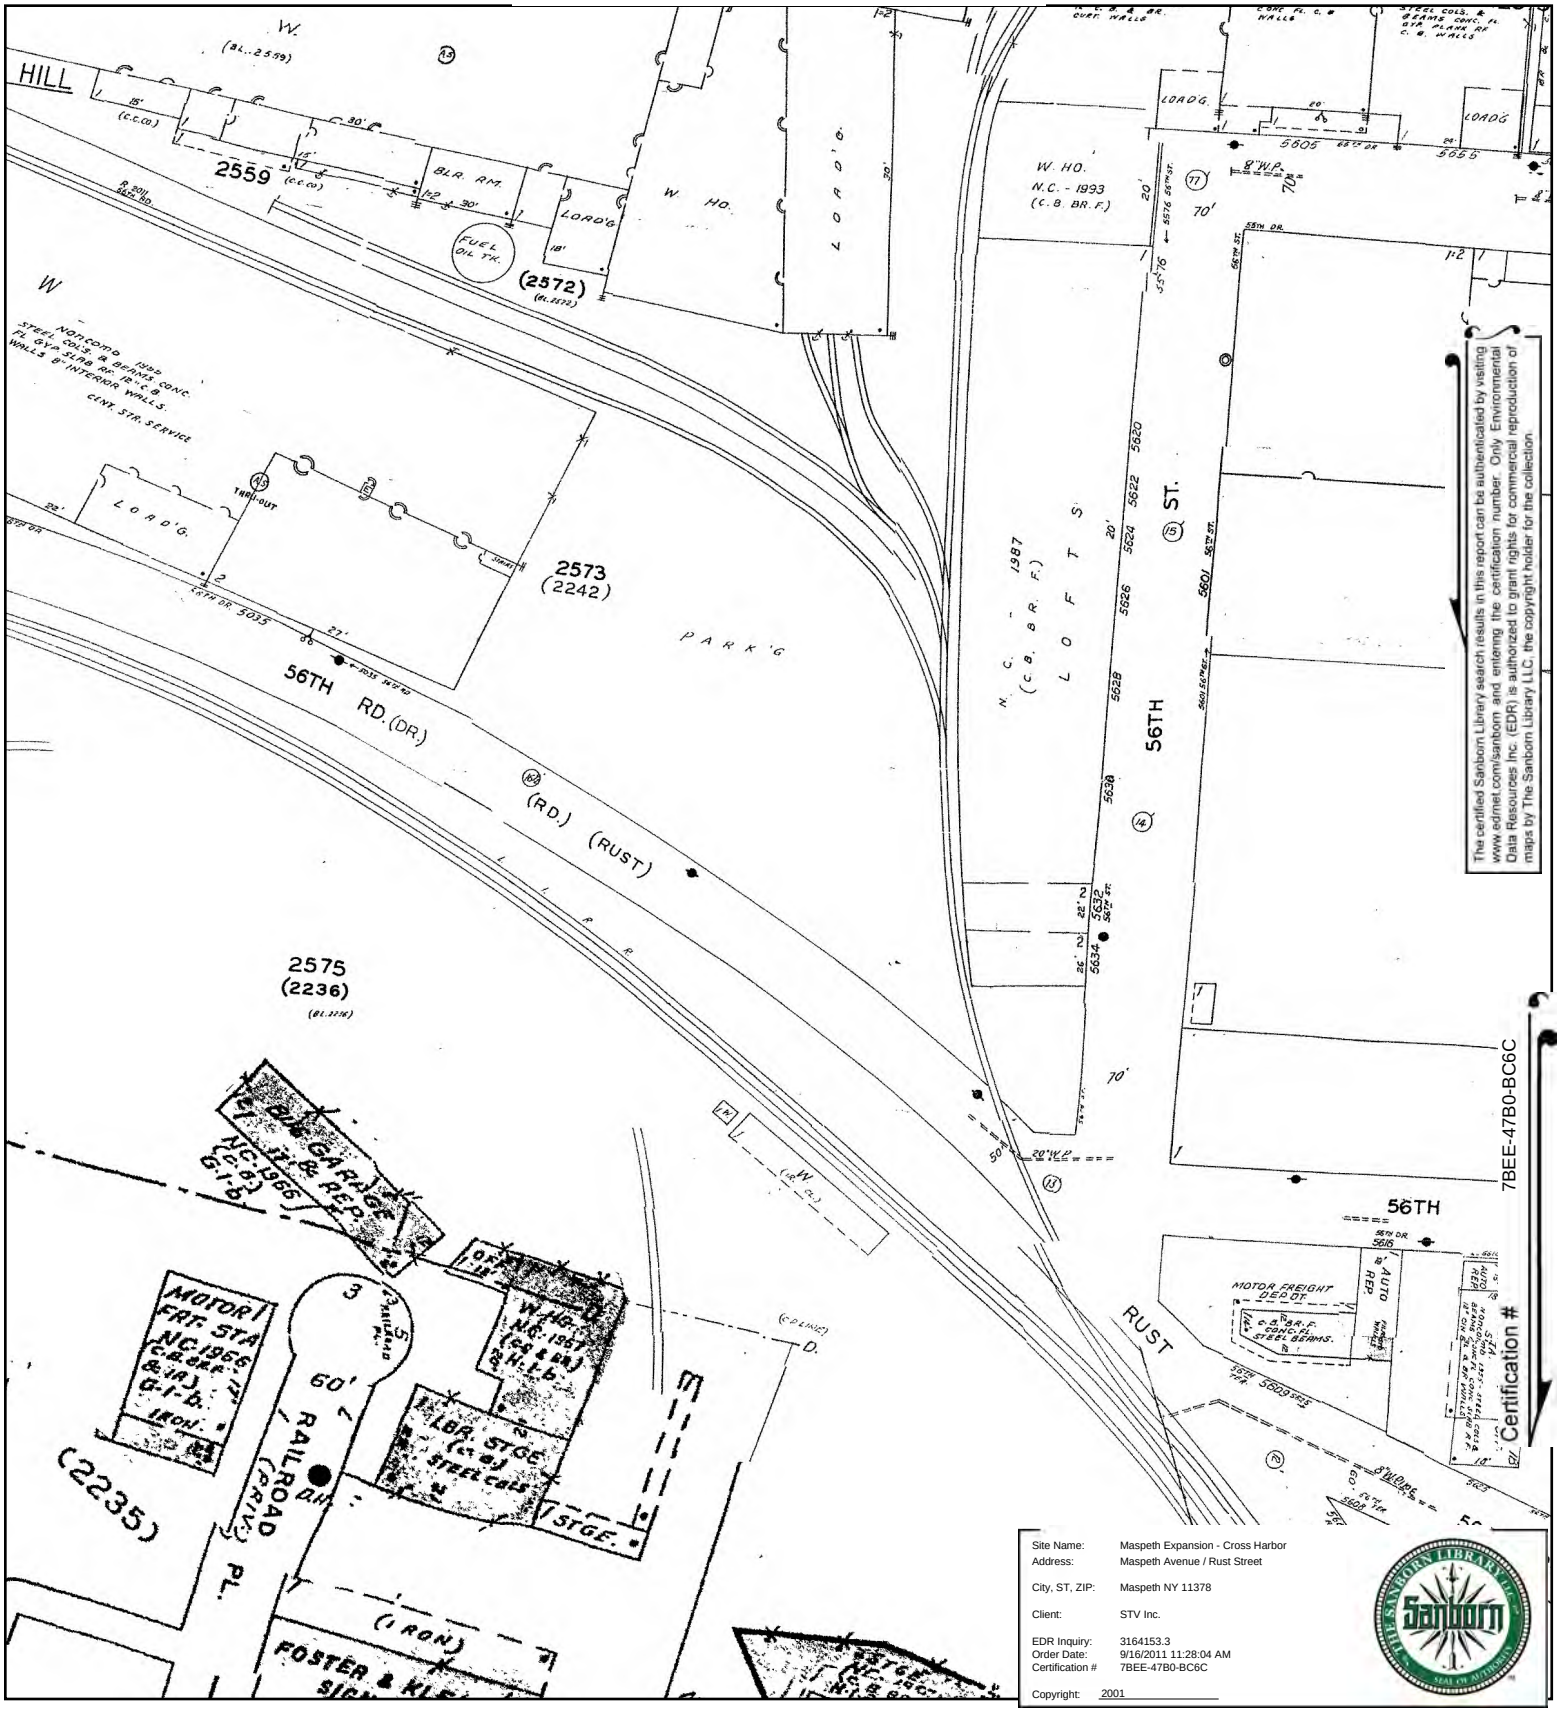

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2001

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

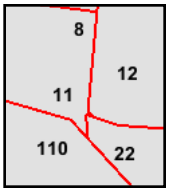

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1999 Certified Sanborn Map

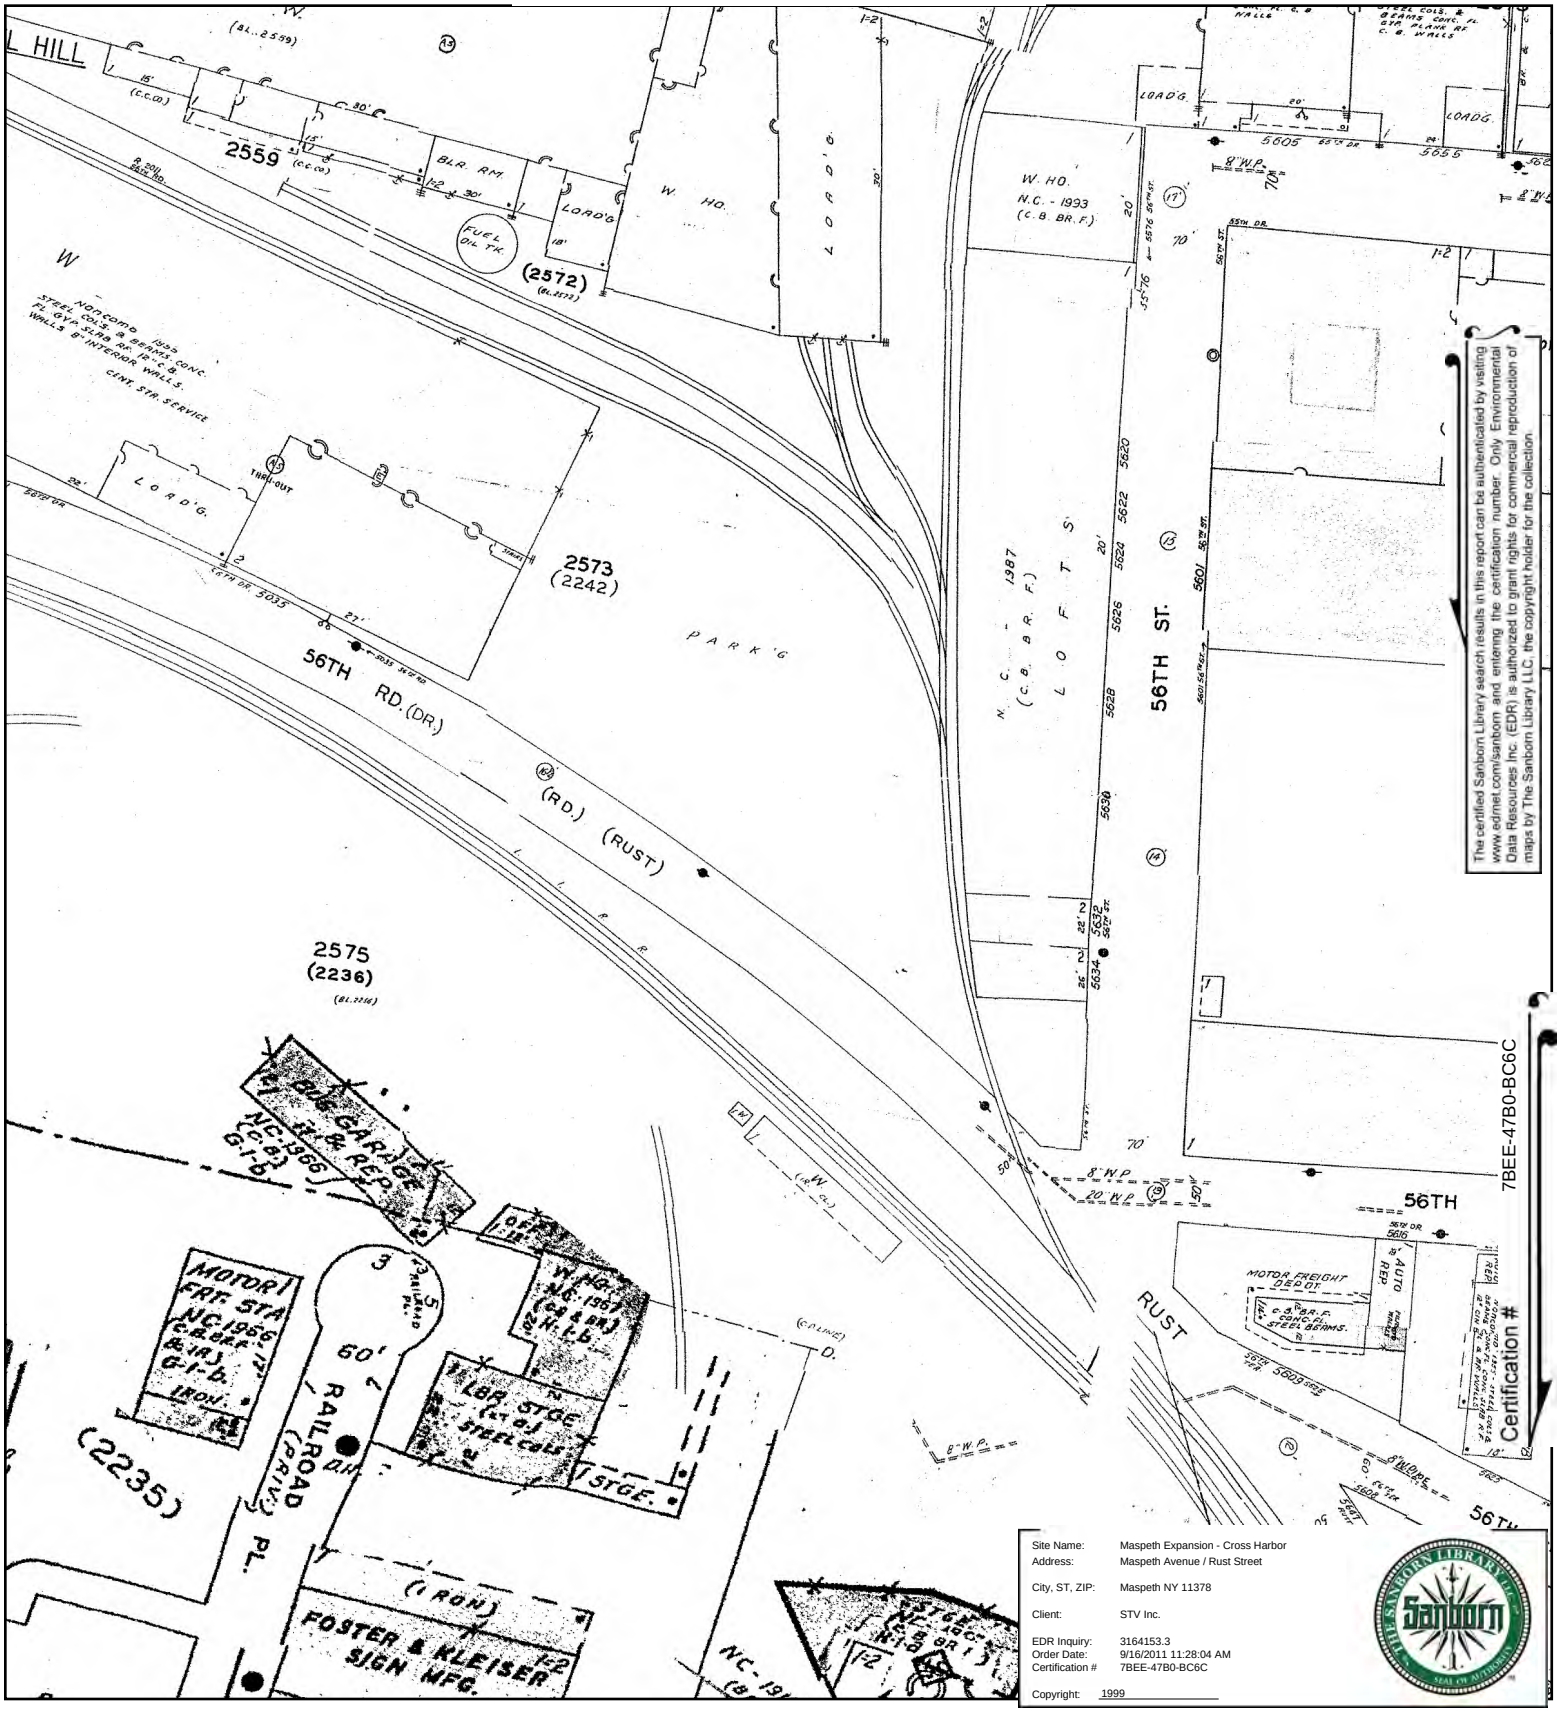

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

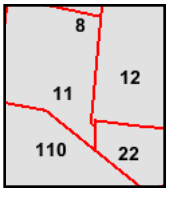

Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22
Volume 3, Sheet 110

N

1996 Certified Sanborn Map

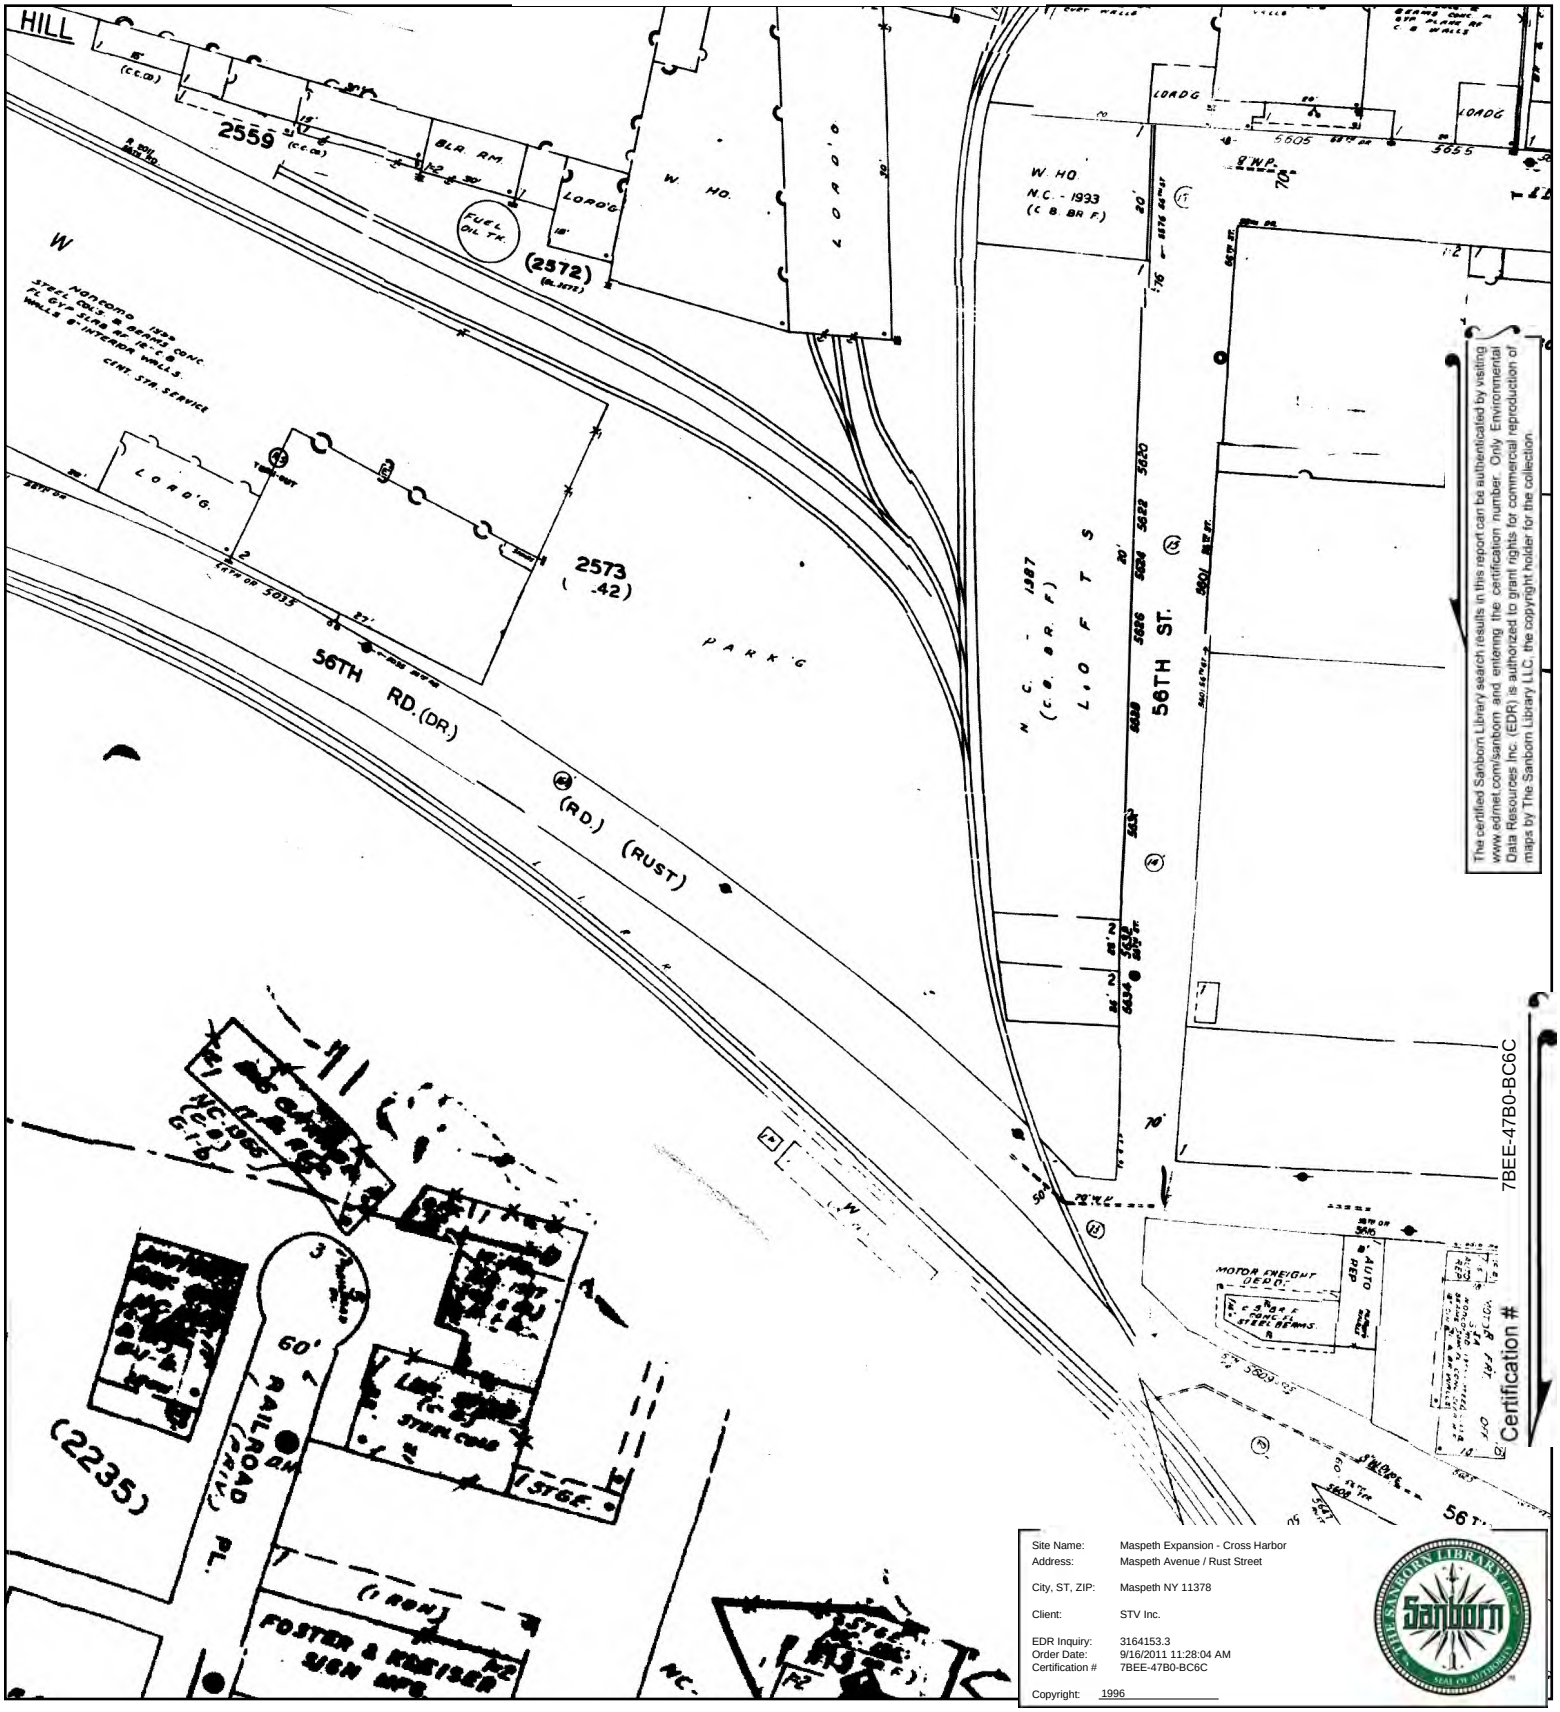

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

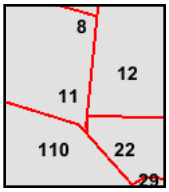

Volume 3, Sheet 110
Volume 3, Sheet 8
Volume 3, Sheet 11
Volume 3, Sheet 12
Volume 3, Sheet 22

N

Maspeth Expansion - Cross Harbor
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Inquiry Number: 3164153.3
September 16, 2011

Certified Sanborn® Map Report

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

9/16/11

Site Name:
Maspeth Expansion - Cross
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Client Name:
STV Inc.
225 Park Ave S
New York, NY 10003

EDR Inquiry # 3164153.3

Contact: Doane E. Cafferty

The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by STV Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, State, Zip: Maspeth, NY 11378
Cross Street:
P.O. # 4014403
Project: Cross Harbor-Maspeth Expansion
Certification # 7BEE-47B0-BC6C

Maps Provided:

2006	1999	1991	1980
2005	1996	1990	1971
2004	1995	1988	1950
2003	1994	1986	1936
2002	1993	1985	1914
2001	1992	1982	1902

Sanborn® Library search results
Certification # 7BEE-47B0-BC6C

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ✓ Library of Congress
- ✓ University Publications of America
- ✓ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

STV Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

2006 Source Sheets

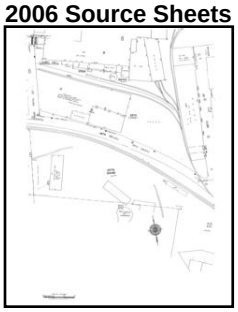

Volume 3, Sheet 11

Volume 3, Sheet 22

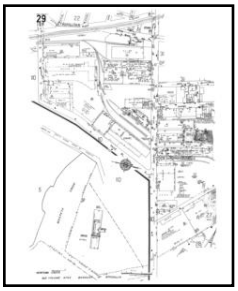

Volume 3, Sheet 29

Volume 3, Sheet 110

2005 Source Sheets

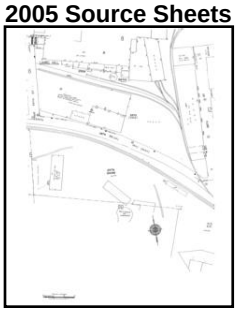

Volume 3, Sheet 11

Volume 3, Sheet 22

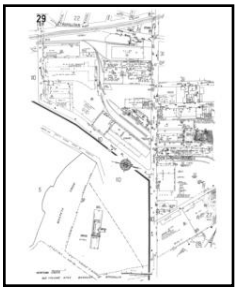

Volume 3, Sheet 29

Volume 3, Sheet 110

2004 Source Sheets

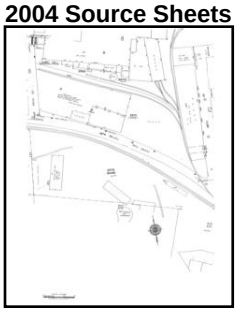

Volume 3, Sheet 11

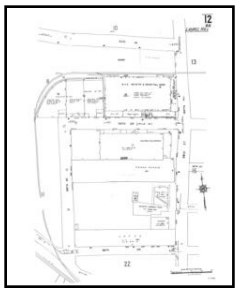

Volume 3, Sheet 12

Volume 3, Sheet 22

Volume 3, Sheet 29

Volume 3, Sheet 110

2003 Source Sheets

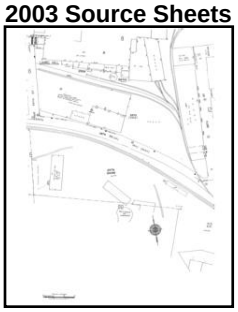

Volume 3, Sheet 11

Volume 3, Sheet 22

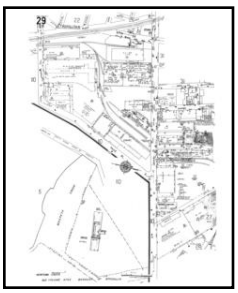

Volume 3, Sheet 29

Volume 3, Sheet 110

2002 Source Sheets

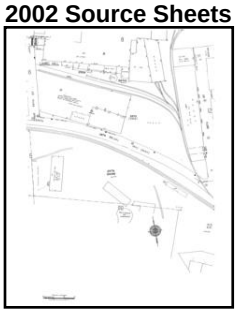

Volume 3, Sheet 11

Volume 3, Sheet 22

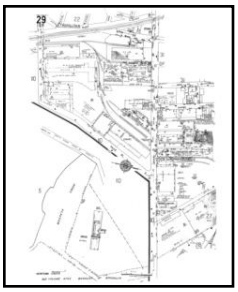

Volume 3, Sheet 29

Volume 3, Sheet 110

2001 Source Sheets

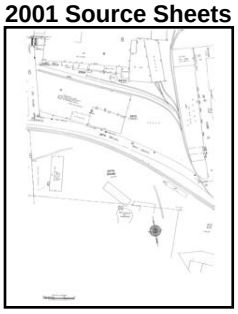

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

Volume 3, Sheet 110

1999 Source Sheets

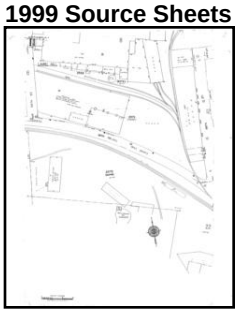

Volume 3, Sheet 11

Volume 3, Sheet 22

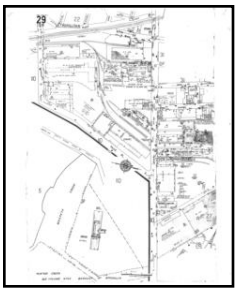

Volume 3, Sheet 29

Volume 3, Sheet 110

1996 Source Sheets

Volume 3, Sheet 110

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

1995 Source Sheets

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

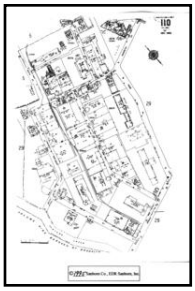

Volume 3, Sheet 110

1994 Source Sheets

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

Volume 3, Sheet 110

1993 Source Sheets

Volume 3, Sheet 110

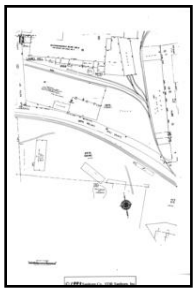

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

1992 Source Sheets

Volume 3, Sheet 110

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

1991 Source Sheets

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

Volume 3, Sheet 110

1990 Source Sheets

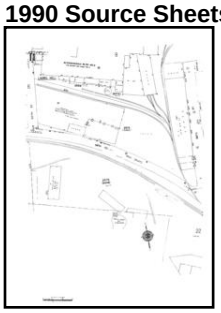

Volume 3, Sheet 11

Volume 3, Sheet 22

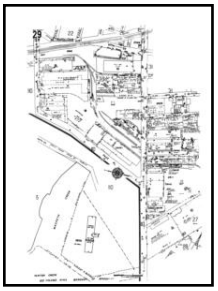

Volume 3, Sheet 29

Volume 3, Sheet 110

1988 Source Sheets

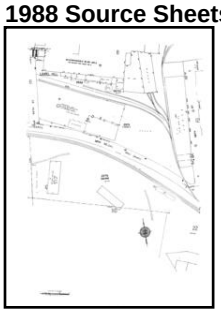

Volume 3, Sheet 11

Volume 3, Sheet 22

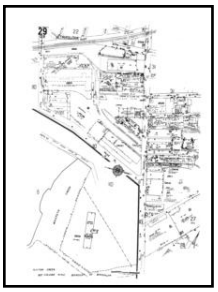

Volume 3, Sheet 29

Volume 3, Sheet 110

1986 Source Sheets

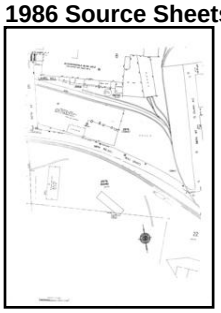

Volume 3, Sheet 11

Volume 3, Sheet 29

Volume 3, Sheet 110

1985 Source Sheets

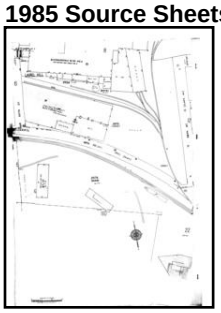

Volume 3, Sheet 11

Volume 3, Sheet 22

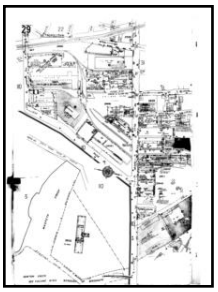

Volume 3, Sheet 29

Volume 3, Sheet 110

1982 Source Sheets

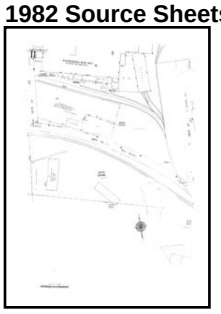

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

Volume 3, Sheet 110

1980 Source Sheets

Volume 3, Sheet 110

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

1971 Source Sheets

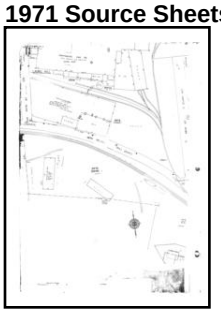

Volume 3, Sheet 11

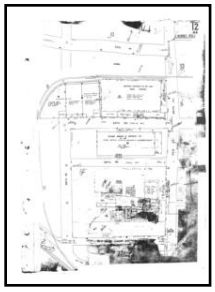

Volume 3, Sheet 12

Volume 3, Sheet 22

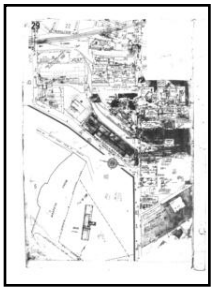

Volume 3, Sheet 29

1950 Source Sheets

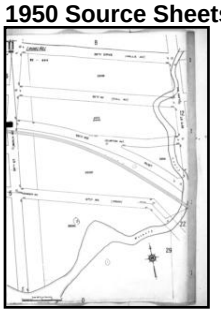

Volume 3, Sheet 11

Volume 3, Sheet 22

Volume 3, Sheet 29

1936 Source Sheets

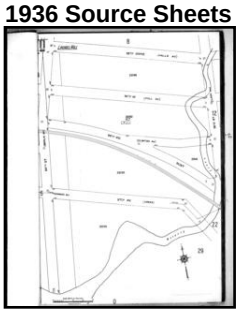

Volume 3, Sheet 11

Volume 3, Sheet 22

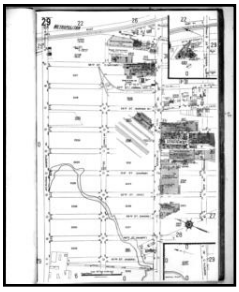

Volume 3, Sheet 29

1914 Source Sheets

Volume 3, Sheet 11

Volume 3, Sheet 22

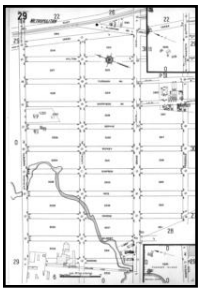

Volume 3, Sheet 29

1902 Source Sheets

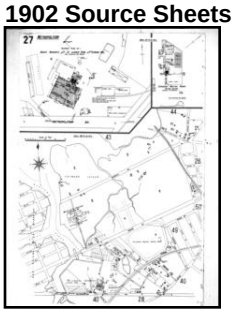

Volume 3, Sheet 27

2006 Certified Sanborn Map

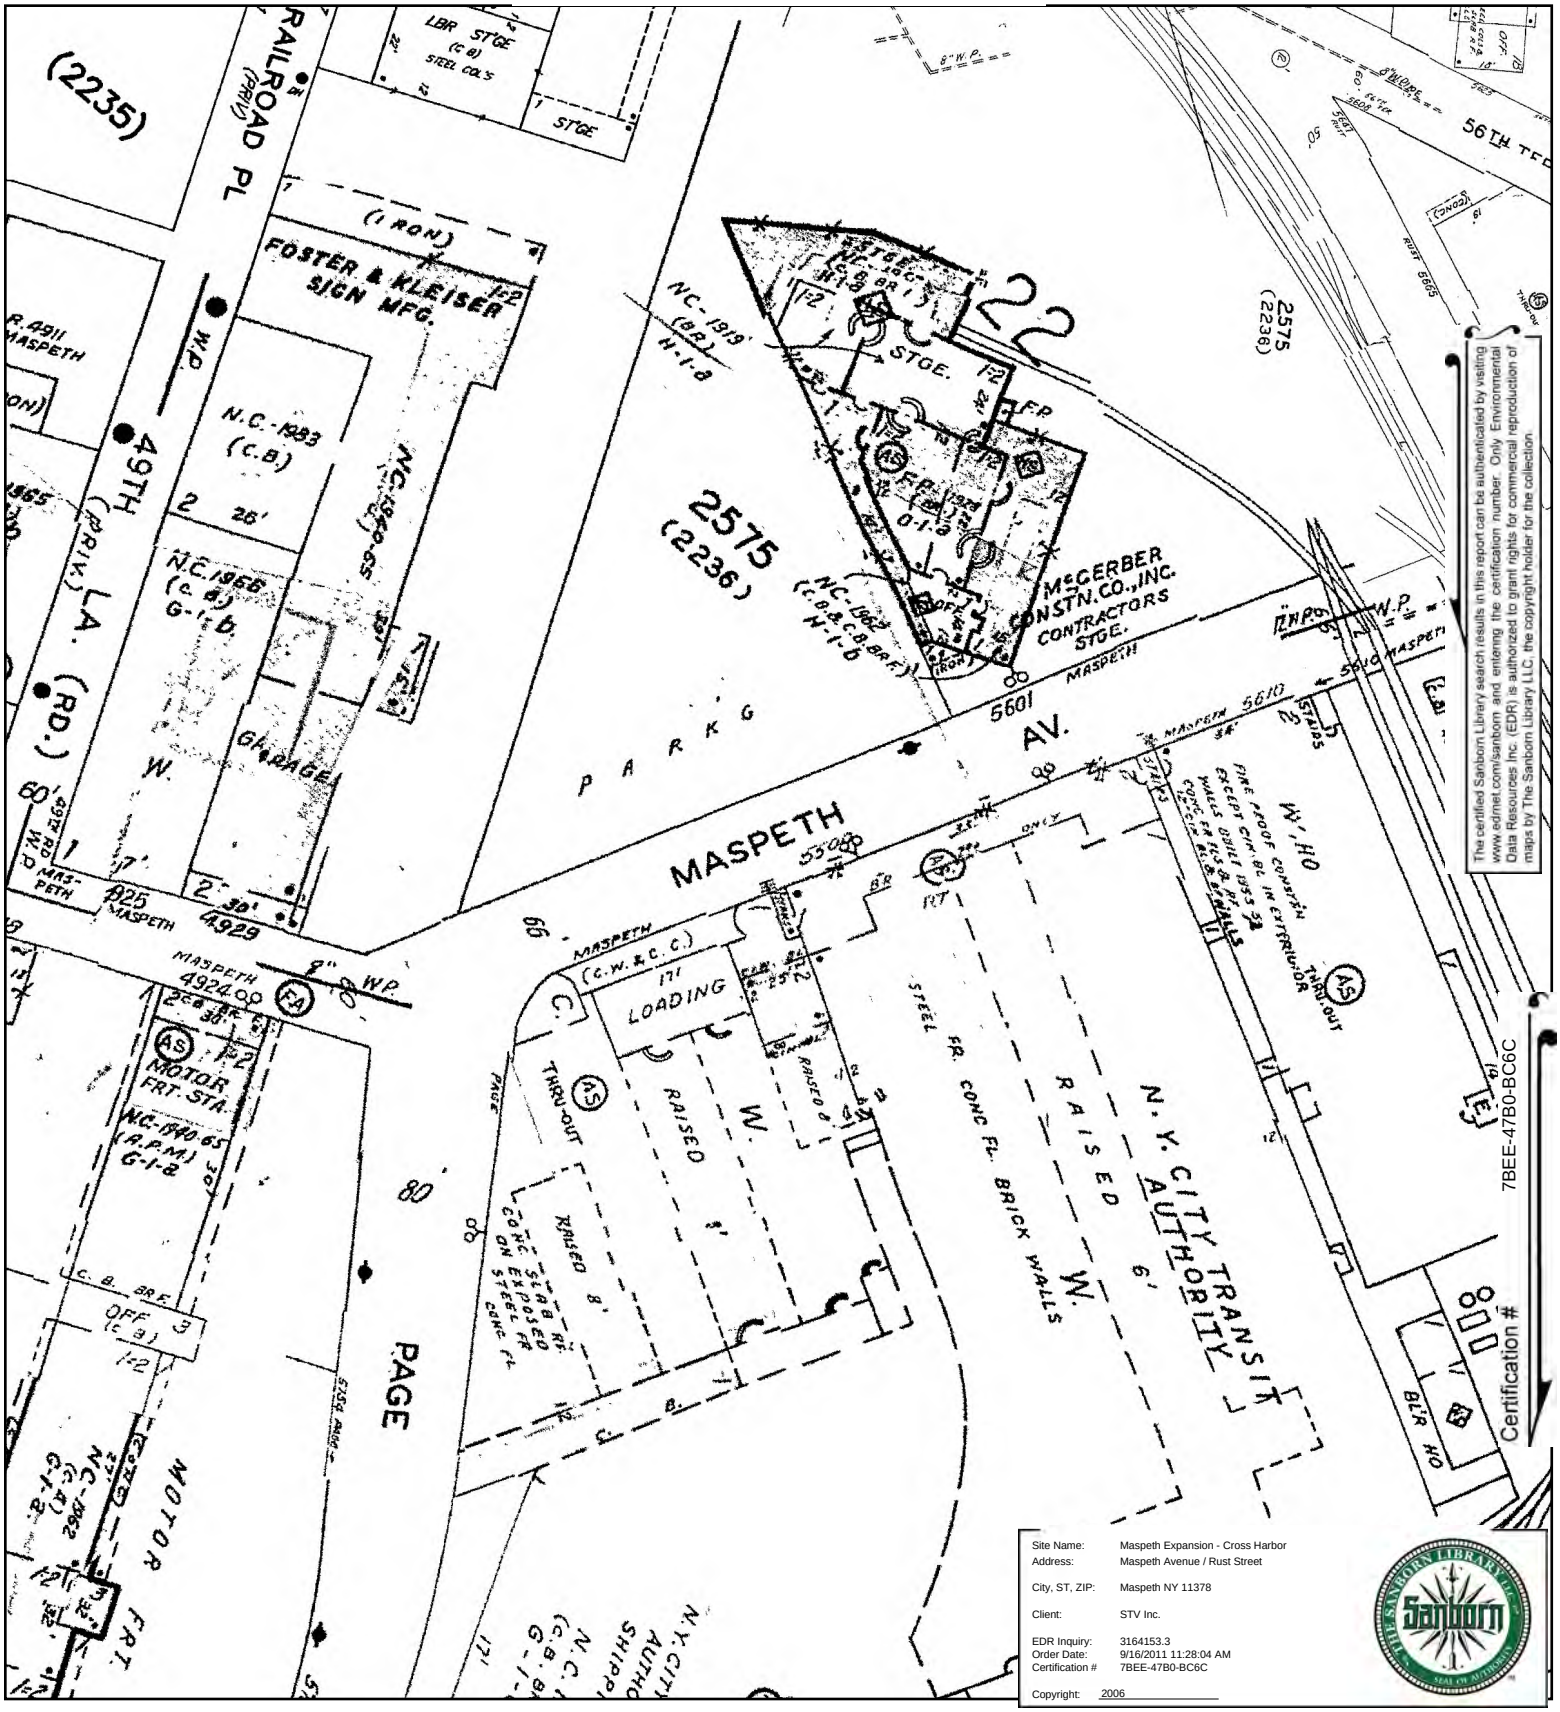

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

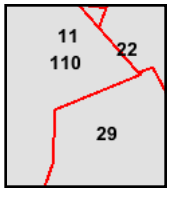

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2005 Certified Sanborn Map

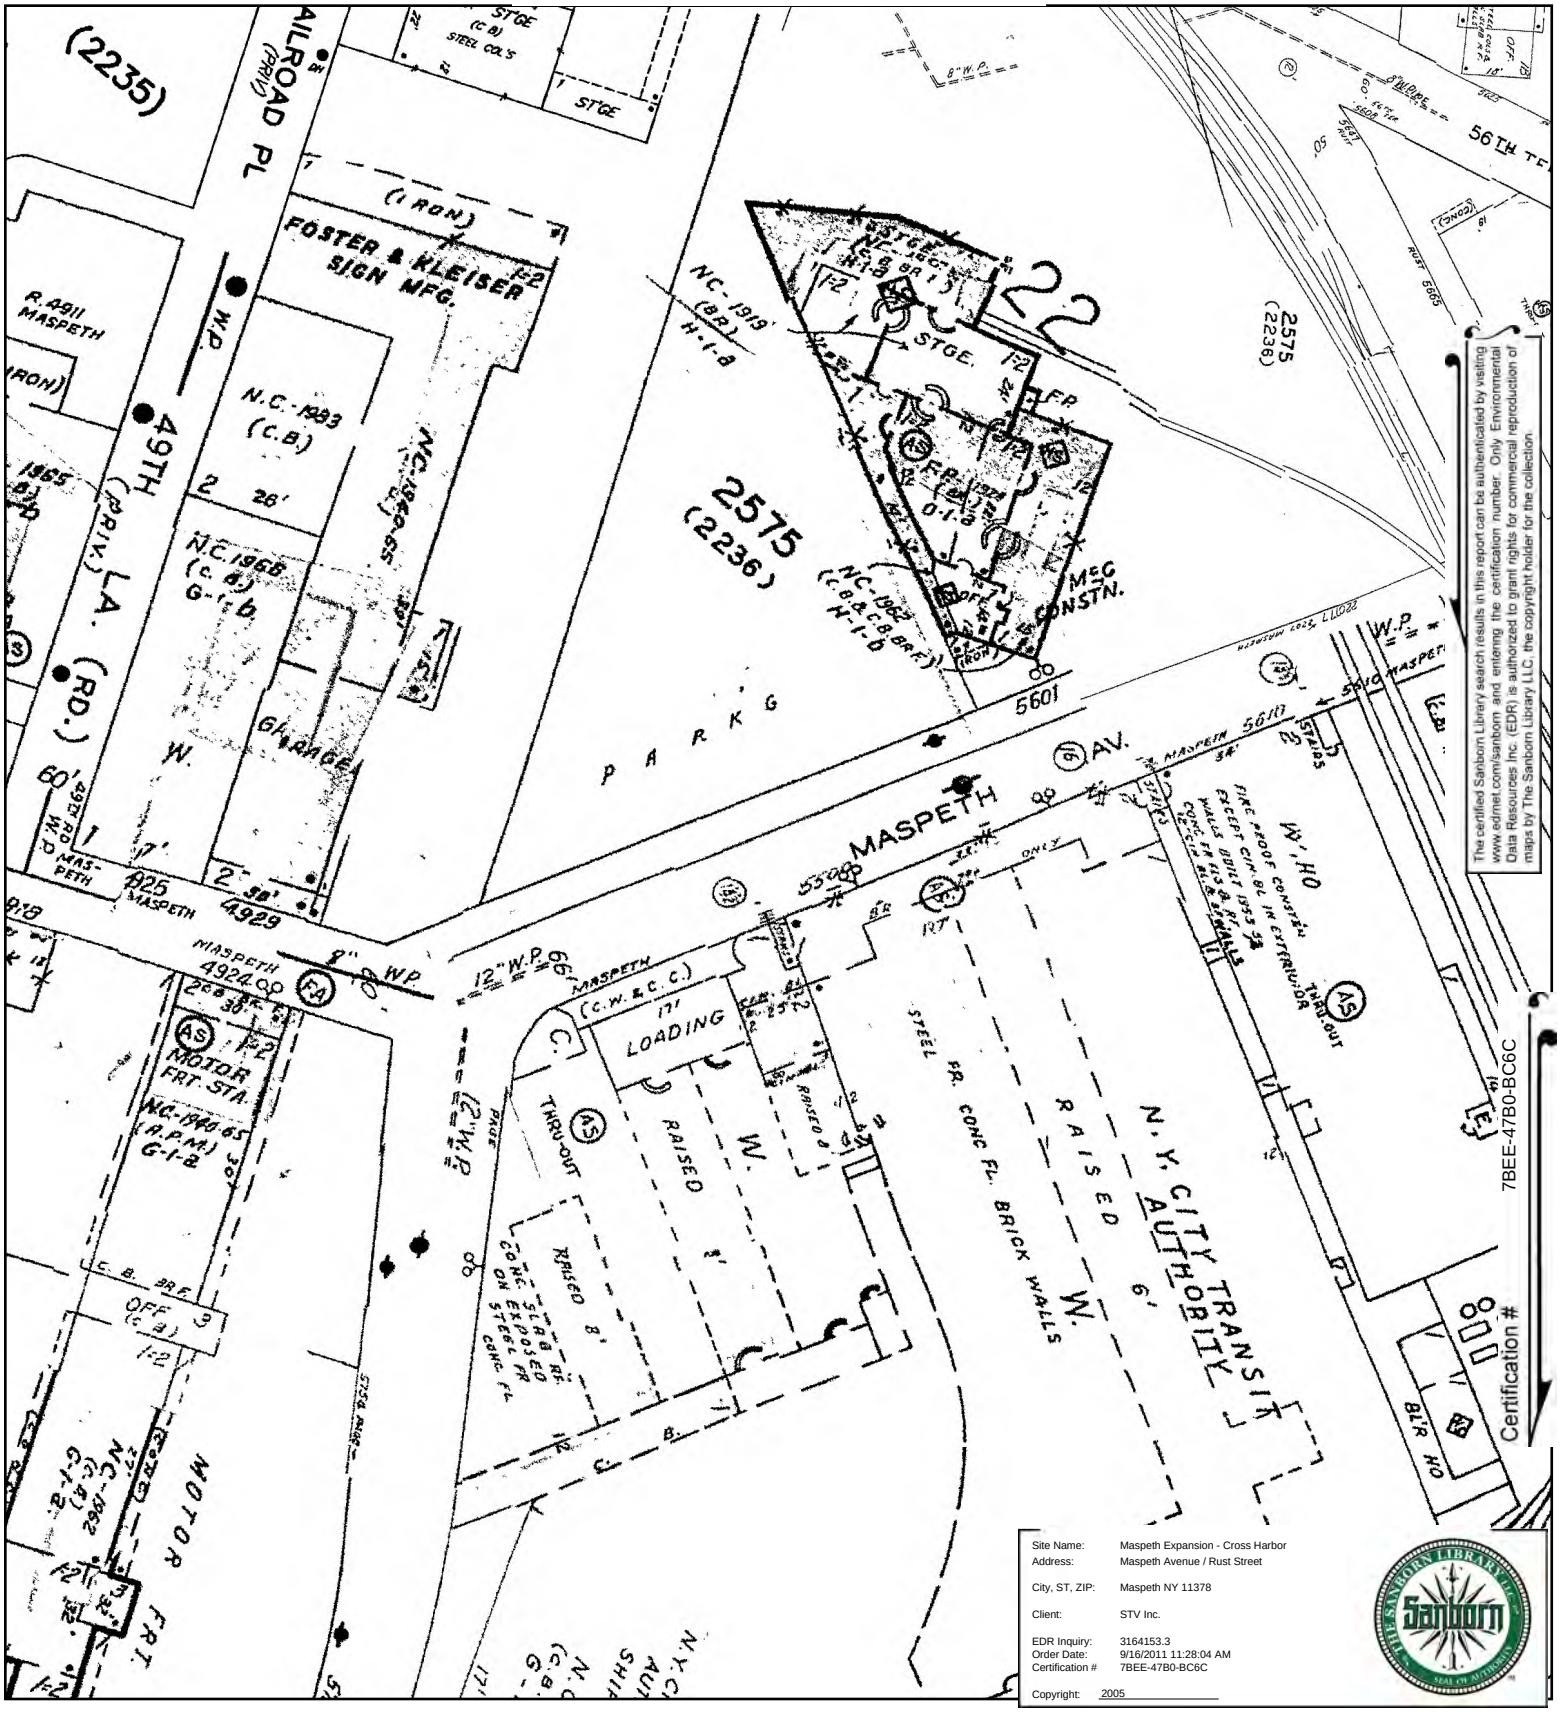

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

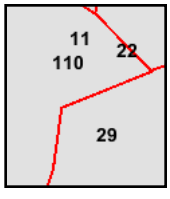

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2004 Certified Sanborn Map

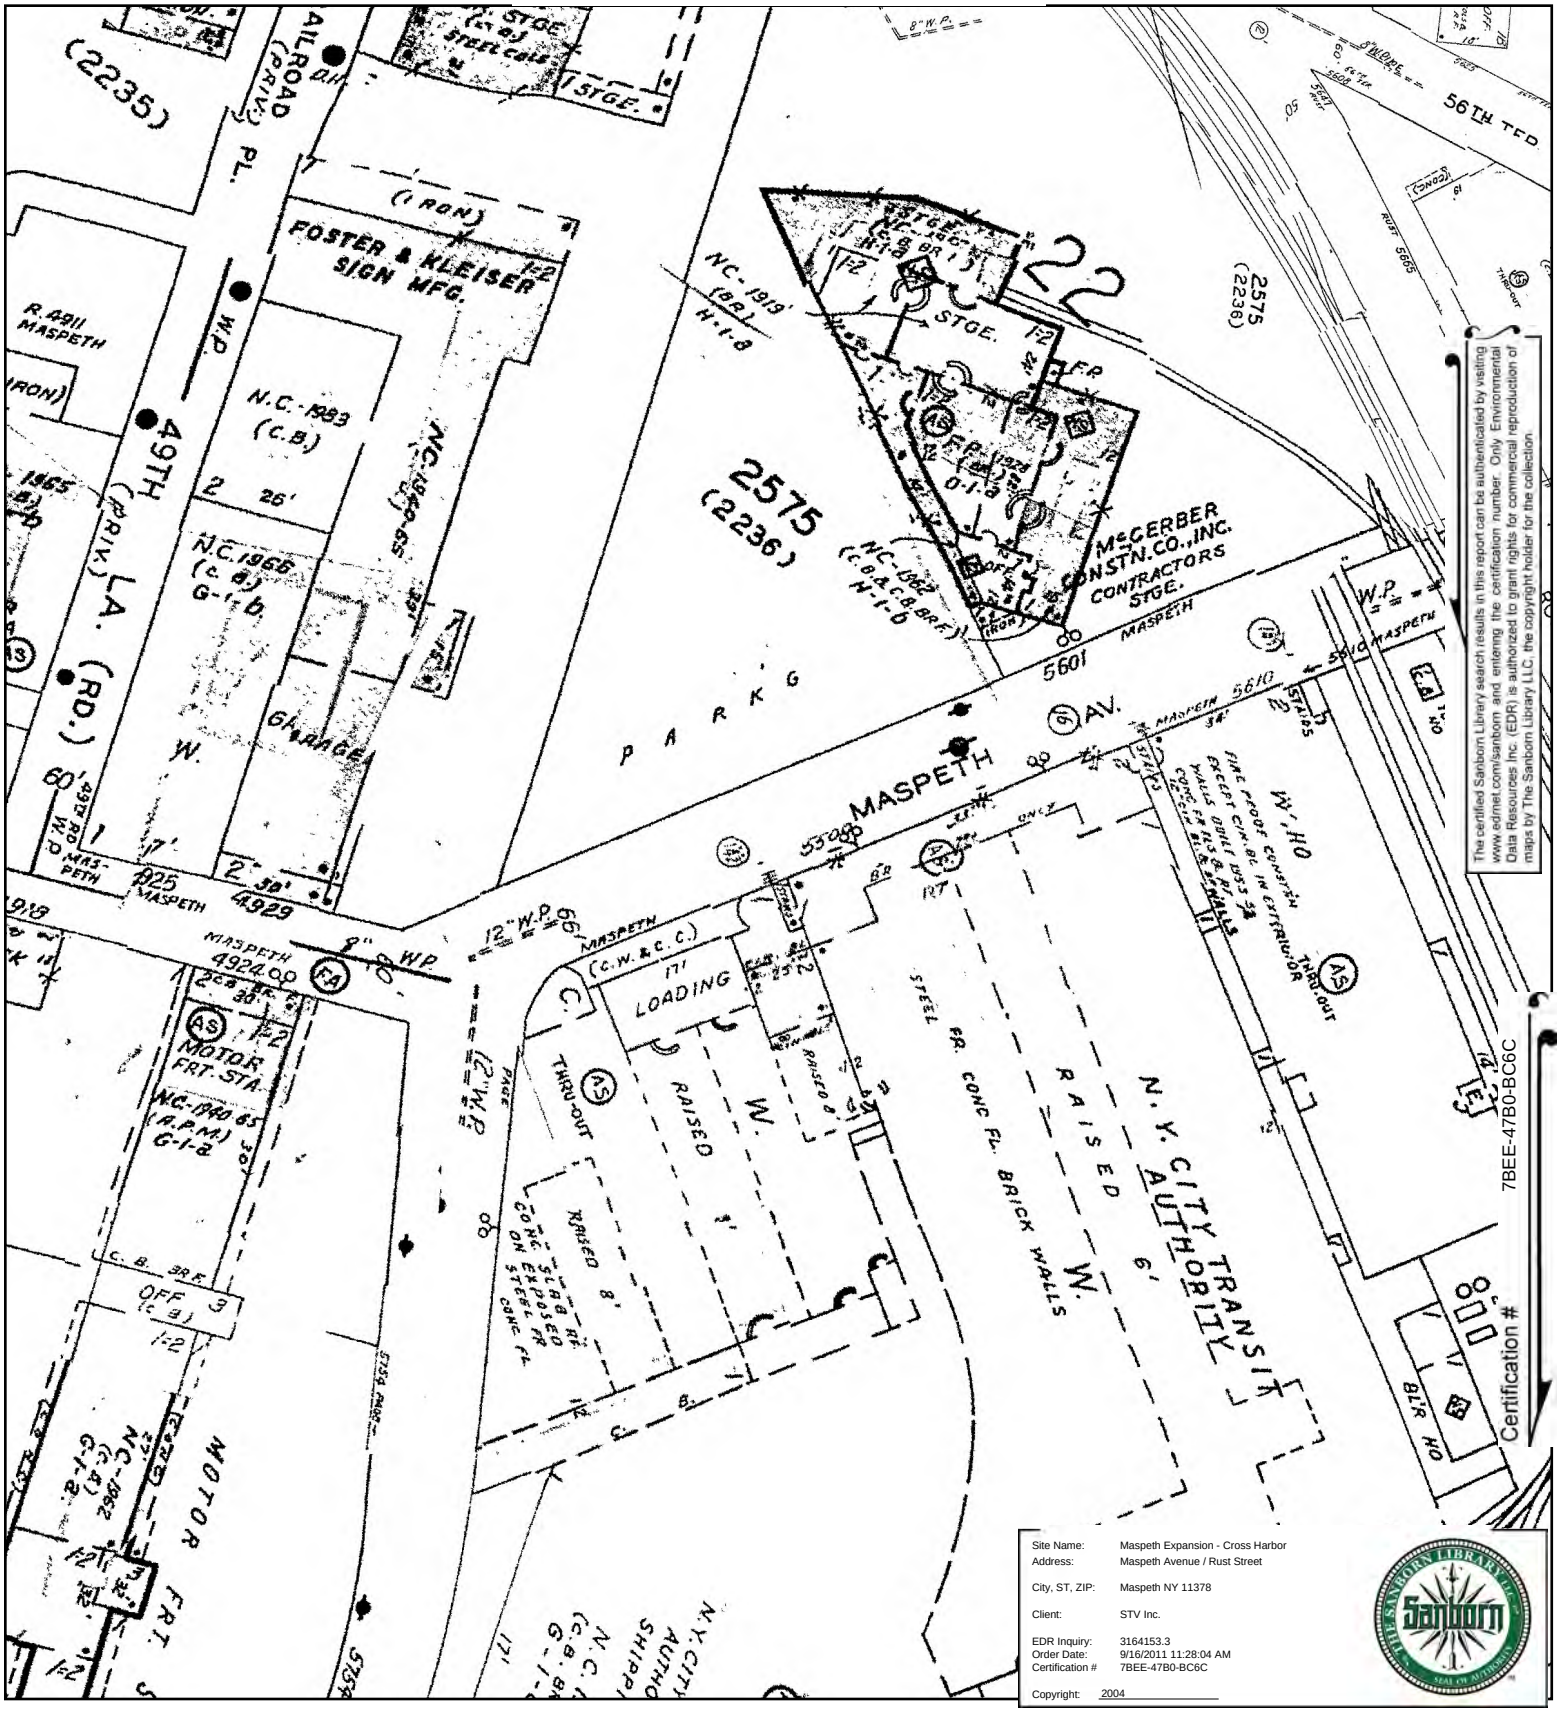

2003 Certified Sanborn Map

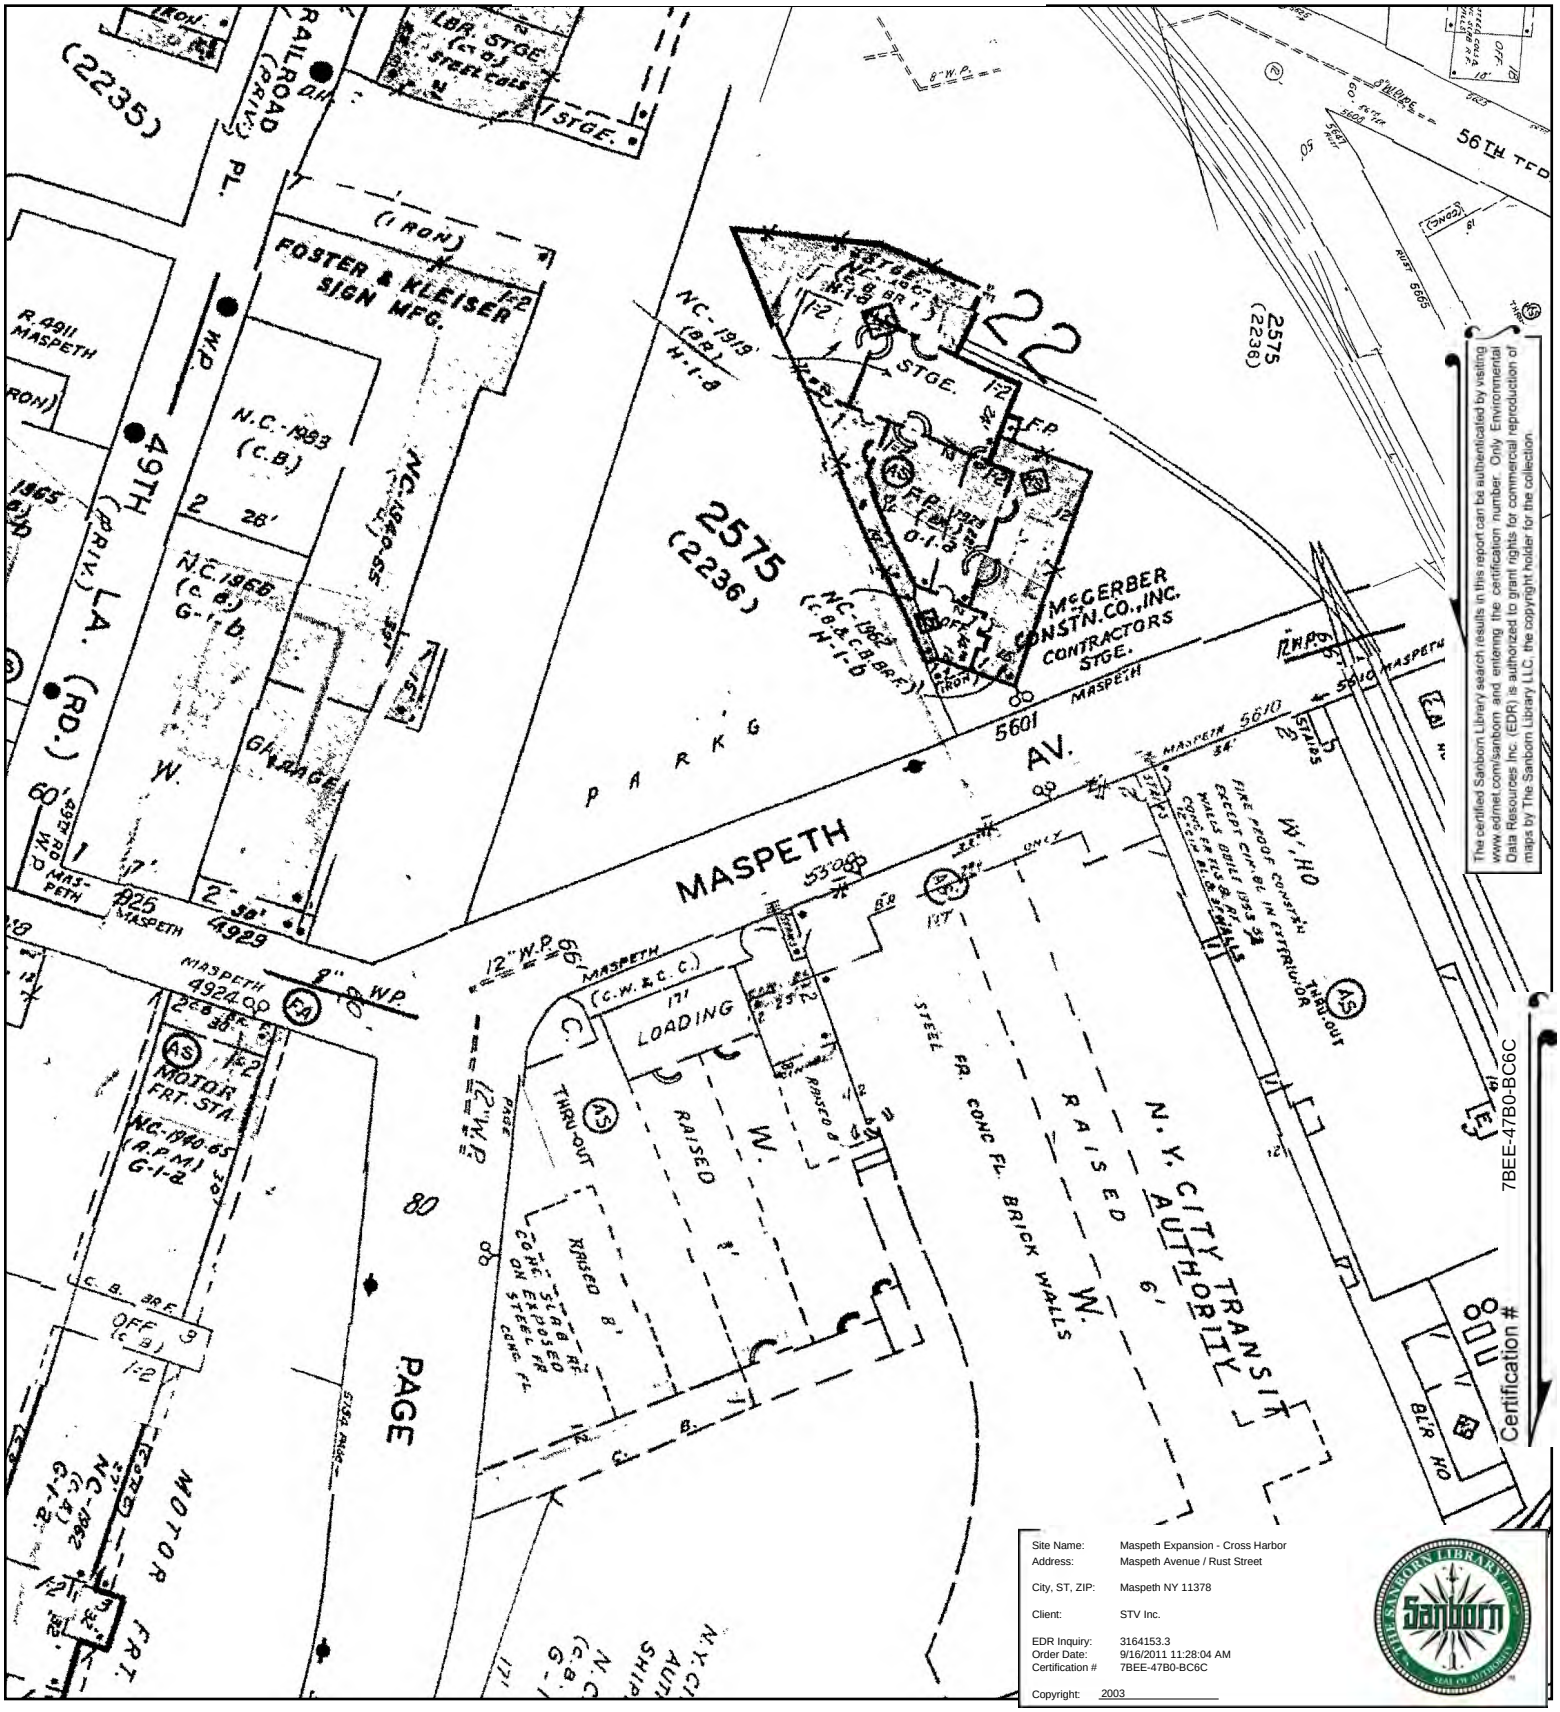

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

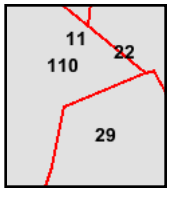

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2002 Certified Sanborn Map

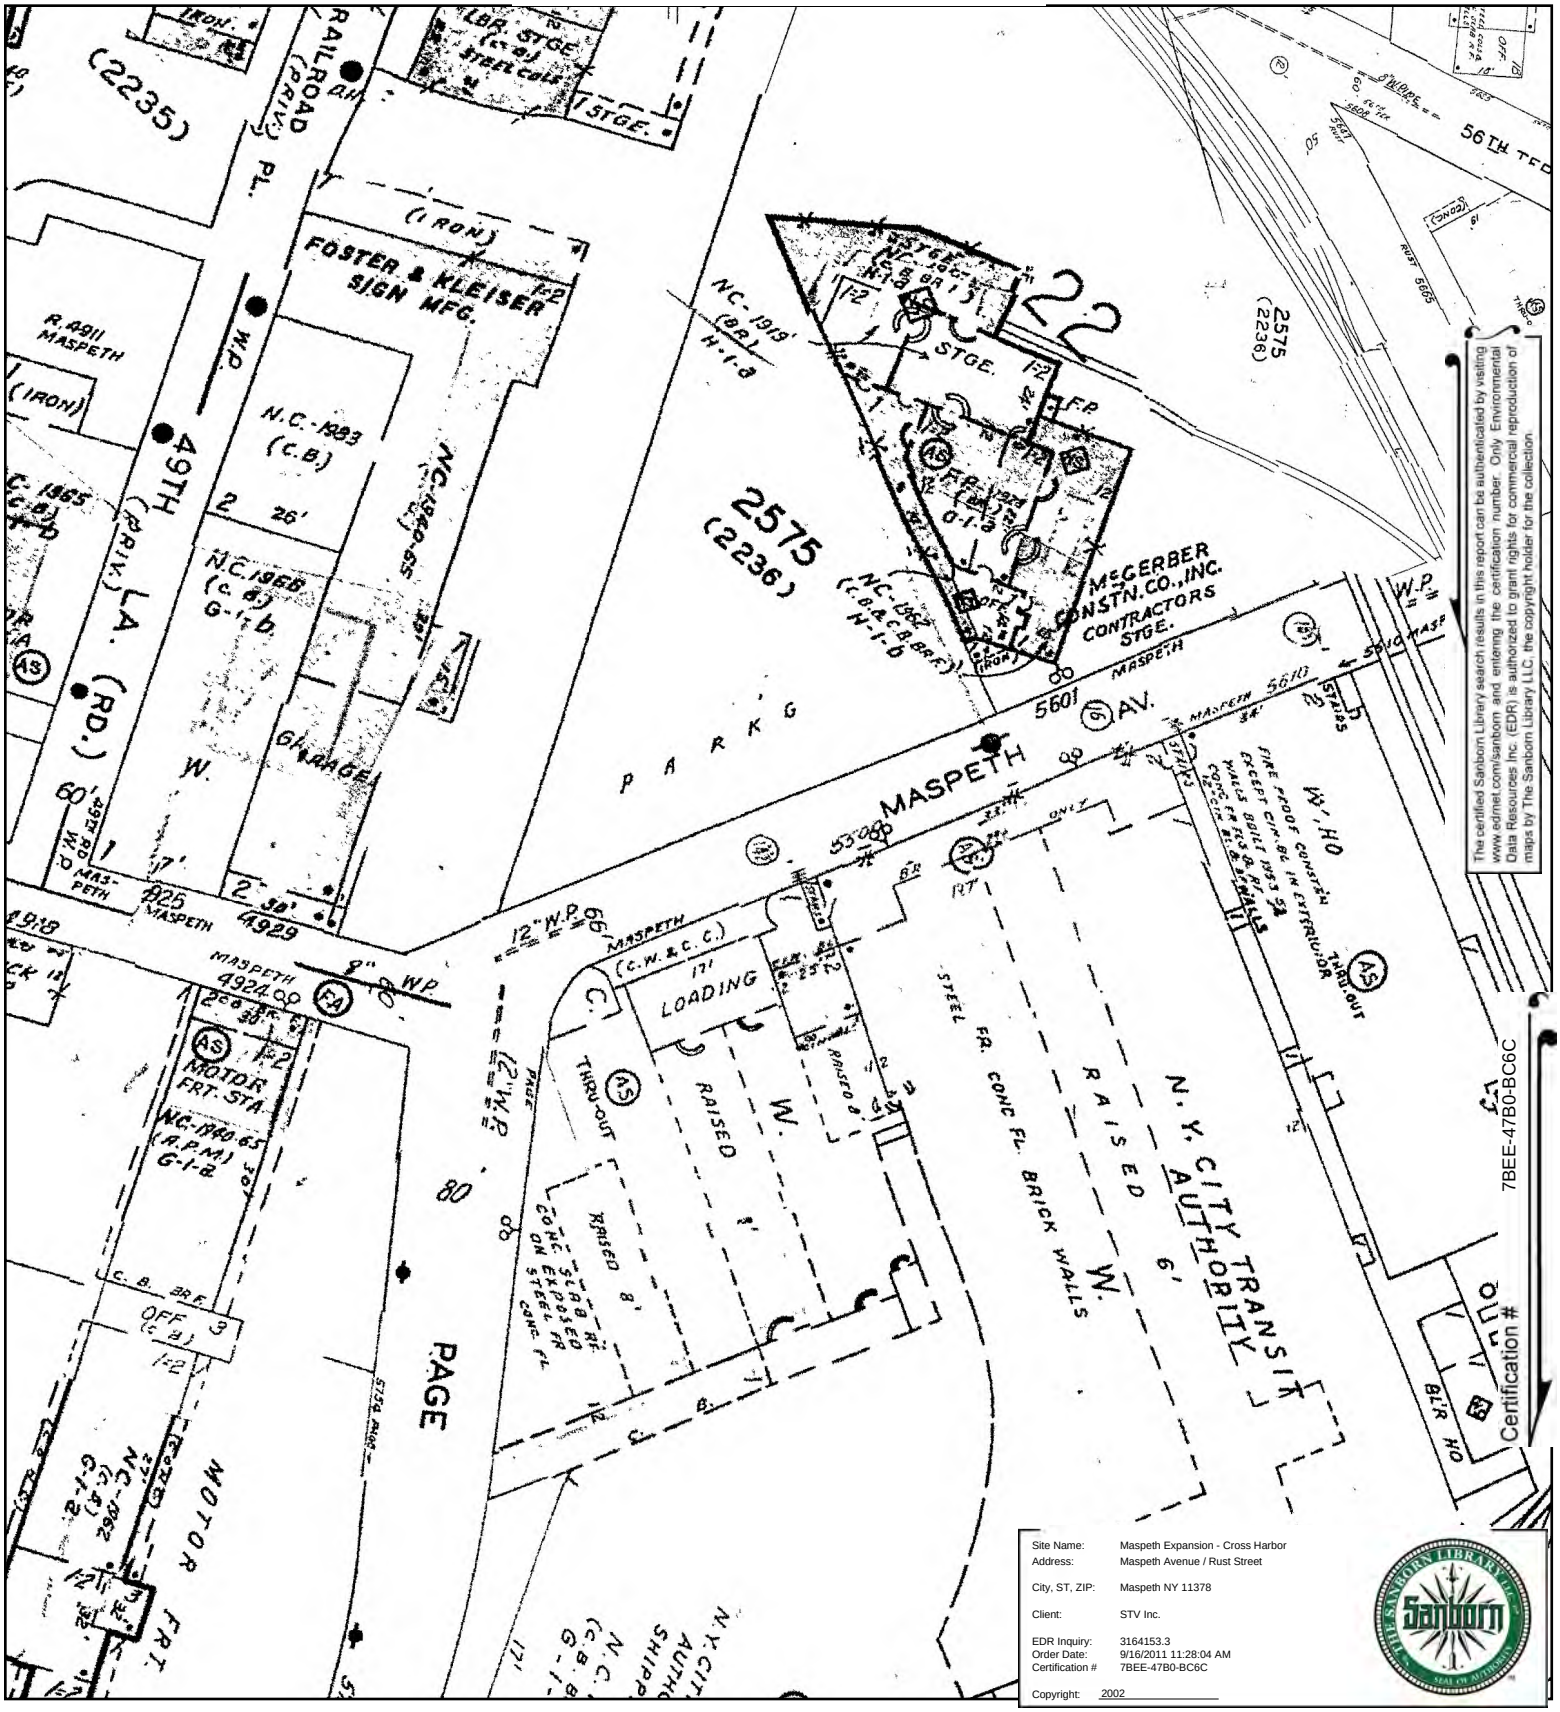

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2002

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

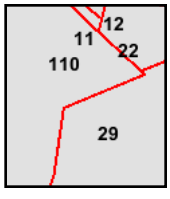

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

2001 Certified Sanborn Map

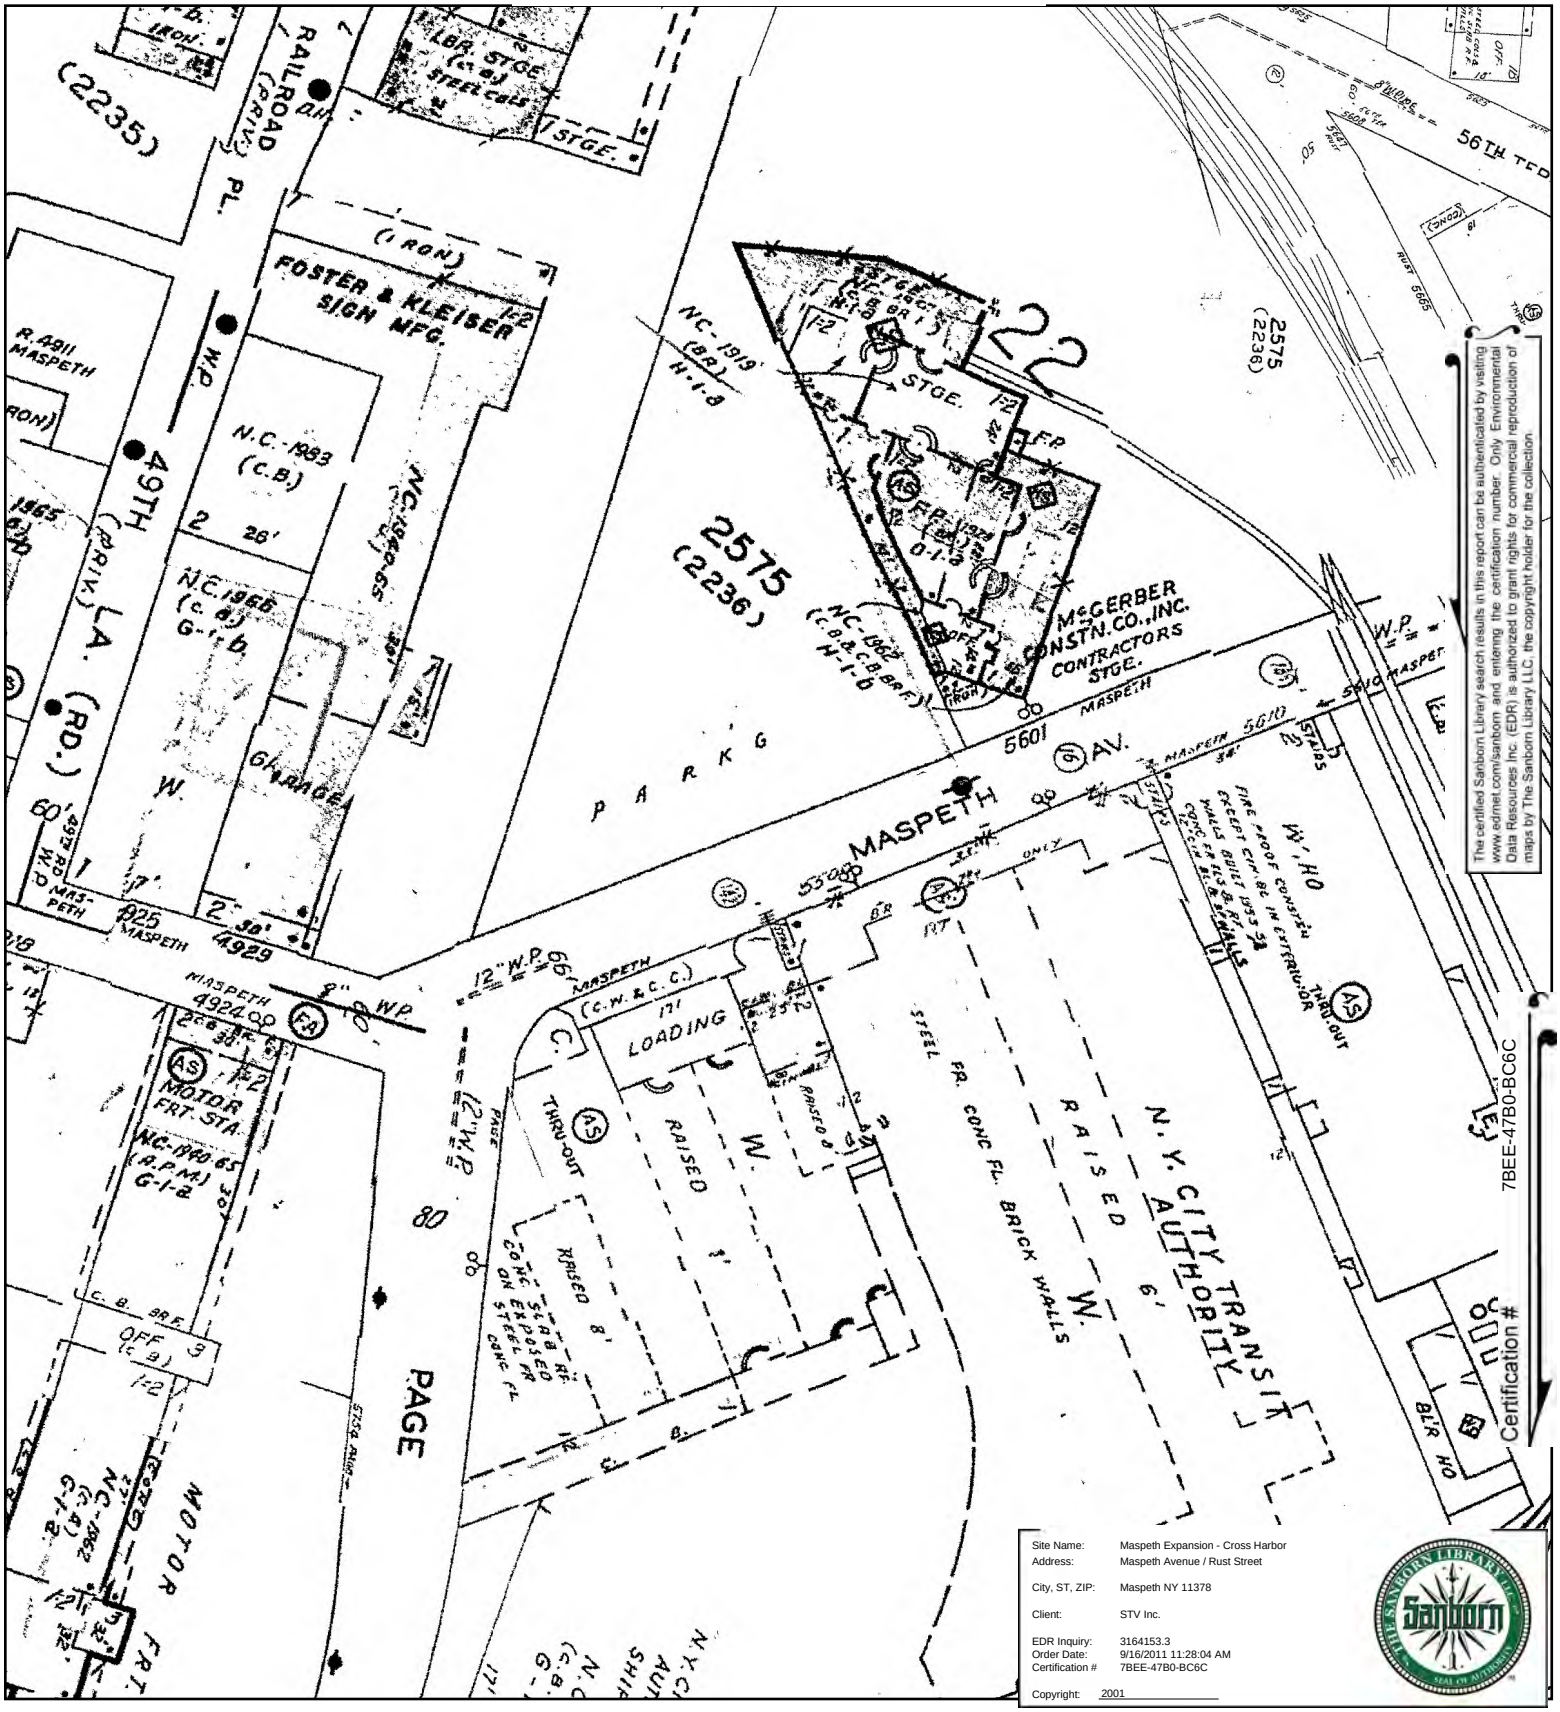

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

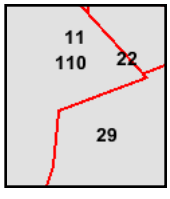

Volume 3, Sheet 11
Volume 3, Sheet 22
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1971 Certified Sanborn Map

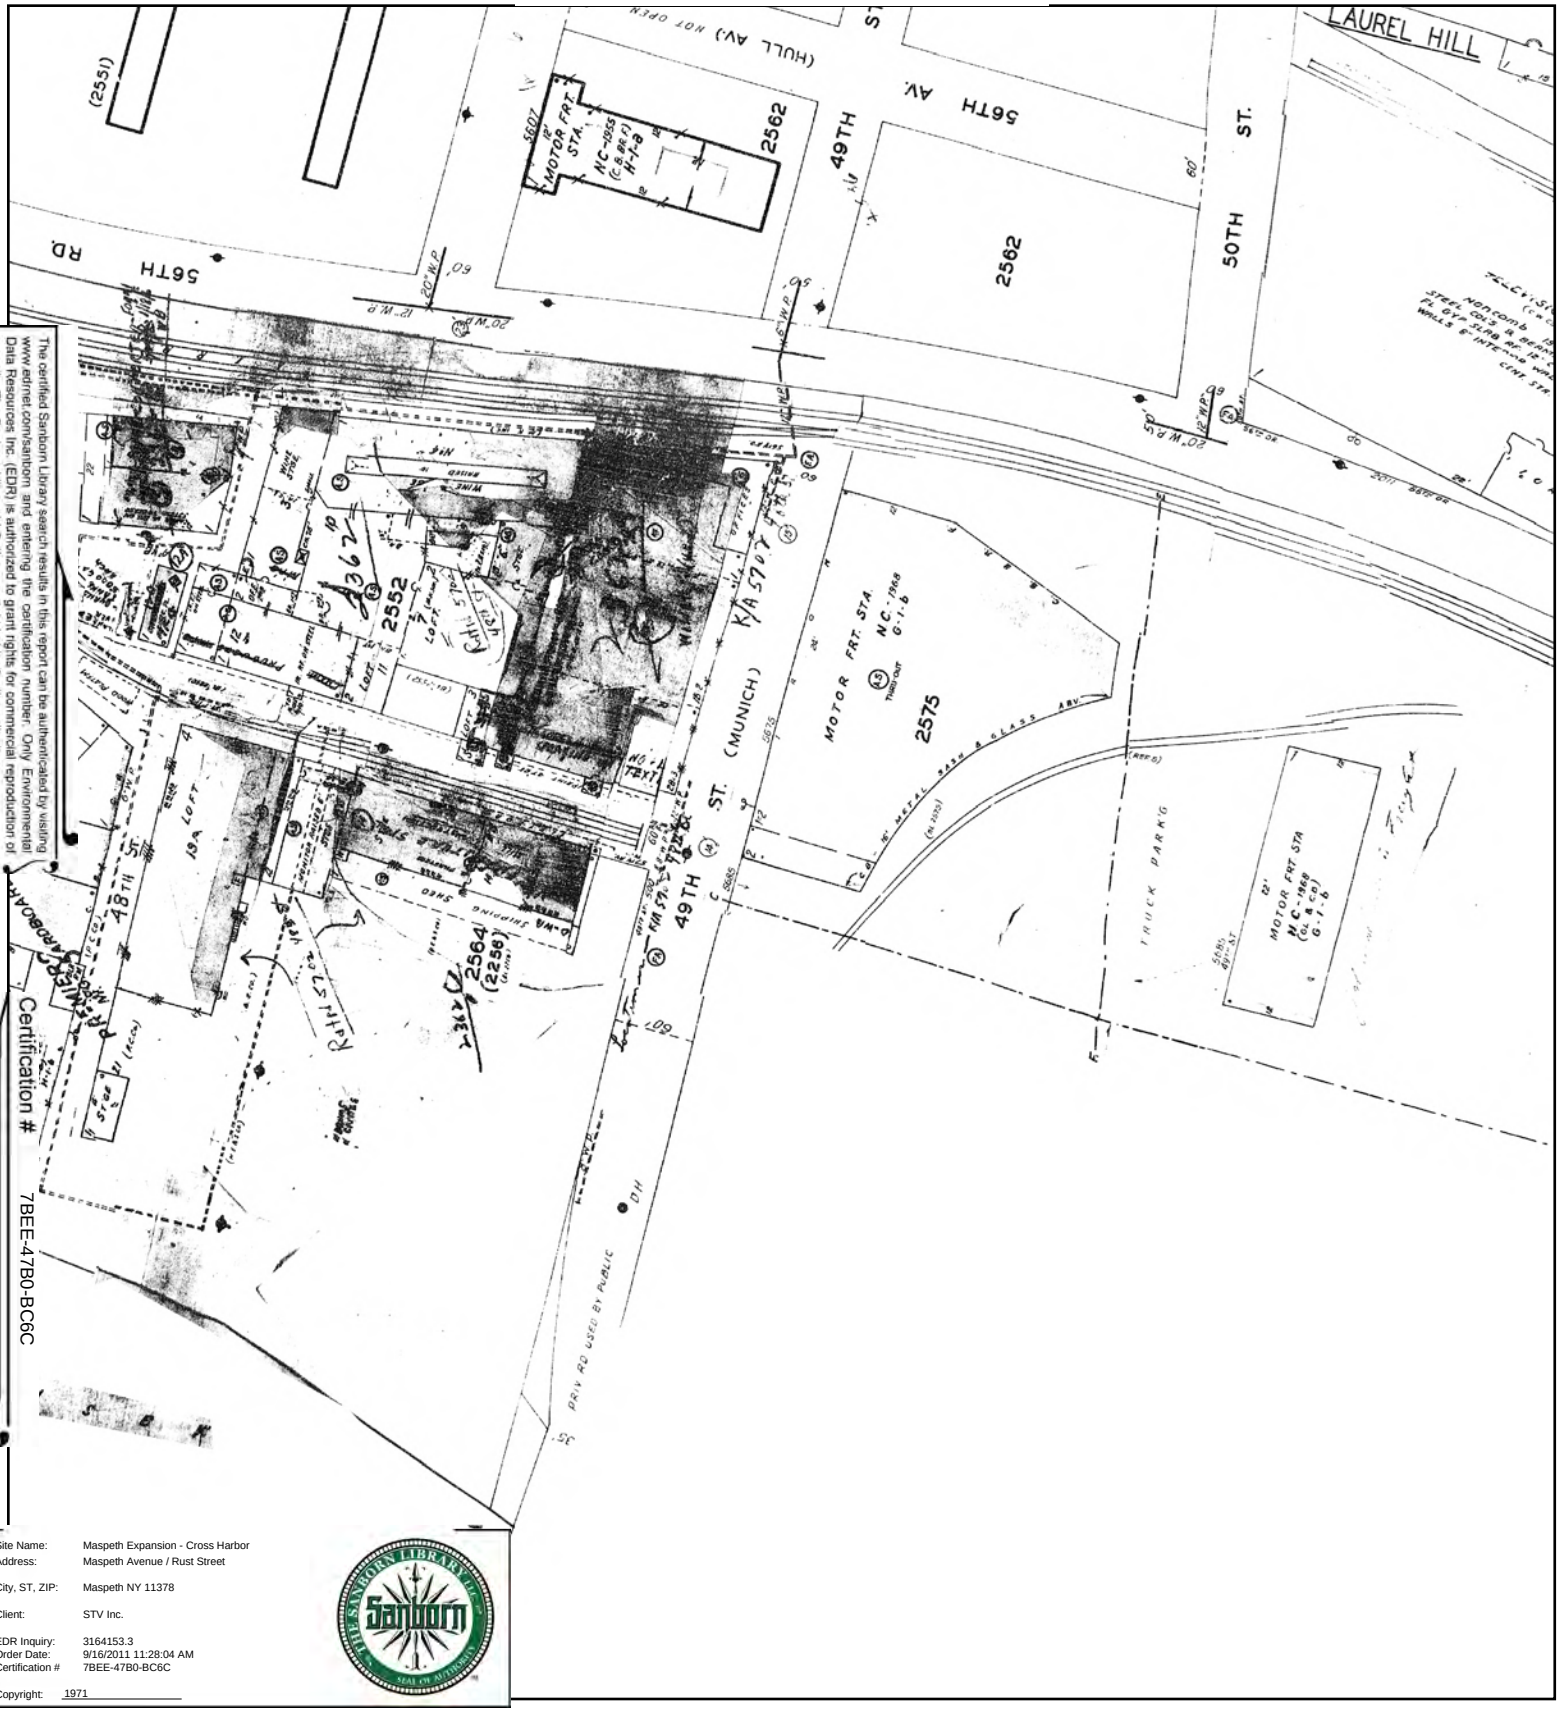

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1971

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

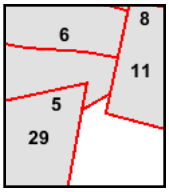

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29

0 Feet 165 330 660

N

1950 Certified Sanborn Map

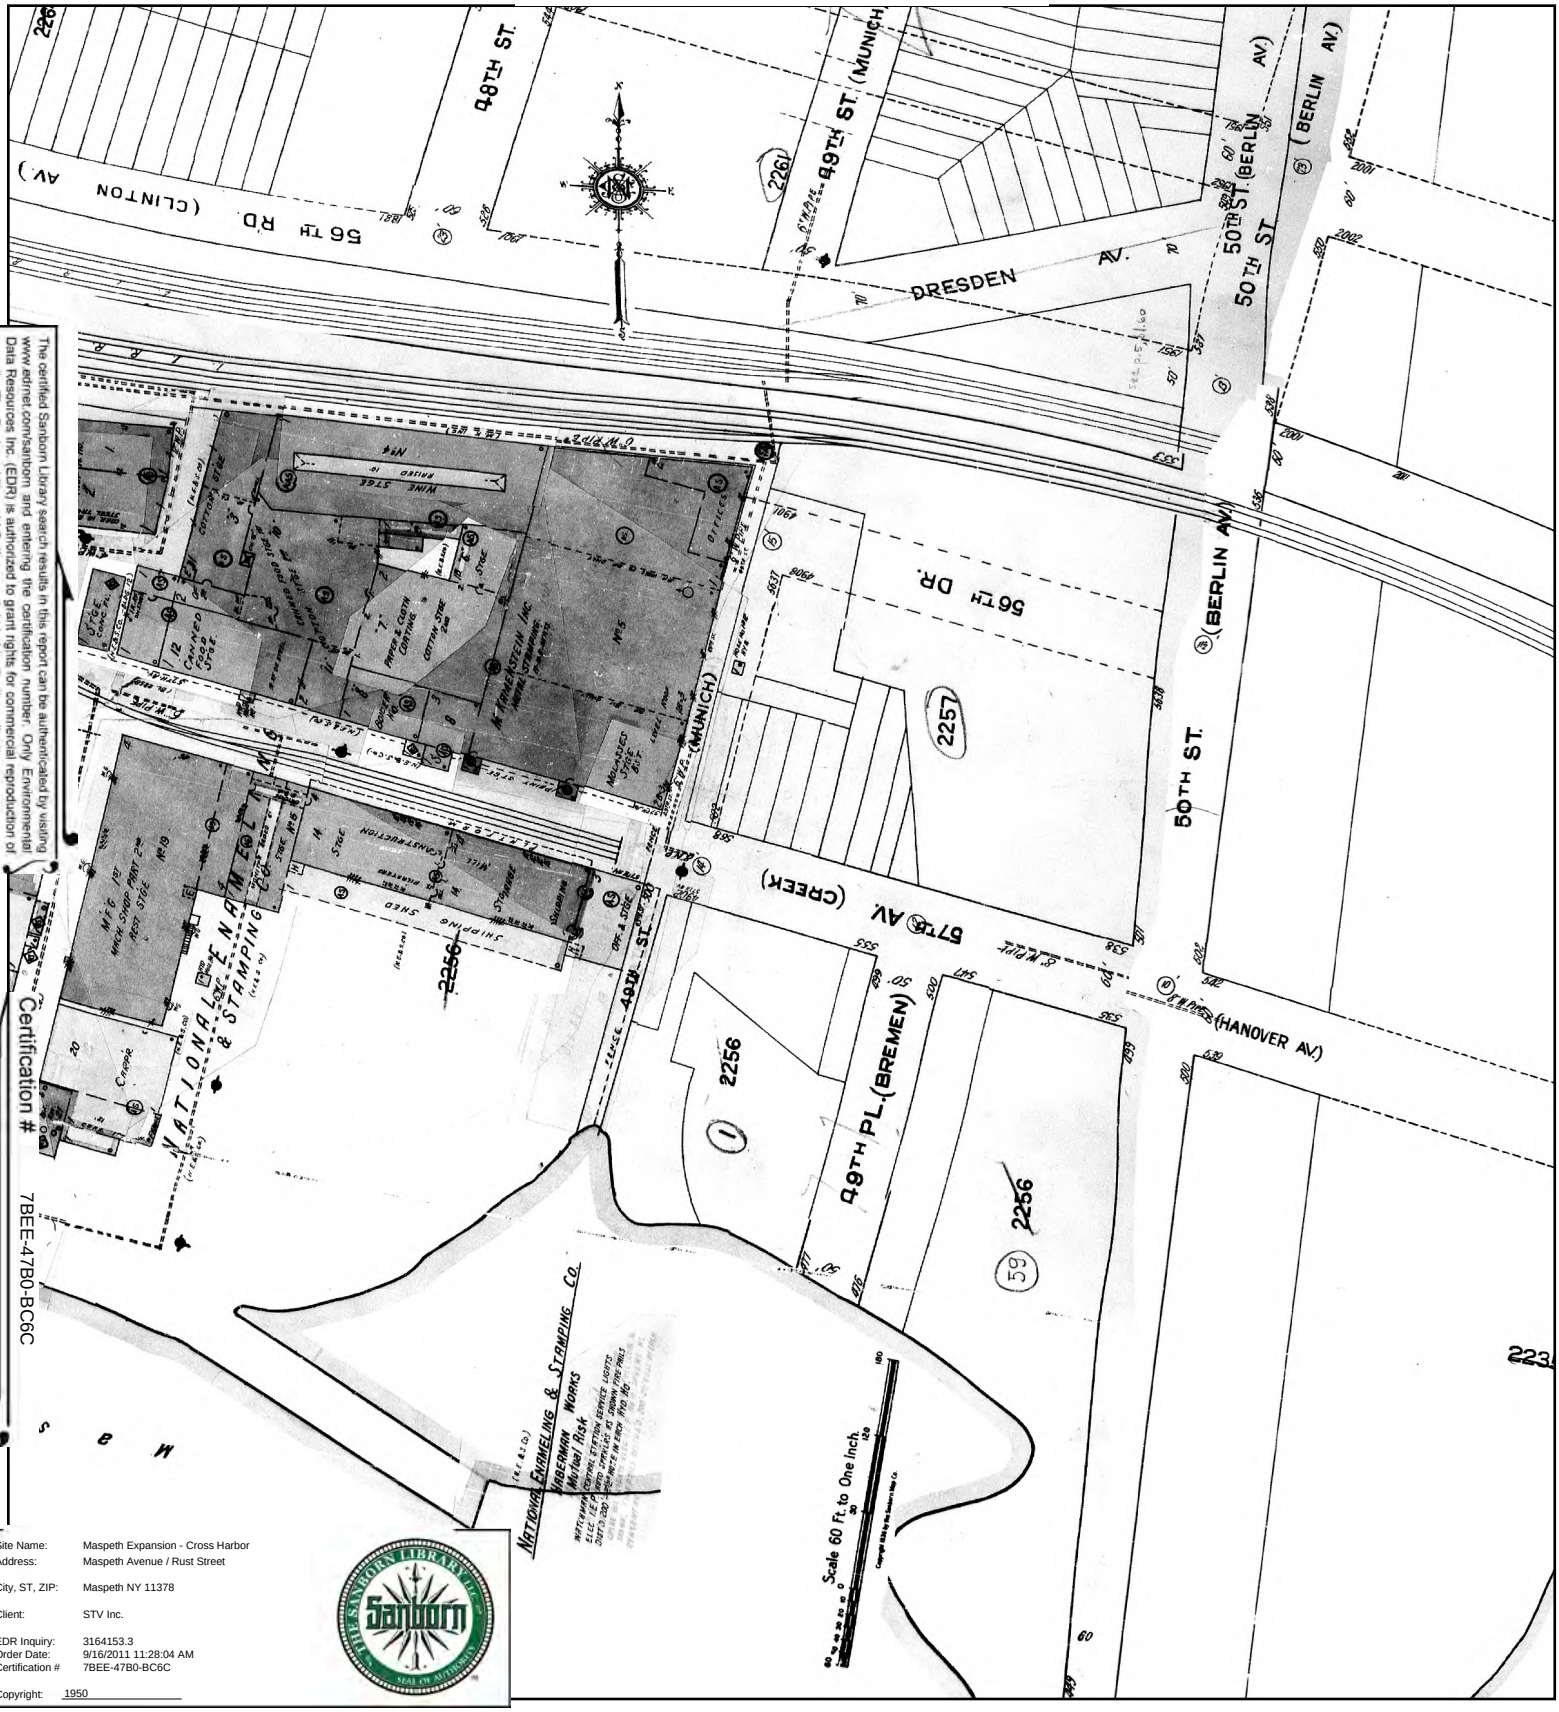

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1950

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

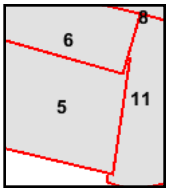

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11

0 Feet 165 330 660

N

1936 Certified Sanborn Map

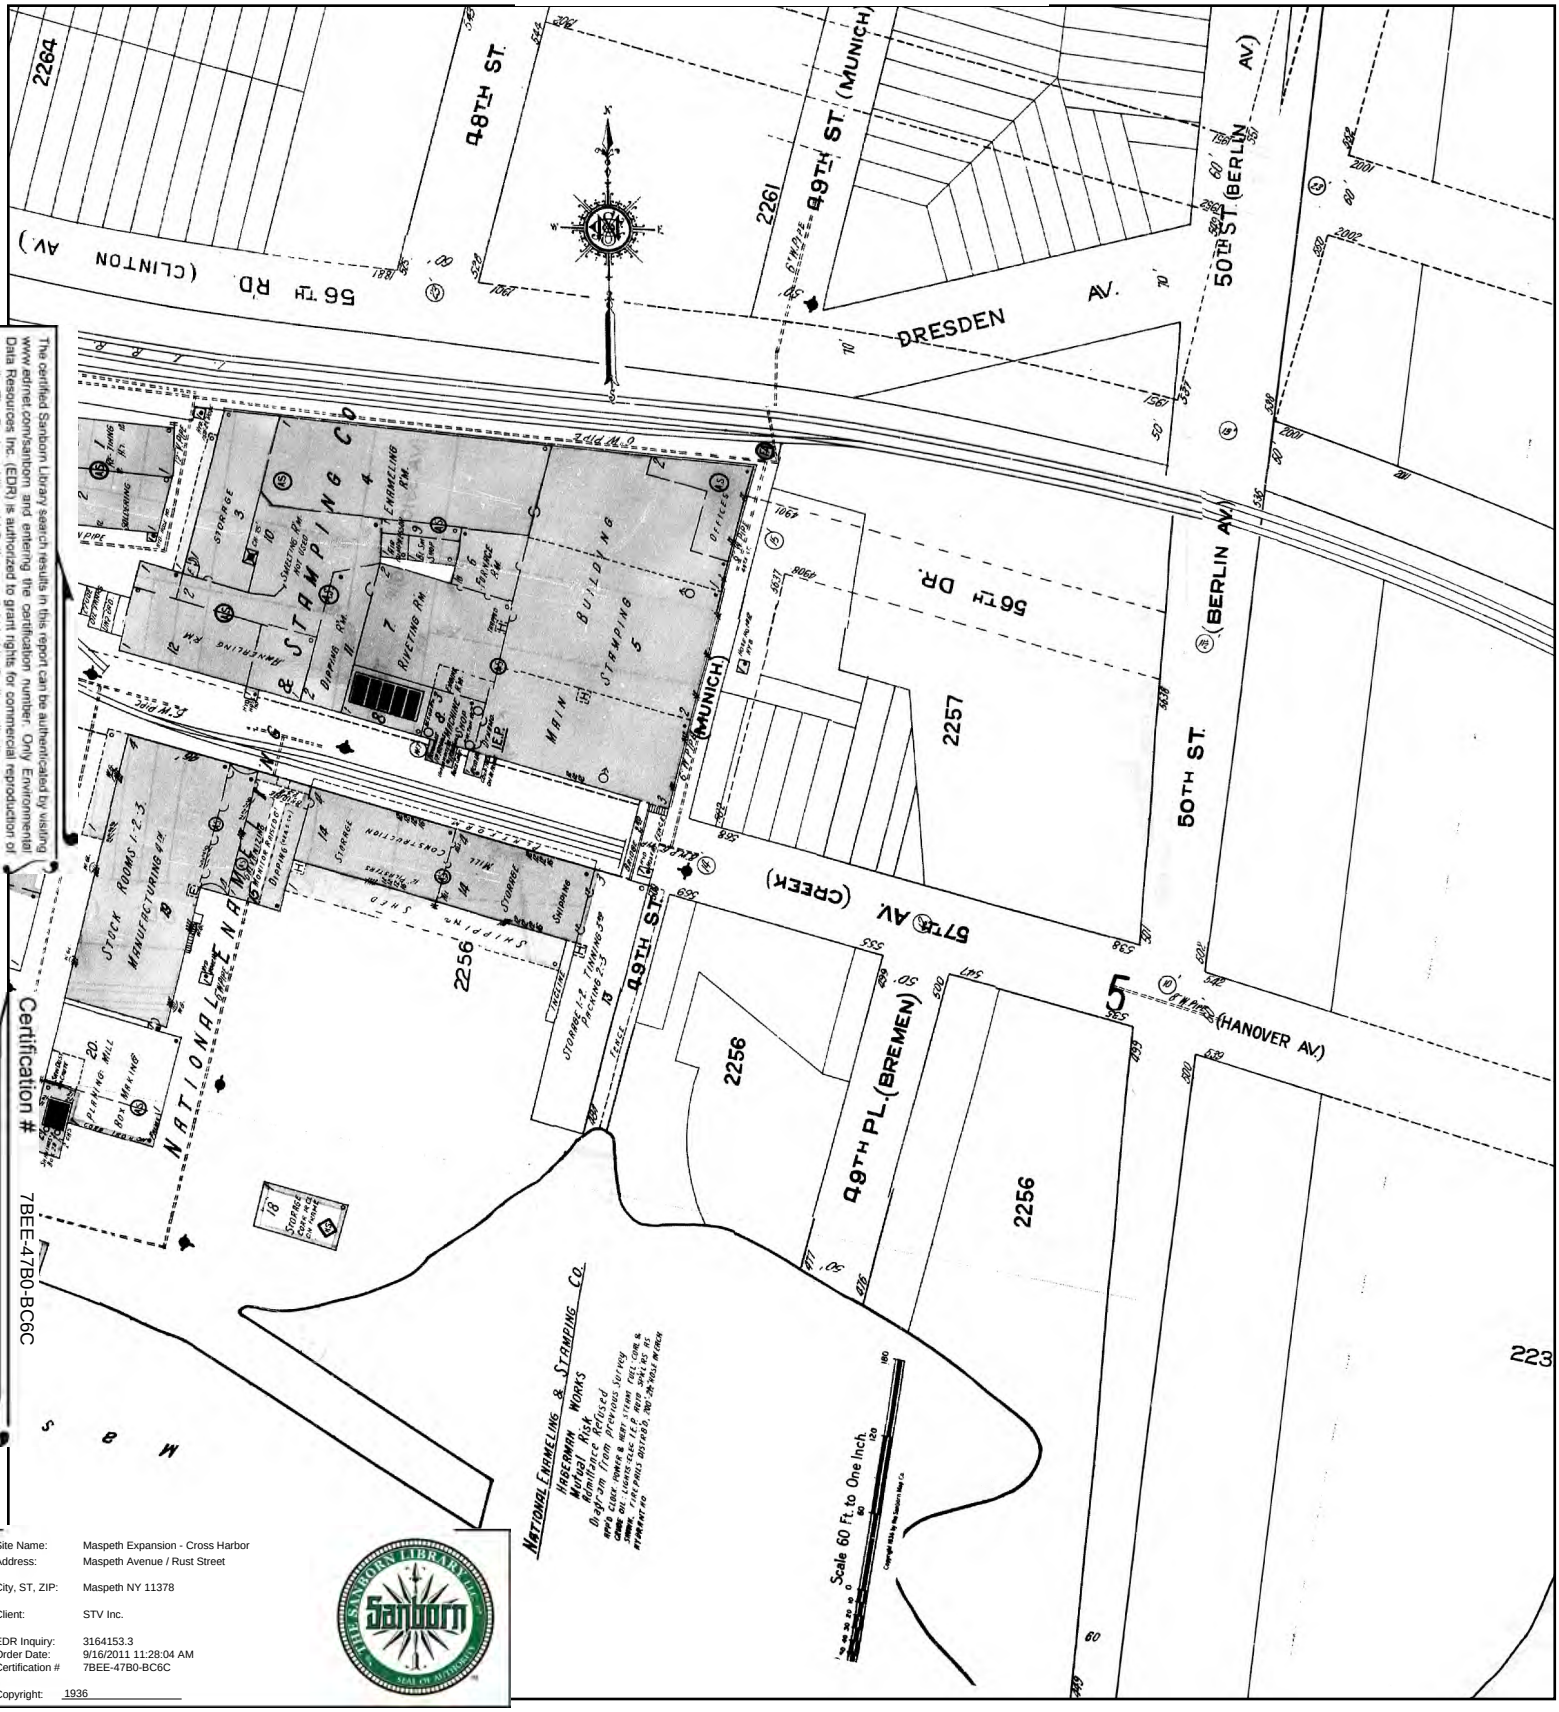

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1936

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

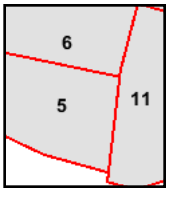

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11

N

1914 Certified Sanborn Map

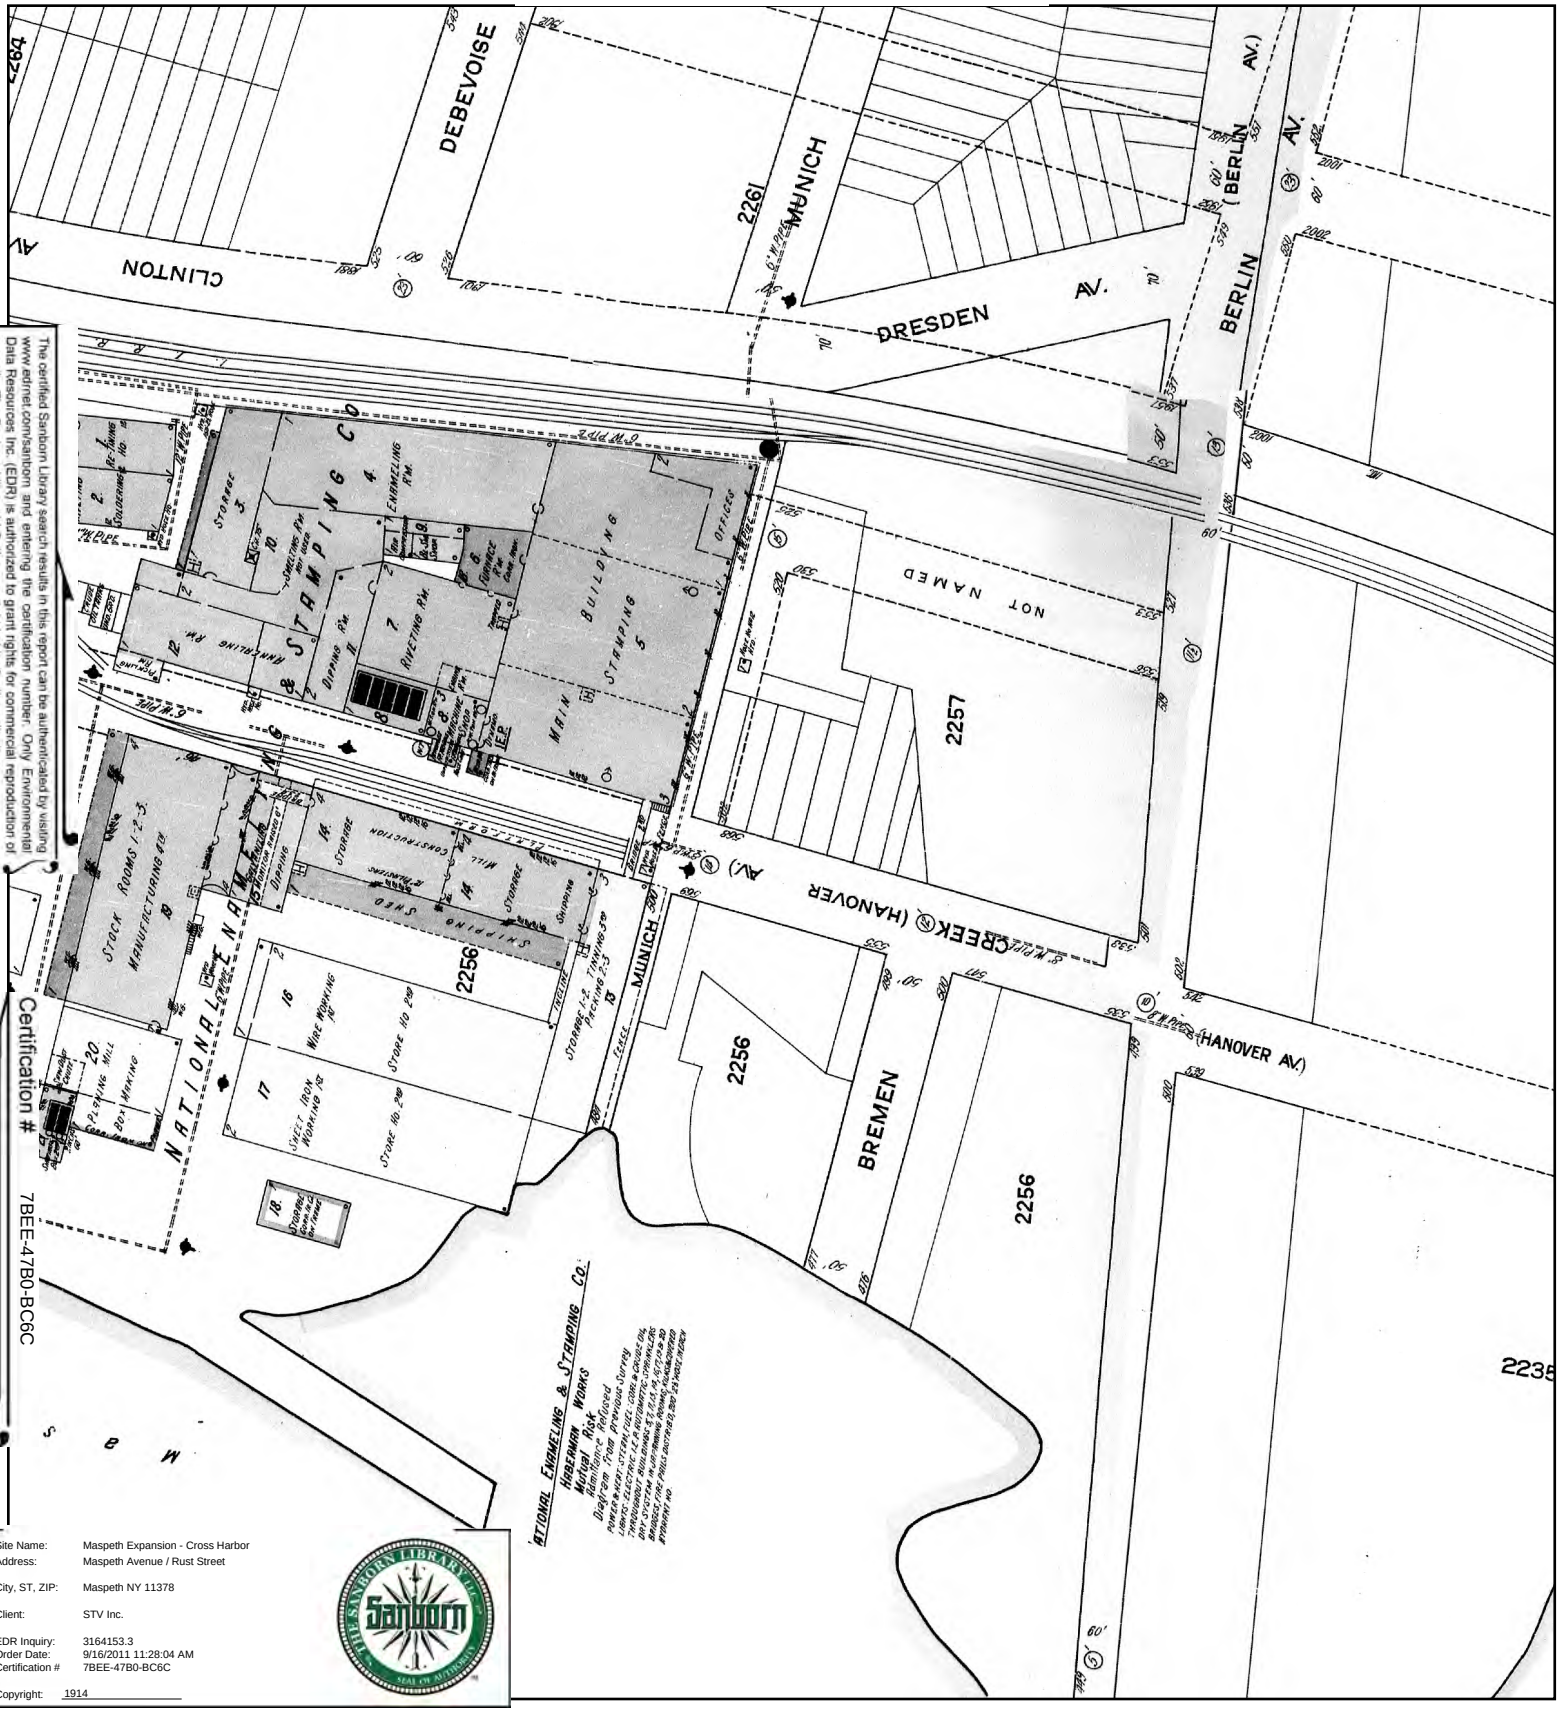

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1914

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

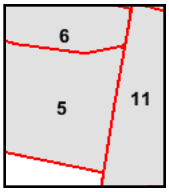

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11

0 Feet 165 330 660

N

1993 Certified Sanborn Map

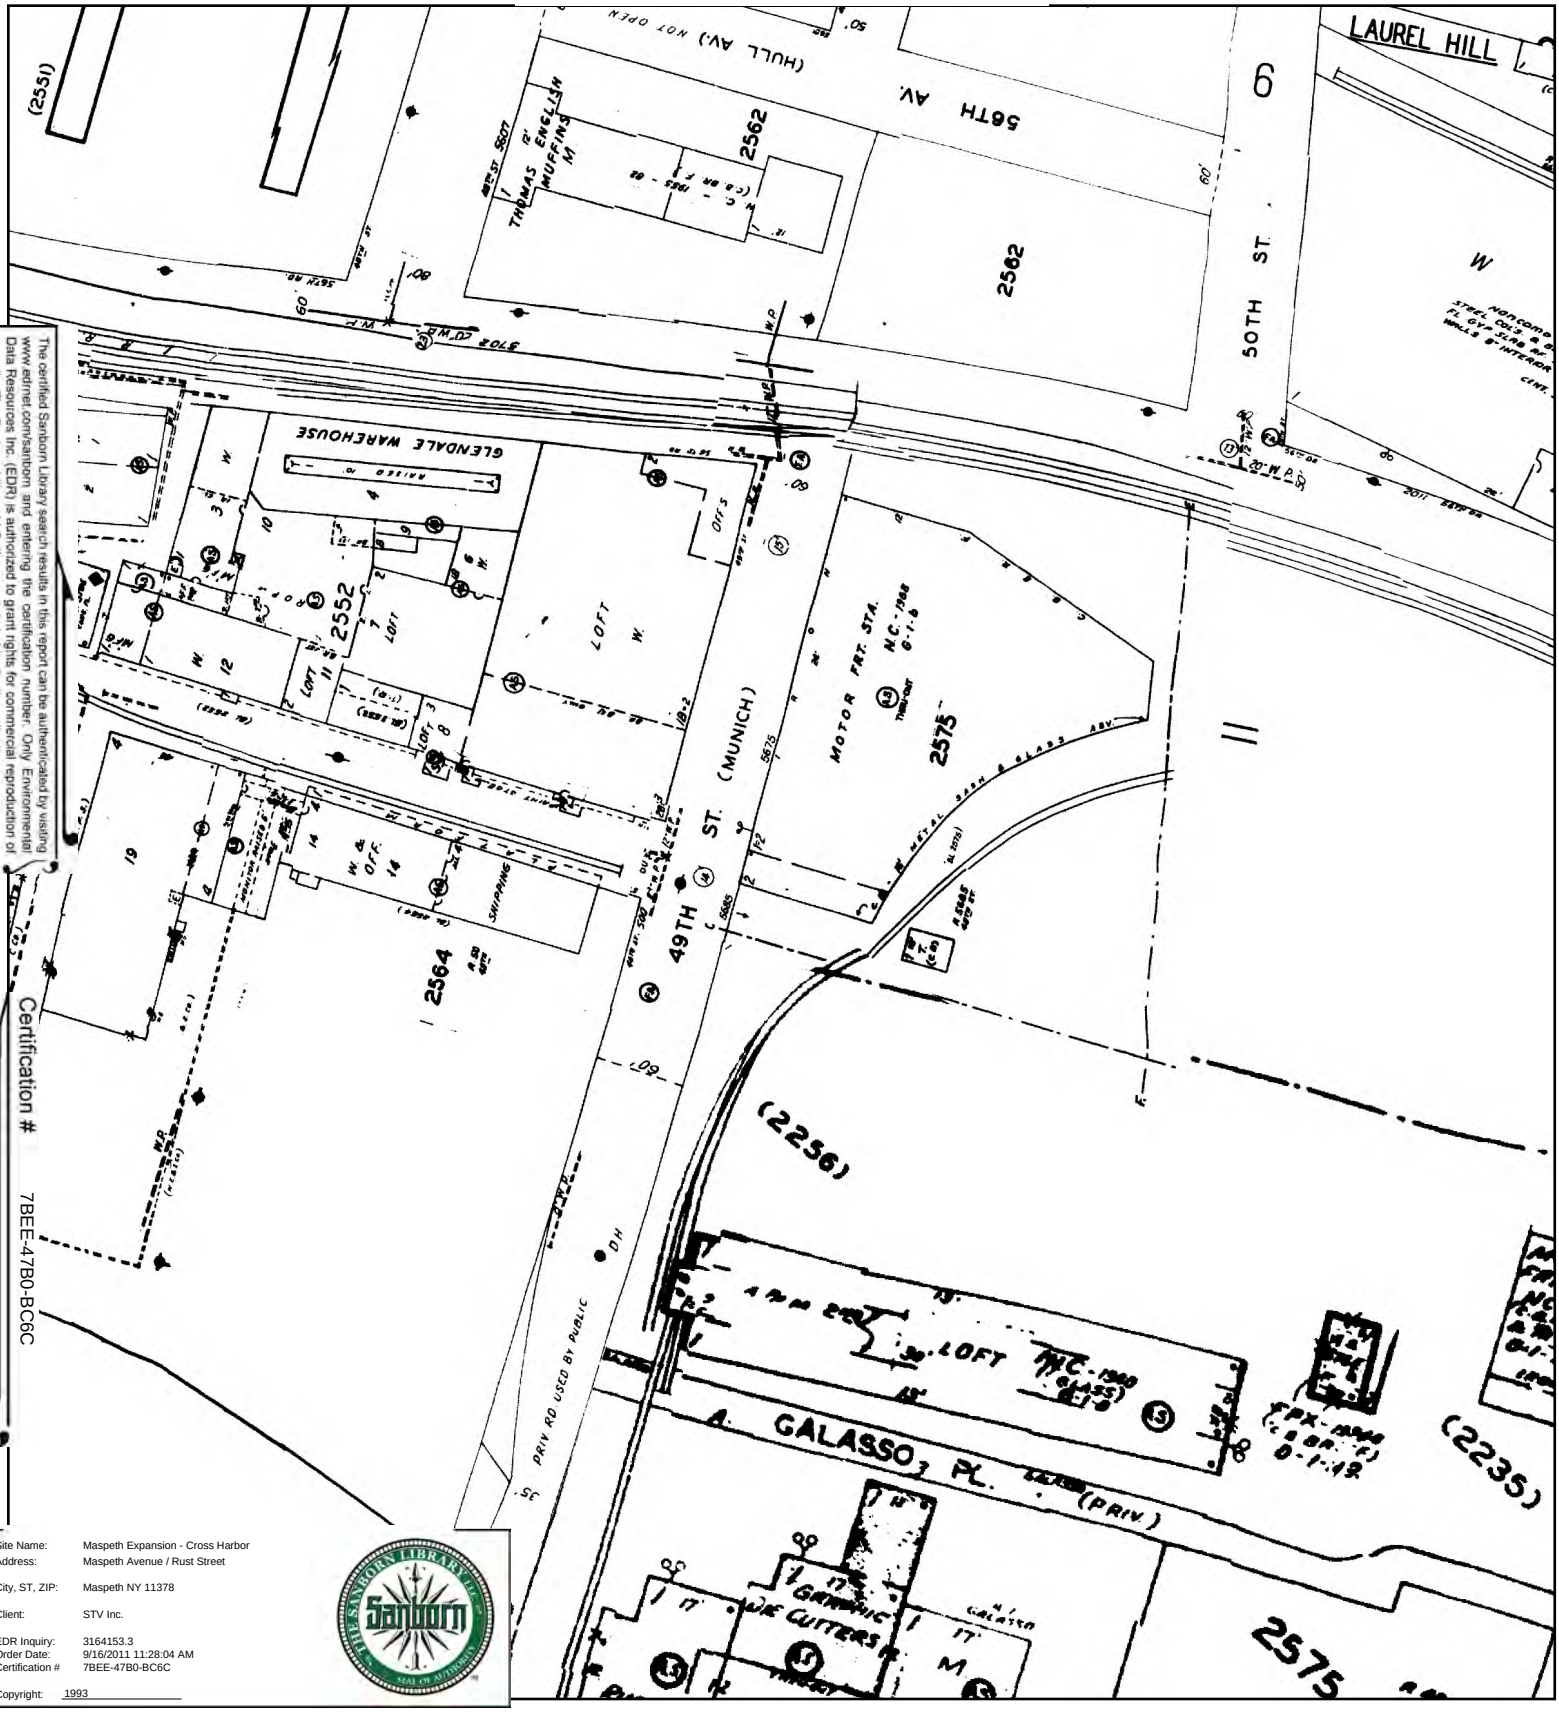

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1993

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

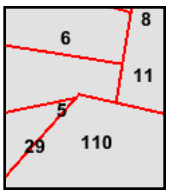

Volume 3, Sheet 110
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29

0 Feet 165 330 660

N

1992 Certified Sanborn Map

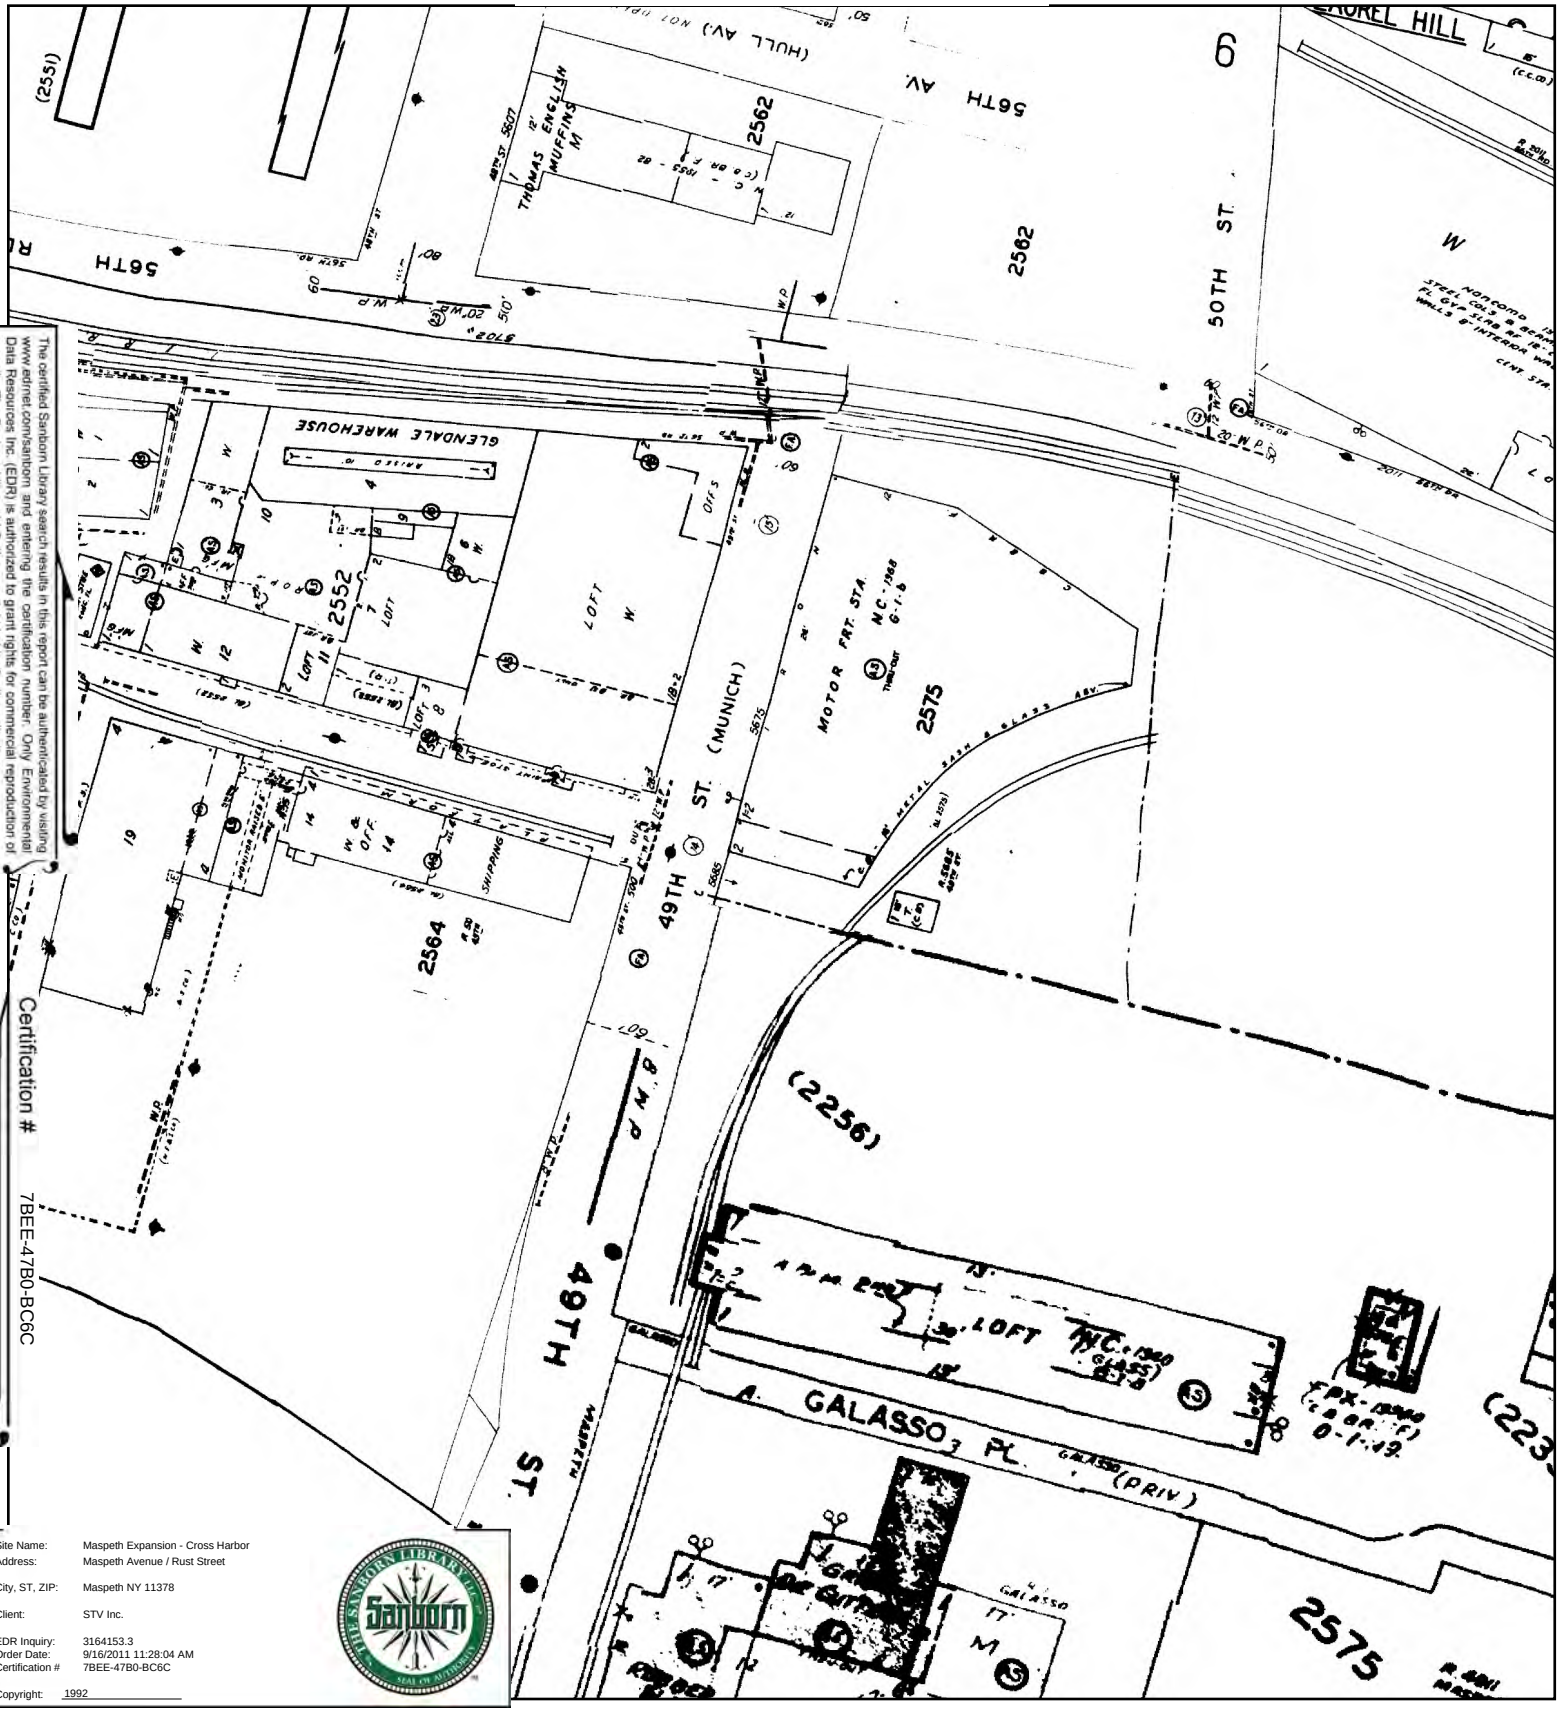

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1992

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

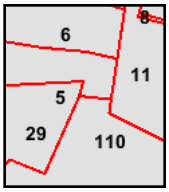

Volume 3, Sheet 110
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29

N

1991 Certified Sanborn Map

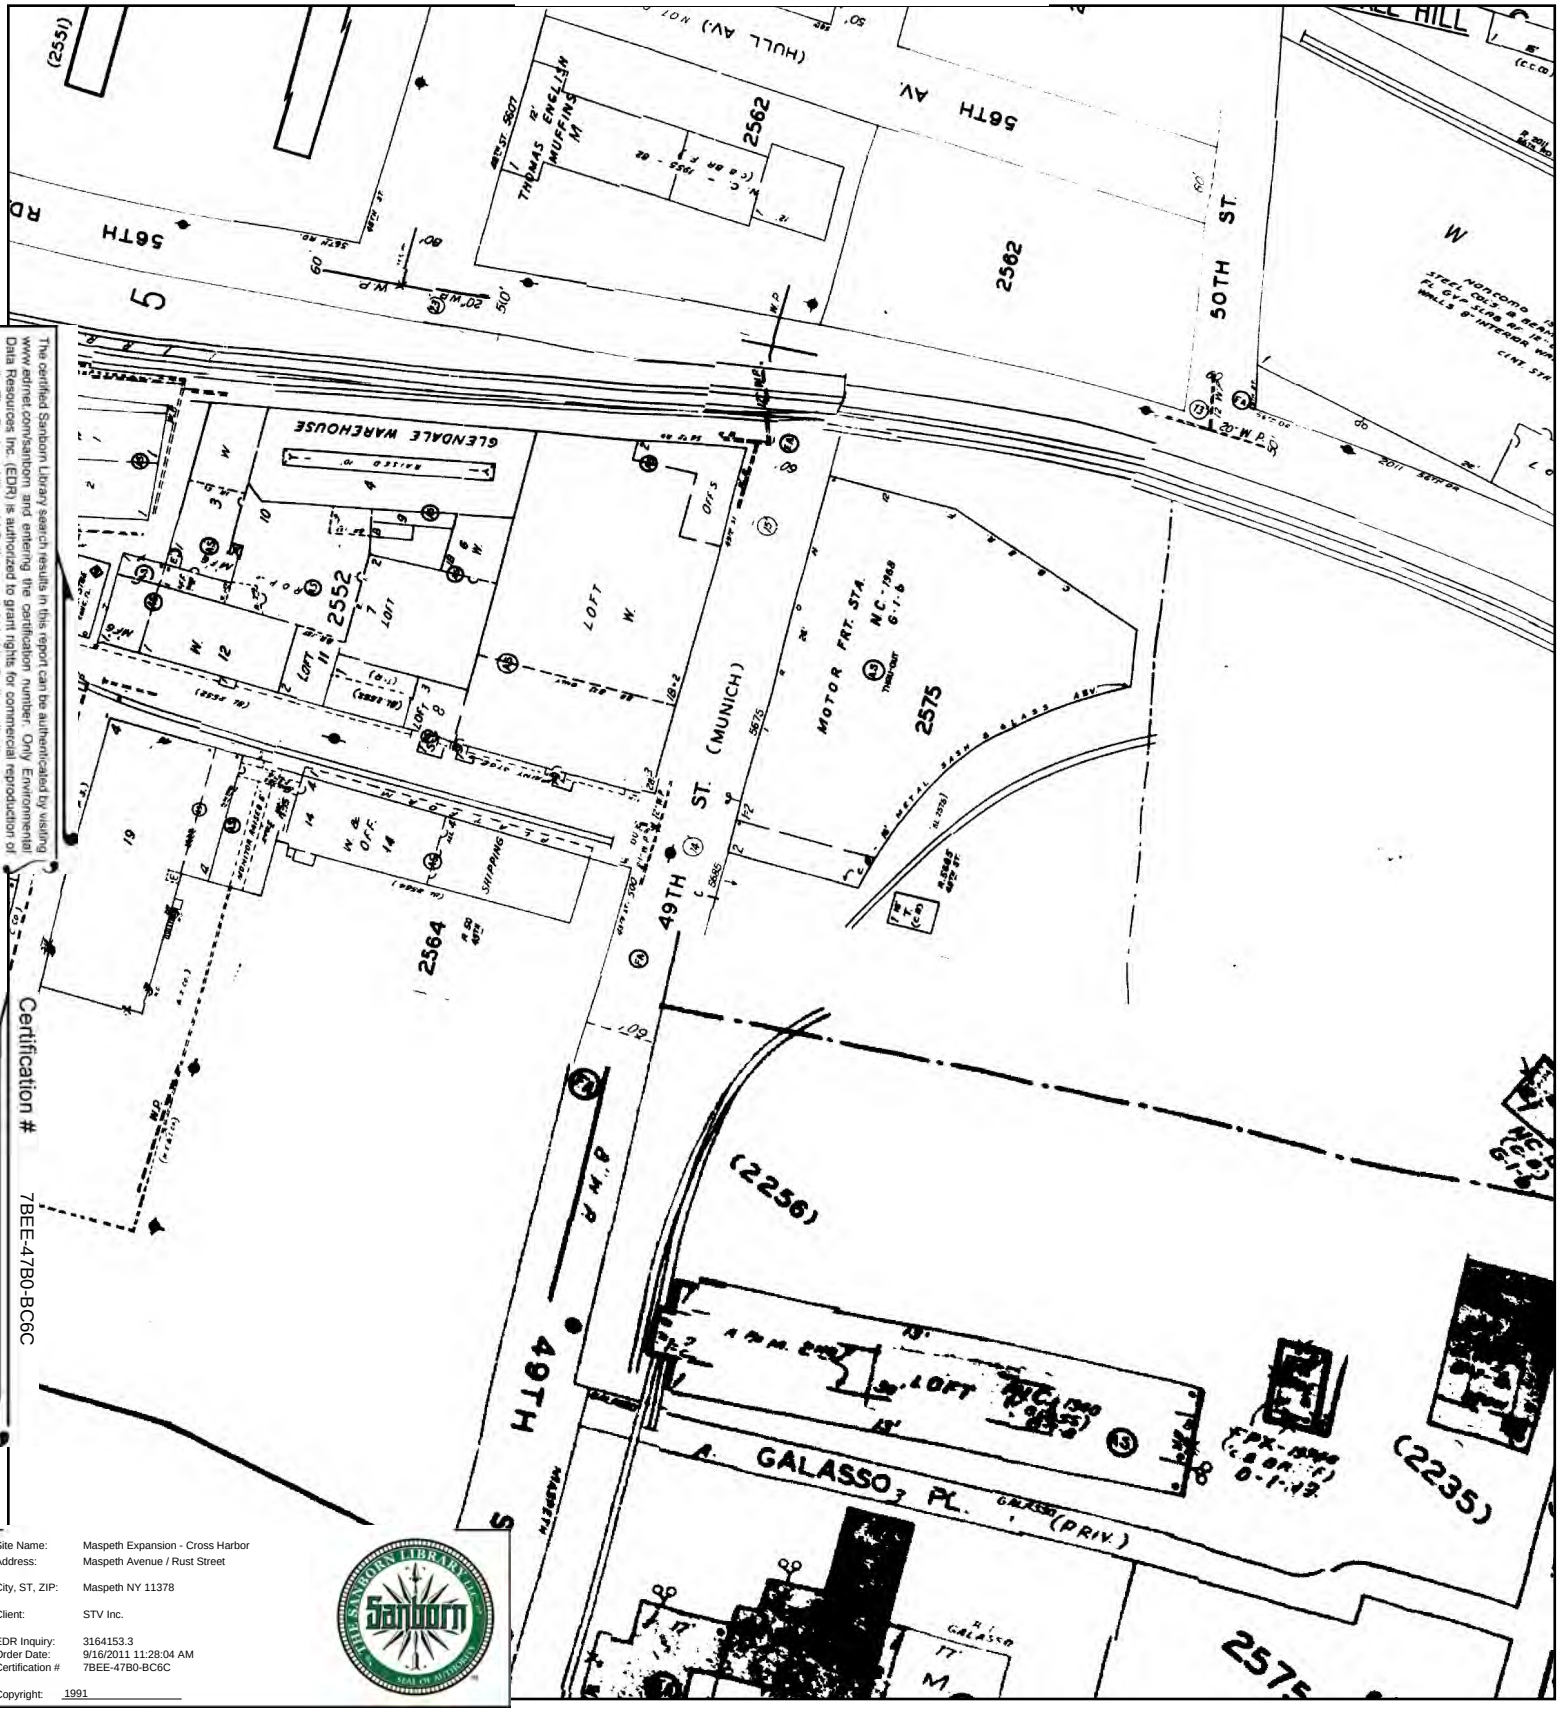

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1991

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

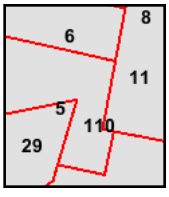

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1990 Certified Sanborn Map

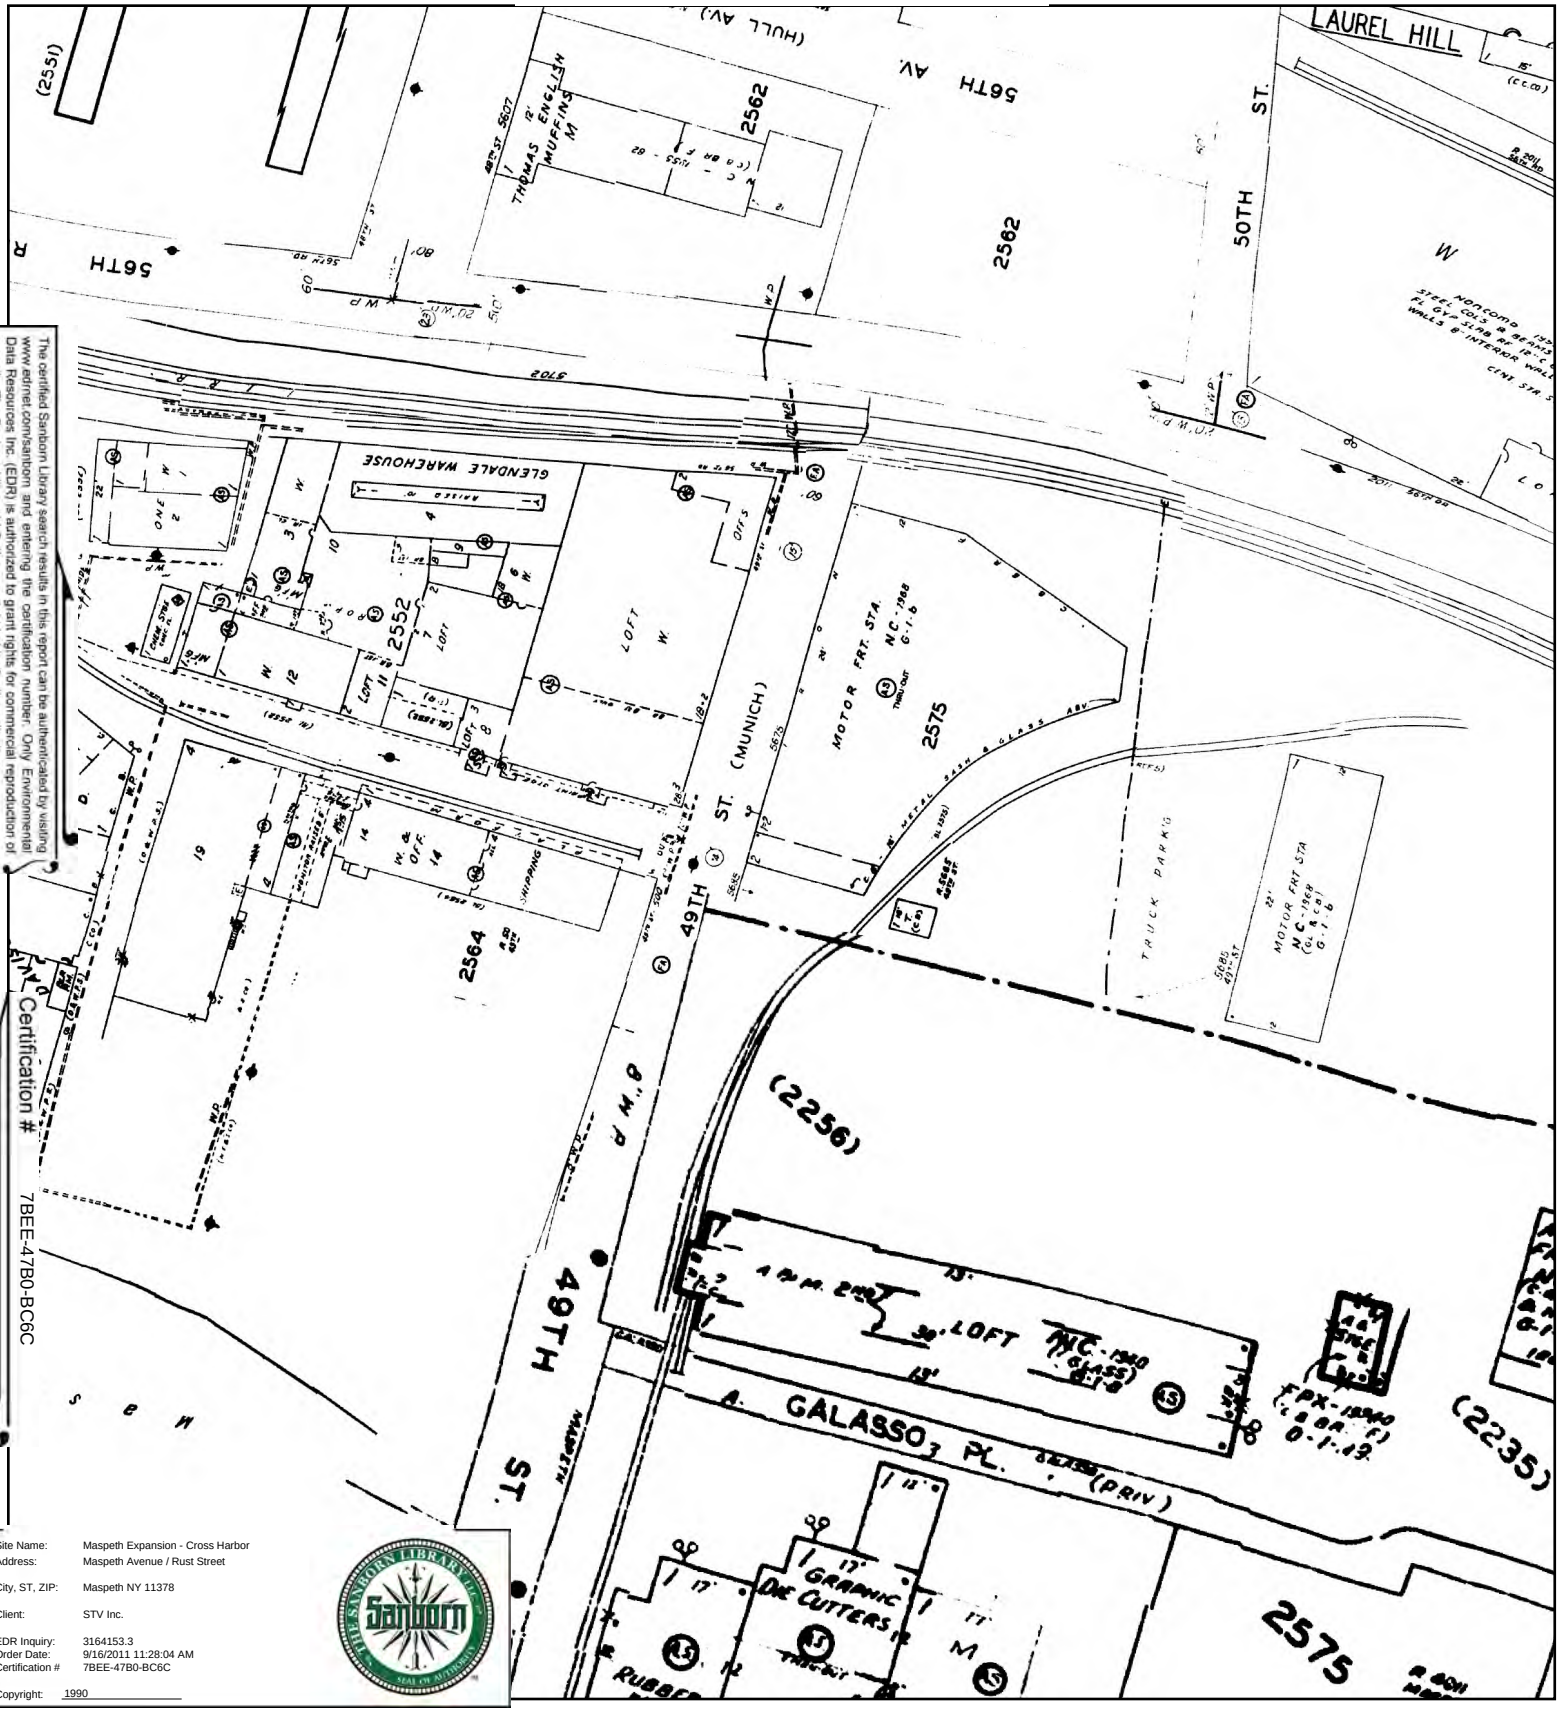

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1990

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

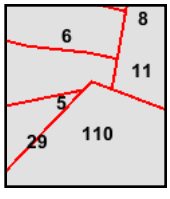

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1988 Certified Sanborn Map

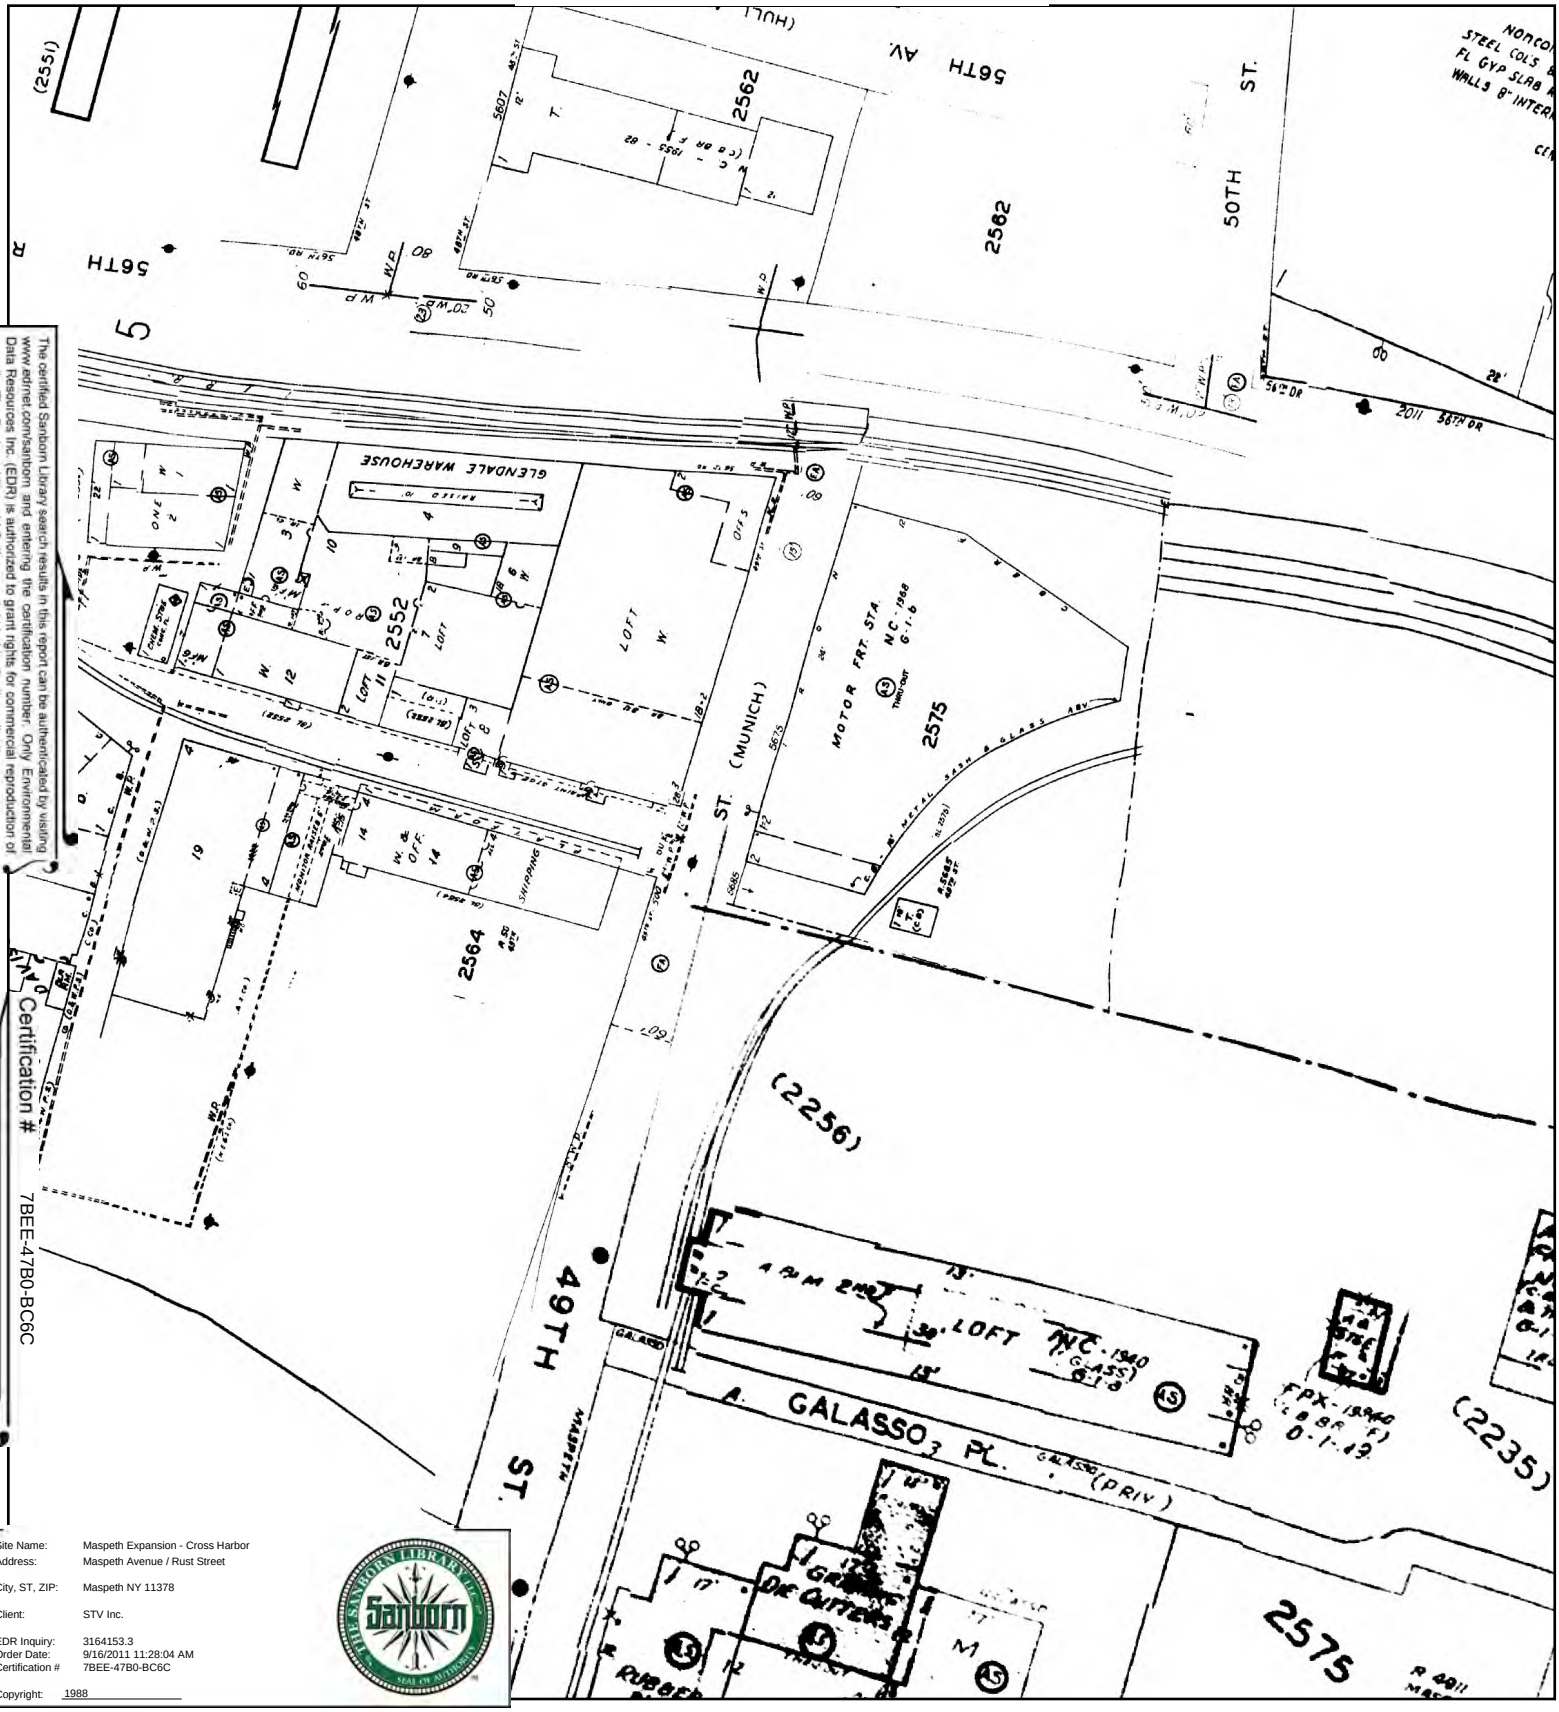

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn, and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1988

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

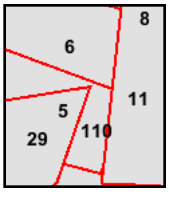

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

N

1986 Certified Sanborn Map

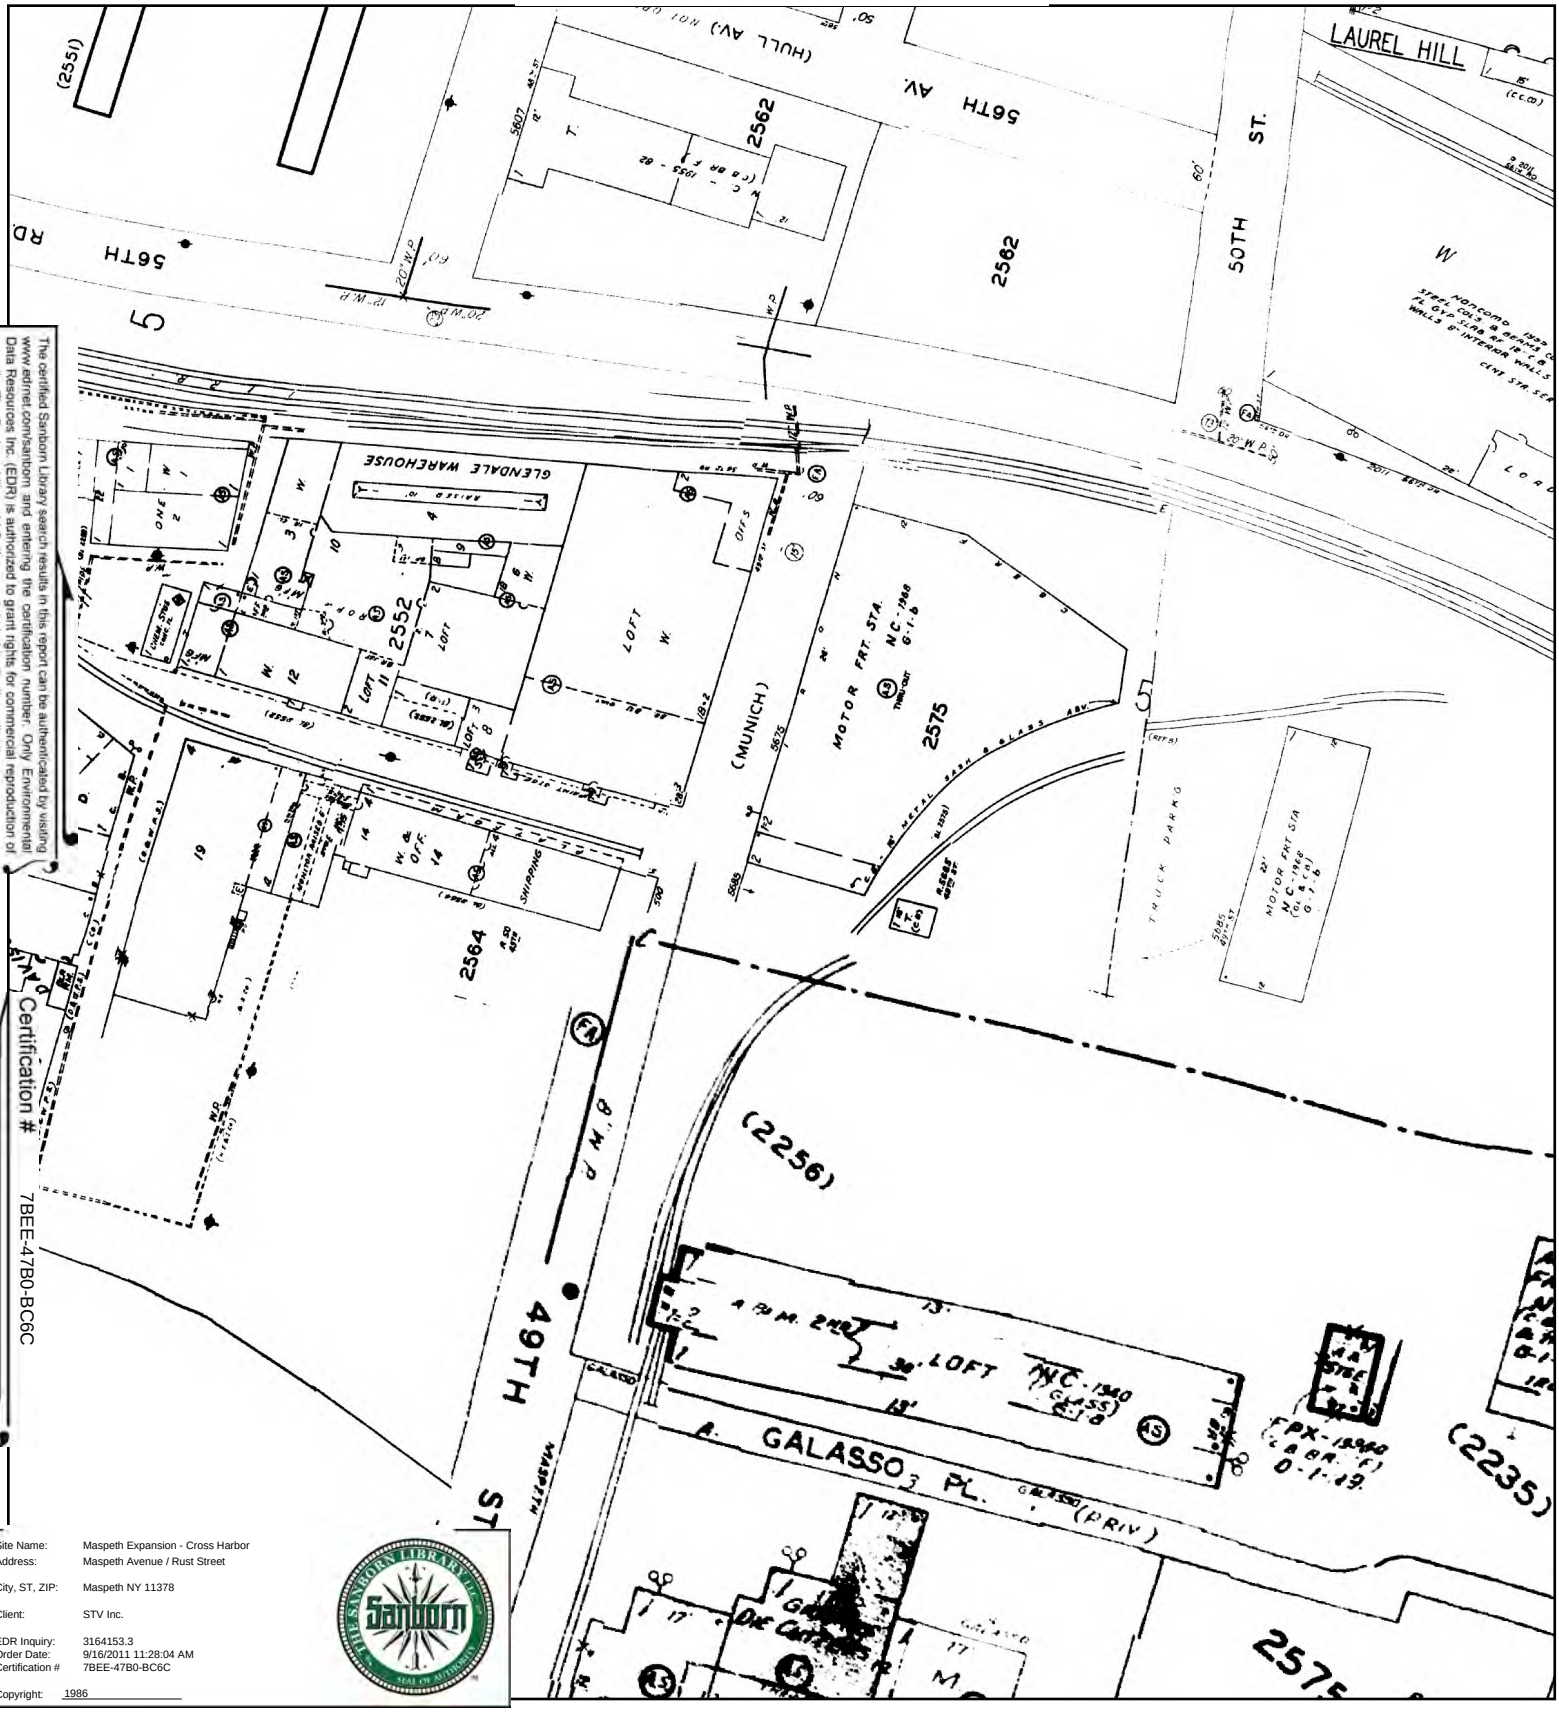

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1986

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

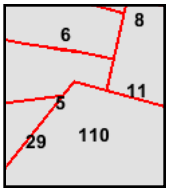

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1985 Certified Sanborn Map

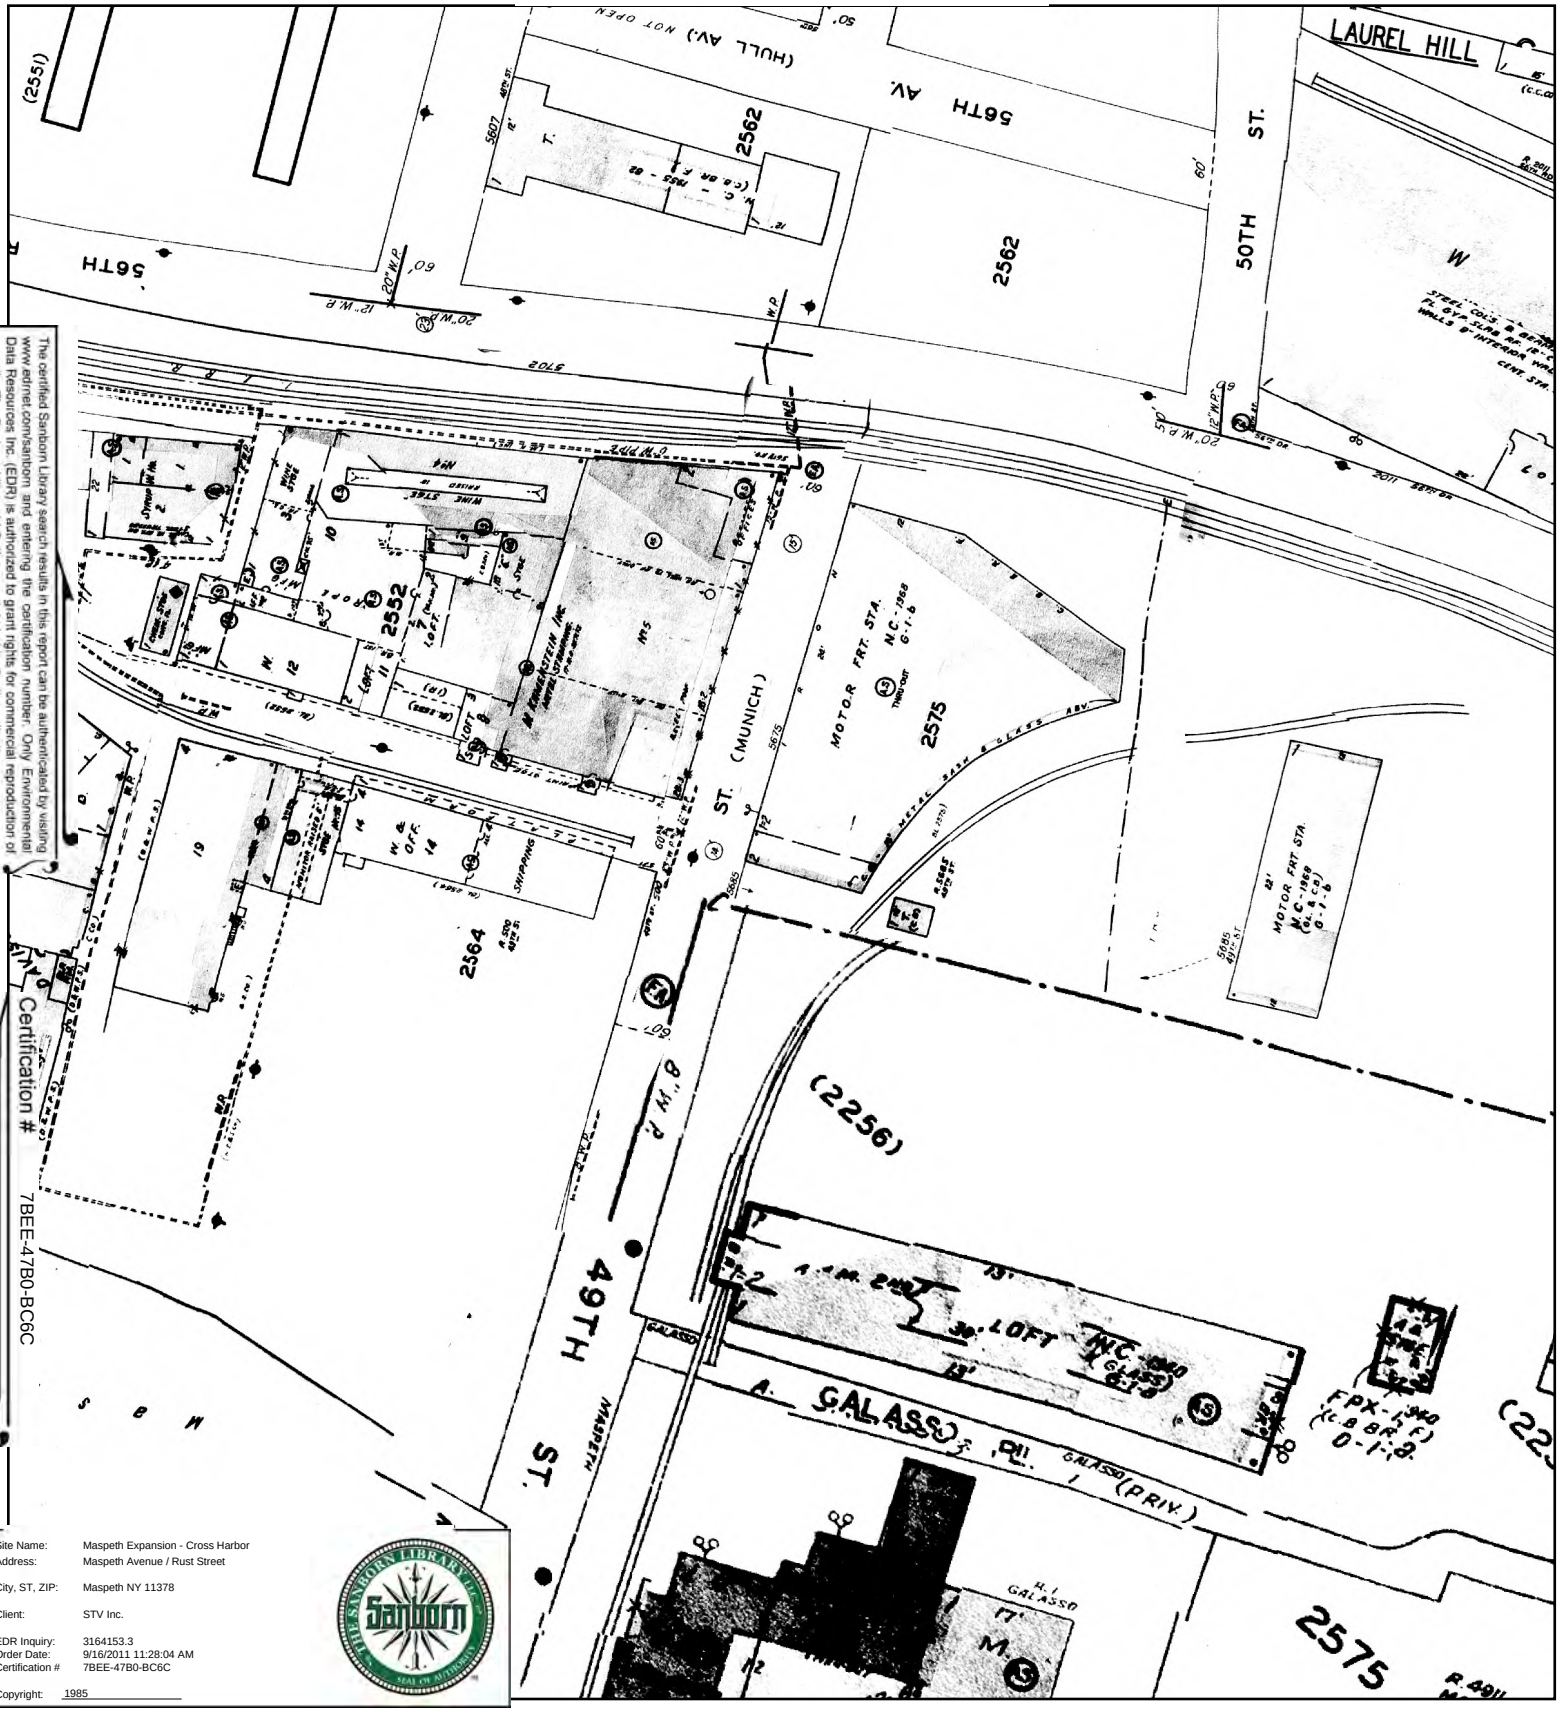

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1985

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

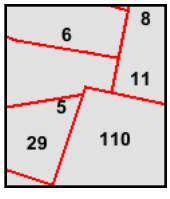

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1982 Certified Sanborn Map

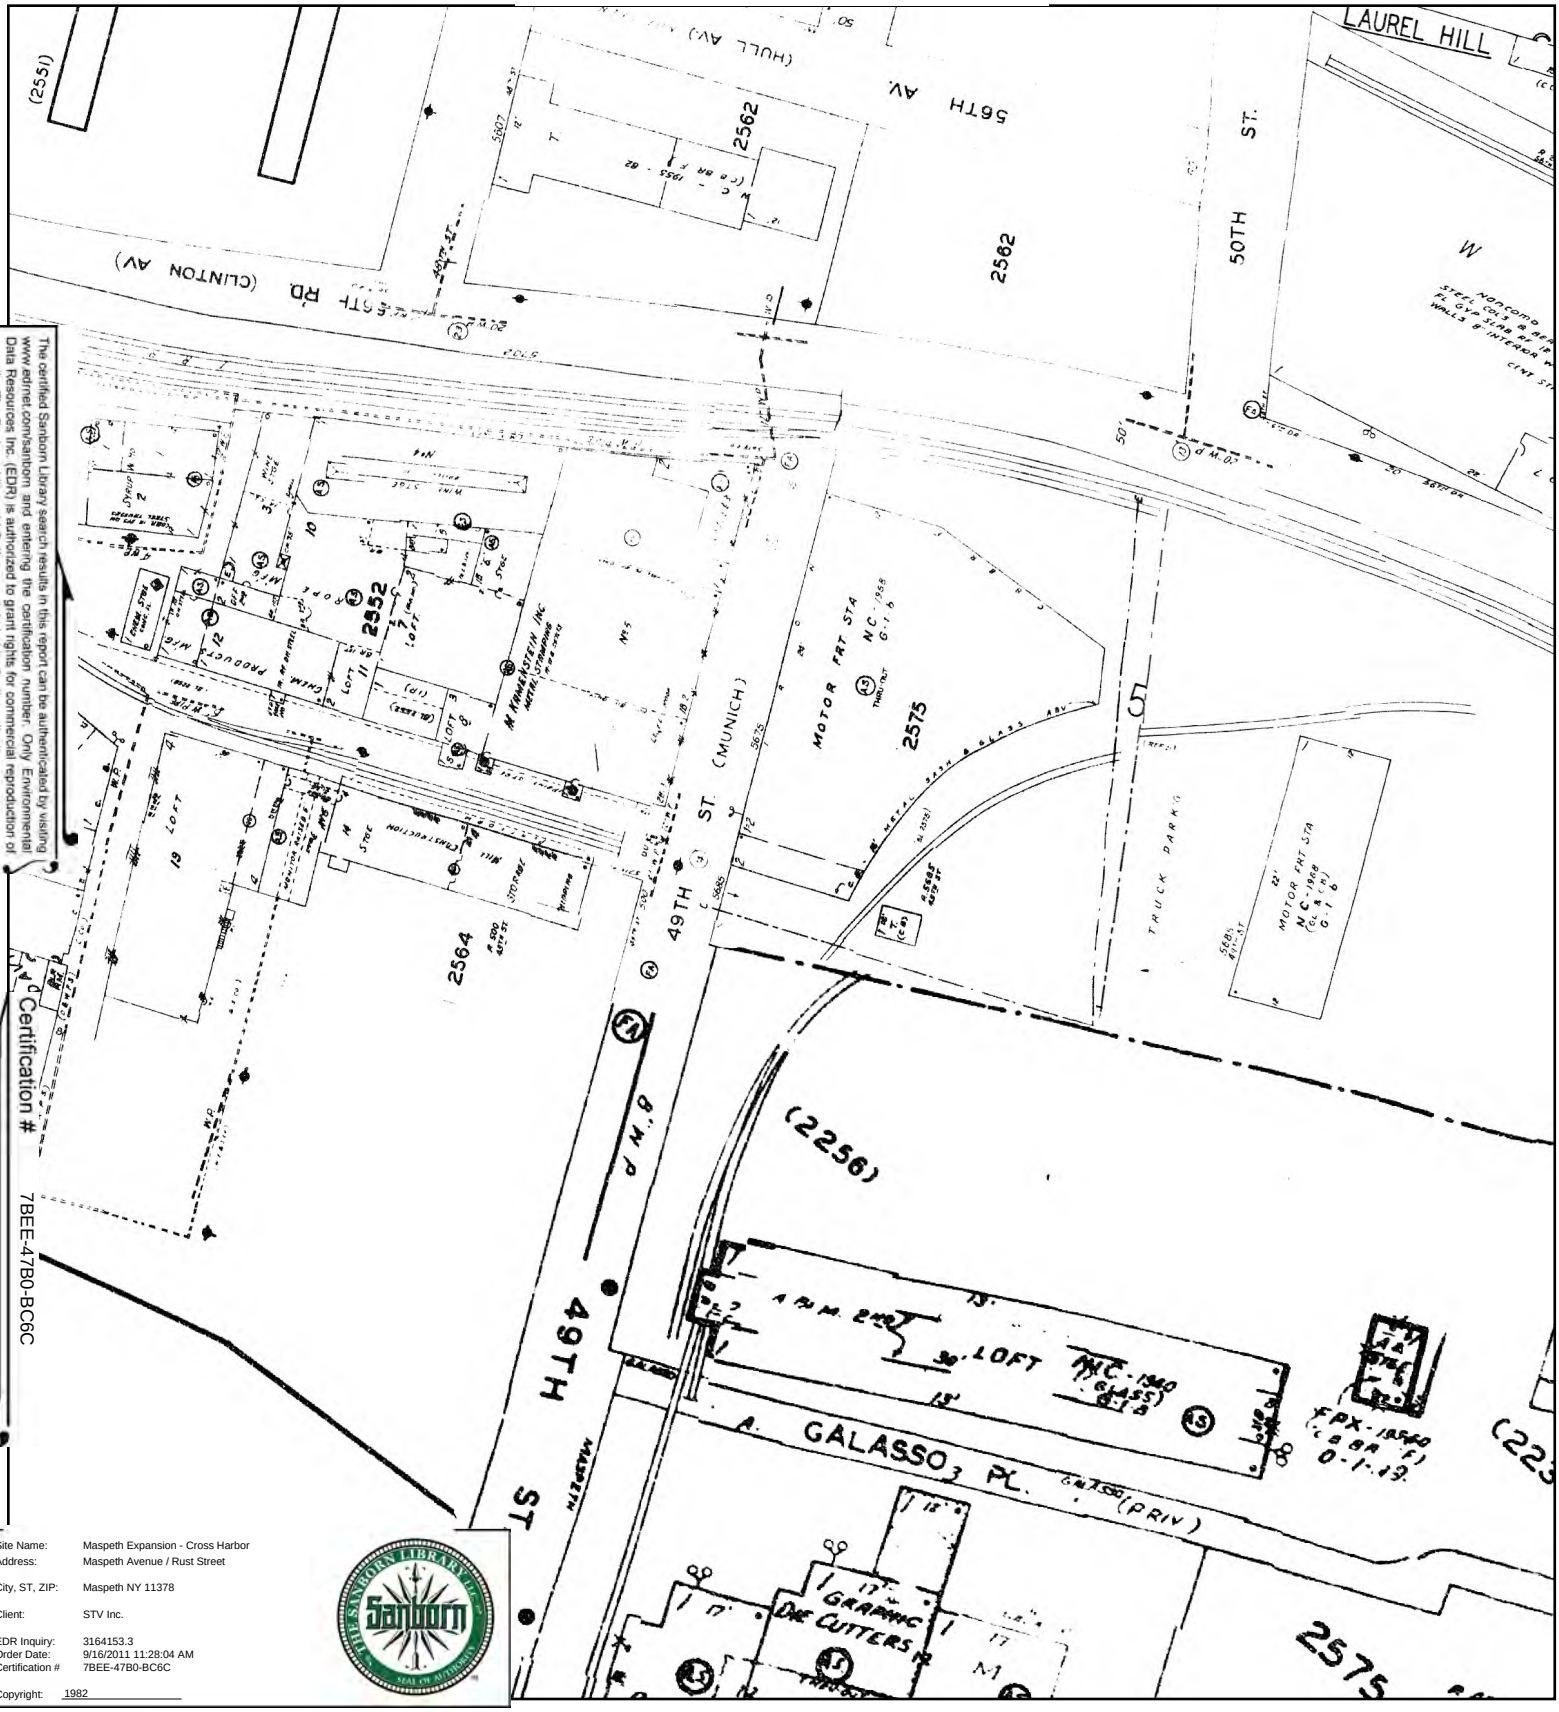

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1982

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

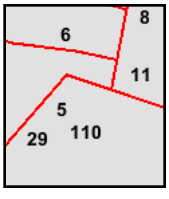

Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29
Volume 3, Sheet 110

0 Feet 165 330 660

N

1980 Certified Sanborn Map

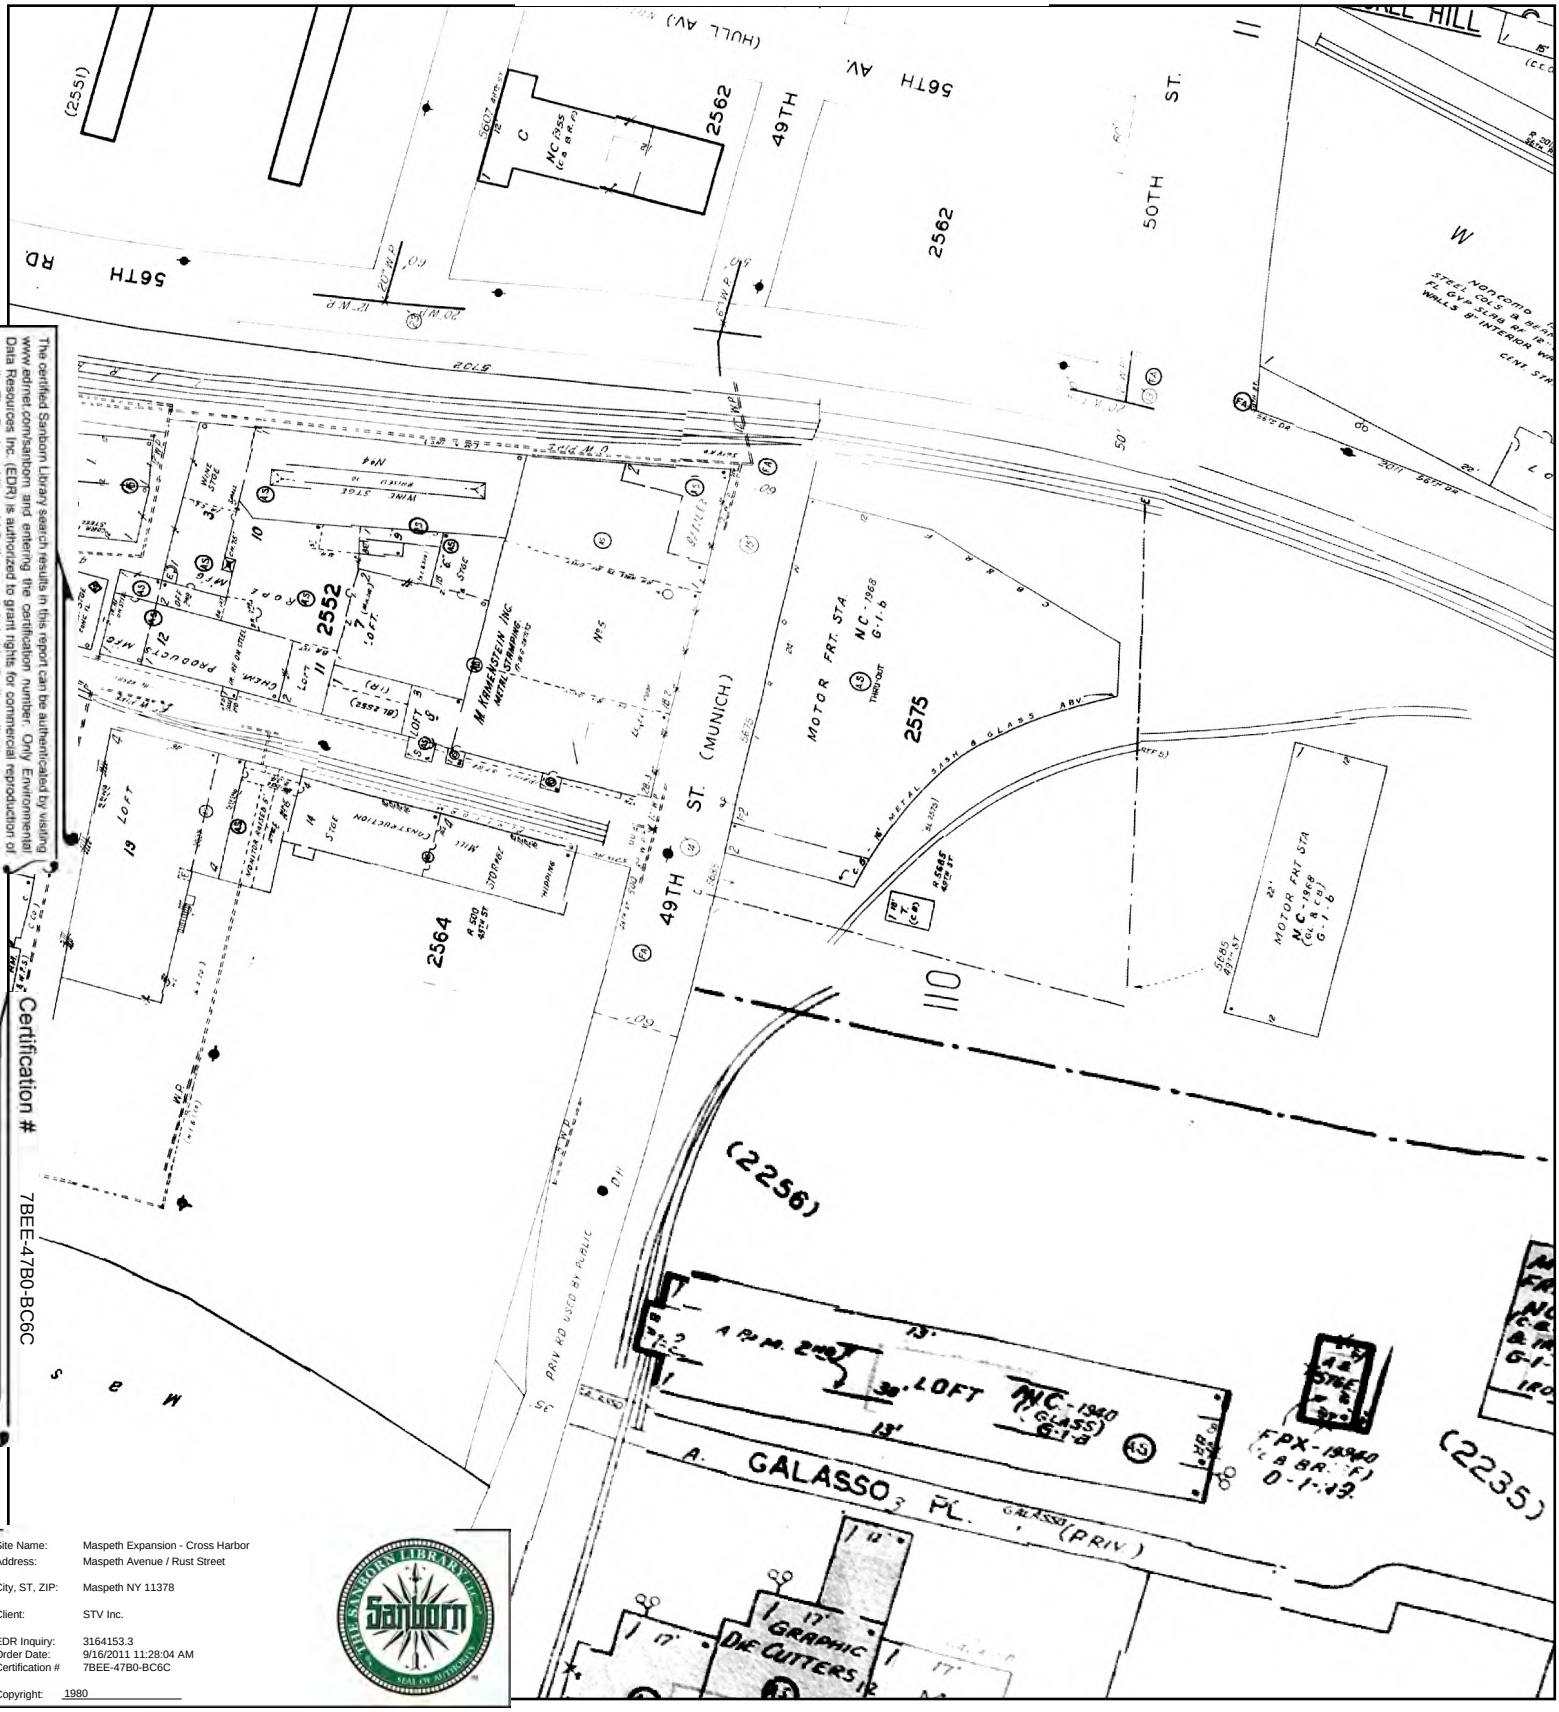

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1980

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

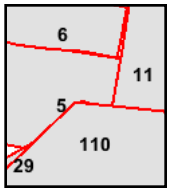

Volume 3, Sheet 110
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 11
Volume 3, Sheet 29

0 Feet 165 330 660

N

1993 Certified Sanborn Map

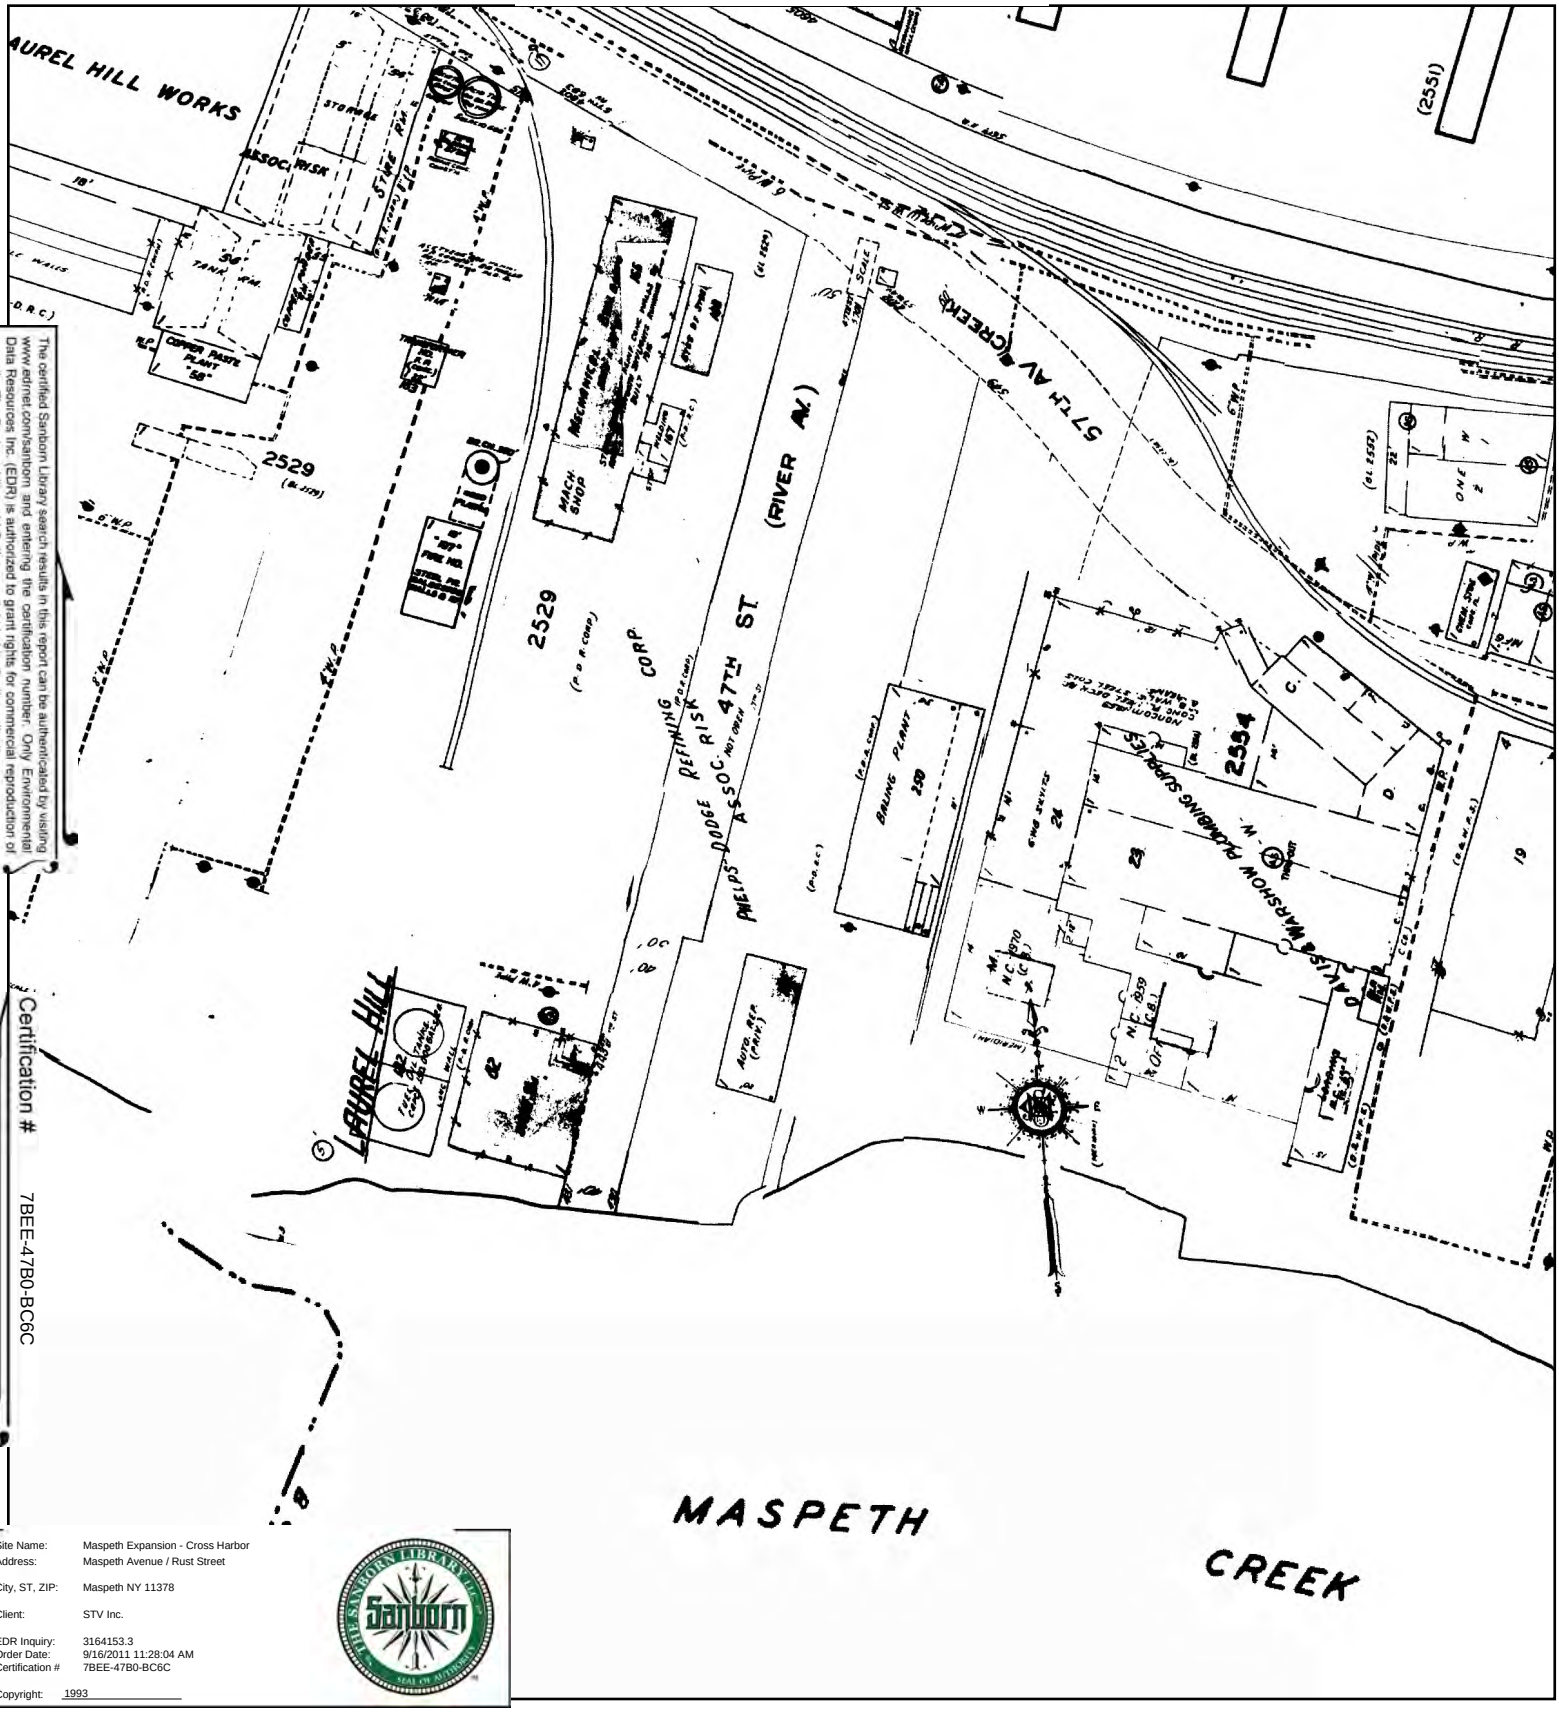

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1993

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

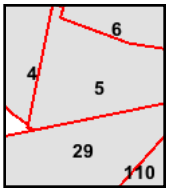

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1992 Certified Sanborn Map

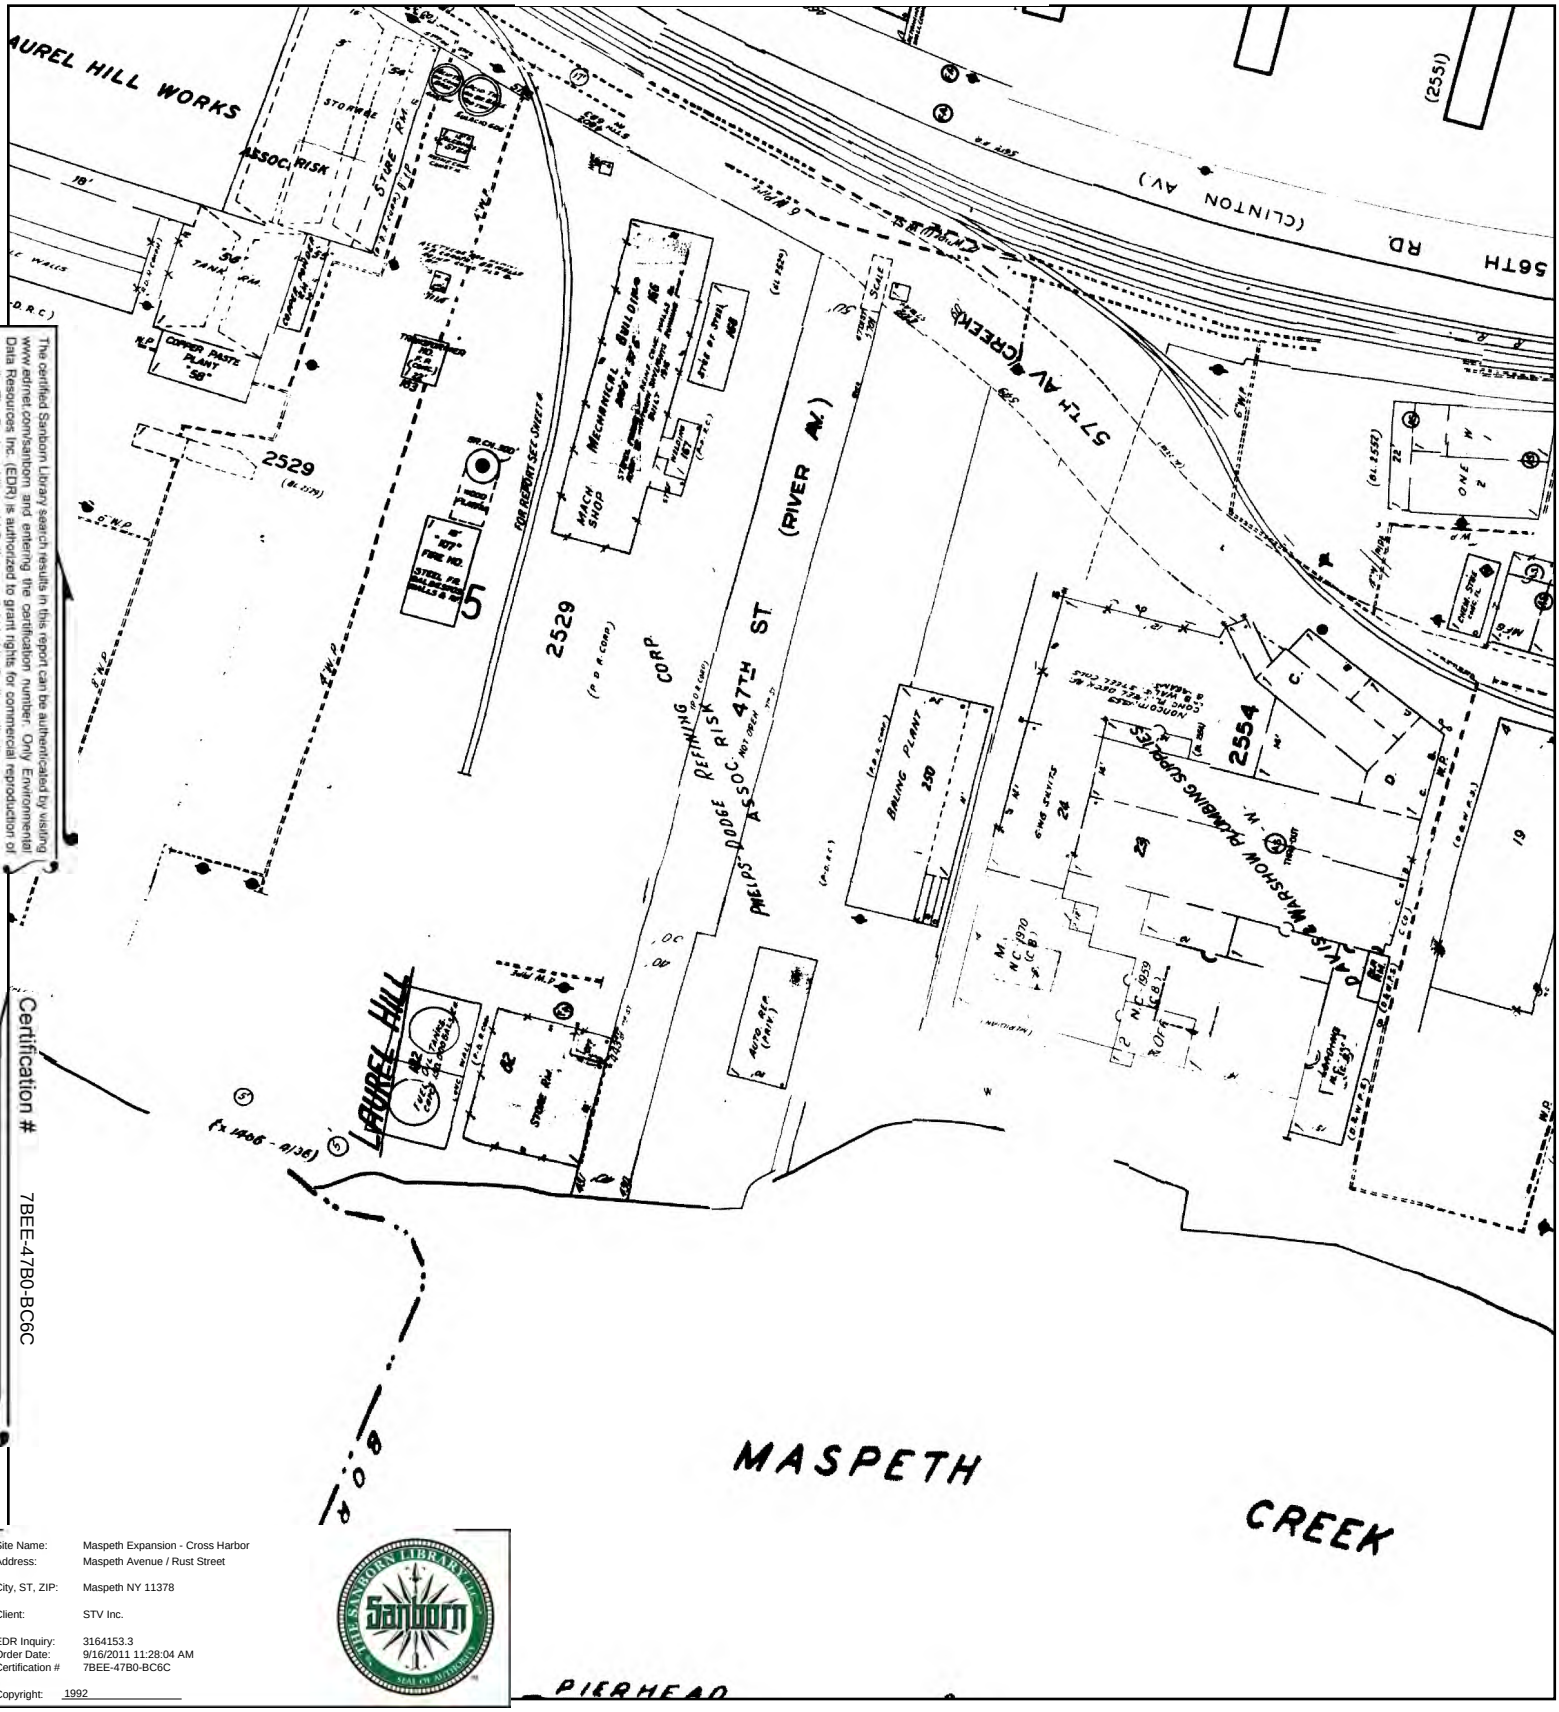

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1992

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

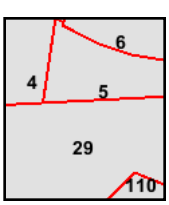

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1991 Certified Sanborn Map

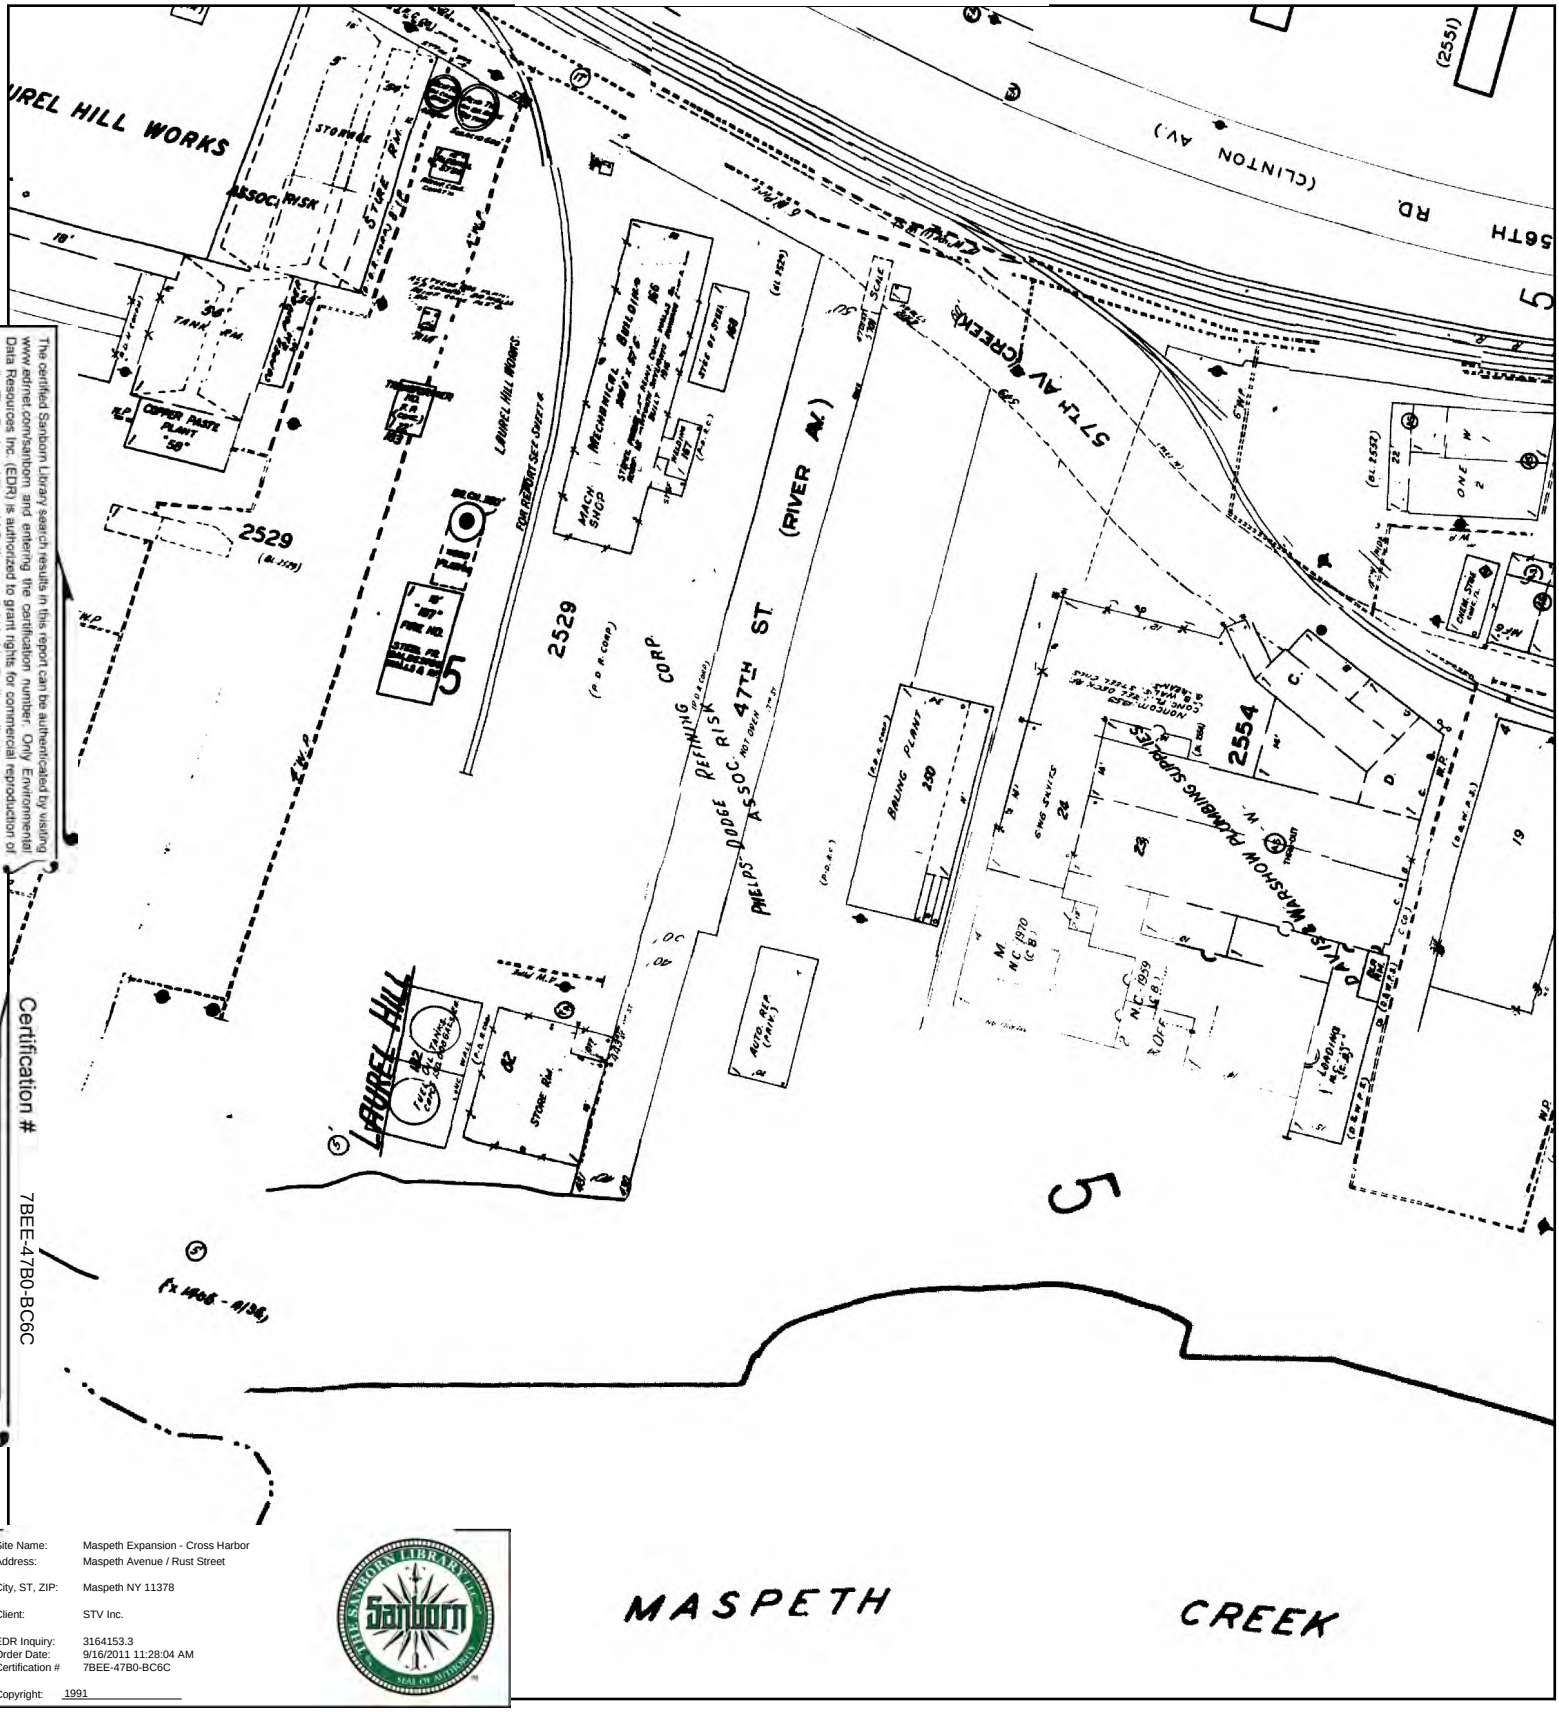

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1991

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

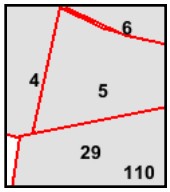

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 29

0 Feet 165 330 660

N

1990 Certified Sanborn Map

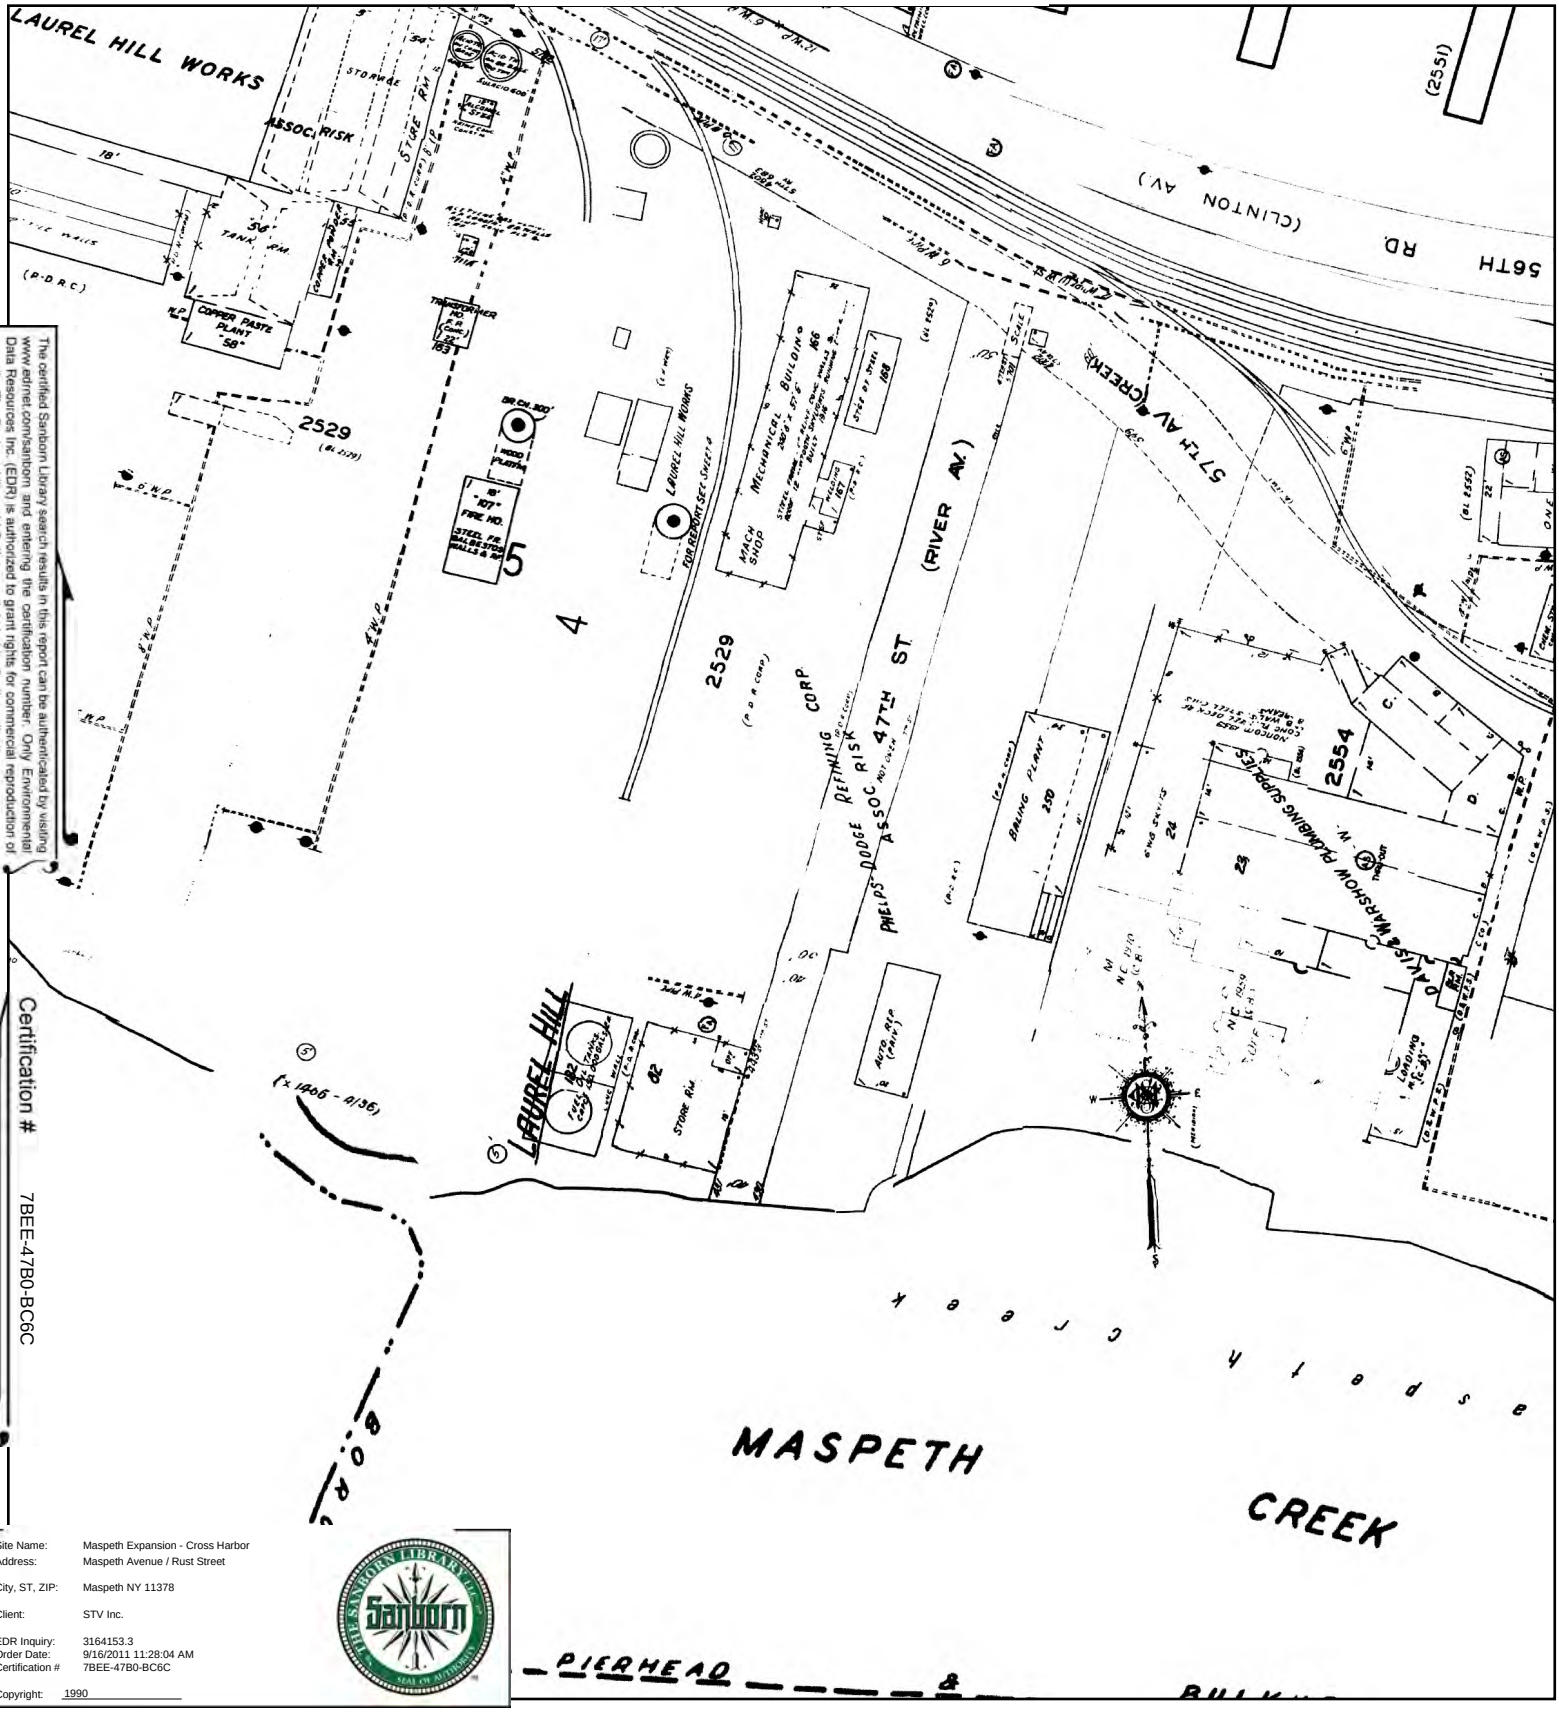

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn, and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1990

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

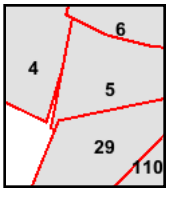

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

N

1988 Certified Sanborn Map

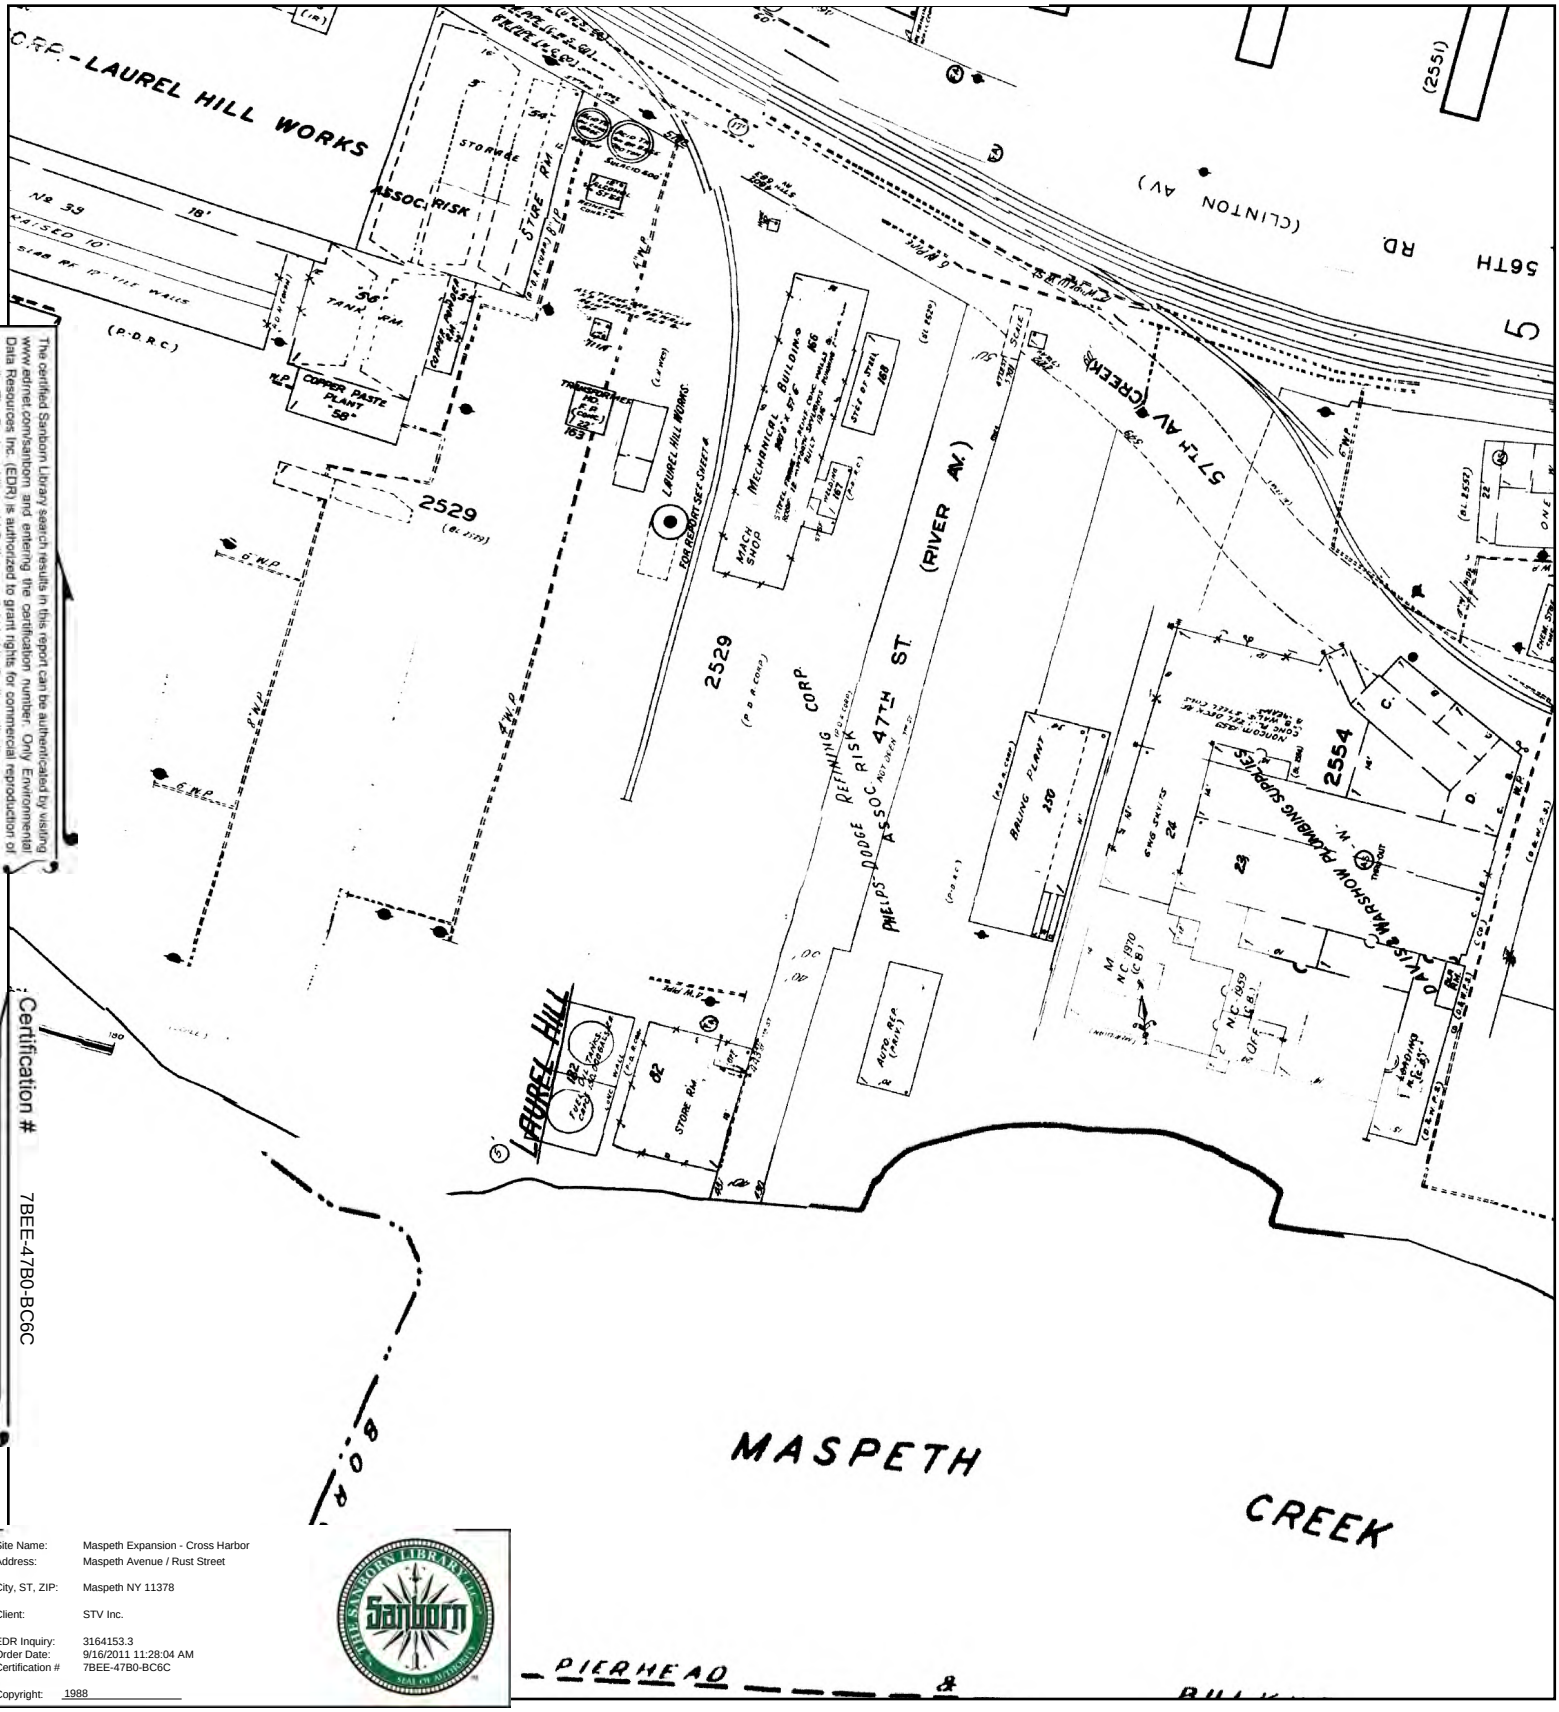

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1988

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

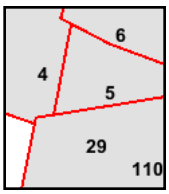

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1986 Certified Sanborn Map

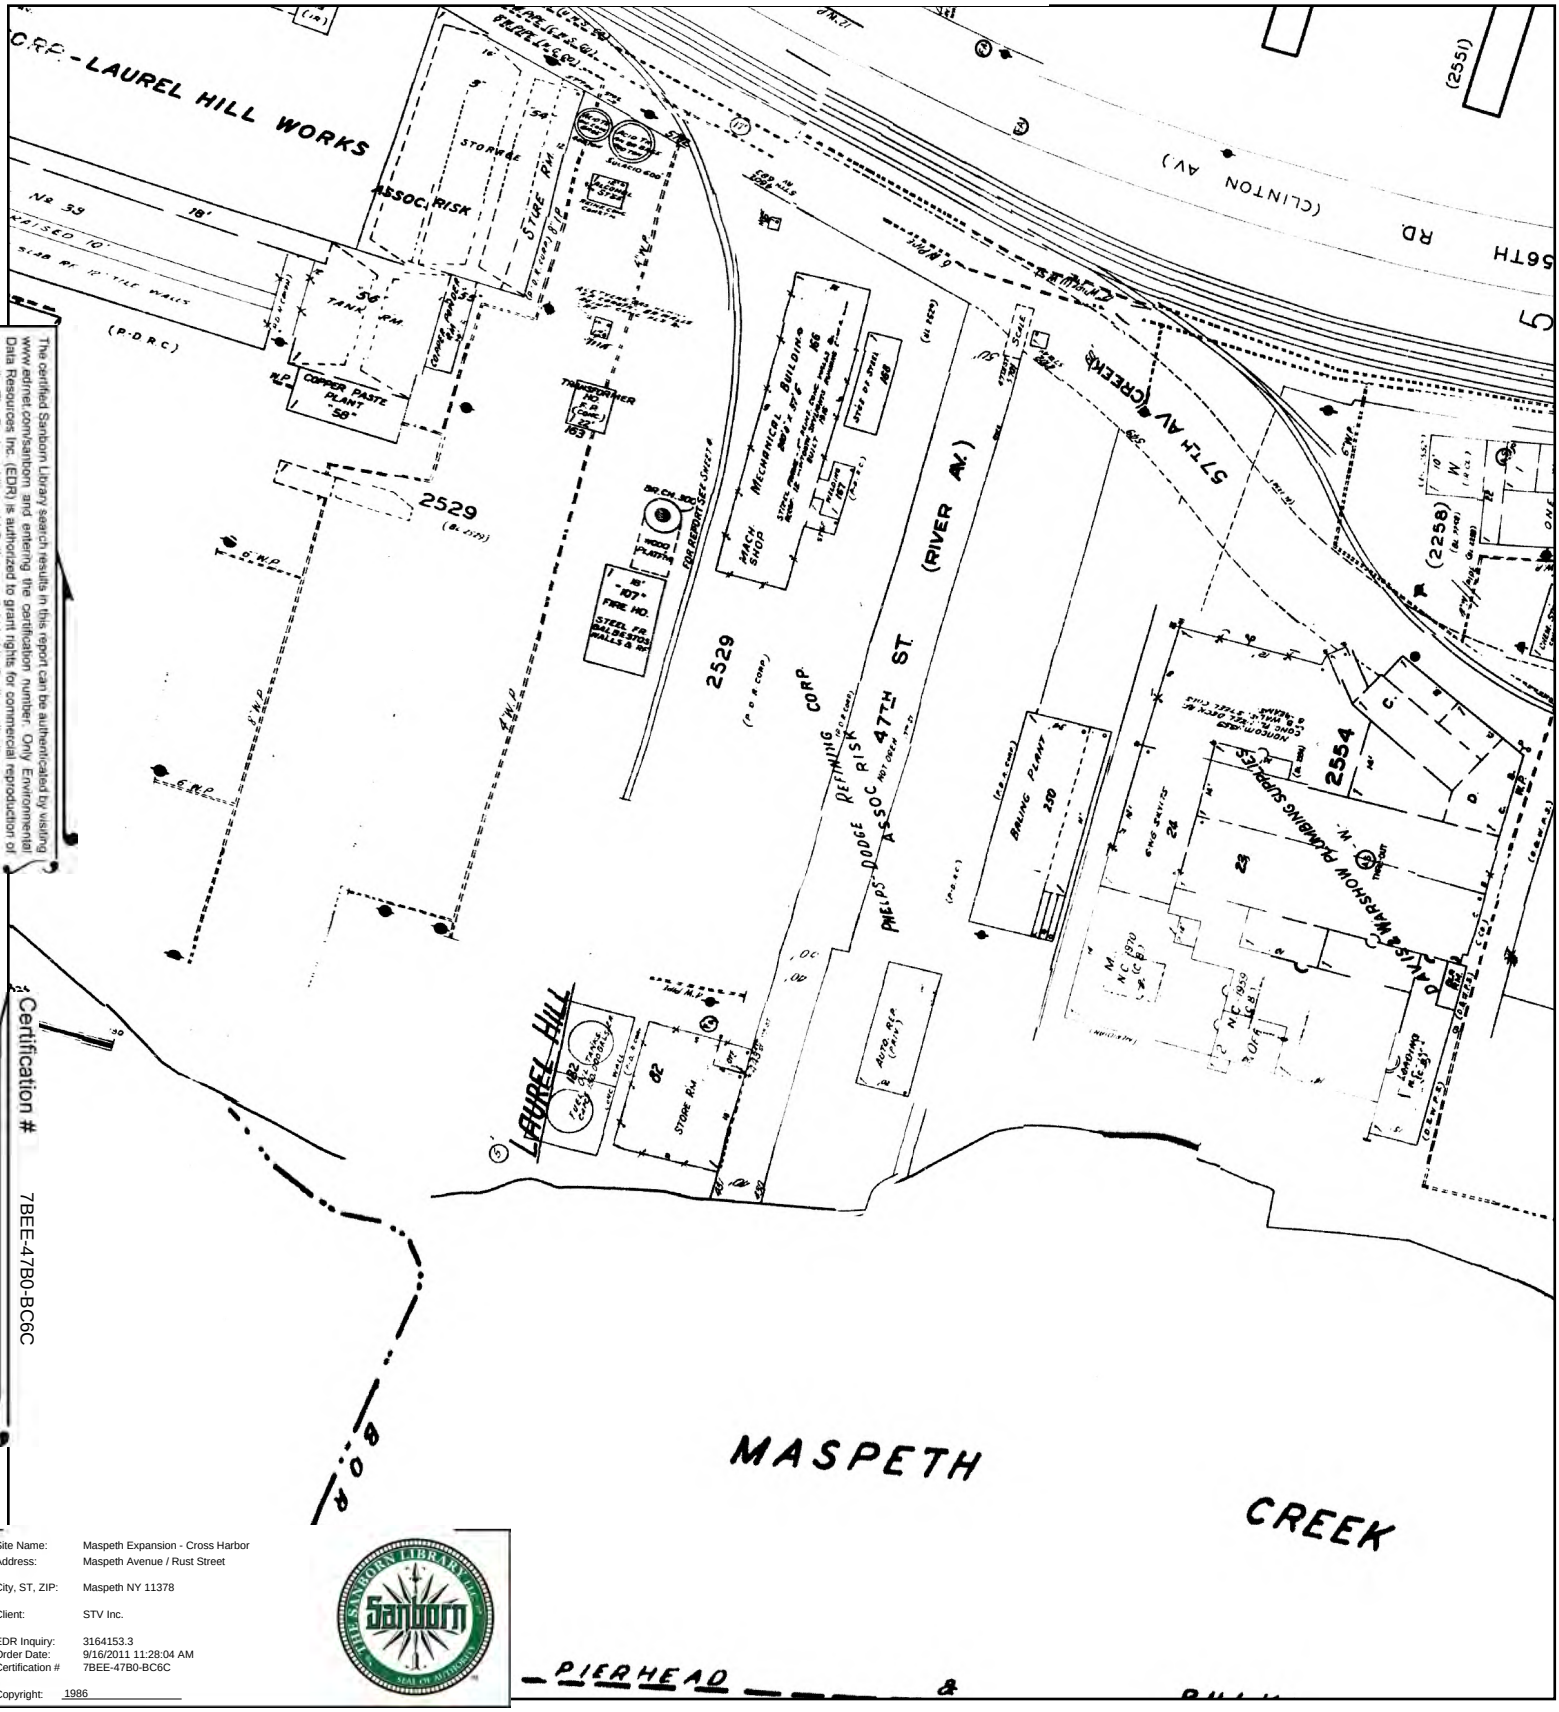

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn, and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1986

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

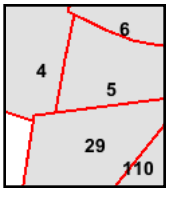

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1985 Certified Sanborn Map

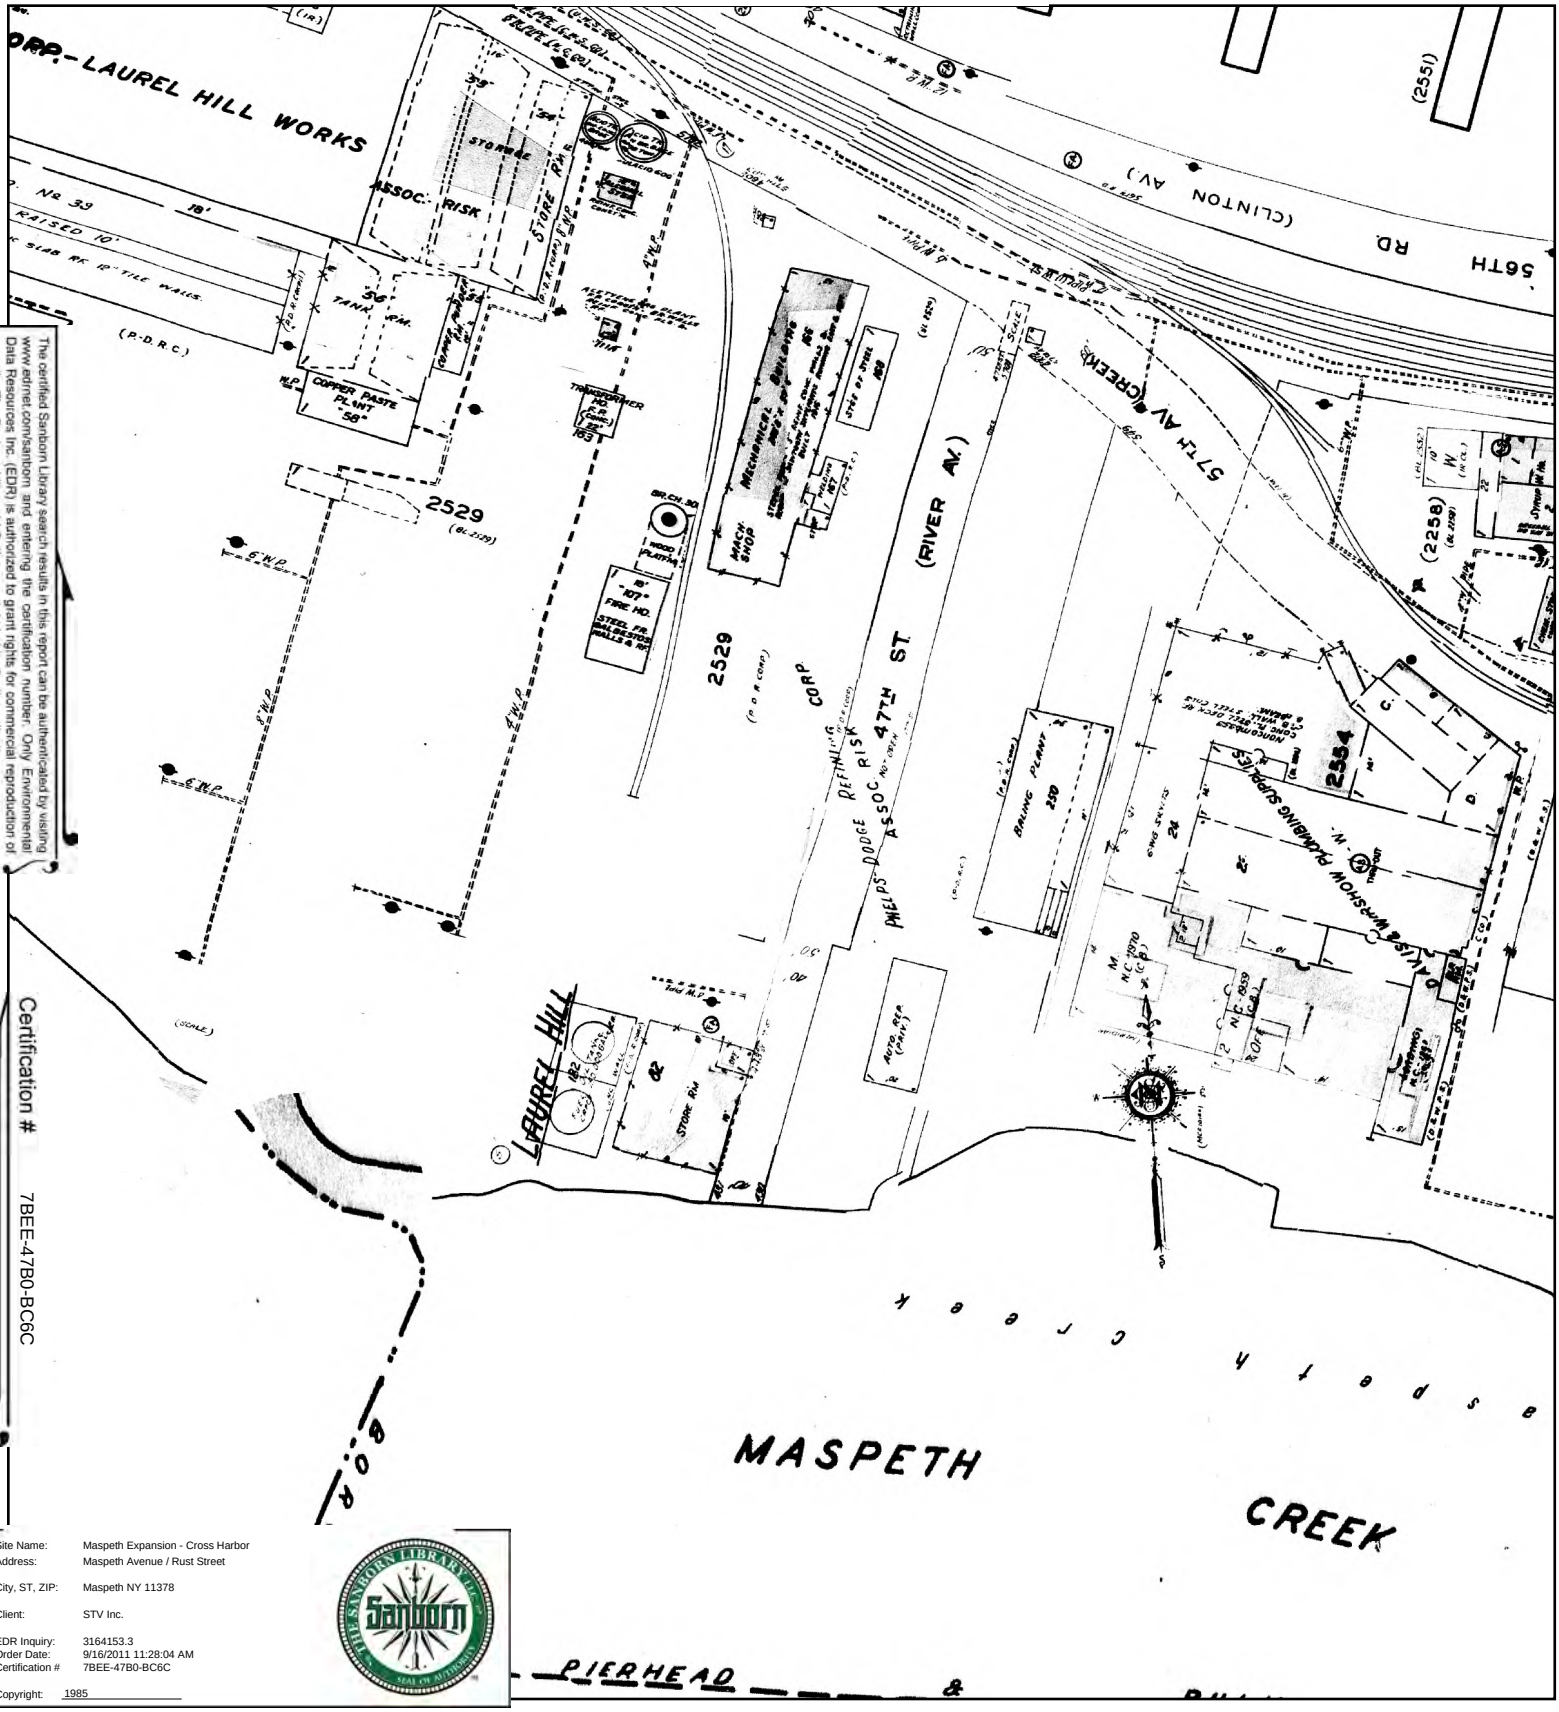

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1985

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

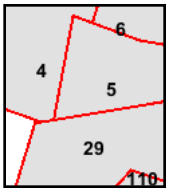

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1982 Certified Sanborn Map

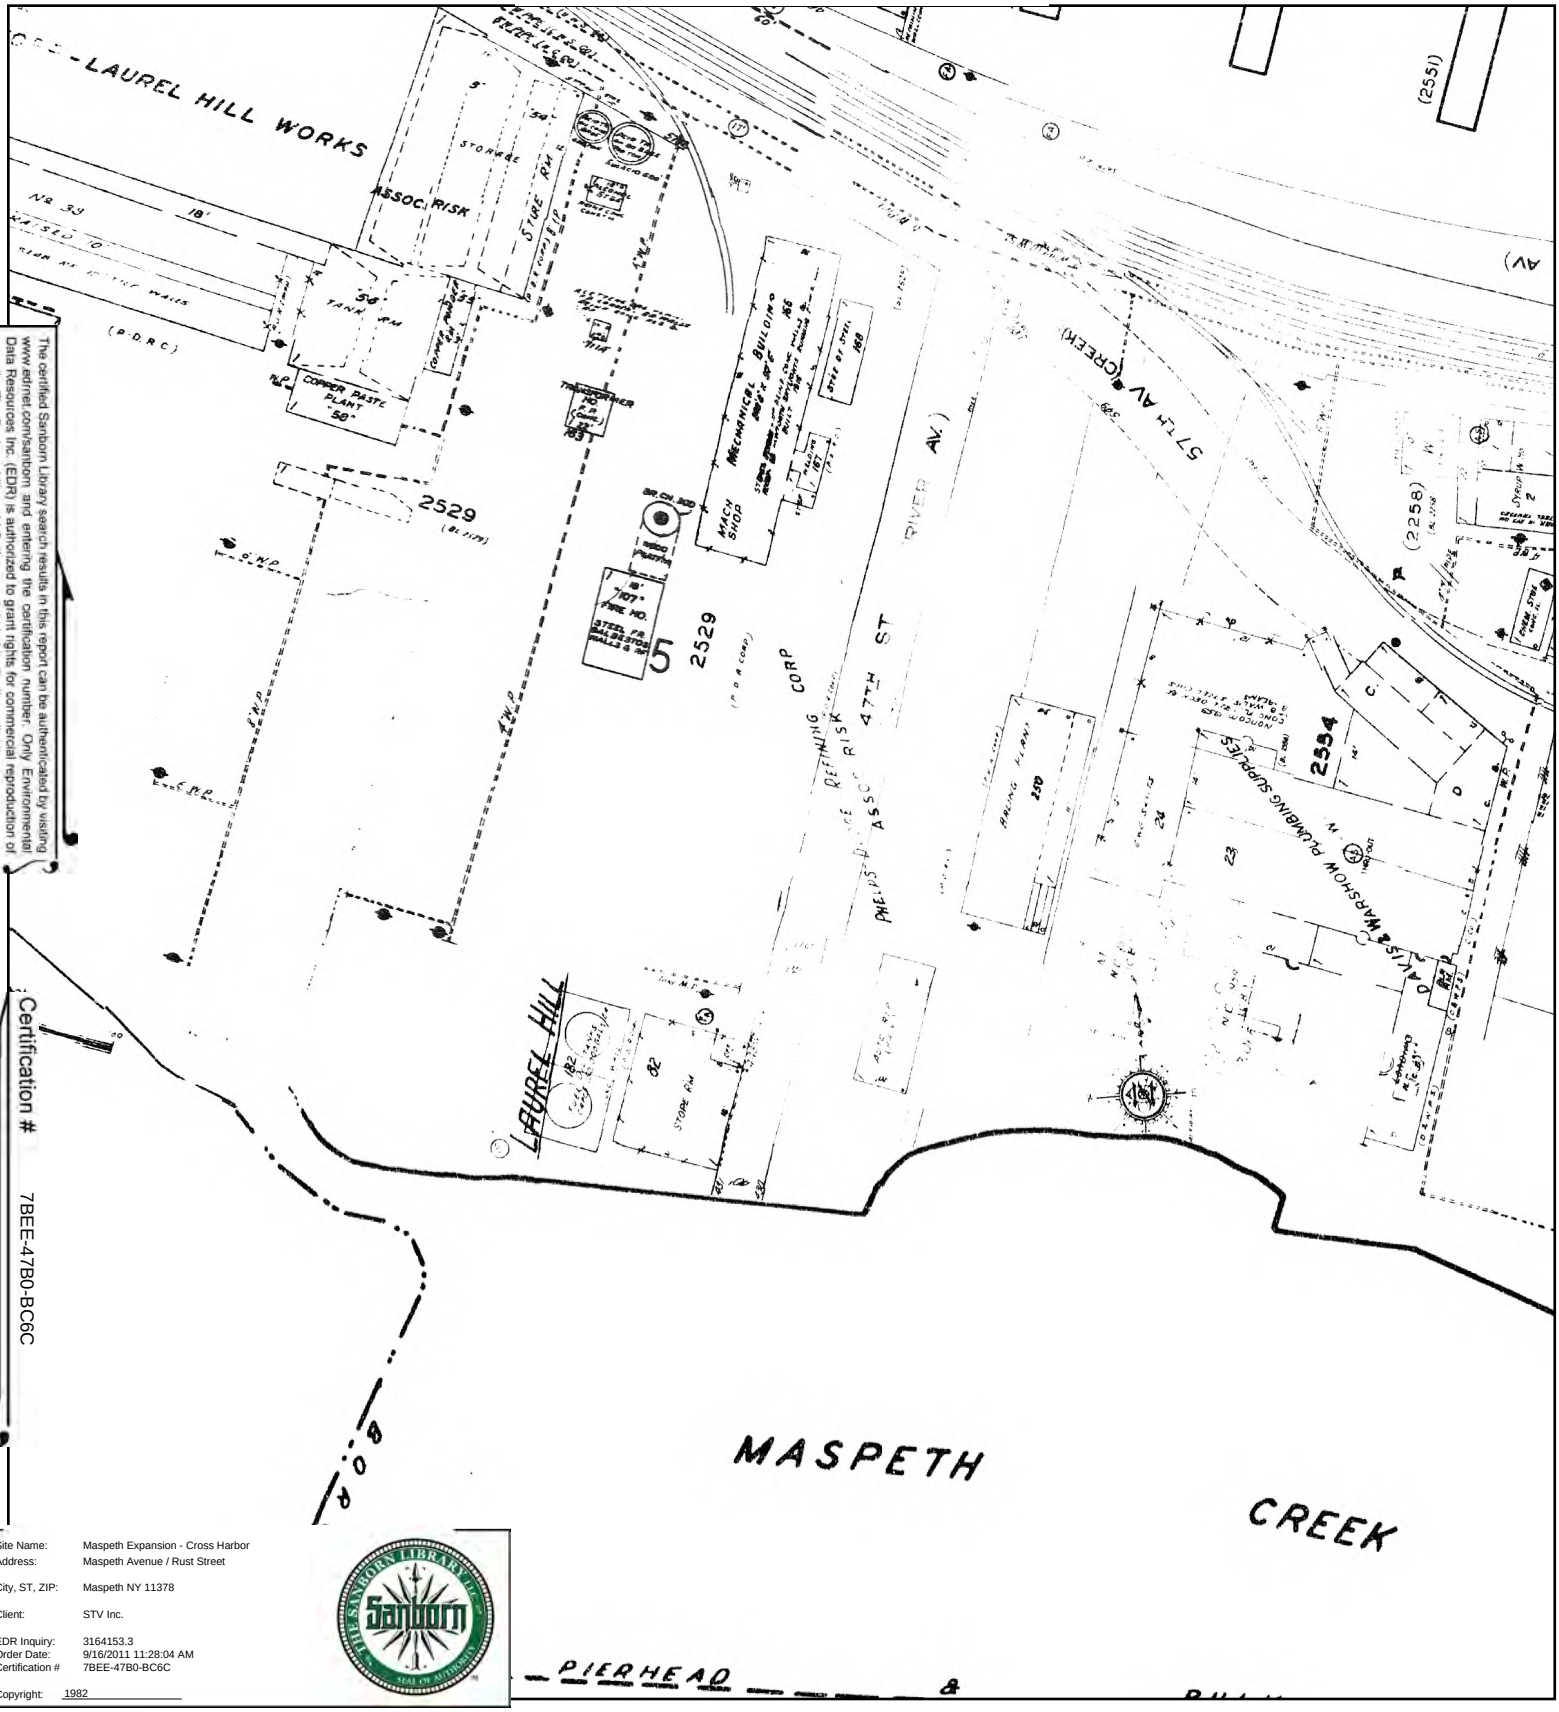

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1982

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

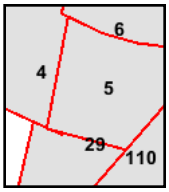

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1980 Certified Sanborn Map

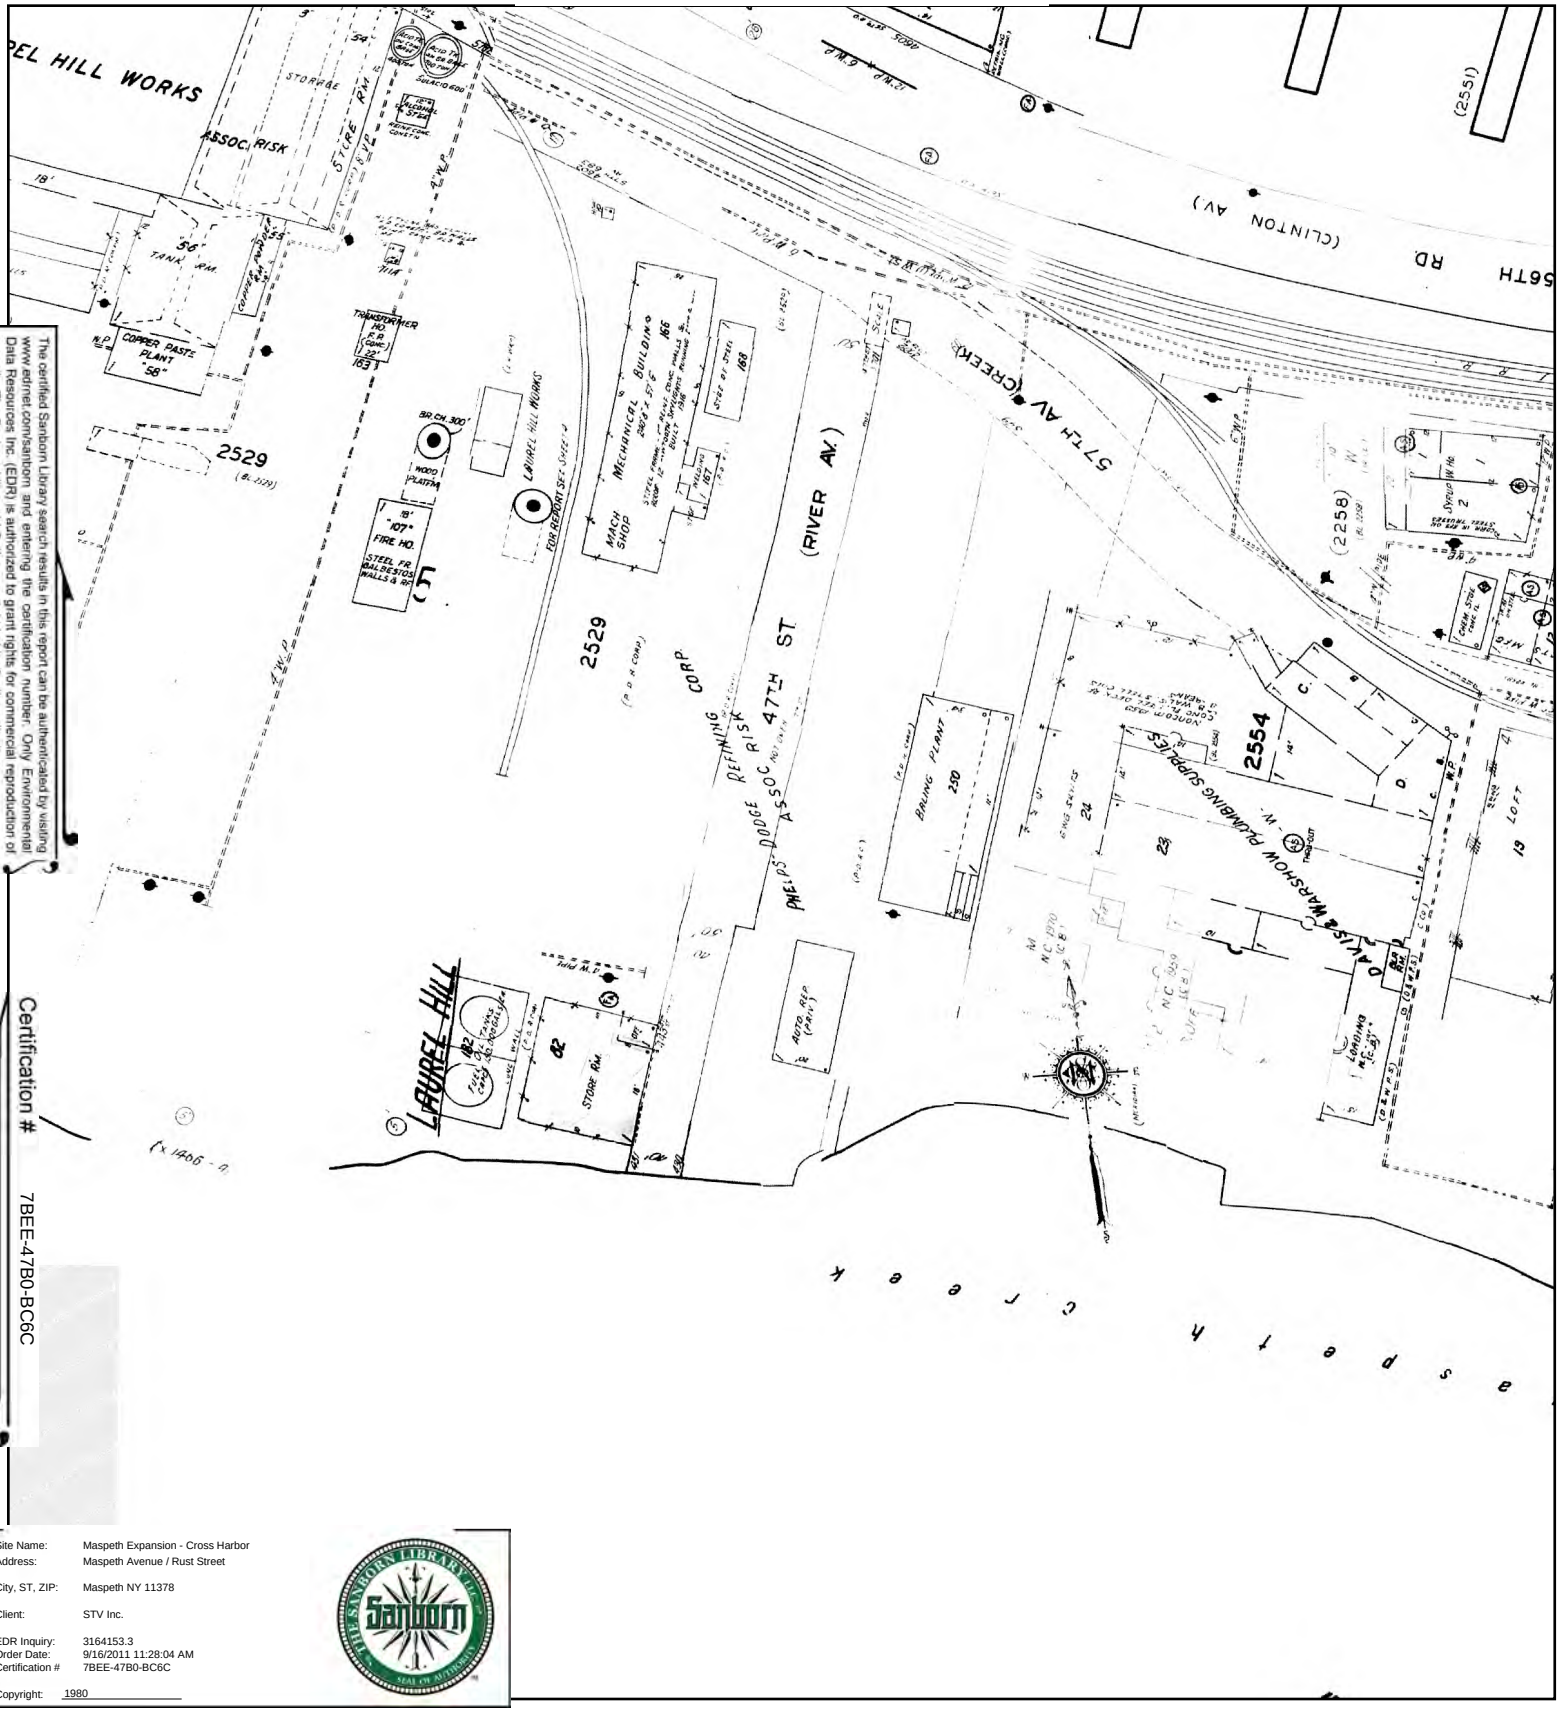

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1980

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

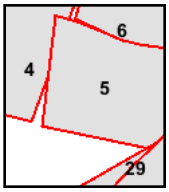

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6

0 Feet 165 330 660

N

Maspeth Expansion - Cross Harbor
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Inquiry Number: 3164153.3
September 16, 2011

Certified Sanborn® Map Report

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

9/16/11

Site Name:
Maspeth Expansion - Cross
Maspeth Avenue / Rust Street
Maspeth, NY 11378

Client Name:
STV Inc.
225 Park Ave S
New York, NY 10003

EDR Inquiry # 3164153.3

Contact: Doane E. Cafferty

The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by STV Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, State, Zip: Maspeth, NY 11378
Cross Street:
P.O. # 4014403
Project: Cross Harbor-Maspeth Expansion
Certification # 7BEE-47B0-BC6C

Maps Provided:

2006	1999	1991	1980
2005	1996	1990	1971
2004	1995	1988	1950
2003	1994	1986	1936
2002	1993	1985	1914
2001	1992	1982	

Sanborn® Library search results
Certification # 7BEE-47B0-BC6C

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ✓ Library of Congress
- ✓ University Publications of America
- ✓ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

STV Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

2006 Source Sheets

Volume 3, Sheet 4

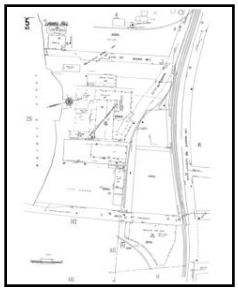
Volume 3, Sheet 5

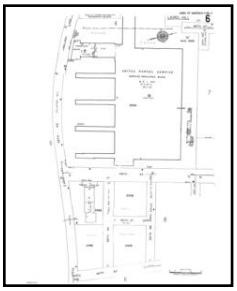
Volume 3, Sheet 6

Volume 3, Sheet 29

2005 Source Sheets

Volume 3, Sheet 4

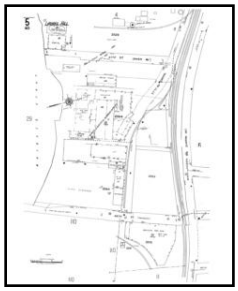
Volume 3, Sheet 5

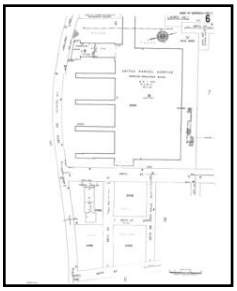
Volume 3, Sheet 6

Volume 3, Sheet 29

2004 Source Sheets

Volume 3, Sheet 4

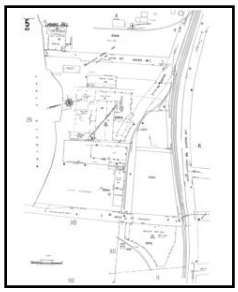
Volume 3, Sheet 5

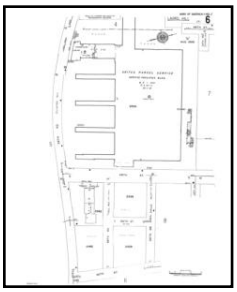
Volume 3, Sheet 6

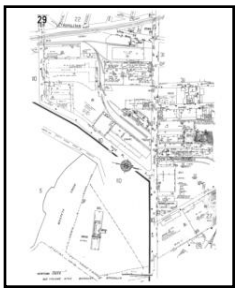
Volume 3, Sheet 29

2003 Source Sheets

Volume 3, Sheet 4

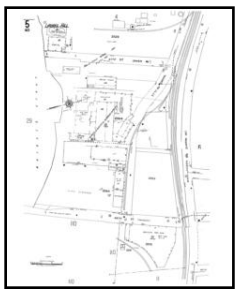
Volume 3, Sheet 5

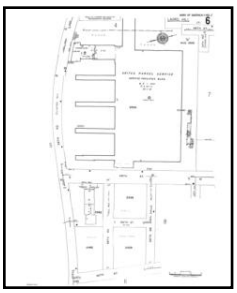
Volume 3, Sheet 6

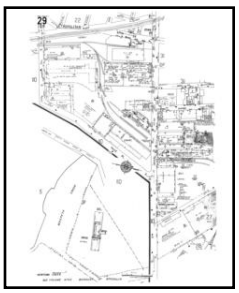
Volume 3, Sheet 29

2002 Source Sheets

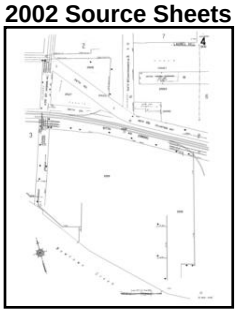

Volume 3, Sheet 4

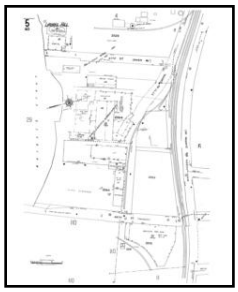

Volume 3, Sheet 5

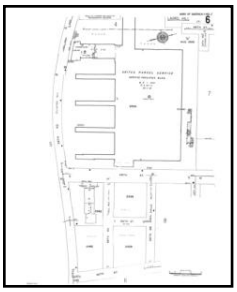

Volume 3, Sheet 6

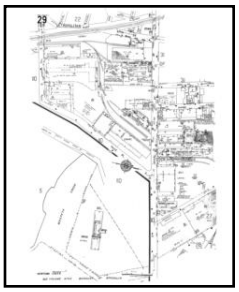

Volume 3, Sheet 29

2001 Source Sheets

Volume 3, Sheet 4

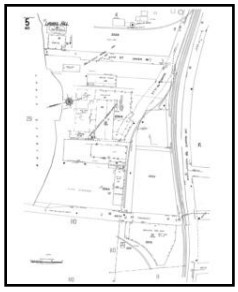

Volume 3, Sheet 5

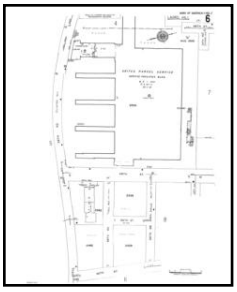

Volume 3, Sheet 6

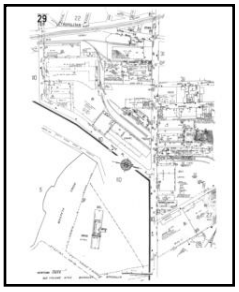

Volume 3, Sheet 29

1999 Source Sheets

Volume 3, Sheet 4

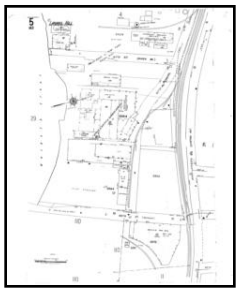

Volume 3, Sheet 5

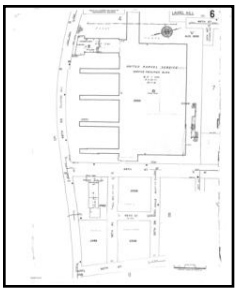

Volume 3, Sheet 6

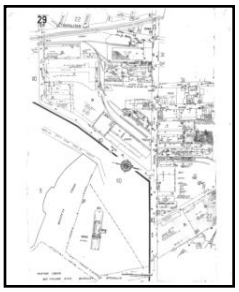

Volume 3, Sheet 29

1996 Source Sheets

Volume 3, Sheet 4

Volume 3, Sheet 5

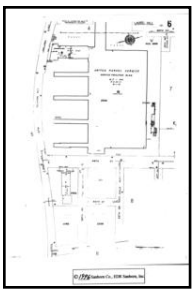

Volume 3, Sheet 6

Volume 3, Sheet 29

1995 Source Sheets

Volume 3, Sheet 4

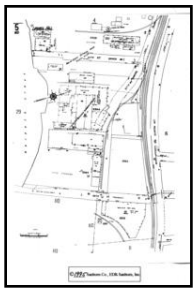

Volume 3, Sheet 5

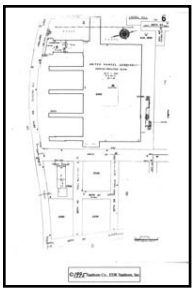

Volume 3, Sheet 6

Volume 3, Sheet 29

1994 Source Sheets

Volume 3, Sheet 4

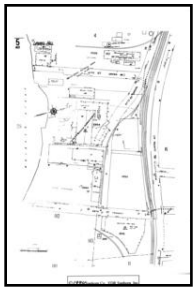

Volume 3, Sheet 5

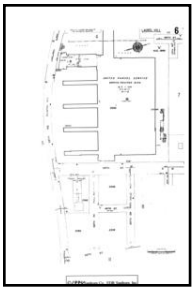

Volume 3, Sheet 6

Volume 3, Sheet 29

1993 Source Sheets

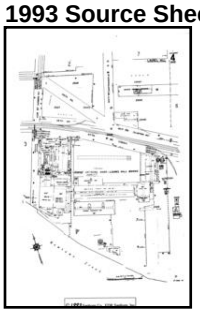

Volume 3, Sheet 4

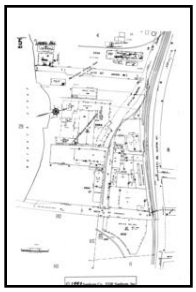

Volume 3, Sheet 5

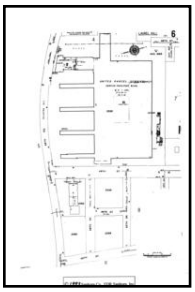

Volume 3, Sheet 6

Volume 3, Sheet 29

1992 Source Sheets

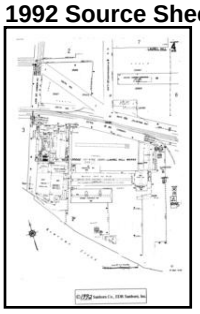

Volume 3, Sheet 4

Volume 3, Sheet 5

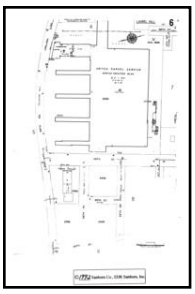

Volume 3, Sheet 6

Volume 3, Sheet 29

1991 Source Sheets

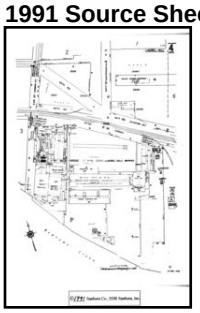

Volume 3, Sheet 4

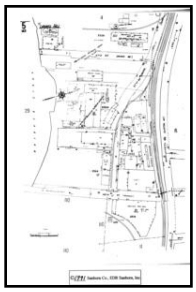

Volume 3, Sheet 5

Volume 3, Sheet 29

1990 Source Sheets

Volume 3, Sheet 4

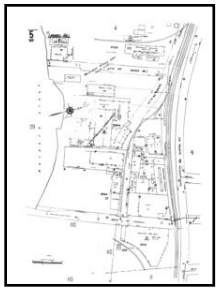

Volume 3, Sheet 5

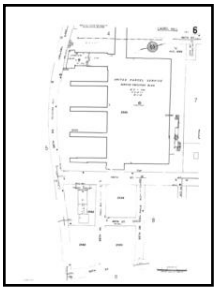

Volume 3, Sheet 6

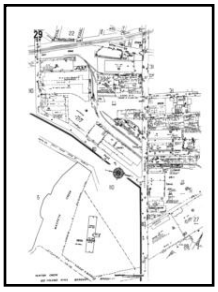

Volume 3, Sheet 29

1988 Source Sheets

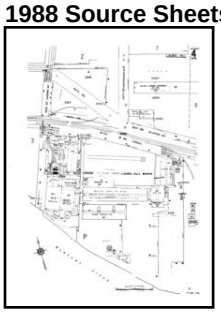

Volume 3, Sheet 4

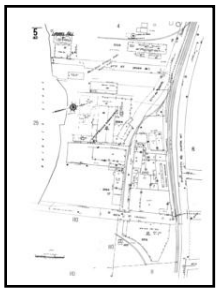

Volume 3, Sheet 5

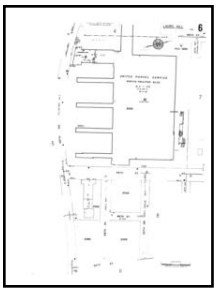

Volume 3, Sheet 6

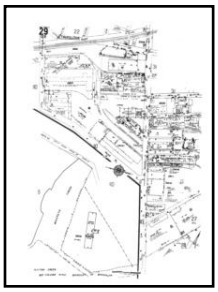

Volume 3, Sheet 29

1986 Source Sheets

Volume 3, Sheet 4

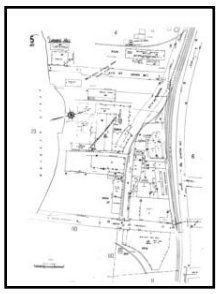

Volume 3, Sheet 5

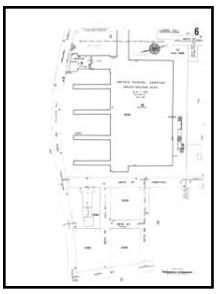

Volume 3, Sheet 6

Volume 3, Sheet 29

1985 Source Sheets

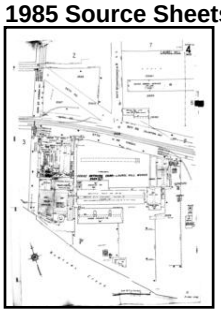

Volume 3, Sheet 4

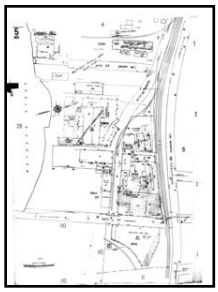

Volume 3, Sheet 5

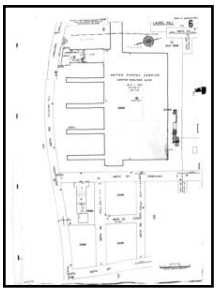

Volume 3, Sheet 6

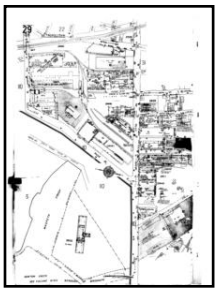

Volume 3, Sheet 29

1982 Source Sheets

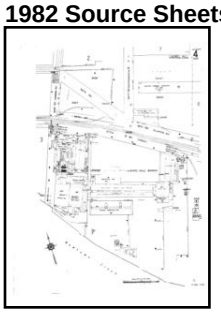

Volume 3, Sheet 4

Volume 3, Sheet 5

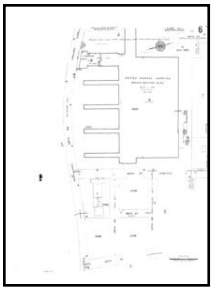

Volume 3, Sheet 6

Volume 3, Sheet 29

1980 Source Sheets

Volume 3, Sheet 4

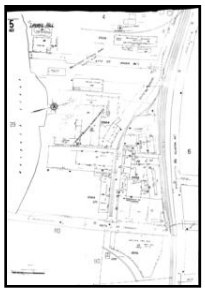

Volume 3, Sheet 5

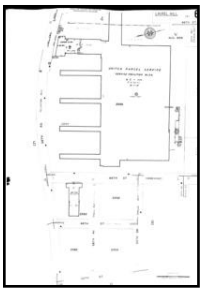

Volume 3, Sheet 6

1971 Source Sheets

Volume 3, Sheet 4

Volume 3, Sheet 5

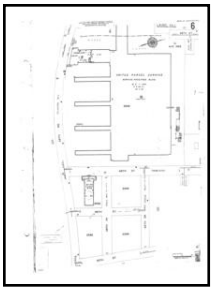

Volume 3, Sheet 6

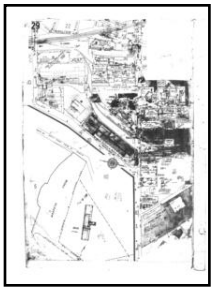

Volume 3, Sheet 29

1950 Source Sheets

Volume 3, Sheet 4

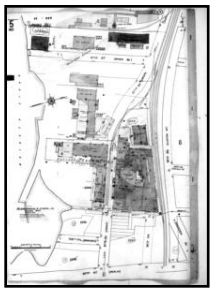

Volume 3, Sheet 5

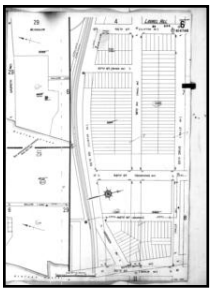

Volume 3, Sheet 6

1936 Source Sheets

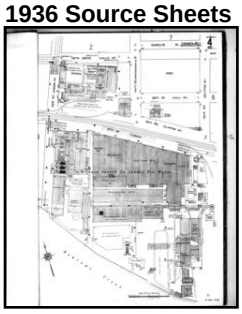

Volume 3, Sheet 4

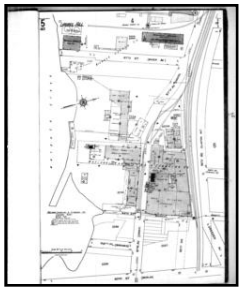

Volume 3, Sheet 5

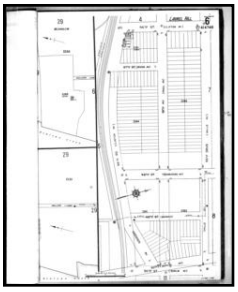

Volume 3, Sheet 6

1914 Source Sheets

Volume 3, Sheet 4

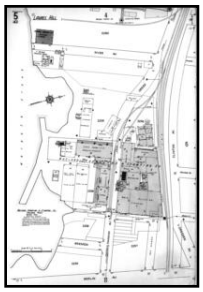

Volume 3, Sheet 5

Volume 3, Sheet 6

2006 Certified Sanborn Map

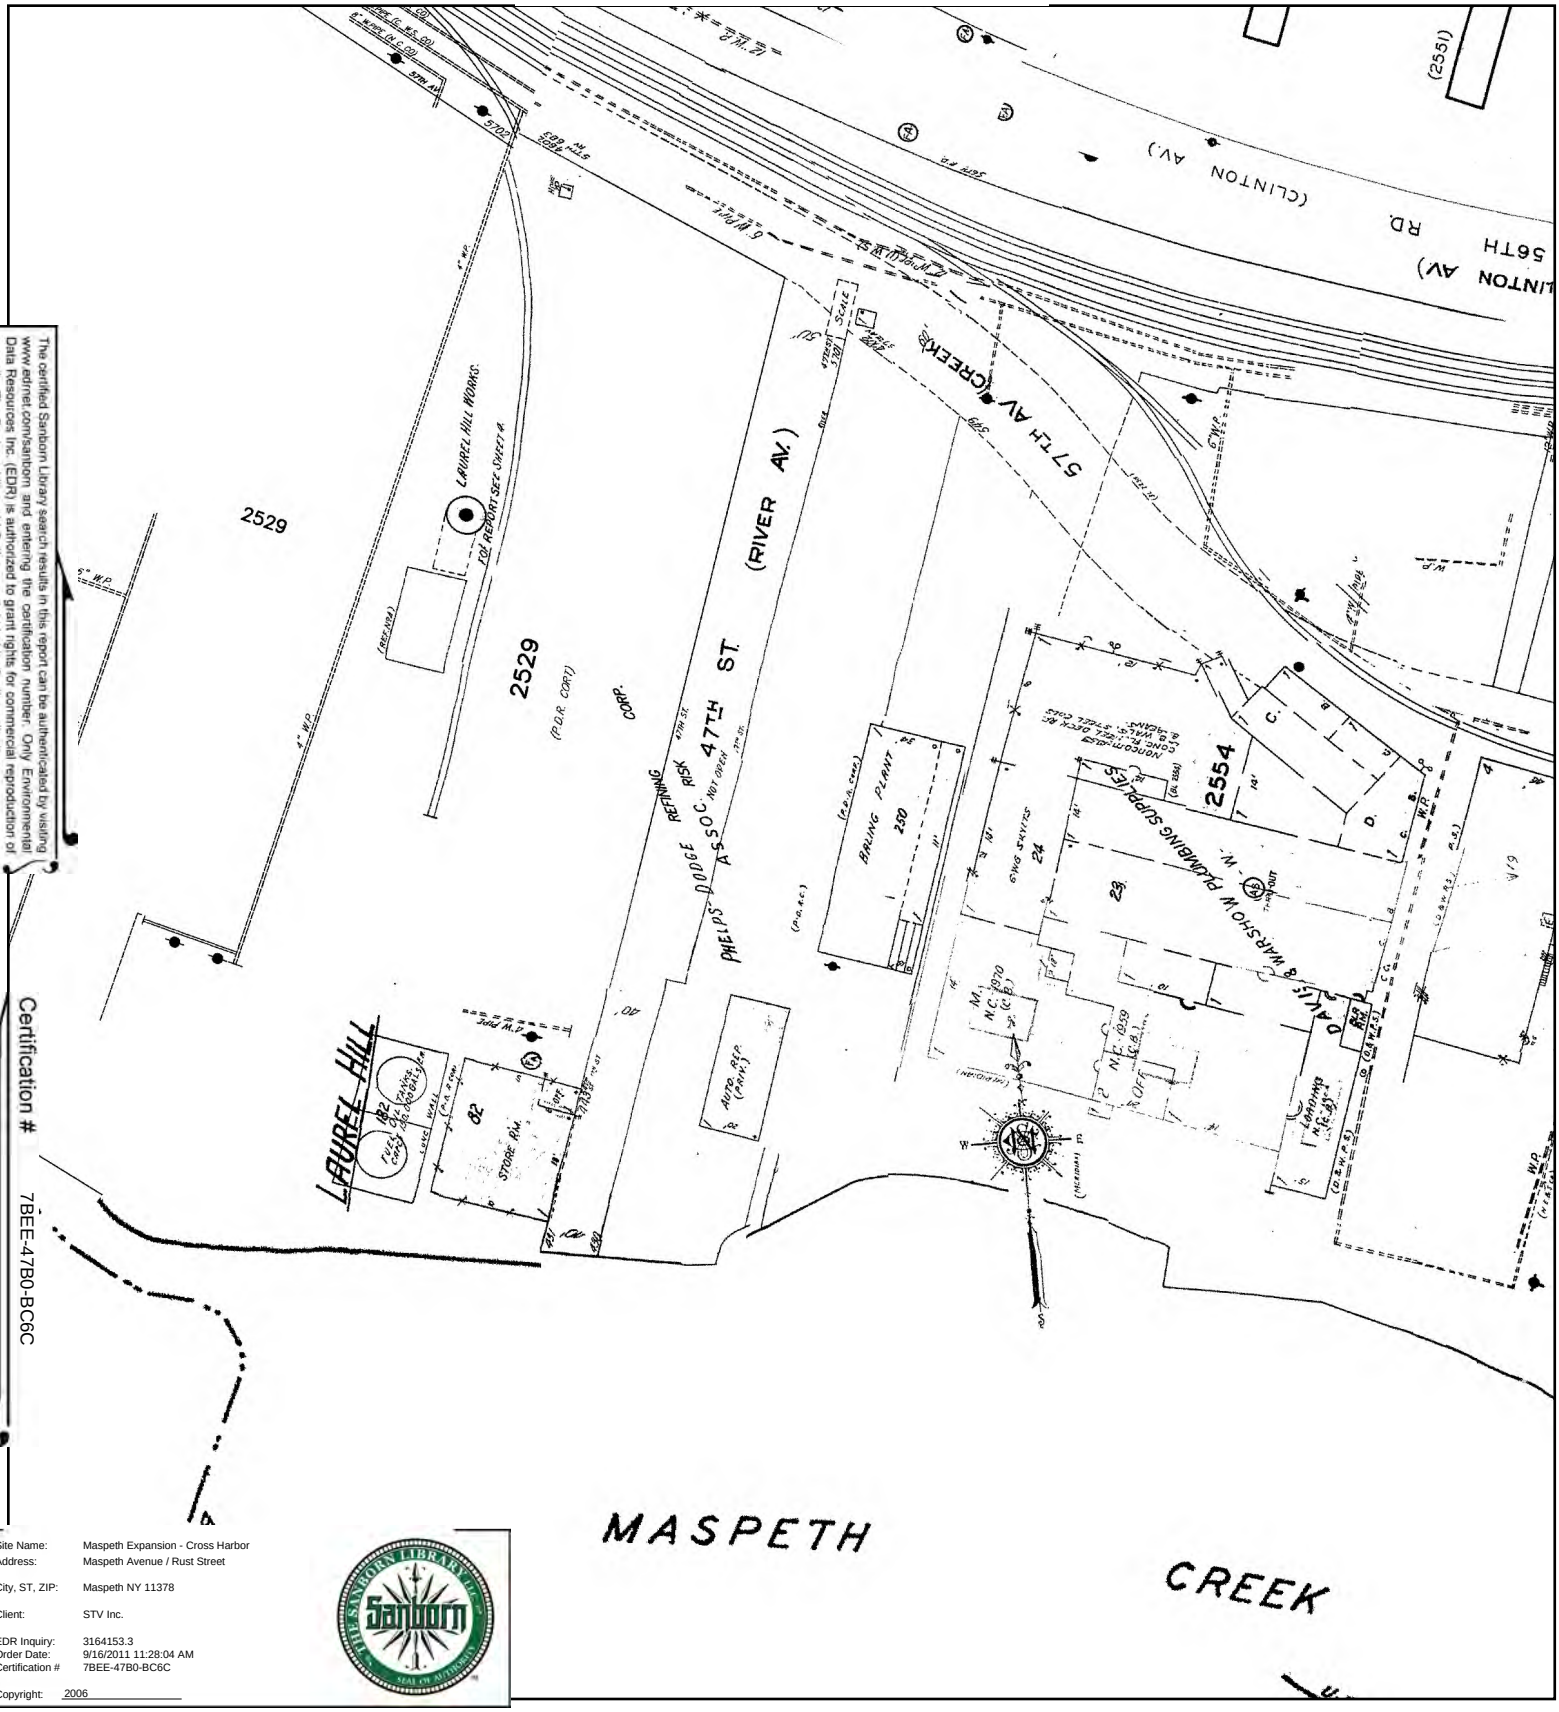

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 2006

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

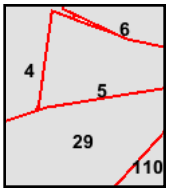

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

2005 Certified Sanborn Map

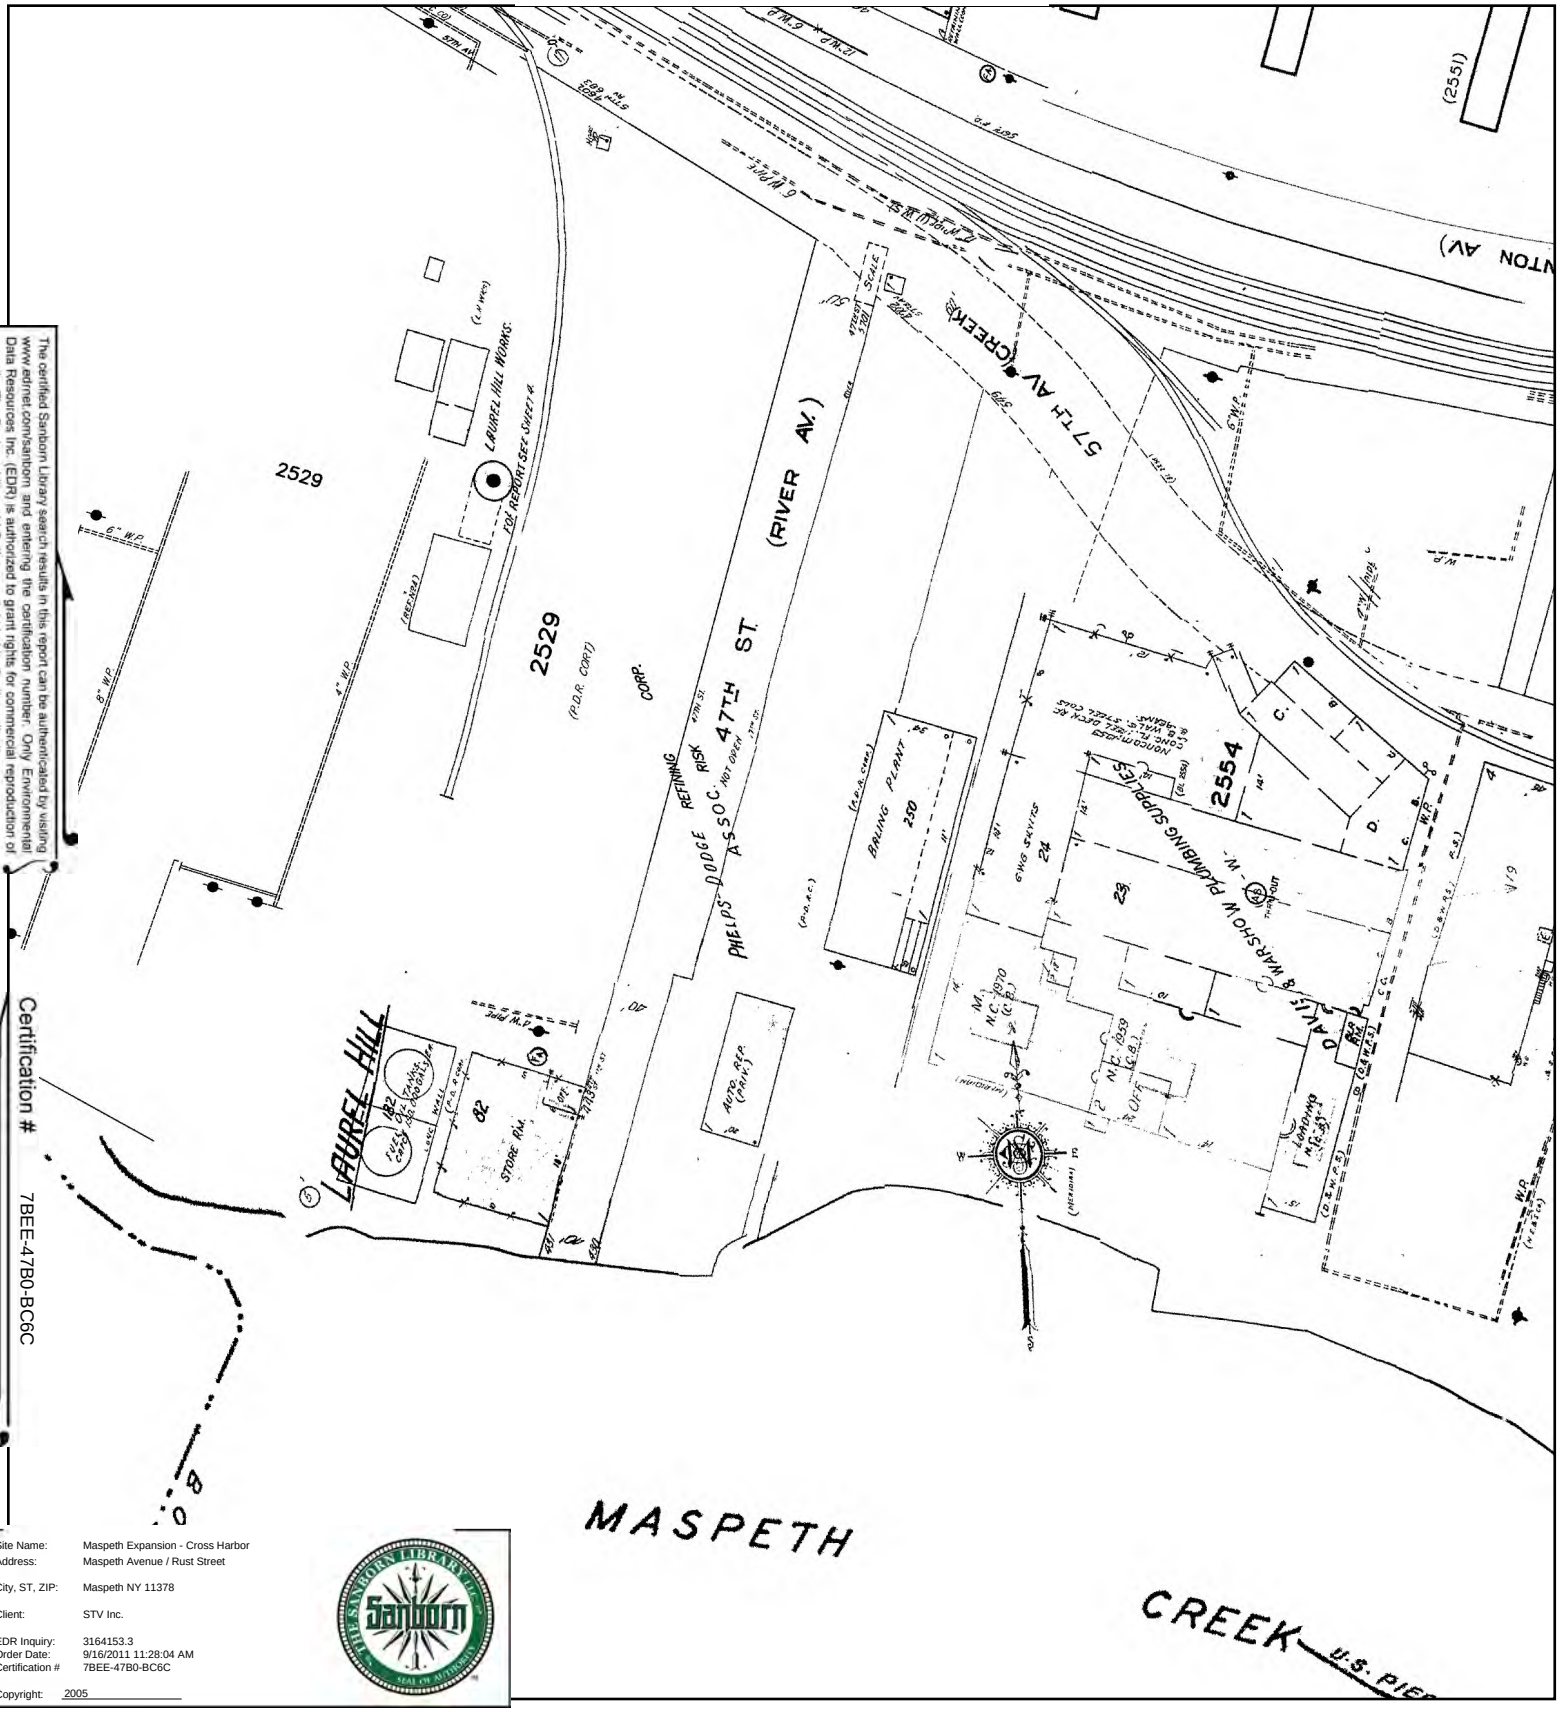

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2005

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

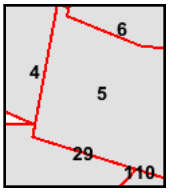

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

2004 Certified Sanborn Map

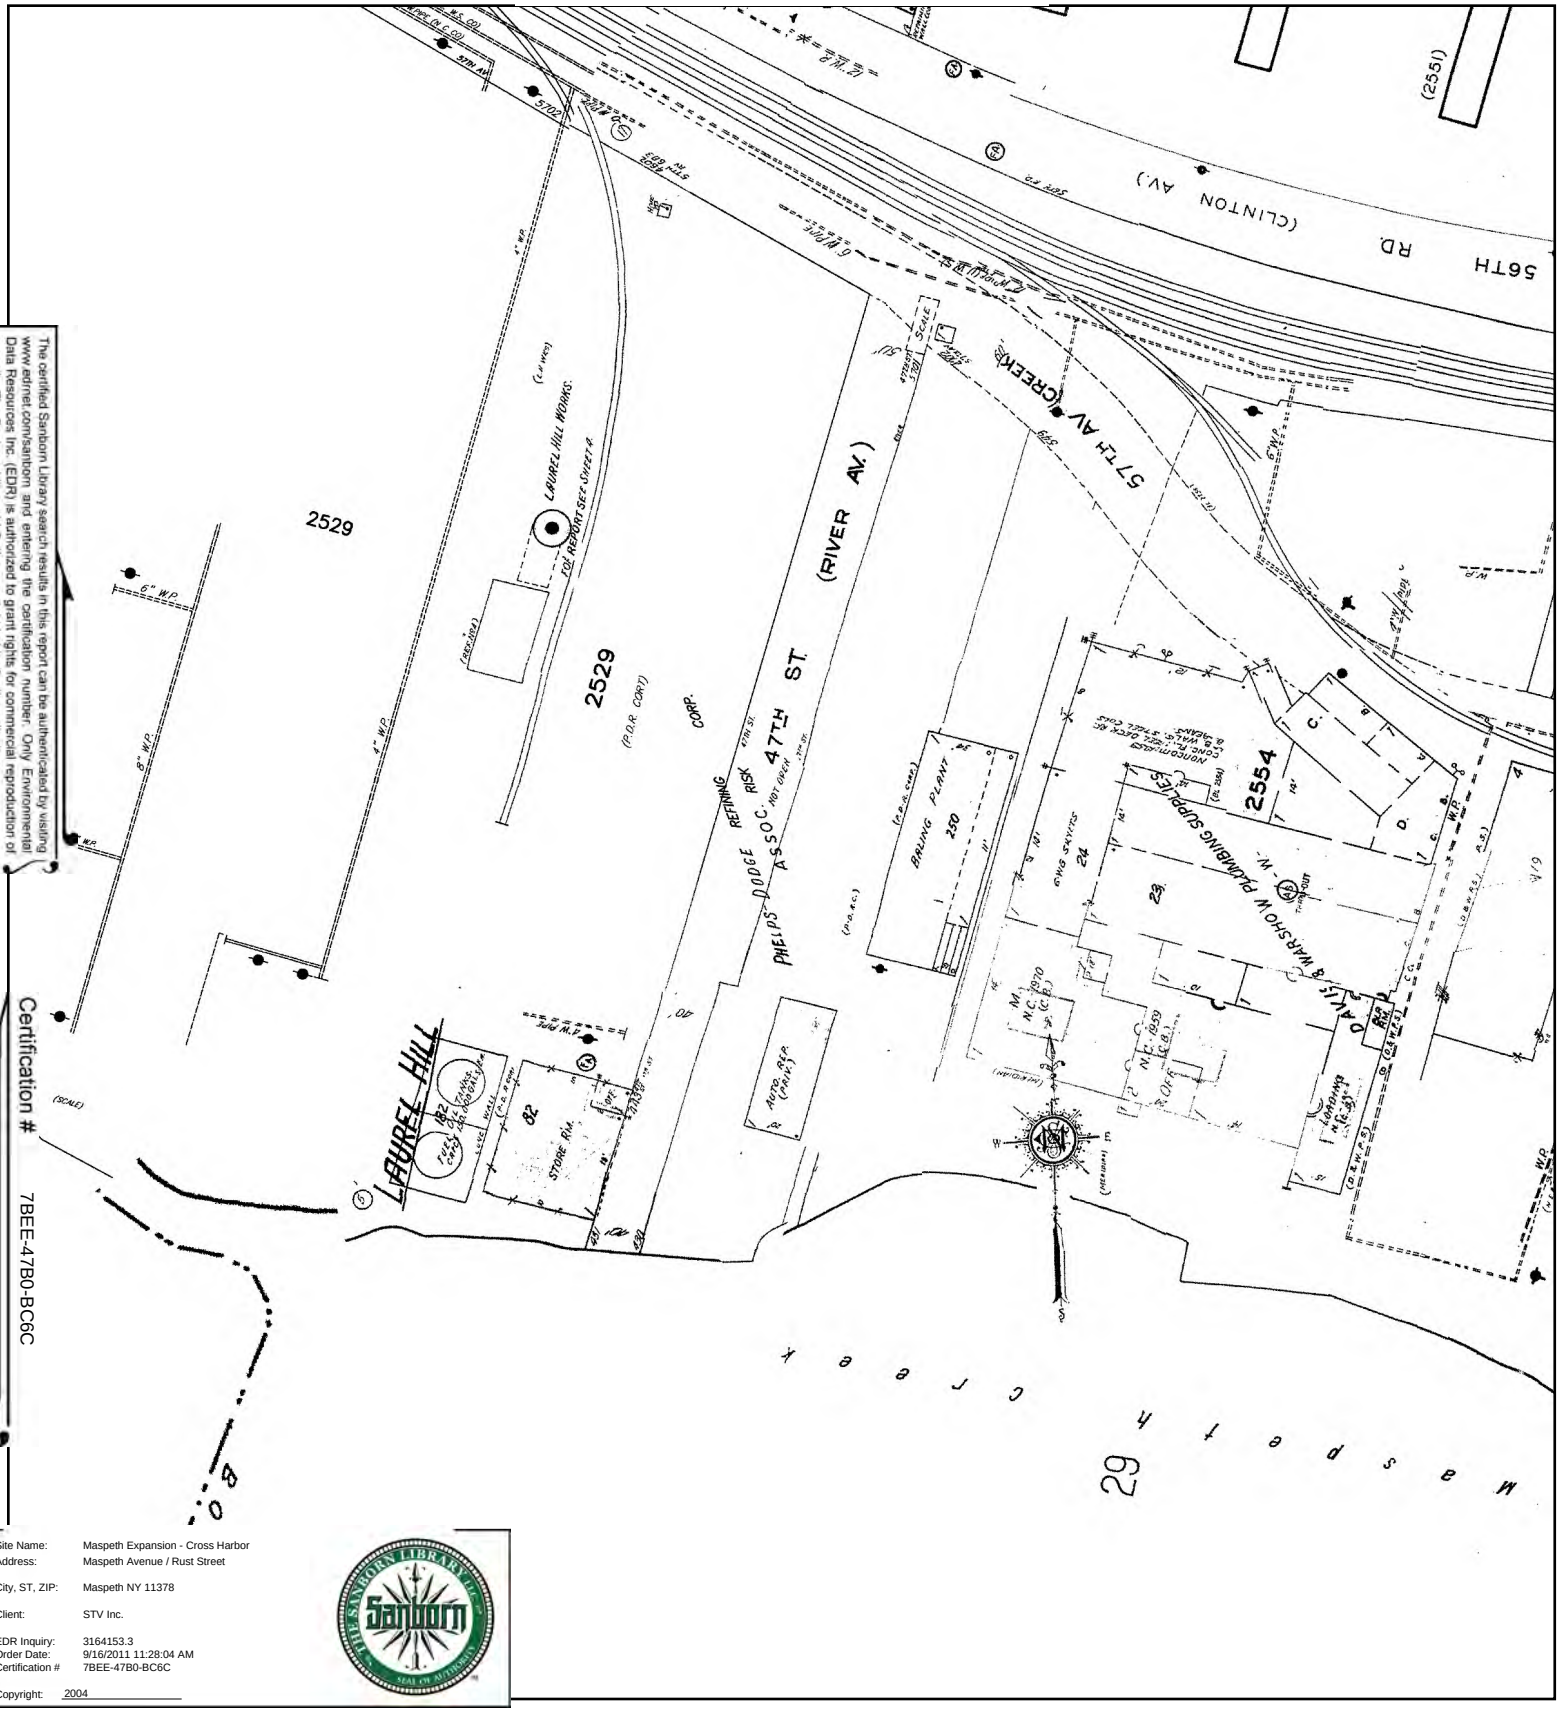

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2004

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

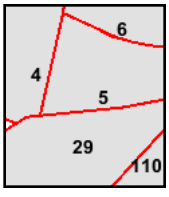

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

2003 Certified Sanborn Map

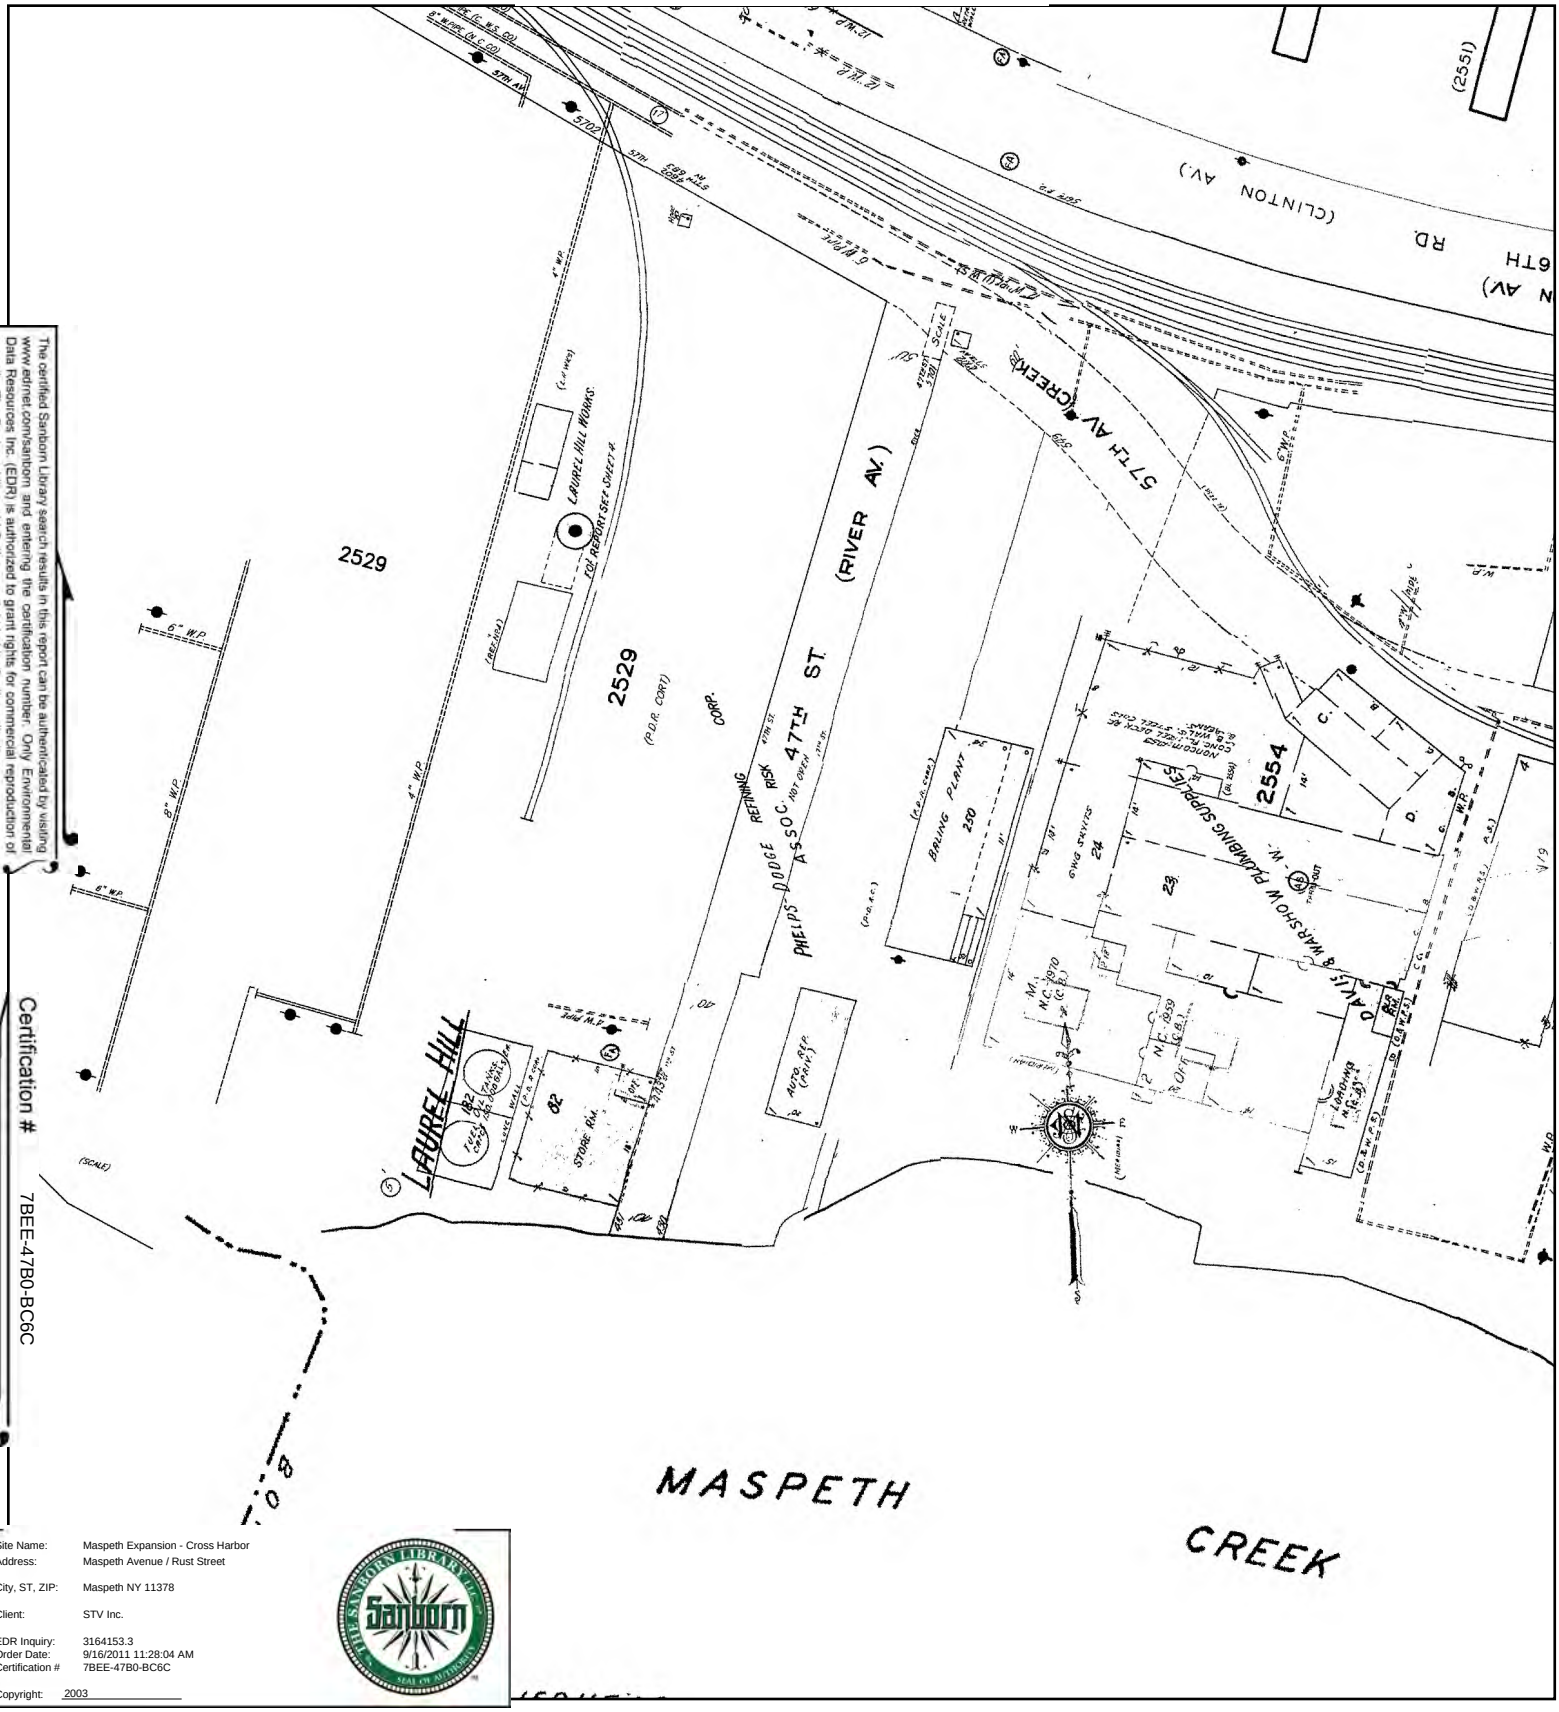

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	2003

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

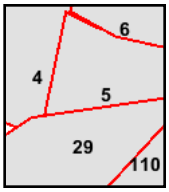

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

2002 Certified Sanborn Map

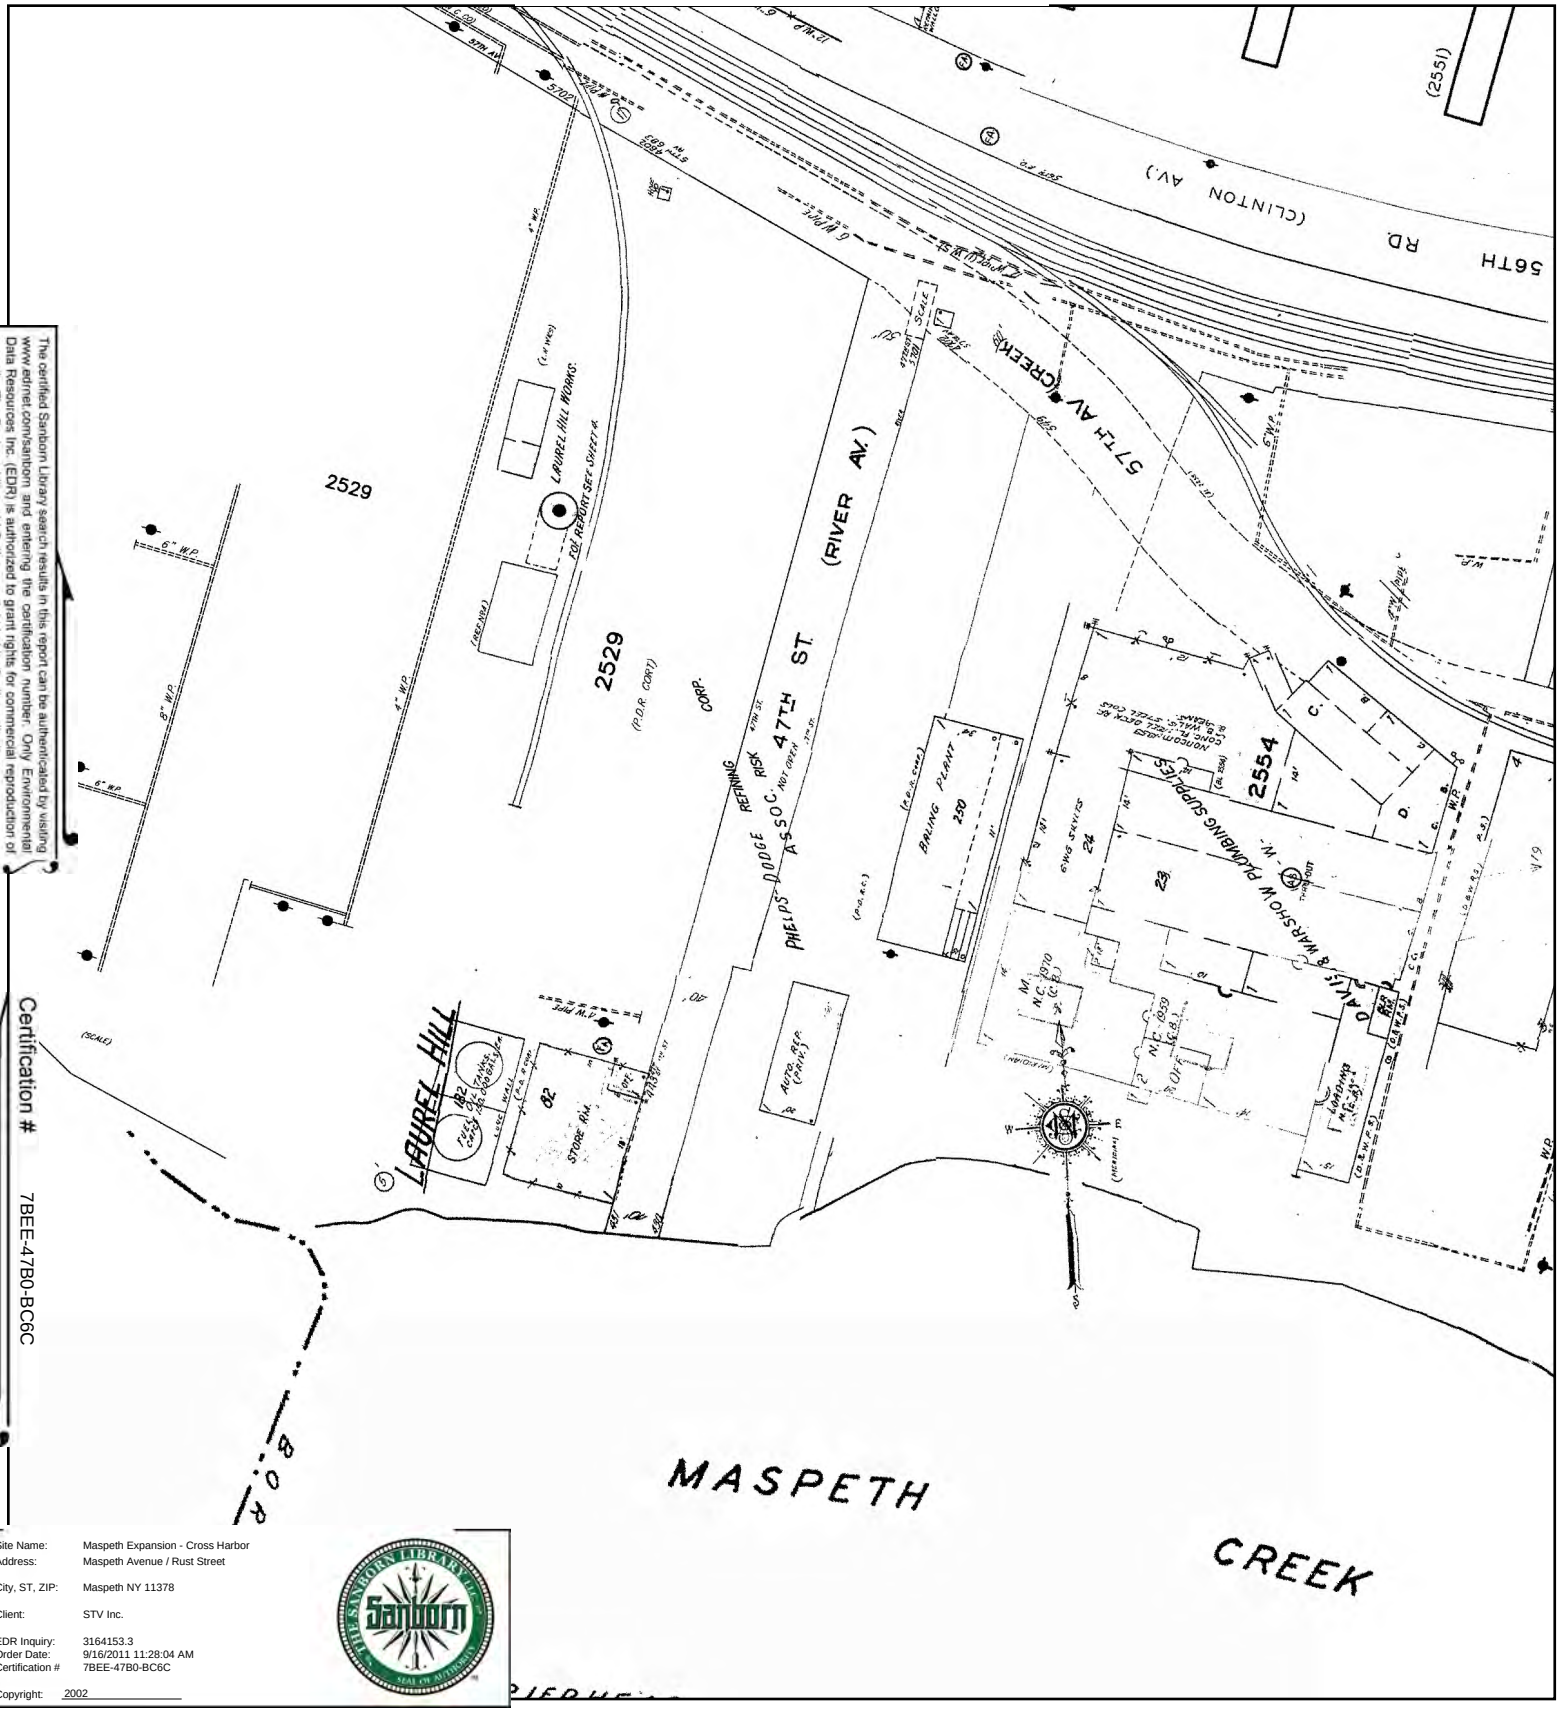

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 2002

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

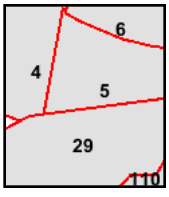

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

2001 Certified Sanborn Map

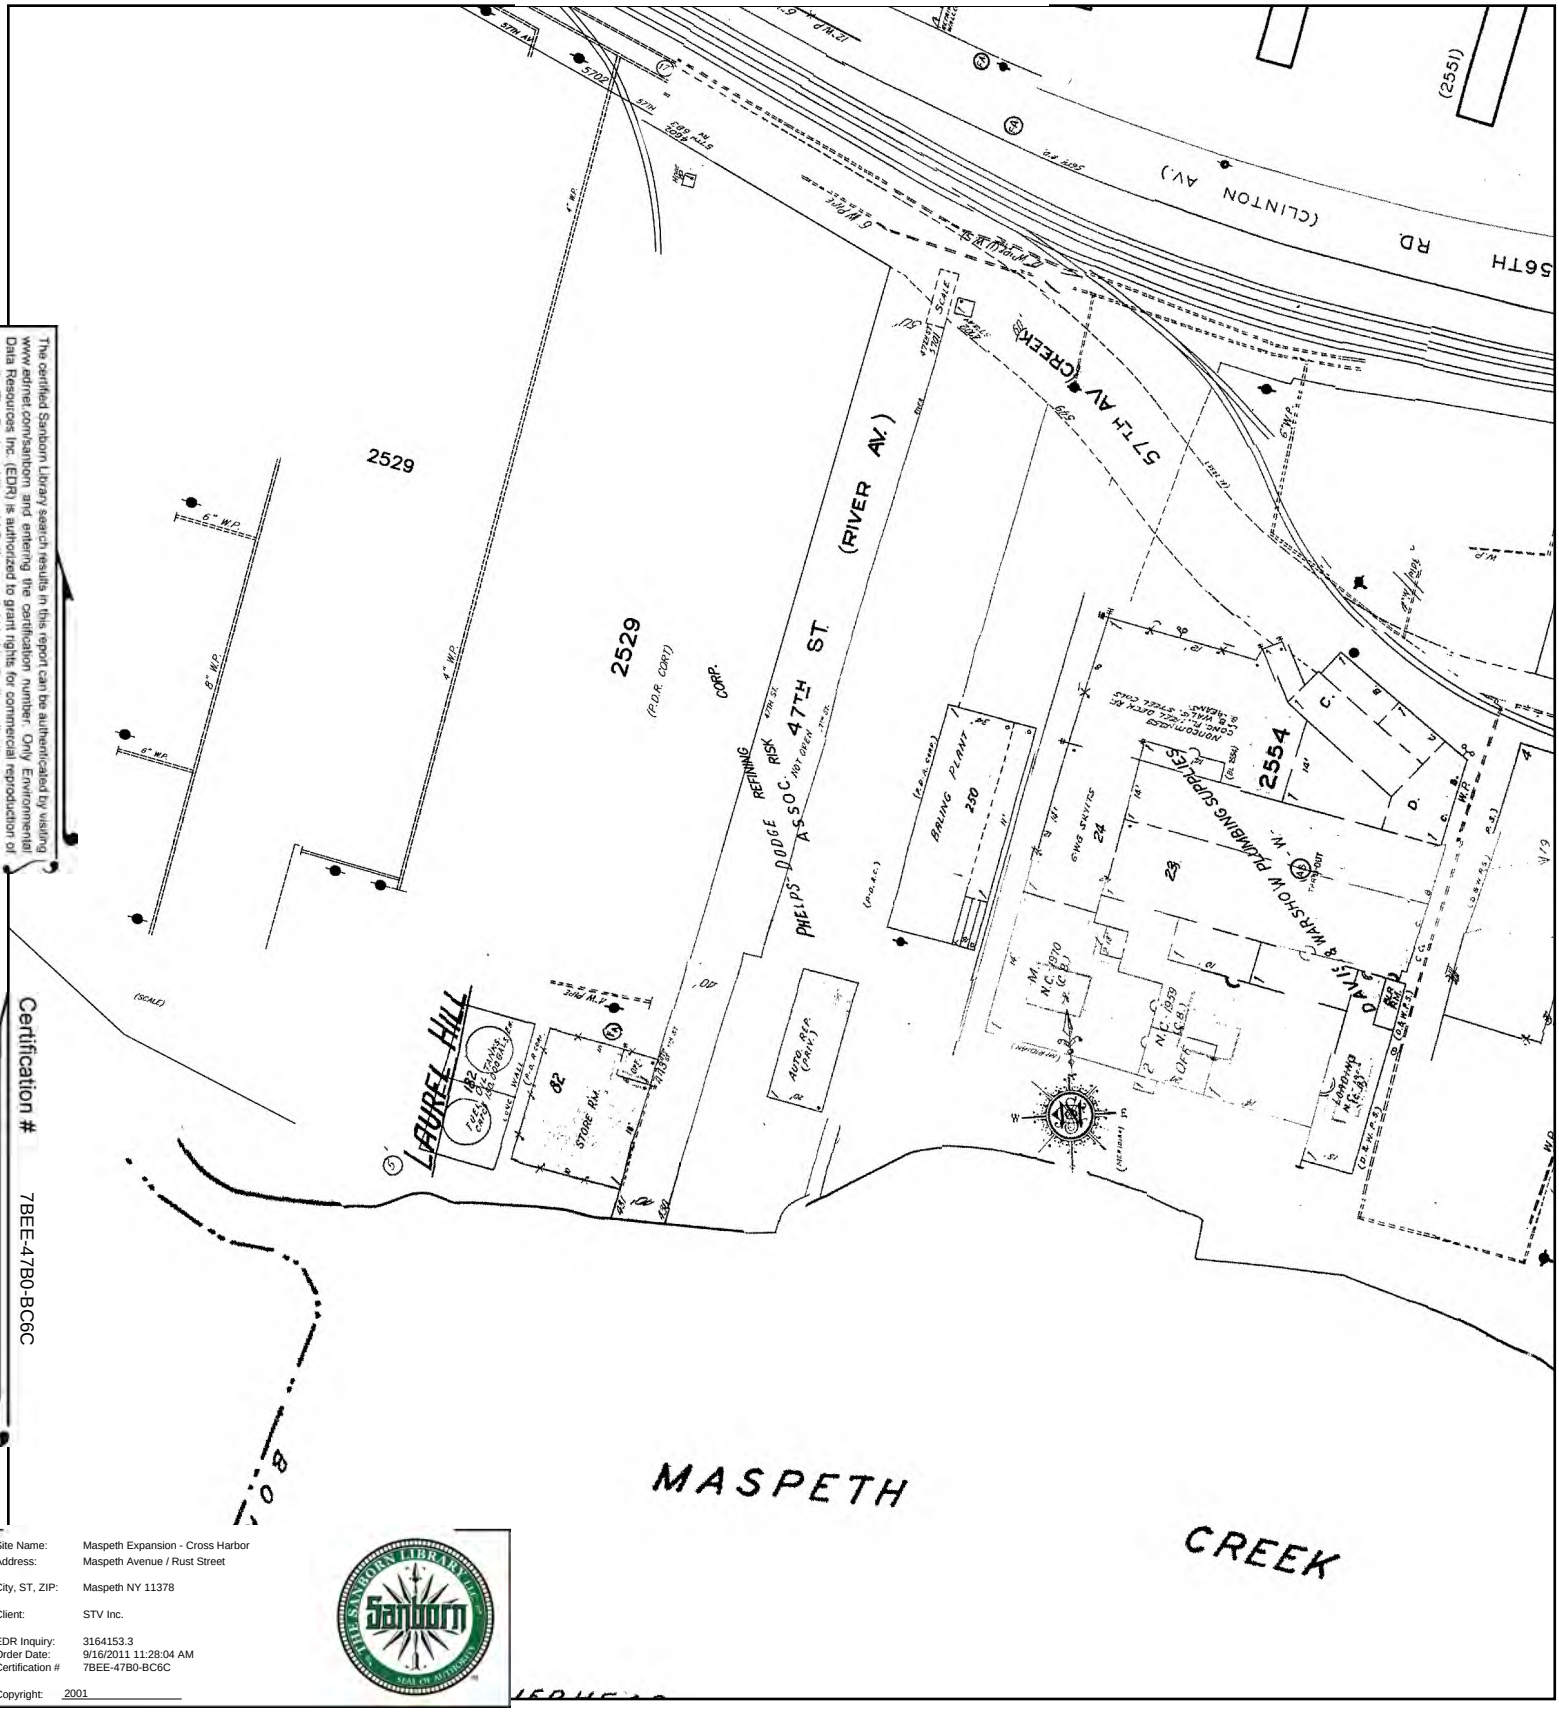

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 2001

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 165 330 660

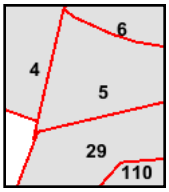

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

N

1999 Certified Sanborn Map

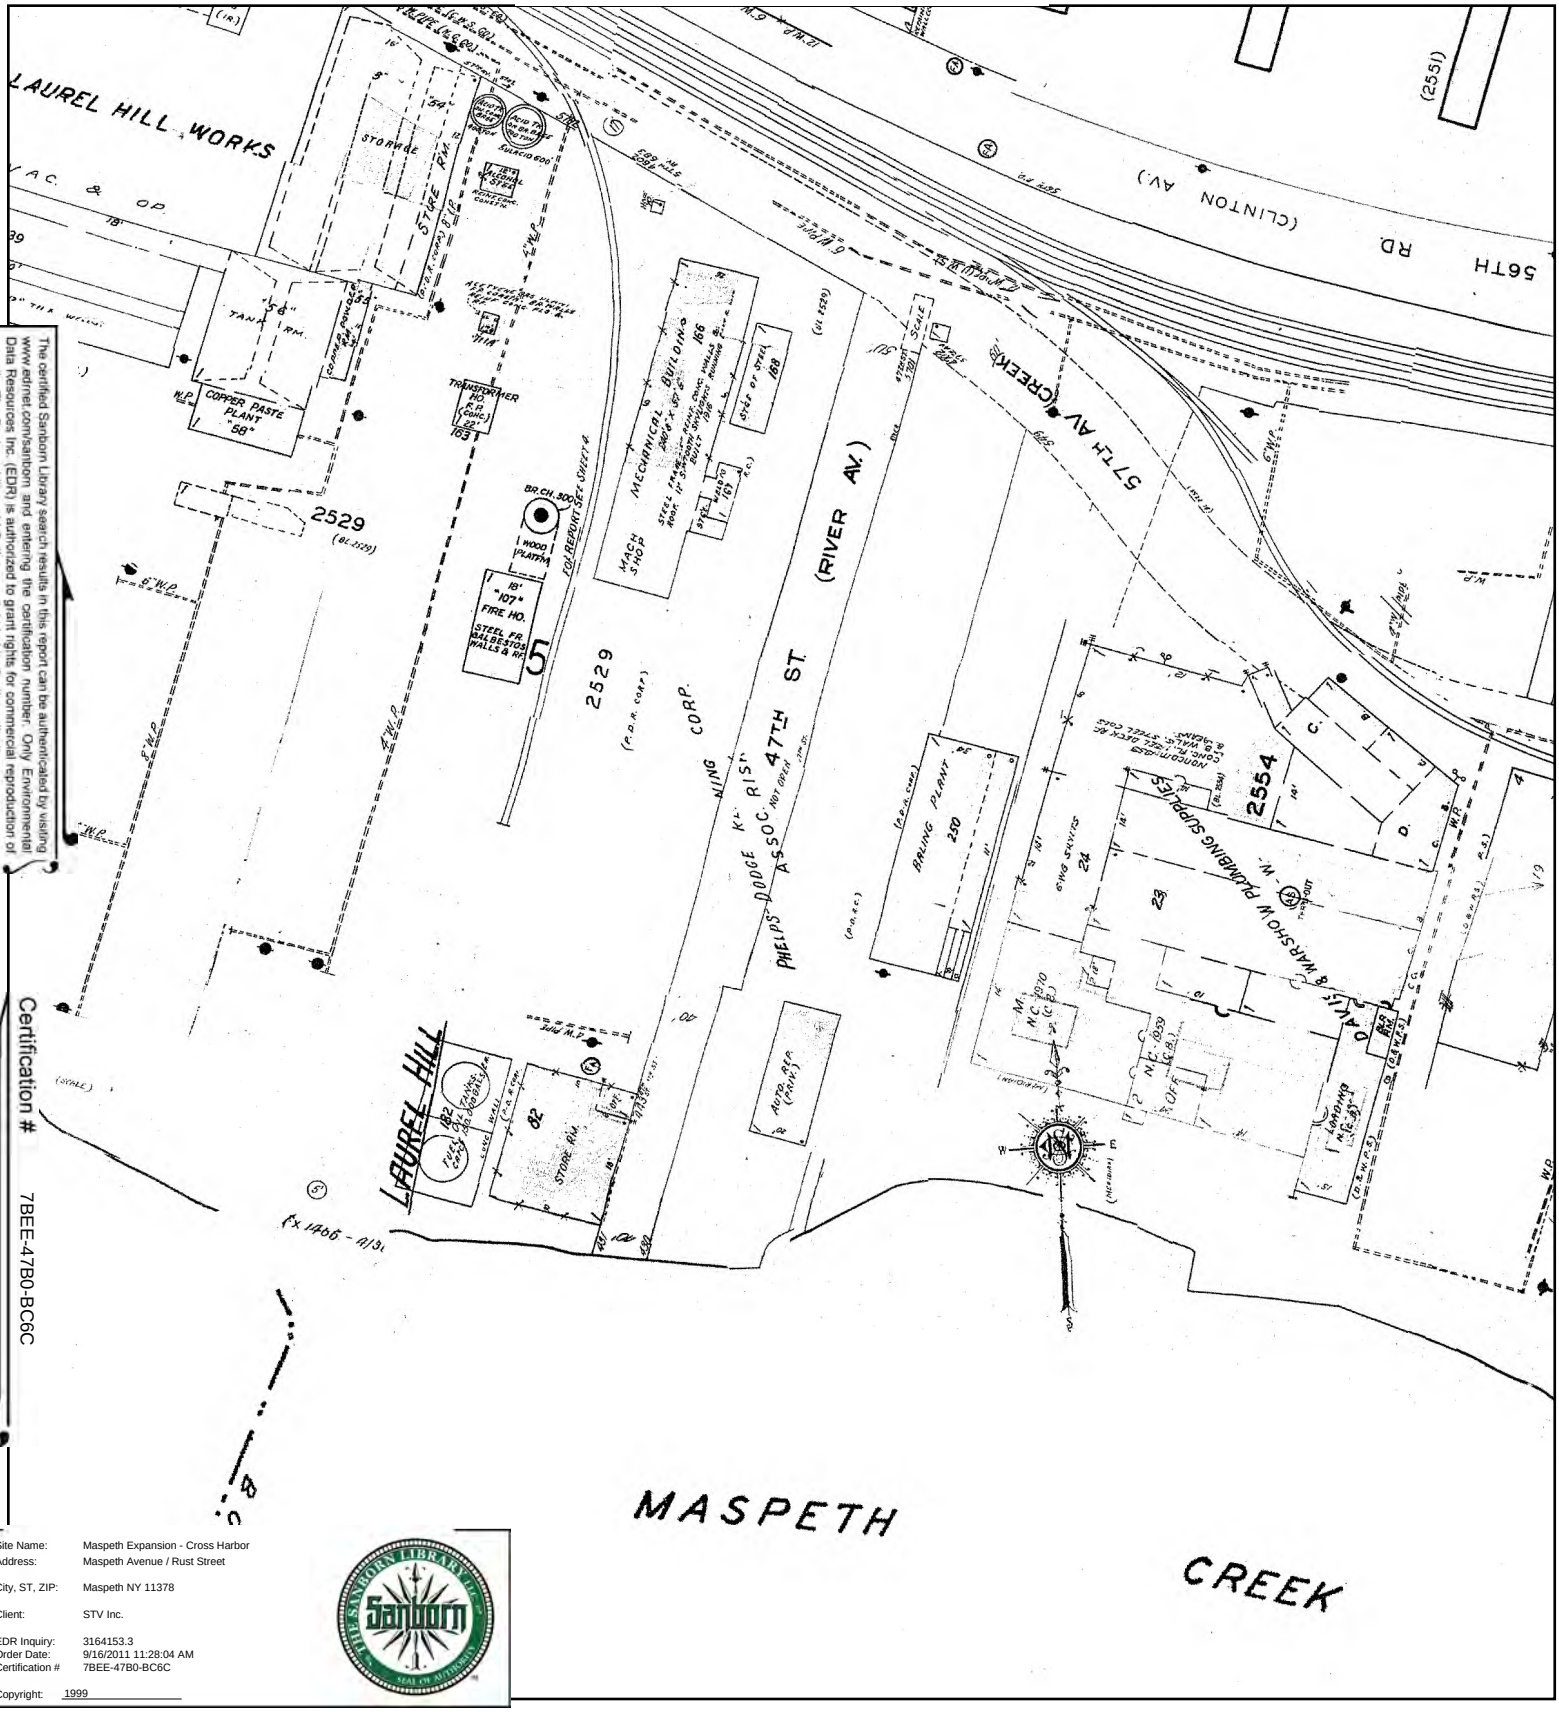

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1999

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

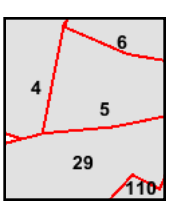

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1996 Certified Sanborn Map

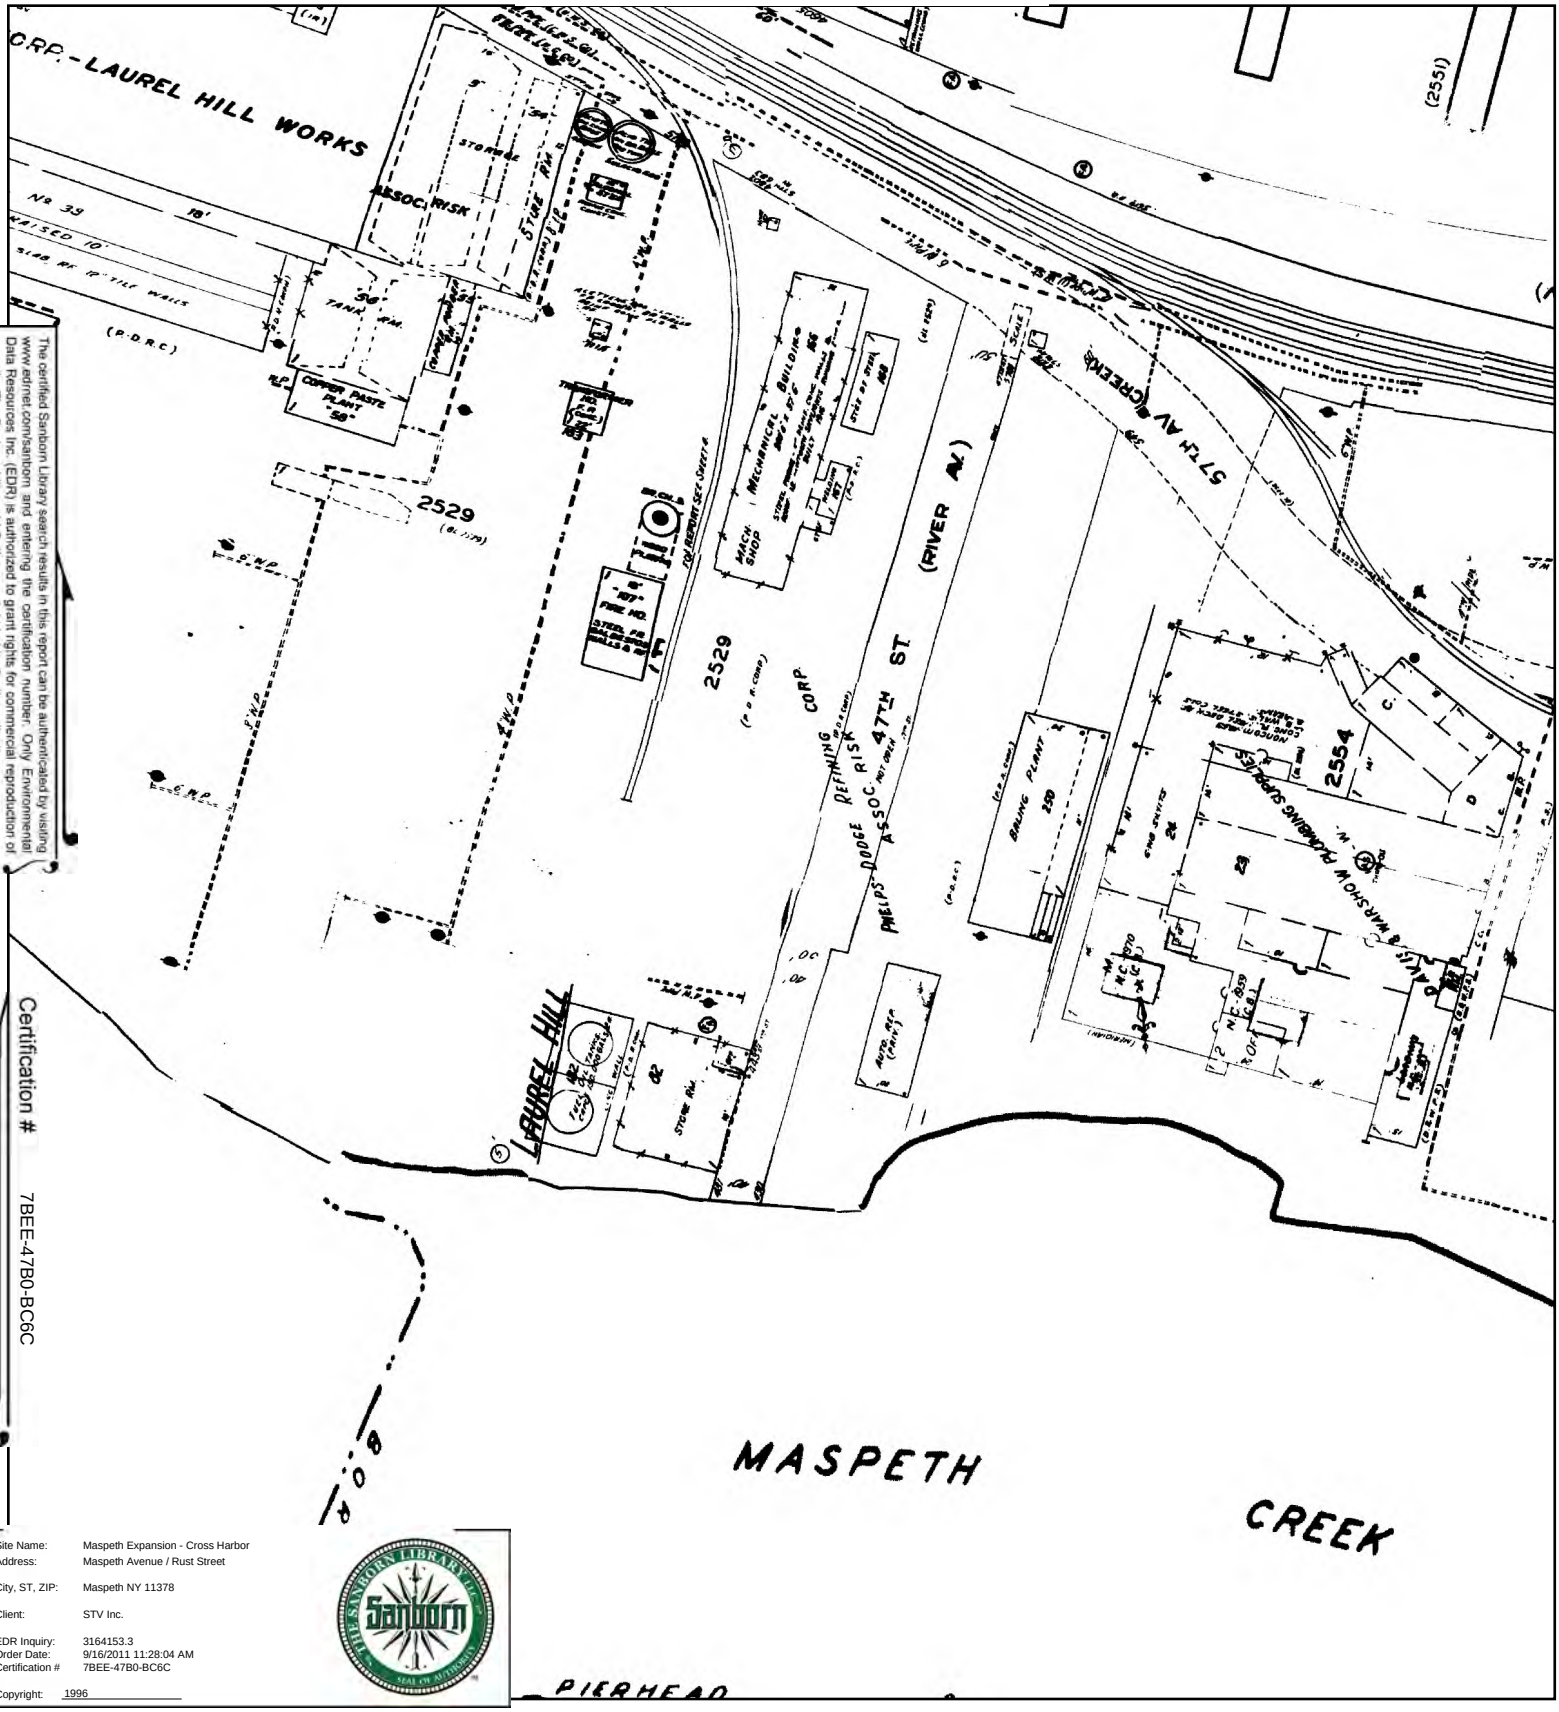

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1996

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

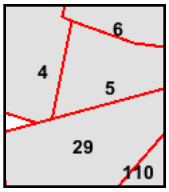

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1995 Certified Sanborn Map

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name: Maspeth Expansion - Cross Harbor
Address: Maspeth Avenue / Rust Street
City, ST, ZIP: Maspeth NY 11378
Client: STV Inc.
EDR Inquiry: 3164153.3
Order Date: 9/16/2011 11:28:04 AM
Certification # 7BEE-47B0-BC6C
Copyright: 1995

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

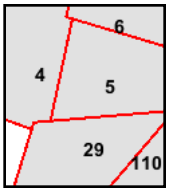

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N

1994 Certified Sanborn Map

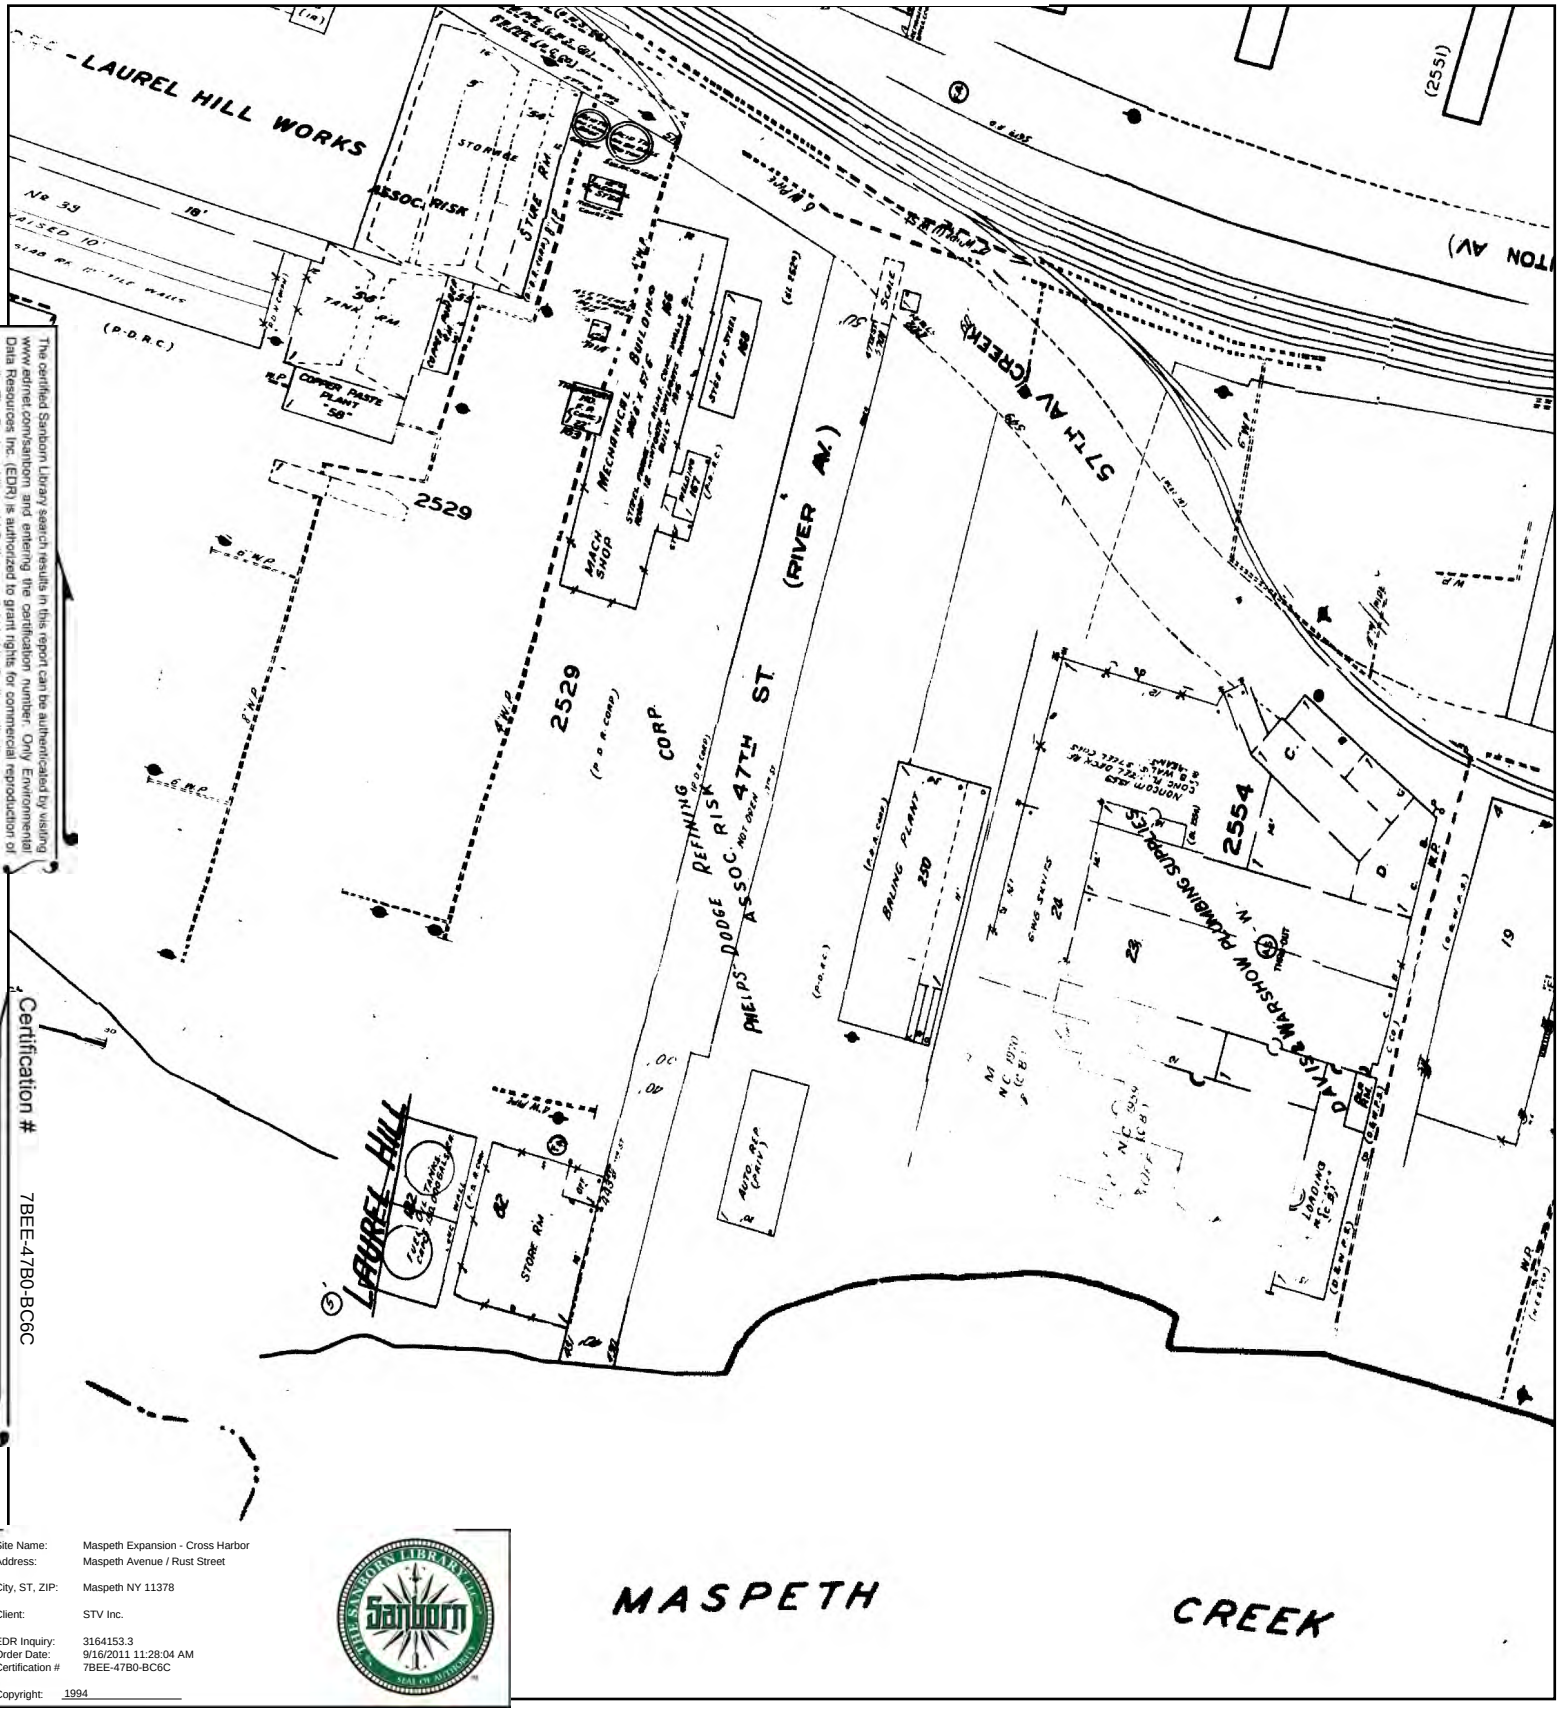

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 7BEE-47B0-BC6C

Site Name:	Maspeth Expansion - Cross Harbor
Address:	Maspeth Avenue / Rust Street
City, ST, ZIP:	Maspeth NY 11378
Client:	STV Inc.
EDR Inquiry:	3164153.3
Order Date:	9/16/2011 11:28:04 AM
Certification #	7BEE-47B0-BC6C
Copyright:	1994

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

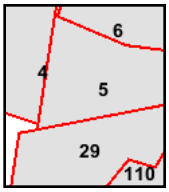

Volume 3, Sheet 4
Volume 3, Sheet 5
Volume 3, Sheet 6
Volume 3, Sheet 29

0 Feet 165 330 660

N